

Stone with poor pointing (appears to have had linostone applied over face and joints are not

 
Linostone or cement to be carefully removed. Assume 30% indentation, 50% application of ST.one mortar repair and 20% brushing back required to




Indents required



Joints to be raked out and repointed in lime-based




 Area of stone to be raked out and repointed in



Damp stone - source to be stopped and stone allowed to dry out prior to treating with DOFF

 
system



Copyright and not to be reproduced without the consent of Holmes Miller Holmes Miller accepts responsibility for this document only to the commissioning Party and not to any other. Holmes Miller does not accept liability for accuracy or veracity of survey information provided by others and horizontal dimensions and levels provided by Holmes Miller and based on survey information provided by others must be verified on site
DO NOT SCALE: Use figured dimensions only

 ======== Proposed roof access





Holmes Miller 89 Minerva Stree

Glasgow G3 8LE 0141 204 2080

City Halls & Old Fruitmarket Roofworks City Building

Drawing Name

Zone 1 - West Elevation Southern Half

Scale @A3	Checked	Revision
1:100	DJ	P01

Drawing Number

CHF-HML-01-XX-DR-A-12112

