


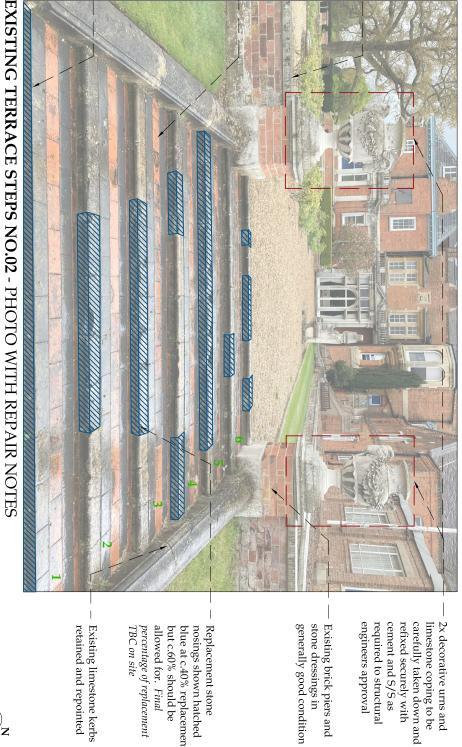



EXISTING STEPS NO.02 - URN AND PIER



EXISTING TERRACE

4000

EXISTING GRAVEL PATH

> sections to match and worn. New Stone nosings to treads 02-06 are badly cracked

existing. See marked up

photograph opposite for

extent of replacement

generally in good condition and are to

Existing engineering brick treads are

ΠÞ

PIER W/ URN

G

4

w

N

replaced with new

section to match

not included in works. To be

repointed at a later repaired and and stone copings

Existing low walls

step 01 missing. Stone nosing to bottom

GRASS SLOPE

HABERDASHER'S SCHOOL Job No: 9756-1 9756-1 P(0)1001 May 2021 1:50 & 1:20 @A3 Checked: GQ NCB 7 BISHOP'S TERRACE LONDON SE11 4UE GILES QUARME ARCHITECTS
(Chartered Architects)

## GENERAL NOTES:

- To be read with general location plan 9756-1 P(0)1000 and all structural engineers documents;
- replacement to the limestone nosings and the treads are required. Complete repointing is required in lime mortar Existing Steps 02: Steps to formal rose gardens formed from 6 treads, with carefully taken down and securely and the decorative urns are to be movement. However, localised areas of evidence of structural cracking or limestone kerbs, nosings and dressings to 2x brick piers. The steps are in a better condition than Steps 01, with no

REVIEW AND DRAFT FOR COMMENT

 $\textbf{D}_{\!\mathbf{z}}$ 

Tel: Fax: E-mail

(020) 7582 0748 (020) 7793 8807 mail@quarme.co

percentage of replacement TBC on site

nosings shown hatched blue at c.40% replacement

Replacement stone

PLAN WITH REPAIRS/REBUILDING - 1:50@A3

**EXISTING TERRACE STEPS NO.02:** 

GRASS SLOPE

PIER W/ URN

570

blue engineering and red brick. Mostly in good condition with

alternating courses of

formed from Existing treads are

> repointed be retained and

some bricks requiring replacement with

match from elsewhere

profiles to upper New to match nosing

missing to tread no.1. Limestone nosing 840