scale @ A3

date: 4 May 2023 drawn by: IDP

checked by:



Brecklands, Lower Froyle Window schedule

Window	List	Ċ
--------	------	---

			Rev Comment A Windows updated B Windows updated		Issued By Susue Date IDP 17-07-2023 IDP 25-07-2023
Window	l ist		B Windows updated		IDP 25-07-2023
- ID	List	size (mm)	description	condition	Proposed action
Ground	Floor				
G 01		1,653×1,350	Single glazed Timber frame casement window	Paintwork flaking, putty missing in places, sill rotten	Replace with new double glazed painted timber window to match
G 02		1,109×1,350	Single glazed Timber frame casement window	Paintwork flaking, putty missing in places	Replace with new double glazed painted timber window to match
G 03		1,653×1,350	Single glazed Timber frame casement window	Paintwork flaking	Replace with new double glazed painted timber window to match
G 04		1,653×1,350	Single glazed Timber frame casement window	Paintwork flaking	Replace with new double glazed painted timber window to match
G 05		1,109×1,350	Single glazed Timber frame casement window	Paintwork flaking, putty missing in places	Replace with new double glazed painted timber window to match
G 06		1,653×1,350	Single glazed Timber frame casement window	Paintwork flaking	Replace with new double glazed painted timber window to match
G 07		1,653×1,350	single glazed metal casement windows with leaded light panes on spike hinges set into timber subframe. fixed leaded light centre pane set direct into timber subframe with putty	timber subframe appears to be sound, metal casement sash rusting in spots, leaded lights appear sound	Cut out below window and install new timber projecting sill, rubdown, de-rust and paint metal frame, prepare and repaint timberwork
G 08		1,653×1,350	Single glazed Timber frame casement window	Paintwork flaking	Replace with new double glazed painted timber window to match
G 09		1,653×1,350	single glazed metal casement windows with leaded light panes on spike hinges set into timber subframe. fixed leaded light centre pane set direct into timber subframe with putty	timber subframe appears to be sound, metal casement sash rusting in spots, leaded lights appear sound	rubdown, de-rust and paint metal frame, prepare and repaint timberwork
G 10		500×500	Single glazed Timber frame tophung window	Paintwork flaking, no sill	Replace with new double glazed painted timber window to match
G 11		1,653×1,350	single glazed metal casement windows with leaded light panes on spike hinges set into timber subframe. fixed leaded light centre pane set direct into timber subframe with putty	timber subframe appears to be sound, metal casement sash rusting in spots, leaded lights appear sound, no sill, projecting or otherwise	Cut out below window and install new timber projecting sill,rubdown, de-rust and paint metal frame, prepare and repaint timberwork
G 12		1,653×1,350	single glazed metal casement windows with leaded light panes on spike hinges set into timber subframe. fixed leaded light centre pane set direct into timber subframe with putty	timber subframe appears to be sound, metal casement sash rusting in spots, leaded lights appear sound, no sill, projecting or otherwise	Cut out below window and install new timber projecting sill, rubdown, de-rust and paint metal frame, prepare and repaint timberwork
G 13		1,109×975	Modern timber casement window (in new extension)	Good condition	Replace with new double glazed painted timber window to match
G 14		620×975	Modern timber top hung window (in new extension)	Good condition	Replace with new double glazed painted timber window to match
G 15		1,109×975	Modern timber casement window (in new extension)	Good condition	Cut out below window and install new timber projecting sill, rubdown, de-rust and paint metal frame, prepare and repaint timberwork
First Flo	or				
F 00		1,109×975	Modern timber casement window (in new extension)	Paintwork minor flaking	Replace with new double glazed painted timber window to match
F 01		1,653×975	Single glazed Timber frame casement window	Paintwork flaking	Replace with new double glazed painted timber window to match
F 02		1,653×975	Single glazed Timber frame casement window	Paintwork flaking	Replace with new double glazed painted timber window to match
F 03		1,109×975	Single glazed Timber frame casement window	Paintwork minor flaking	Replace with new double glazed painted timber window to match