



Lead work flat ridge

Green slate roof with mitred hops

Cast iron ogee gutters

Timber fascia

Sandstone columns

Basalt curbs

Insert drainage channel
along edge of kerb.

Orange line.

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

West Elevation

19/45

Figure 1

March 2021

Not to scale



Lead work with flat ridge

Green slate roof with
mitred hips

Cast iron ogee gutters

Timber fascia

Sandstone columns

Basalt curbs

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

East Elevation

19/45

Figure 2

March 2021

Not to scale

N1



HEAD
Original
Heavily eroded
Replace

N2



HEAD
Original
Heavily eroded
Replace

N3



HEAD
Original
NE corner lost
Replace



COLUMN
Scuffed area
Brush back with
brass brush parallel
to the fluting



COLUMN
Original
Retain indent
repair at base
Minor NHL plastic
repair required



COLUMN
Original
Okay condition
Rainwater fixing
holes to be
reformed using
NHL plastic repair



BASE
Recent
Solve standing water
Remove green moss
with DOFF cleaning



BASE
Original
Repair not required
Remove green
moss with DOFF
cleaning



BASE
Original
repaired
Detail lost
Replace

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey N1 - N2 - N3

19/45

Figure 3

March 2021

Not to scale

N4



HEAD
Original
No repair
required

N5



HEAD
Original
Minor NHL
plastic repair
required to
bottom rib

N6



HEAD
Original
No repair
required
Realign



COLUMN
Original
Out of alignment
Realign
Cut out poor
patching
Replace with NHL
plastic repair



COLUMN
Original
Cut out poor
patching
Replace with NHL
plastic repair
Stone indent
repair
required at base



COLUMN
Original
Cut out poor
patching
Replace
with NHL plastic
stone repair
Stone indent
repair required at
base



BASE
Original
Poor condition
Replace



BASE
Original
Poor condition
Replace



BASE
Original
Retain

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey N4 - N5 - N6

19/45

Figure 4

March 2021

Not to scale

N7 work carried out in 2022



HEAD
Original
NHL plastic
repair to top rib
Realign



COLUMN
Original
Hit by car
Realign
Large indent
required at base



BASE
Original
Retain

N8



HEAD
Original
Cut to
accommodate
rainwater pipe
Retain



COLUMN
Original
Heavily repaired
recent middle
section NHL plastic
repair to small hole



BASE
Original
Retain

N9



HEAD
Original
Retain



COLUMN
Original
Indent required
at top



BASE
Original
Retain

N10



HEAD
Original
Badly chipped
on E side



COLUMN
Original
Large indent
required at base
Cut out poor
patching
Replace with NHL
plastic repair



BASE
Original
Retain
Requires DOFF
cleaning

E1



HEAD
Original
Heavily
damaged
Replace



COLUMN
Original
Heavily damaged
Replace



BASE
Original
Heavily damaged
Replace

E2



HEAD
Original
Heavily
damaged
Replace



COLUMN
Possibly original
Heavily damaged
Poorly repaired
Replace



BASE
Original
Replace

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey N10 - E1 - E2

19/45

Figure 6

March 2021

Not to scale

W1



HEAD
Original
Heavily
damaged
Replace

W2



HEAD
Original
Cut out poor
mortar repair
Replace with
NHL plastic
repair

S1



HEAD
Original
Recent vehicle
damage
Replace



COLUMN
Recent
Retain



COLUMN
Original
Retain



COLUMN
Recent
Recent vehicle
damage
Major crack
Replace top
section (900 mm)



BASE
Recent
Retain



BASE
Original
Retain



BASE
Original
Heavily
damaged
Poorly repaired
Replace

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey W1 - W2 - S1

19/45

Figure 7

March 2021

Not to scale

S2



HEAD
Recent
No repair
required

S3



HEAD
Original
No repair
required

S4



HEAD
Original
Wet rot in SW
corner
Replace S and
W sections



COLUMN
Recent
No repair
required



COLUMN
Original
Heavily repaired
No repair
required



COLUMN
Original
Heavily repaired
No repair
required



BASE
Recent
Insert stone
plinth



BASE
Original
Wet rot at level of
concrete
Cut out rotten
timber
Replace
Insert stone
plinth



BASE
Original
Heavily eroded
from water
damage
Insert stone
plinth

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey S2 - S3 - S4

19/45

Figure 8

March 2021

Not to scale

S5



HEAD
Original
No repair
required

S6



HEAD
Original
No repair
required

S7



HEAD
Original
Poorly painted
No repair
required



COLUMN
Original
Heavy erosion and
splitting
No repair required



COLUMN
Original
Heavy erosion and
splitting
No repair required



COLUMN
Original
Heavy erosion and
splitting
No repair required



BASE
Original
Recent good repair
Insert stone plinth



BASE
Original
Heavily eroded
Insert stone plinth



BASE
Original
Heavily eroded
Insert stone plinth

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey S5 - S6 - S7

19/45

Figure 9

March 2021

Not to scale

S8



HEAD
Original
No repair
required

S9



HEAD
Original
No repair
required

S10



HEAD
Original
Replace



COLUMN
Original lower
section
Upper section
replaced
No repair required



COLUMN
Original
Heavily eroded
and split
Large indent
required across
splitting (450 mm
tall by 150 mm
wide)



COLUMN
Original
Indent required at
base
Remove iron and
lead fixings.
Replace with NHL
plastic repair



BASE
Original eroded
Insert stone plinth



BASE
Original
Light erosion
Insert stone plinth



BASE
Original
Replace

Countryside Consultants
Architects & Planners

Townhead, Alston, Cumbria, CA9 3SL Tel: 381906 Fax: 381908

The Shambles, Hexham

Column Condition Survey S8 - S9 - S10

19/45

Figure 10

March 2021

Not to scale