



Property Risk Inspection  
LIMITED

# ARBORICULTURAL ASSESSMENT REPORT



**Risk Address:**

21 Freeman Avenue, Henley, Ipswich, IP6 0RZ

**For:**

**Client:** Sedgwick International UK  
**Insurer:** Fairmead

**Client Ref:** 9461250  
**Insurer Ref:** D141112170



**PRI Ref:** 219594



**Arborist:** Margaret MacQueen



**Survey Date:** 03/03/2022



**QC:** Margaret MacQueen



**QC Date:** 04/03/2022



## CONTENTS

1.0	INTRODUCTION AND BRIEF .....	3
2.0	LIMITATIONS .....	3
3.0	DISCUSSION AND ANALYSIS .....	4
4.0	CONCLUSIONS AND RECOMMENDATIONS .....	5
5.0	APPENDIX 1: TREE TABLES .....	6
6.0	APPENDIX 2: SITE PLAN.....	8
7.0	APPENDIX 3: SITE PHOTOGRAPHS .....	9





## 1.0 INTRODUCTION AND BRIEF

- 1.1** Property Risk Inspection has been instructed on behalf of the building insurers of the insured property. We have been advised that the insured property has suffered differential movement and damage that is considered to have been caused by trees growing adjacent to the property influencing soils beneath its foundations.
- 1.2** We have been instructed to undertake a survey of the vegetation growing adjacent to the insured property in order to provide our opinion as to whether, based on the available information, any of this vegetation is likely to be influencing soil moisture levels beneath the foundations of the property, and if so, to provide recommendations as to what tree management could be implemented to effectively prevent damage continuing.
- 1.3** The vegetation growing adjacent to the risk address has been surveyed from the ground. All distances are measured to the nearest point of the risk address unless otherwise stated.

## 2.0 LIMITATIONS

- 2.1** Recommendations with respect to tree management are associated with the risk address as stated on the front cover of this report and following consultation with investigating engineers. The survey of trees and any other vegetation is associated with impacts on the risk address subject of this report. Matters of tree health, structural condition, and/or the safety of vegetation under third party control are specifically excluded. Third party land owners are strongly advised to seek their own professional advice as it relates to the health and stability of trees under their control.
- 2.2** Recommendations do not take account of any necessary permission (statutory or otherwise) that must be obtained before proceeding with any tree works.
- 2.3** Recommendations do not take account of any requirements for survey or mitigation relating to European or other protected species, e.g. bird nesting or bats. Land owners must obtain their own professional advice in respect of any protected species.



## **3.0 DISCUSSION AND ANALYSIS**

### **3.1 Soils, soil water and vegetation**

All vegetation requires water to live, and this water is substantially accessed from the soil within which the plants' roots grow.

If the soil is classified as a clay soil, then it will hold very much more water than sands, gravels and loam soils. As plants abstract water from the clay soil, the soil volume will “shrink” and “swell” during the summer as water is first removed and then added by summer rainfall. In years in which rainfall during the summer is less than the total amount of water taken from the soil by plants, shrinkage will occur. This shrinkage may remove support from building foundations, leading to cracking in the fabric of the building.

### **3.2 Vegetation management**

The control of trees, shrubs, and climbers, by removal or pruning as appropriate, are proven techniques that can control total soil water loss thereby minimising soil shrinkage and allowing repairs to proceed.

If vegetation management works are carried out promptly, then repairs can usually proceed very quickly and the duration and distress associated with the disruption that tree related subsidence brings can be minimised.

### **3.3 Third party liaison and statutory controls**

Tree roots do not respect physical or property boundaries and can travel for many metres beyond the above ground “dripline” of the canopy of the vegetation.

The purpose of this report is to ascertain which vegetation is the most likely substantial and/or effective contributory cause of the damage witnessed to allow for liaison with third parties or with local administrative Councils as necessary.

### **3.4 Evidential framework**

The engineer has determined on a preliminary basis the damage to the property, its location and the likely mechanism of movement, and has concluded that the building failure is related to differential subsidence damage caused as a result of the action of vegetation. Where a factual geotechnical report has been completed, this will describe the below ground foundation design, soil and geotechnical conditions, as well as any root identification where available.



## 4.0 CONCLUSIONS AND RECOMMENDATIONS

### 4.1 Recommendations

On the basis of our findings, we have considered a practical vegetation management specification.

This specification will assist in reducing the impact of the adjacent vegetation on soil moisture levels, thereby potentially stabilising foundations of the affected area of the building.

Where felling has been proposed, this will be on the basis that the vegetation in question would not respond well to a severe reduction in leaf area that would inevitably lead to decay, the development of potential hazards, and an annual or other on-going management commitment and cost.

If pruning is recommended, the specification will be designed to allow continual ease of re-pruning with a reasonable prospect of a reduction in soil water use.

### 4.2 Recommended vegetation management to address the current subsidence:

Tree No:	Species	Works Required
T1	Lime	Fell and treat stump with eco plugs (broadleaved).

### STATUTORY CONTROLS

Babergh and Mid Suffolk Council has confirmed that the implicated Lime vegetation is subject to a Tree Preservation Order. There are no Conservation Area controls.



## 5.0 APPENDIX 1: TREE TABLES

Tree No	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	Dist to bldg. (m)	Roots Implicated	Pruning history	Recommendation	Tree work constraints	Notes	Owner address	Owner
S1	Lilac	Semi-Mature	Good	4	3.50	100*	1.5	N	No significant recent management.	No work required.			20 Freeman Avenue Henley Ipswich IP6 0RZ	P3P
T1	Lime	Semi-Mature	Good	15.5	11.0	700	7	N	Subject to past management.	Fell and treat stump with eco plugs (broadleaved).		PH advised they are permitted to prune every 3 years	21 Freeman Avenue Henley Ipswich IP6 0RZ	PH
T2	Beech	Young	Fair	6.2	7.0	180	12	N	Subject to past management.	No work required.			21 Freeman Avenue Henley Ipswich IP6 0RZ	PH
T3	Lime	Semi-Mature	Good	15	12	700*	13	N	Subject to past reduction management (within last 3years).	keep pruned			22 Freeman Avenue Henley Ipswich IP6 0RZ	P3P




Tree No	Common Name	Age Class	Condition	Height (m)	Crown Spread (m)	Stem diam. (mm)	Dist to bldg. (m)	Roots Implicated	Pruning history	Recommendation	Tree work constraints	Notes	Owner address	Owner
T4	Lime	Semi-Mature	Good	15	12	700*	16.5	N	Subject to past reduction management (within last 3 years).	keep pruned			20 Freeman Avenue Henley Ipswich IP6 0RZ	P3P

\* Value is estimated





## 6.0 APPENDIX 2: SITE PLAN

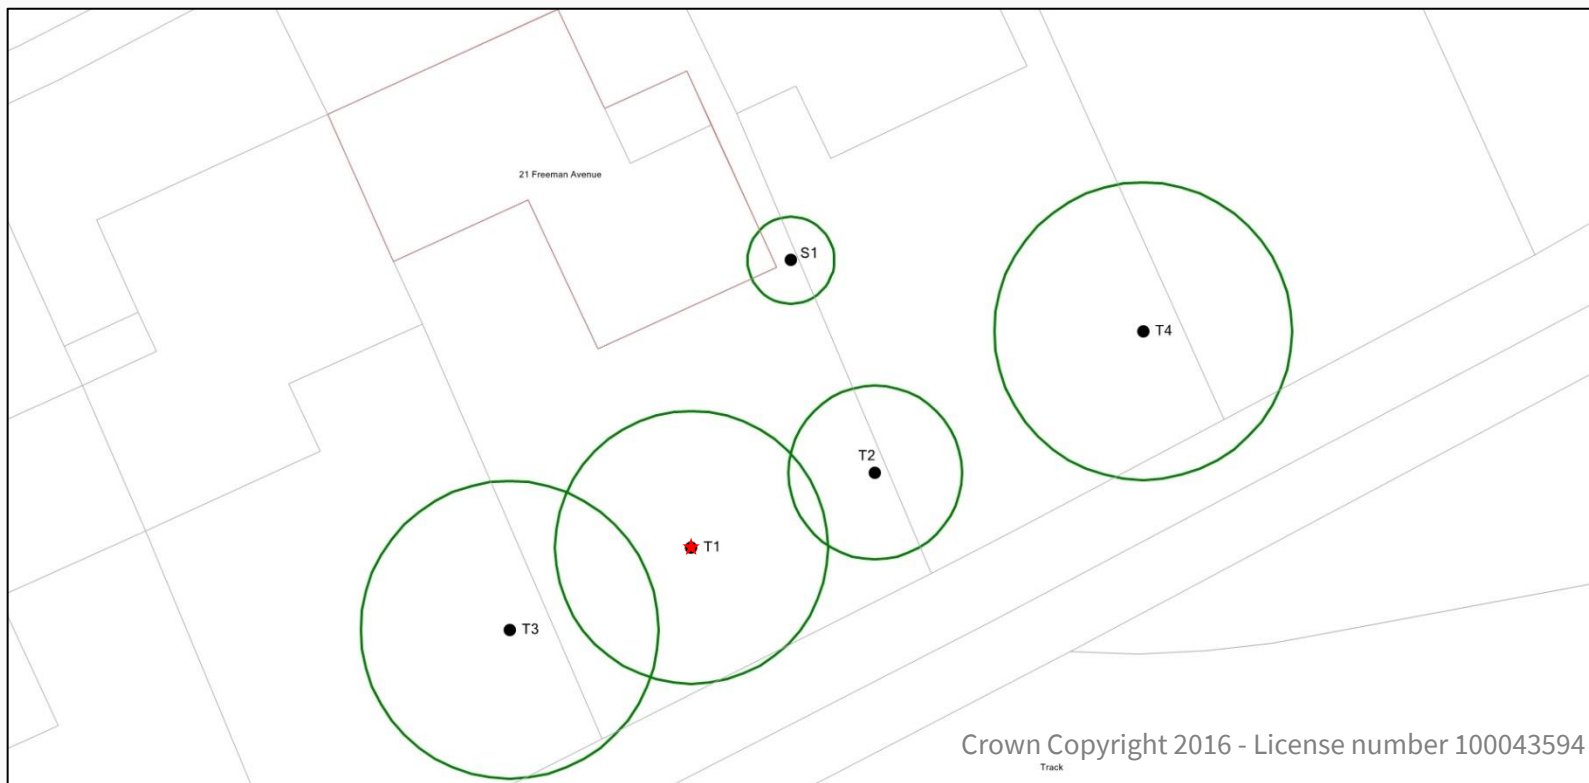

**Location:** 21 Freeman Avenue, Henley, Ipswich, IP6 0RZ

**Job Ref:** 219594

**Survey Date:** 03/03/2022 - NTS

By Property Risk Inspection - Insurance Services





## 7.0 APPENDIX 3: SITE PHOTOGRAPHS



T1 - Lime on left



T2 - Beech mid view



Property rear elevation



S1 - Lilac mid view



T3 - Lime



T3 - Lime & distant view



T4 - Lime and distant view



T4 - Lime & distant view



# Property Risk Inspection

## LIMITED

### Insurance Services

2 The Courtyards  
Phoenix Square  
Wyncolls Road  
Colchester  
Essex CO4 9PE

01206 751626

[insurance@propertyriskinspection.co.uk](mailto:insurance@propertyriskinspection.co.uk)

[www.propertyriskinspection.co.uk](http://www.propertyriskinspection.co.uk)