

# SCHEDULE OF TREES

The Grange, Elmswell, Suffolk

Surveyed By: Alex Garnham Date: 2022-12-07

Managed By: Alex Garnham

TreeNo	Species	DBH	Height		Visual	Crown Spread	Problems / Comments	BS Cat	Work Required	Priority
		Min Dist	Crown Base	Lowest Branch	Age	Water Demand				
		On site	RPA (m <sup>2</sup> )	Aspect	Aspect	SULE				
<b>T004</b>	Ash	710	20.5		High	N7.5, E8, S10.5, W9	<p>Mature Ash on the north side of a mature understorey Laurel hedgerow and south of a clear grass track from the access gates to the rear garden. Specimen has suffered a historic failure of the central leader at 10+ metres, leaving a secondary leader bending south. There is a large open wound on the north face travelling up the secondary stem on the upper side and down the north face of the stem. At 9 metres on the north side, just below the point of failure are two brackets of Inonotus hispidus, and a woodpecker hole at the same height on the east face. Each major crown part has been subject to a major reduction, and has formed a new crown from the regrowth. This likely happened as a response to the major failure. The upper crown is very likely in poor condition, and further assessment by climbing inspection is recommended. March 2024 Update: A climbing inspection has been completed which confirmed good reaction wood around the historic failure of the main stem. The condition of the stem below this in the region of the woodpecker hole and fungal bracket is poor, leaving the specimen predisposed to another event of structural failure at height.</p>	C1	Fell and replace.	1
	8.52	4		M	Moderate					
<b>Yes</b>	228			10+ years	Bare earth					