

GFW04 W04



front elevation - 1:20

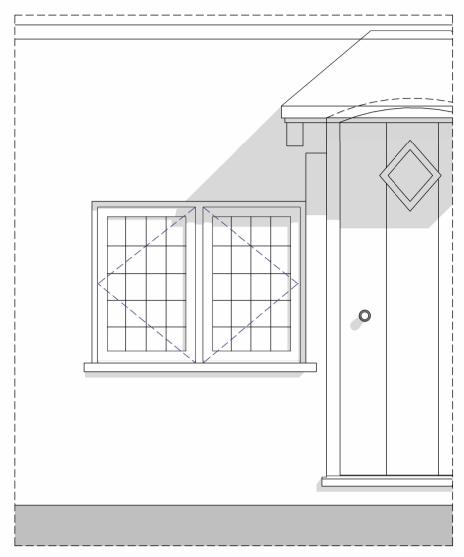

ground floor plan - 1:50

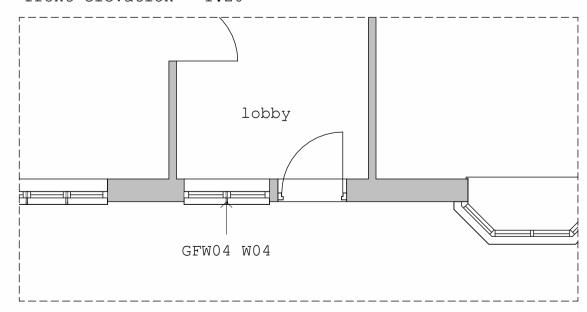

external view



external view

current condition:

estimated late C20 casement window painted shut, unable to easily open LHS of external cill rotten

proposed replacement unit:

3 light 1 window unit to be replaced with like for like timber unit

replacement unit to contain leadwork to match existing

slimline double glazing to remove the need for any further secondary glazing



external view - damaged cill



Mar 24 planning Drawn By:



hello@colonyarchitects.com colonyarchitects.com

Job: Drawing: 997 10-03 Revision: Checked By: