


EXISTING SEB5 CORNER RETURN
SCALE 1:20 @ A0

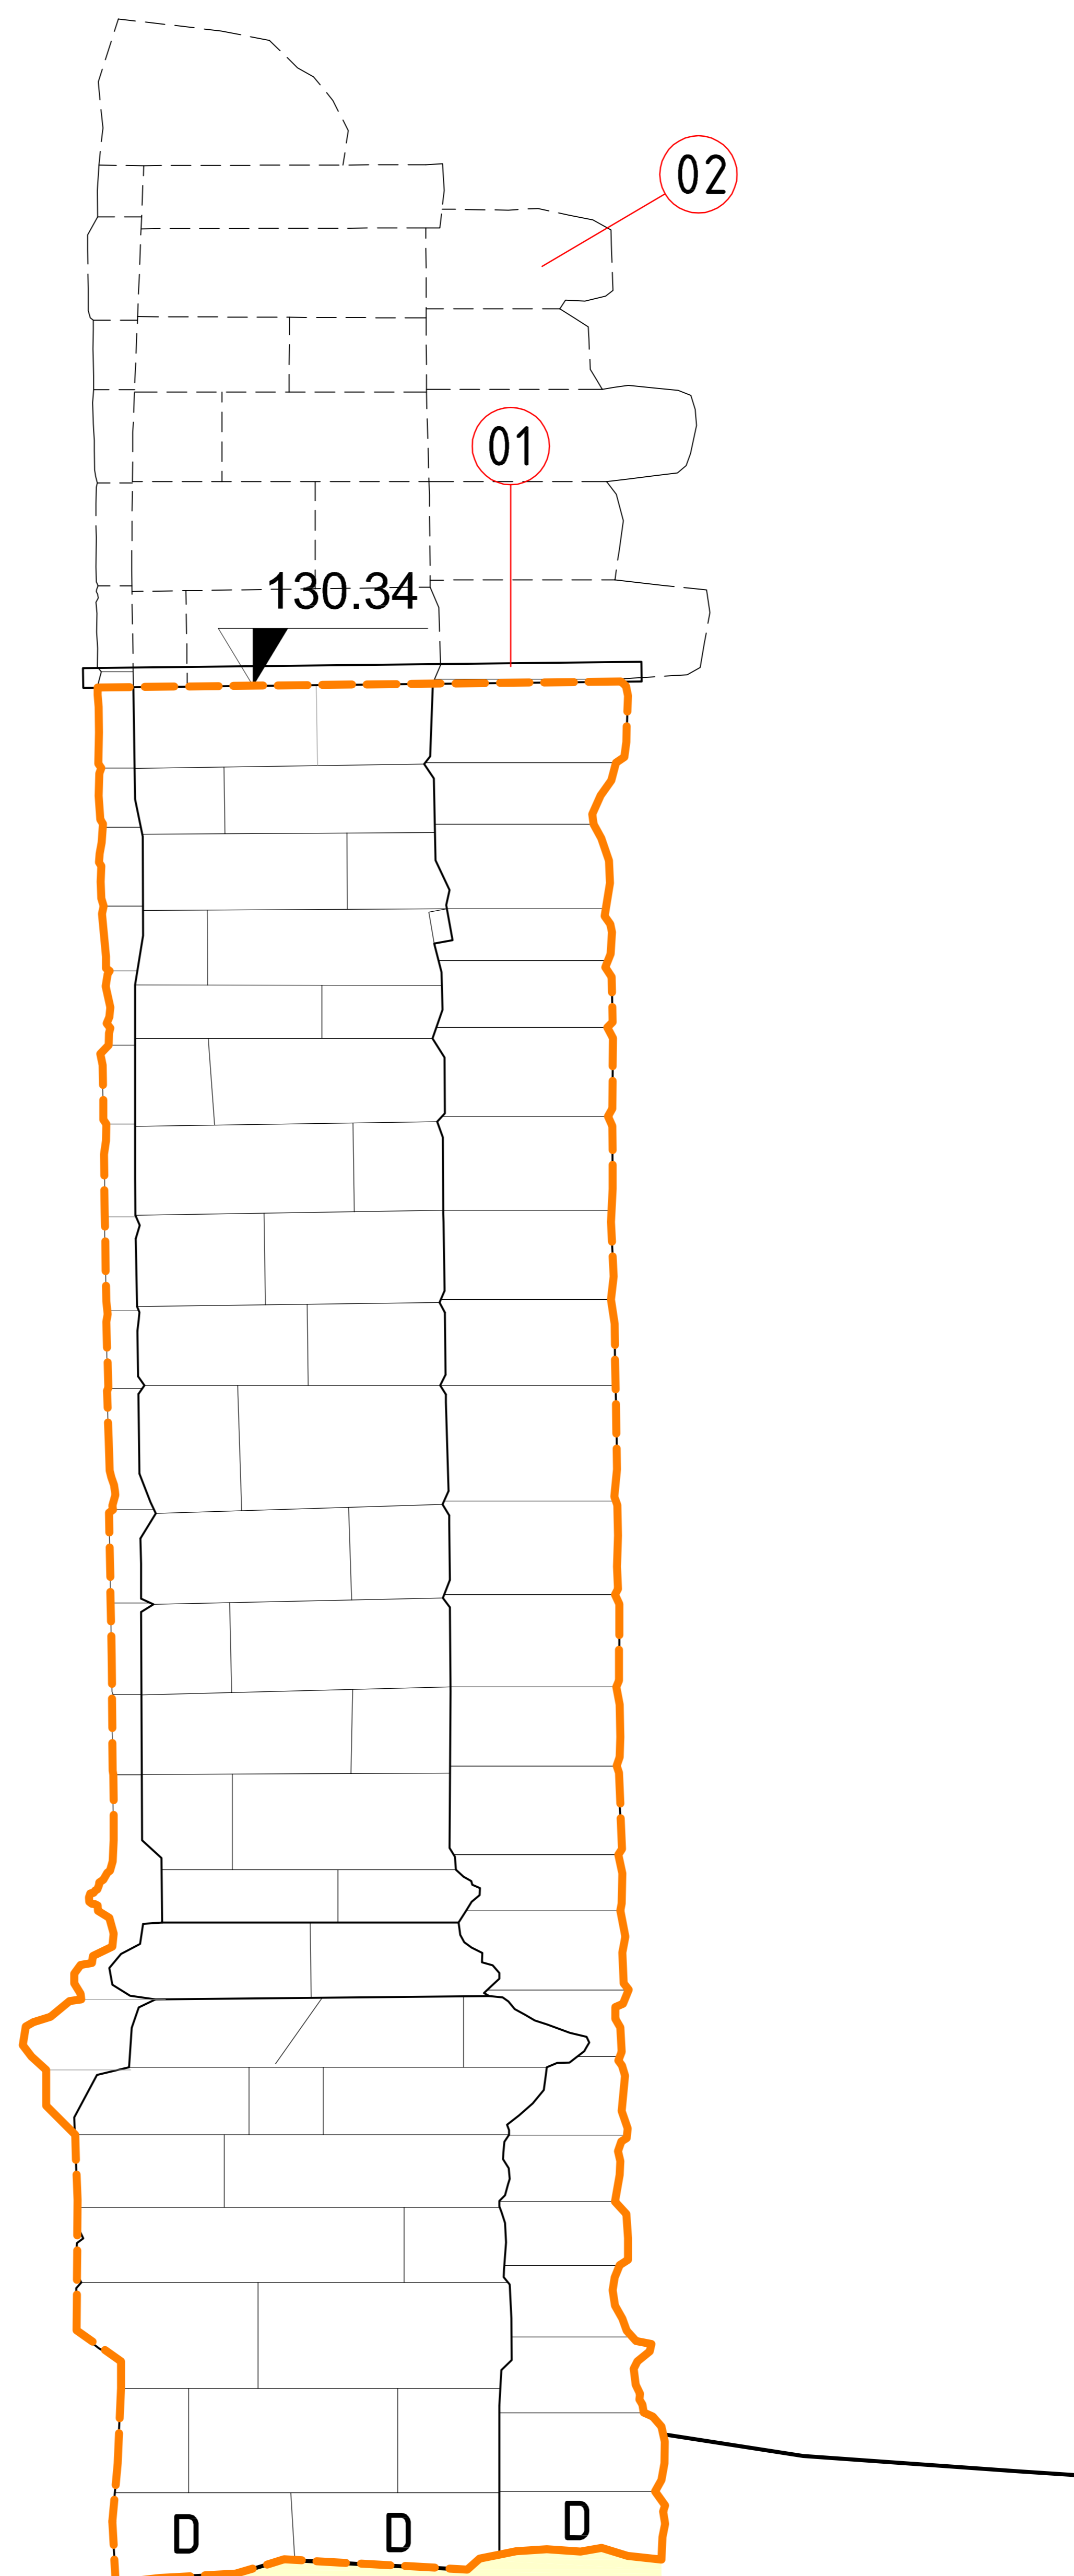

PROPOSED SEB5 CORNER RETURN
SCALE 1:10 @ A0

PHILOSOPHICAL APPROACH

THIS FAÇADE HAS SUFFERED FROM EXTENSIVE UNCONTROLLED COLLAPSE OVER THE YEARS AND THE STRUCTURAL INTEGRITY OF THE REMAINING ELEMENTS IS SIGNIFICANTLY COMPROMISED. ON THE BASIS THAT REPRESENTATIVE SAMPLES OF THE VARIOUS BUILDING ELEMENTS ARE PRESERVED ELSEWHERE IT IS PROPOSED THAT MISSING OR COLLAPSED SECTIONS ARE NOT REINSTATED AND UNSTABLE REMNANTS ARE REMOVED. THE EXISTING MASONRY WILL BE REDUCED IN HEIGHT TO A LOGICAL POINT WHERE IT IS MORE STRUCTURALLY VIABLE AND CAN BE WEATHERED EFFECTIVELY IN ORDER THAT DECAY AND FURTHER COLLAPSE CAN BE ARRESTED AND THE RUIN CONSOLIDATED. STONES TAKEN DOWN WILL BE LEFT ON SITE ADJACENT TO WHERE THEY CAME FROM. A PHOTOGRAPHIC RECORD IS TO BE MADE OF THE STRUCTURE AS IT CURRENTLY STANDS PRIOR TO DISMANTLING.

LABELLING LEGEND


- A: NO WORK REQUIRED
- B: STONE RE-DRESSED IN SITU - NBS CLAUSES C41X / 450 - 458
- C: STONE LOCALLY REPAIRED - NBS CLAUSES C41X / 510 - 692
- D: STONE REPLACED WITH NEW - NBS CLAUSES C41X / 310 - 420


STONEMWORK TO BE GENERALLY REPOINTED IN ACCORDANCE WITH THE SPECIFICATION NBS CLAUSES C41X / 810 - 860


SEB5 CORNER RETURN WORKS:

- 01 NEW CAPPING OF LEAD CLAD PAVING SLABS INSTALLED IN ACCORDANCE WITH DRAWING AR(0)08 SEB5
- 02 STONES REMOVED PERMANENTLY.

LEGEND:

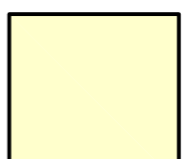 BASE OF WALL EXPOSED, PATCH REPAIRED AND UNDERPINNED ONLY WHERE UNDERMINED BY IVY / ROOT BALLS (ON REAR FACE AS NECESSARY - IN 900MM SECTION LENGTHS. EXTENT TO BE AGREED ON SITE UPON INSPECTION).

 ALL DATUMS TAKEN FROM LASER SCAN, ACCURACY TO BE CHECKED ON SITE. NEW / REPAIRED LINTELS, CILLS AND CAPPINGS SHOULD BE POSITIONED TO ALIGN WITH THE SURROUNDING STRUCTURE WHICH MAY NOT BE PERFECTLY TRUE OR PLUMB DUE TO THE SETTLEMENT OF THE EXISTING STRUCTURE. SEVERE ANOMALIES TO BE BROUGHT TO THE ATTENTION OF THE ARCHITECT/ENGINEER FOR INSTRUCTION. SEE DRAWING EW(0)01 FOR PROPOSED GROUND LEVEL DATUMS.

 ALL STONES TO BE NUMBERED AND CATALOGUED PRIOR TO PIER BEING CAREFULLY TAKEN DOWN TO GROUND LEVEL. PIER TO BE RECONSTRUCTED TO DATUM SHOWN USING SALVAGED STONES DEEMED ACCEPTABLE FOR RE-USE (WITH RE-DRESSING) IN ORIGINAL UN-DISPLACED POSITIONS. STONES CONSIDERED TO BE TOO BADLY DAMAGED OR ERODED FOR REPAIR REPLACED WITH NEW TO ORIGINAL PROFILE.