


Significant damage - all paneling and skirting against external wall damaged (part of the frame to sash window possibly also damaged) with some damage to skirtings on the South and North wall at the Western end of the room. Fruiting bodies visible throughout Western part of the room including alongside the bath paneling (approx 2/3rds of the room is affected). Significant damage to floorboards at the Western end of the room and since drying out to central areas too. Potential damage to joist ends adjacent to the West wall and to lower sections of plasterwork in the worst affected areas Access to this room is unsafe at present

Damage to a small area of floorboards

Damp/mould on wall behind shutters. Damage to skirting and panelling

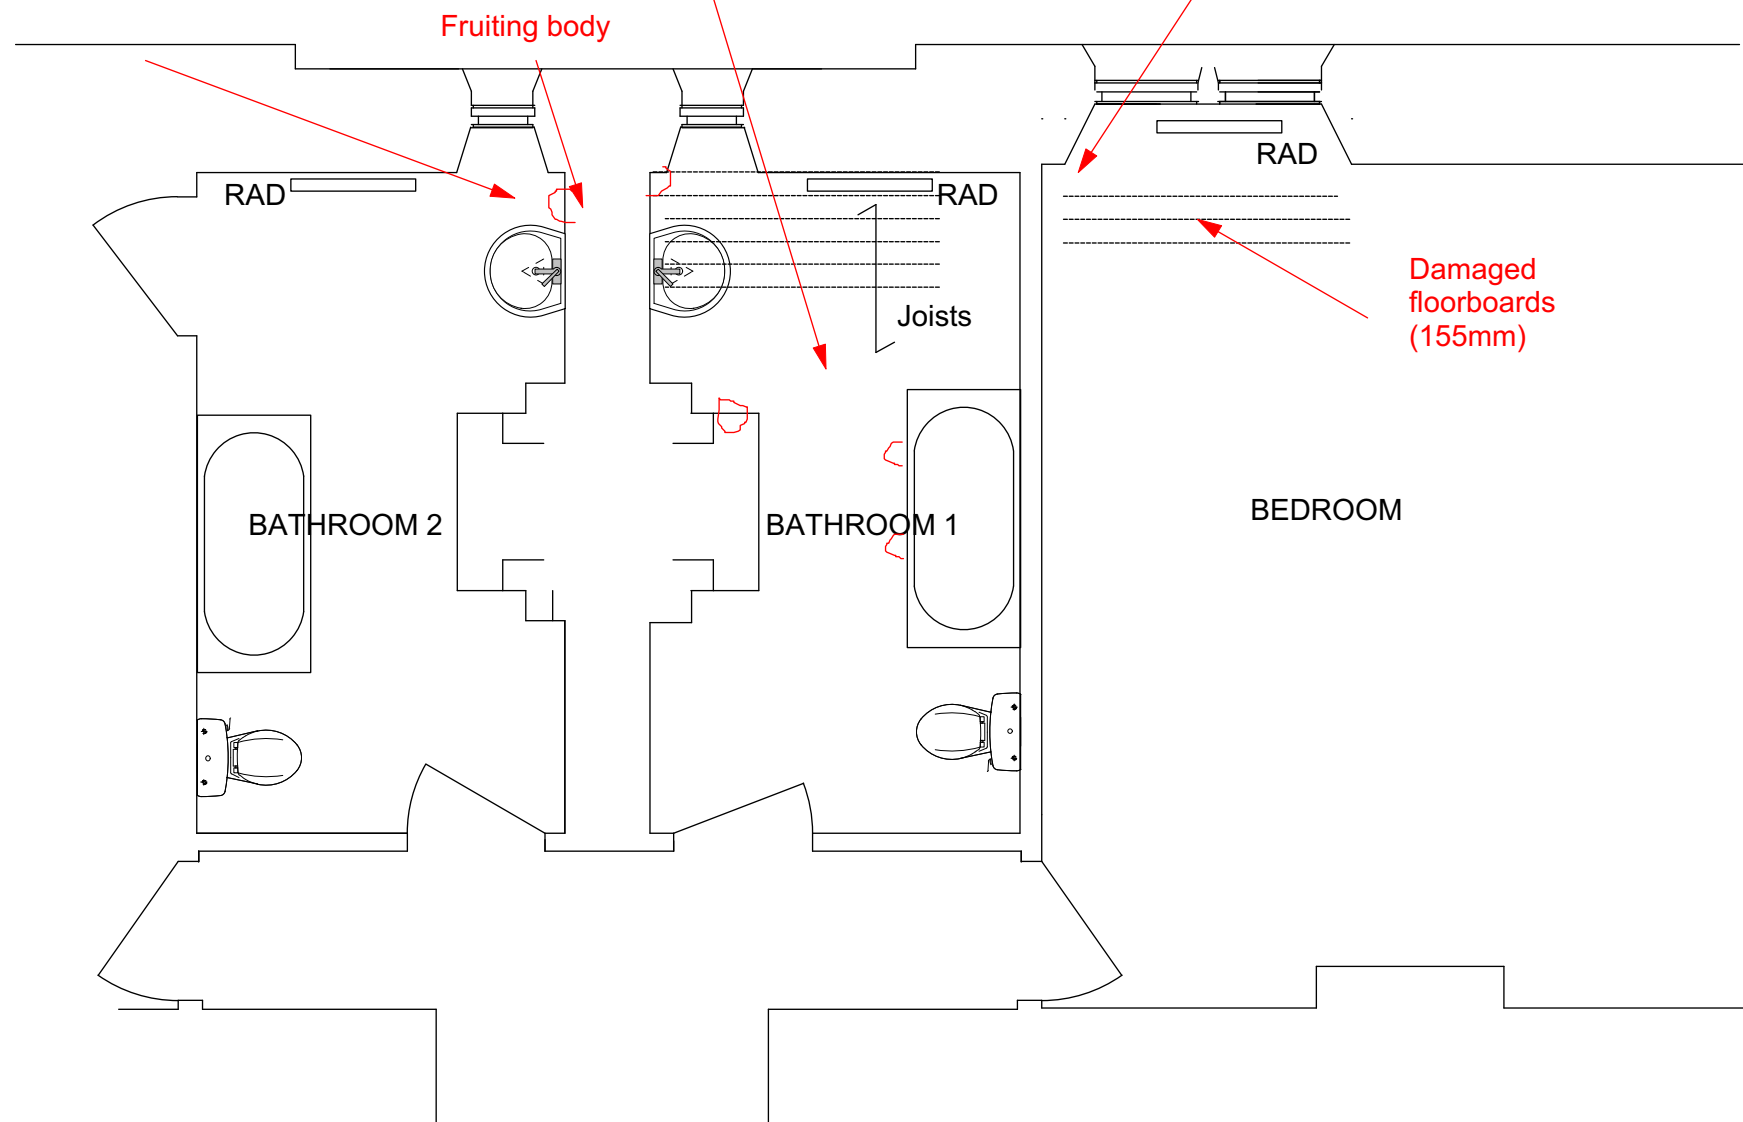

Please note that due to access limitations there have had to be some assumptions made on thickness of external walls etc

Rev A. 180718. Notes added

**EMBLETON TOWER  
EMBLETON  
ALNWICK**

**PLAN OF NORTH WEST BEDROOM  
AND ADJACENT BATHROOMS  
AS EXISTING**

Scales 1:50


Date Sept 2017

BR

*Spence and Dower* LLP,  
Chartered Architects  
25 Main Street  
Ponteland  
Newcastle upon Tyne NE20 9NH  
Tel: (01661) 820071  
Fax: (01661) 823788  
architects@spenceanddower.co.uk

0

5M

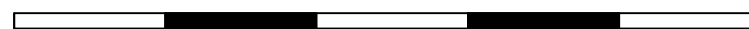

All dimensions should be checked on site.  
Do not scale from this drawing

© Spence and Dower LLP

M631 / 02

Rev.  
A