



Your ref DLG-SN-20-002040

Our ref ZBM07029GLOB

tel: [Redacted]
 email: [Redacted]

360Globalnet Ltd
 Regus House, Herald Way,
 Pegasus Business Park,
 Castle Donnington,
 Leicestershire
 DE74 2TZ

Issue date: 10/03/2021

Monitoring Visit: 3 of 4

Monitoring Plus Report

Owners name	Mrs. F. Kelman	Suspected cause	To be advised	Monitoring type	Levels & Cracks
Address	14 Buckfast Avenue Kirby Cross Frinton-on-Sea Essex CO13 0PU	Principal area of damage	To be advised	Installed	06/11/2020
		Damage category	To be advised	No of visits / weeks	4 @ 8.7
Home phone		Surface geology	To be advised	Completion date	
Work phone		Feedback from last visit		Status	open
Correspondence address		0			
Comment		Sketch showing location of monitoring points			
Max movement	7.2	<p>Front Elevation</p>			
Focal area					
0					

Level monitoring results

Survey: By: Date: Point ID	1 CV 06/11/2020		2 CV 08/01/2021		3 CV 10/03/2021		4		5	
	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
1	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0
2	1003.02	0.0	1003.98	1.0	1004.36	1.3				
3	1003.65	0.0	1006.31	2.7	1007.04	3.4				
4	1009.51	0.0	1014.04	4.5	1015.89	6.4				
5	1002.69	0.0	1007.19	4.5	1009.92	7.2				
6	1010.12	0.0	1011.57	1.5	1012.84	2.7				
7	1008.29	0.0	1008.70	0.4	1009.40	1.1				
8	1005.51	0.0	1005.00	-0.5	1005.32	-0.2				
9	933.09	0.0	937.30	4.2	938.80	5.7				
10	1023.44	0.0	1028.71	5.3	1029.89	6.5				
11	1022.15	0.0	1021.89	-0.3	1023.81	1.7				

closing error (mm)



0.10

0.00

0.00

0.00


0.00

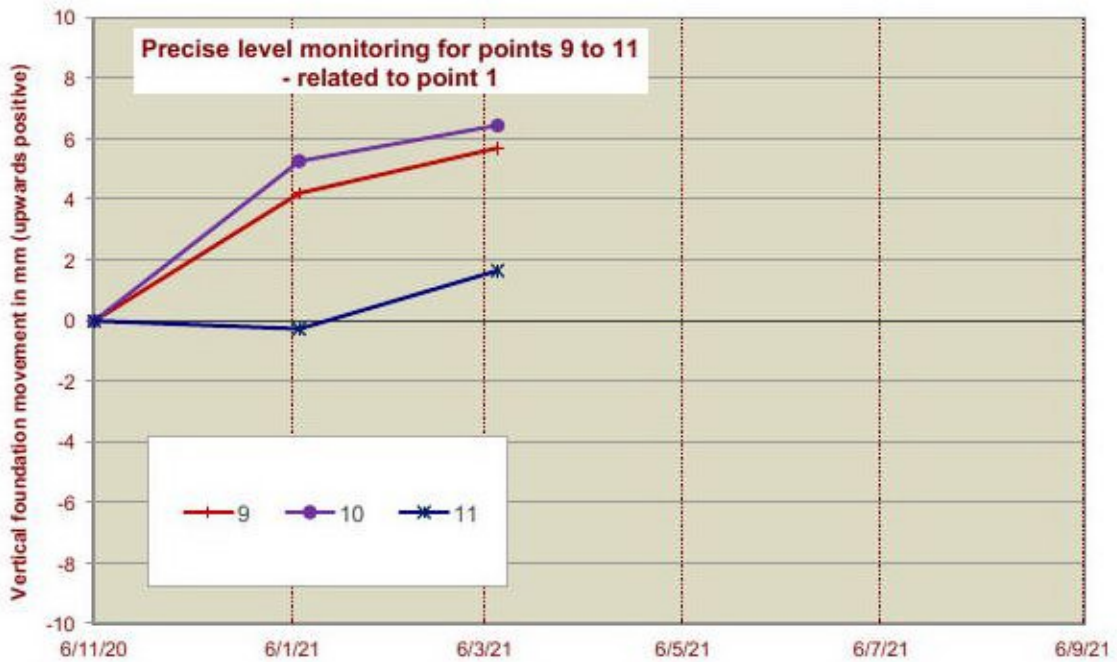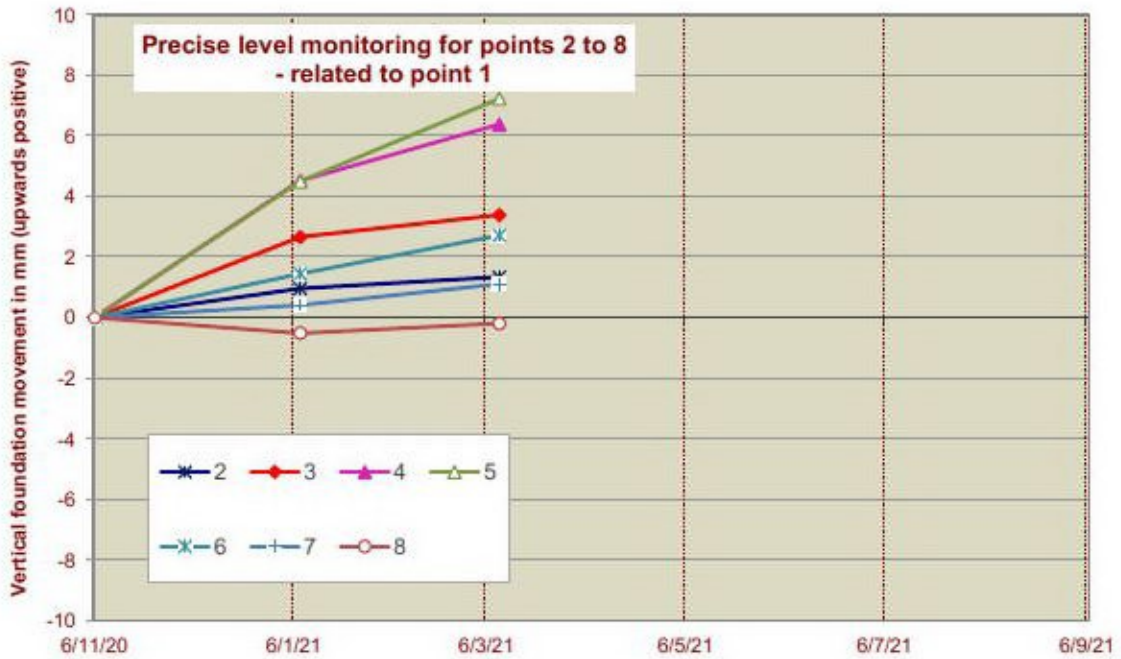

Crack monitoring results

Survey: By: Date:		1 CV 06/11/2020		2 CV 08/01/2021		3 CV 10/03/2021		4	5
Point ID	Initial widths mm		<i>chngs</i> <i>mm</i>		<i>chngs</i> <i>mm</i>		<i>chngs</i> <i>mm</i>		<i>chngs</i> <i>mm</i>
A (horiz)	3.6	70.63	0.0	70.08	-0.5	70.07	-0.6		
A (vert)		73.27	0.0	72.17	-1.1	71.57	-1.7		
A (chck)		101.23	0.0	101.21	0.0	101.20	0.0		
B (horiz)	2.5	89.59	0.0	89.05	-0.5	88.45	-1.1		
B (vert)		84.16	0.0	83.19	-1.0	82.53	-1.6		
B (chck)		122.29	0.0	122.29	0.0	122.28	0.0		

A (horiz)	External Crack to rear wall
B (horiz)	External Crack to right-hand wall at rear

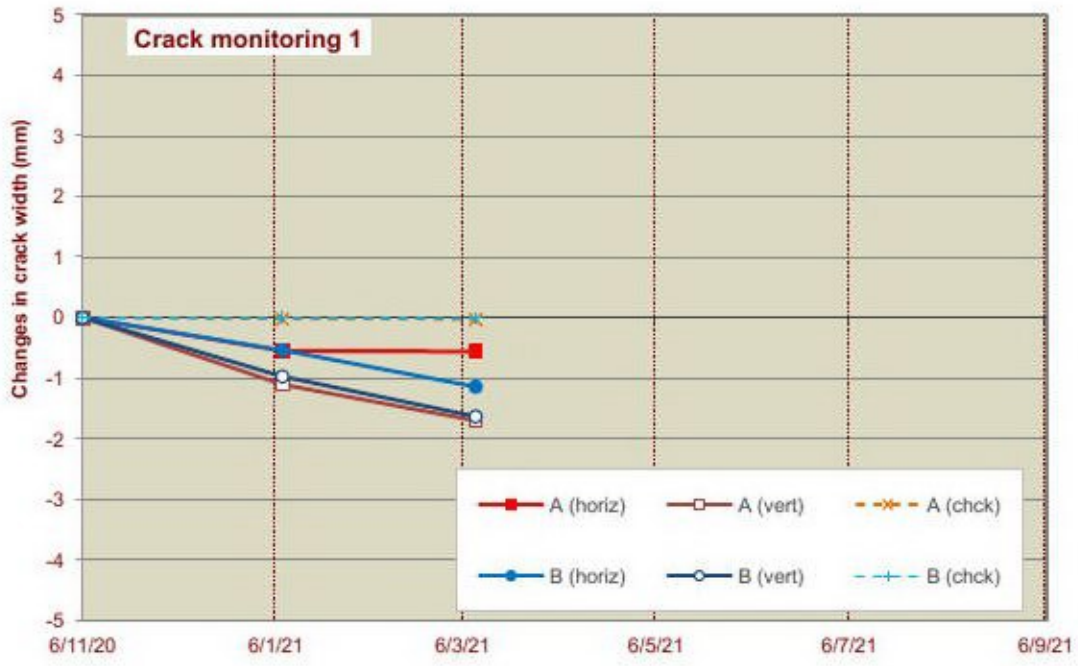

Date 10/03/2021

Comment



Crack A



Crack B

