



Arboricultural Impact Assessment

Pretyman Avenue, Bacton

On behalf of

Bellway Homes Limited

Author	Geoff Clack BA(Hons) NDArb TechArborA
Quality Reviewer	Gary Meadowcroft Dip.Arb (RFS) M.arbor.A
Report Status	Rev B
Date of Issue	23-08-21

Professional Service • Pragmatic Solutions
Ecology, Arboriculture, Countryside Management


Phone: 01268 711 021 Email: team@ses-eco.co.uk website: www.ses-eco.co.uk
Address: Unit 1, The Sudbury Stables, Sudbury Road, Downham, Essex, CM11 1LB

Executive summary

An arboricultural survey has been carried out, and this report prepared to support a planning application at Pretyman Avenue, Bacton.

1. Details of all trees forming the survey can be found in Appendix 3, including specific comments in relation to their condition and quality.
2. The area subject to survey includes 40 individual trees, 1 group of trees and 16 hedges.
3. The proposed layout will require the removal of 8 individual trees. The proposed layout will require the part removal of 2 hedges.
4. No Root Protection Areas (RPAs) of any retained trees will be incurred into by the design layout.
5. Provided precautions to protect the retained trees are specified and implemented through the measures included in this report, the development proposal will have minimal impact on the retained trees or their wider contribution to amenity and character.
6. If the recommendations made within this report are followed, the development will be achievable in arboricultural terms and should be acceptable to the Local Planning Authority.

<u>Tree Survey Summary</u>	A	B	C	U	TOTAL
Trees	0	0	40	0	40
Groups	0	0	1	0	1
Woodlands	0	0	0	0	0
Hedges	0	0	16	0	16
Scrub/Shrubs	0	0	0	0	0
TOTAL	0	0	57	0	57

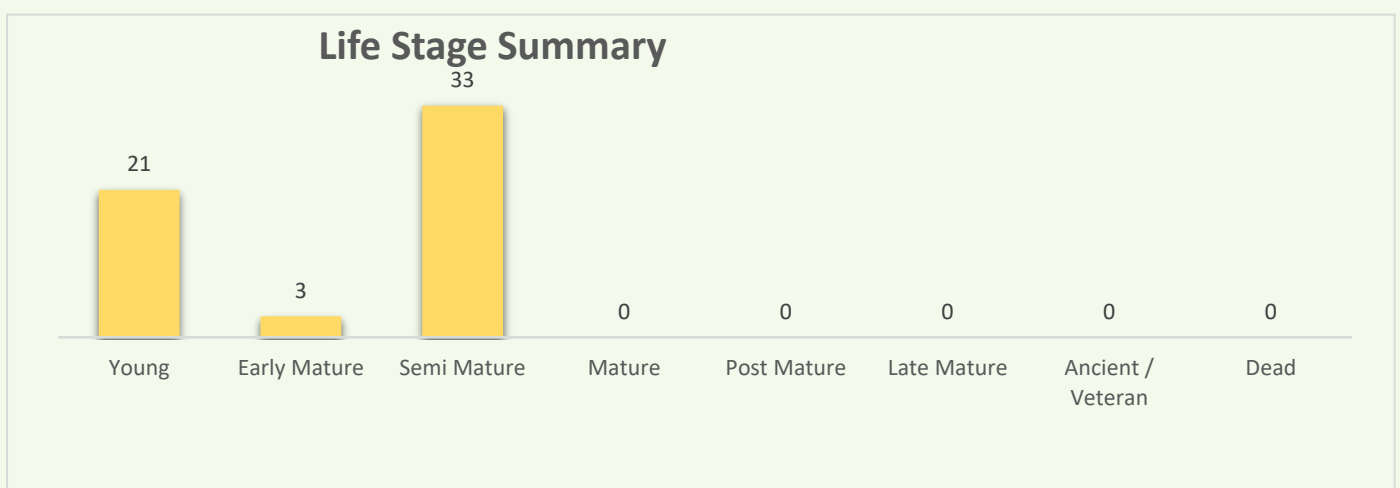

INDEX

CONTENTS

1.0	INTRODUCTION	4
2.0	SITE VISIT AND OBSERVATIONS.....	5
3.0	ARBORICULTURAL IMPACT ASSESSMENT	8
4.0	PRELIMINARY ARBORICULTURAL METHOD STATEMENT	10
5.0	CONCLUSIONS	12
APPENDIX 1:	SURVEY AND BACKGROUND INFORMATION	13
APPENDIX 2:	KEY TO TREE SURVEY SHEET AND SUMMARY	15
APPENDIX 3:	TREE SURVEY SCHEDULE	17
APPENDIX 4:	TREE PROTECTION PLAN (TPP).....	23
APPENDIX 5:	TREE PROTECTION BARRIERS & GROUND PROTECTION DESIGN.....	24
APPENDIX 6:	METHODS OF WORK CLOSE TO TREES	28
APPENDIX 7:	TREE WORK SCHEDULE	33
APPENDIX 8:	SPECIFIC REPORT CAVEAT AND REFERENCES.....	34

1.0 Introduction

1.1 Instruction

Southern Ecological Solutions Ltd. has been instructed to produce an Arboricultural Impact Assessment in support of a planning application at Pretyman Avenue, Bacton. It has been produced in accordance with the principles of British Standard *BS 5837:2012, Trees in relation to design, demolition and construction - Recommendations* and includes the following information to accompany a planning application:

- *details of significant trees including an assessment of condition using BS 5837 categorisation;*
- *a plan showing tree survey information, retention categorisation and root protection areas;*
- *an assessment of the impact of the proposal on trees, any wider impact on the local amenity and any impact trees may have on the proposed development;*
- *a preliminary arboricultural method statement dealing with the protection and management of the trees to be retained;*
- *a schedule of tree works to facilitate construction.*

1.2 Scope and purpose of this report

This report covers trees within the site boundary and its immediate proximity. It is concerned with the impact the development may have on trees, and the effect retained trees may have on the development. Its purpose is to allow the Local Planning Authority to assess the tree information as part of the planning submission.

2.0 Site Visit and Observations

2.1 Site visit

A site visit was undertaken on the 28th January 2021 by Geoff Clack of Southern Ecological Solutions. The weather conditions were Clear and dry.

2.2 Site description

The site is located to the south of Pretymen Avenue and is an open field with scattered young to semi-mature trees and hedges located around the boundary perimeter.

The survey boundary is indicated by the boundaries as per the map below.

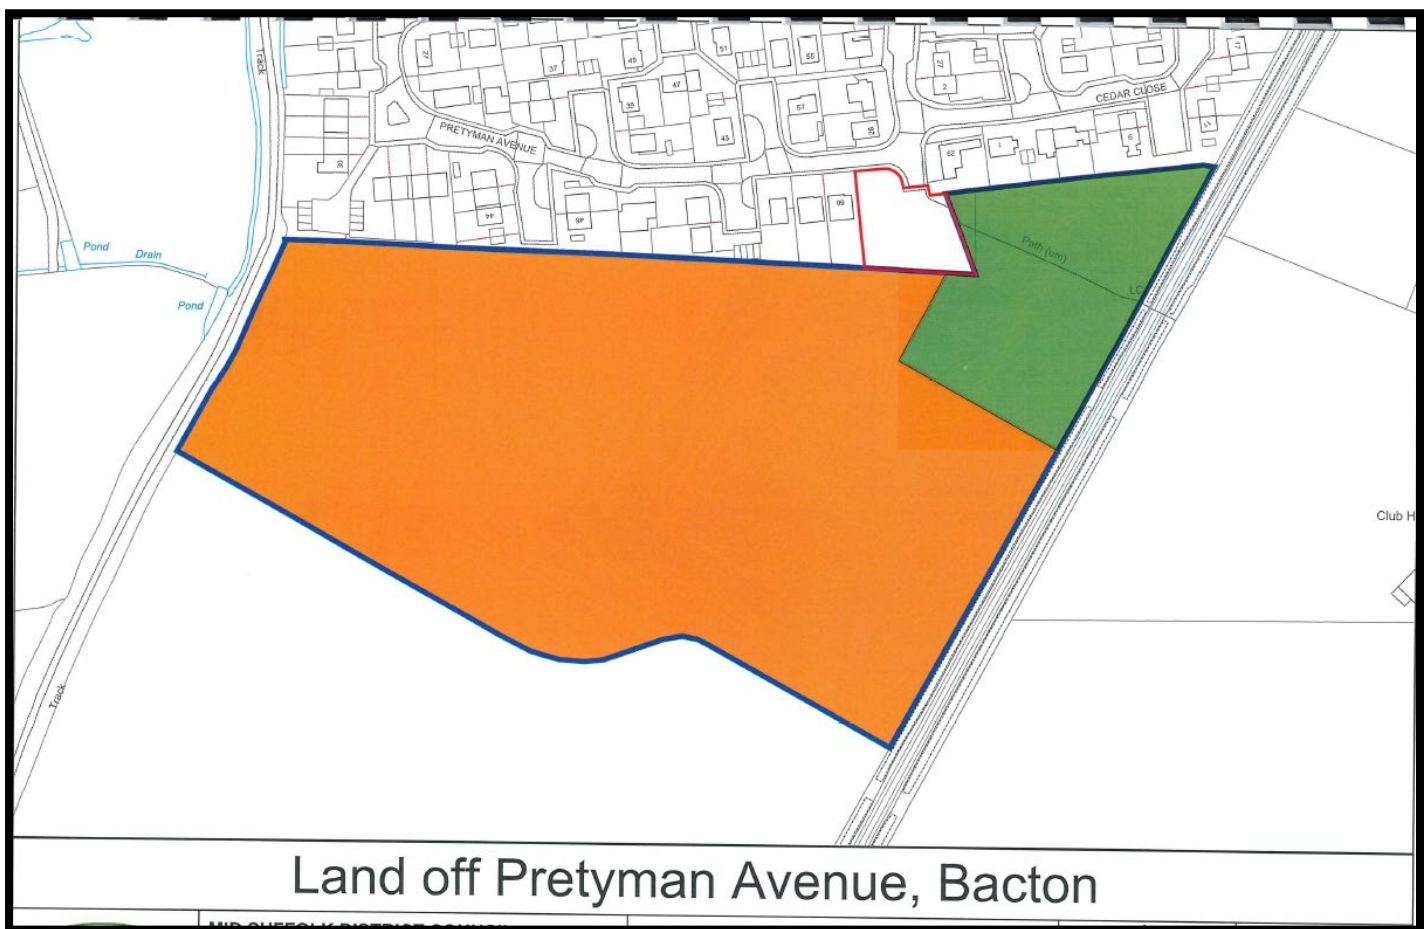


Figure 1 – Boundary of the survey area

2.3 The subject trees

The area relevant for Pretyman Avenue, Bacton, includes 40 individual trees at 'C' category. 1 group at 'C' category and 16 hedges at 'C' category.

All trees were categorised in accordance with Section 4.5 and Table 1 of BS5837.

Table 1 BS5837 Categorisation Summary

	A	B	C	U	TOTAL
Trees	0	0	40	0	40
Groups	0	0	1	0	1
Woodlands	0	0	0	0	0
Hedges	0	0	16	0	16
Scrub/Shrubs	0	0	0	0	0
TOTAL	0	0	57	0	57

2.4 Tree Preservations Orders – Conservation Areas:

2.5 Tree Preservations Orders: a search in the interactive map of Mid Suffolk District Council web page shows that the trees are not within a Conservation Area (CA) or subject to a Tree Preservation Order (TPO)

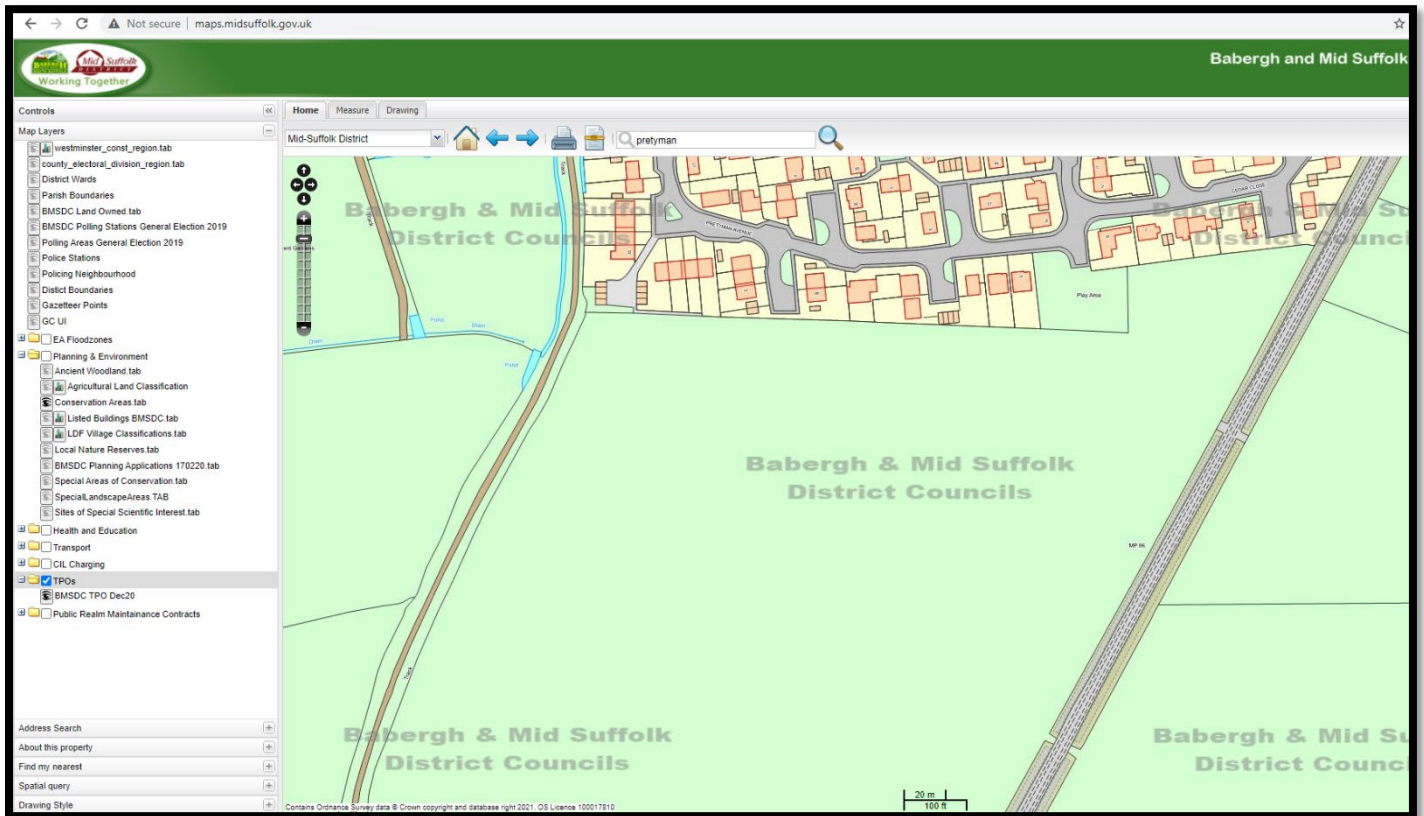


Figure 2 - Capture of Mid Suffolk District Council interactive web site for TPOs and CAs of the area.

Please note the following in relation to vegetation clearance: anyone wishing to undertake works to prune or remove a tree with a Tree Preservation Order or within a Conservation Area will require written authorisation from the Local Planning Authority before any works can proceed.

3.0 Arboricultural Impact Assessment

3.1 Summary of the impact on trees

Development can adversely impact on trees by causing them to be removed to facilitate the development, or in the future, by adversely affecting their potential for retention through a disturbance in Root Protection Areas (RPAs)¹ or through post development pressures to prune or remove.

At the design stage, disturbance within the RPA should be avoided. If unavoidable, (which may need demonstrating), consideration must be given to any construction activity such as demolition, including removal of existing hard surfaces, changing soil levels and the provision of services where within RPAs, as well as new surfaces and structures.

Construction of hard surfaces and other construction may be acceptable within RPAs providing specialist methods of design and construction are used. This will often result in the use of minimal or no-dig methods which result in higher finished levels which must be allowed for during design due to the effect on access thresholds and structure heights etc.

The ability of trees to tolerate some disturbance depends on individual circumstances including prevailing site conditions, tree species, age and condition and this will be assessed by the project arboriculturist.

Protection measures, usually a combination of barriers and ground protection, must be in place before any works (including site clearance) begin, and stay in place for as long as a risk of damage remains (please refer to the Tree Protection Plan - TPP). The protection of trees must take account of the buildability of the proposal, including services, and ensure that all activities, such as storage of materials, parking and the use of plant and vehicles, can be accommodated outside of RPAs. Particular care and planning are necessary for the operation of excavators, lifting machinery and cranes to ensure all vehicle movement and lifting operations will not impact on retained trees.

¹ *Root Protection Area (RPA) - A layout design tool indicating the minimum area surrounding the tree that contains sufficient rooting volume to maintain the tree's viability, and where the protection of the roots and soil structure is treated as a priority. Assessed according to the recommendations set out in clause 4.6 of BS 5837. It is calculated by multiplying the radius squared by 3.142. Clause 4.6.2 of BS 5837 states that the RPA may be changed in shape, considering local site factors, species tolerance, condition and root morphology.*

3.2 Tree protection plan (TPP)

Trees to be retained are coloured coded based on their tree category, whilst trees required for removal to facilitate the development have red hatch lines inside a red circle representing the tree crown spread. Tree protection is shown as barriers and/or ground protection defining the Construction Exclusion Zone (CEZ)², and any areas requiring non-standard methods of demolition or construction are shown.

3.3 Trees to be removed

The proposed layout will require the removal of 8 individual trees. The proposed layout will require the part removal of 2 hedges.

Table 2 Tree removal summary

Removal		TOTAL	Part removal		TOTAL
Trees	T42, T43, T44, T45, T46, T47, T48 and T49	8	Trees		0
Groups		0	Groups		0
Woodlands		0	Woodlands		0
Hedges		0	Hedges	H34 and H41	2
Shrubs		0	Shrubs		0

3.4 Trees to be pruned

There are currently no trees identified on site that will require pruning.

Opportunities for remedial pruning works to low crowns etc. can be identified at later stages in the development process where deemed appropriate. A full Arboricultural Method Statement (AMS) can be produced detailing any pruning works required to accommodate the proposed design layout and/or for access around the site from canopy obstruction. All tree pruning/felling work to facilitate the development can be found in Appendix 7.

3.5 Root protection area incursions

No Root Protection Areas (RPAs) of any retained trees will be incurred into by the design layout.

² Construction Exclusion Zone. An area based on the RPA in m² identified by an arboriculturist, to be protected during development, including demolition and construction work, by the use of barriers and/or ground protection fit for purpose to ensure the successful long-term retention of a tree.

4.0 Preliminary Arboricultural Method Statement

4.1 Introduction

This section is a preliminary arboricultural method statement specifying the methodology to be used for the protection of trees and works close to trees that have the potential to result in the loss of or damage to a tree. It includes details of site management and supervision required for successful tree retention.

4.2 Site clearance

Damage can easily be caused to trees to be retained during initial site clearance. Therefore, tree protection barriers must be in place before site clearance to protect retained trees identified in Appendix 3.

4.3 Site and fuel storage, cement mixing and washing points

All site storage areas, cement mixing and washing points for equipment and vehicles and fuel storage must be outside RPAs. No discharge of potential contaminants will occur within 10 m of a retained tree stem or where there is a risk of run-off into RPAs.

4.4 Tree protection barriers

Appendix 5 includes guidance for protective barriers based on BS 5837:2012. The approximate location of the barriers and the CEZs is shown on the TPP. The precise location of the barriers and other protective measures will be confirmed at the pre-commencement meeting before any demolition or construction activities (including site clearance) start.

4.5 Ground protection

In areas where it is not possible to erect protective barriers, ground protection must be used to protect the RPAs of retained trees. Where it has been agreed during the design stage that vehicular or pedestrian access for the construction operation may take place within the CEZ, the possible effects of construction activity should be addressed by a combination of barriers and ground protection. The position of the barrier may be within the CEZ at the edge of the agreed working zone, but the soil structure beyond the barrier to the edge of the CEZ shall be protected with ground protection.

4.6 Precautions when working in CEZs

Only work agreed with the Local Planning Authority can be carried out within CEZs. Any works must be carried out in accordance with the details as set out in Appendix 6 which are summarised below.

4.7 Installation of new surfacing

Full details of the new surfacing proposed within the RPAs of trees to be retained is not known at the time of writing. However, if resurfacing is required within the RPAs of any trees it will be necessary to use non-standard methods of construction. Ideally, new substrates and finished surfaces should be of a porous design to allow water and an air passage in and out.

4.8 Installation of new services

The exact location of services is often difficult to establish until construction is in progress. Where existing services within RPAs require upgrading or new services have to be installed in RPAs, conventional excavation techniques are unacceptable, and great care must be taken to minimise any disturbance. Trenchless installation should be the preferred option, but if that is not feasible, any excavation must be carried out by hand or using a compressed air lance. The methodology must comply with *NJUG Volume 4: Guidelines for the Planning, installation and Maintenance of Utility Apparatus in Proximity to Trees*.

4.9 Tree works

Recommendations for tree works can be found in the tree works schedule in Appendix 7. All works shall be in accordance with *BS 3998:2010*, or in accordance with current best practice. The use of a competent tree surgery contractor is necessary to comply with this (follow the link for a list of Arboricultural Association approved contractors [Directory of Tree Surgeons - Arboricultural Association](#)). The main contractor and tree surgery contractor must ensure that any necessary consents have been received from the Local Planning Authority regarding planning constraints in regard to trees and that no protected species or habitats are harmed whilst carrying out site clearance or tree surgery works.

5.0 Conclusions

- 5.1** The proposed layout will require the removal of 8 individual trees. The proposed layout will require the part removal of 2 hedges.
- 5.2** No Root Protection Areas (RPAs) of any retained trees will be incurred into by the design layout.
- 5.3** Provided precautions to protect the identified trees are specified and implemented through the measures included in this report; the development proposal will have minimal impact on the retained trees or their wider contribution to amenity and character.
- 5.4** If the recommendations made within this report are followed, the development will be achievable in arboricultural terms and should be acceptable to the Local Planning Authority.

Appendix 1: Survey and Background Information

1.1 Limitations

A detailed topographical plan showing the locations of individual trees was provided by the client and used for the tree survey, so the positions of the trees were understood to be accurate, and SES Ltd accepts no liability for the accuracy of any tree survey drawings based on the topographical plan supplied by the client.

Trees are living organisms whose health and the condition can change rapidly and all trees, even healthy ones, are at risk from unpredictable climatic and manmade events. The assessment of risk for any tree is based upon factors evident at the time of the inspection and the interpretation of those factors by suitably qualified inspectors. The health, condition and safety of trees should be checked on a basis commensurate with the level of risk and preferably on an annual basis.

1.2 Methods

The trees were surveyed from ground level without detailed investigations. All trees with a trunk diameter of 75 mm or above³ were surveyed. All dimensions were estimated unless otherwise indicated. Obvious hedges and shrub masses were identified where appropriate. Information collected is in accordance with recommendations in *Subsection 4.4.2.5 of BS 5837:2012* and includes species, height, diameter, branch spread, crown clearance, age class, physiological condition, structural condition and remaining contribution. Each tree was then allocated one of four categories (U, A, B or C) to reflect its suitability as a material constraint on development.

1.3 Documents and information received

- *Topographical plan*
- *Proposed plan*

1.4 Contact

Name	Company/organisation	Tel. no.
Geoff Clack	SES Arboriculture Ltd	+44 (0)1268 711021

³ *BS 5837 recommends that in most circumstances all trees over 75mm stem diameter should be included in a pre-planning land and tree survey*

1.5 Reference documents

- *British Standards Institution (2012) BS 5837: Trees in relation to design, demolition and construction – Recommendations;*
- *British Standards Institute (2010) BS 3998: Tree work – Recommendations;*
- *DETR Tree Preservation Orders – A Guide to the Law and Good Practice;*
- *National Joint Utilities Group (2007) Volume 4, Issue 2: Guidelines for the planning, installation and maintenance of utility apparatus in proximity to trees;*
- *DTLR (2001) Principles of Tree Hazard Assessment and Management - David Lonsdale.*

1.6 Legal Constraints and Liabilities

1.6.1 Occupiers Liability 1957 and 1984

The Occupiers Liability Act places a duty of care to ensure that no reasonably foreseeable harm takes place due to tree defects. Therefore, this report includes recommendations within the tree tables for work required for safety reasons. ‘Common sense risk management of trees (National Tree Safety Group 2012)’ states that *‘the owner of the land on which a tree stands, together with any party who has control over the tree’s management, owes a duty of care at common law to all people who might be injured by the tree. The duty of care is to take reasonable care to avoid acts or omissions that cause a reasonably foreseeable risk of injury to persons or property.’*

1.6.2 Common Law

This enables pruning back of the crown and roots of trees on adjacent land where they overhang neighbouring property, providing the work is reasonable and does not cause harm. This right does not override TPO and CA legislation.

1.6.3 Ecological Constraints

The Wildlife and Countryside Act 1981, as amended, The Conservation of Habitats and Species Regulations 2010 and the Countryside and Rights of Way Act 2000, provide statutory protection to species of flora and fauna including birds, bats and other species that are associated with trees. These could impose significant constraints on the use and timing of access to the site. It is the responsibility of the main contractor and tree surgery contractor to ensure that no protected species are harmed whilst carrying out site clearance or tree surgery works. Unless competent to do so, the advice of an ecologist must be sought.

Appendix 2: Key to Tree Survey Sheet and Summary

Measurements	Life Stage	Structural and physiological condition	Root Protection Area (RPA)
Height - Measured using a digital laser clinometer (m)	Young trees up to ten years of age	Good: Trees with only a few minor defects and in good overall health needing little, if any attention	<ul style="list-style-type: none"> • The RPA Radius column provides the extent of an equivalent circle from the center of the stem (m). • The RPA is calculated using the formulae described in paragraph 4.6.1 of British Standard 5837: 2012 and is indicative of the rooting area required for a tree to be successfully retained. Tree roots extend beyond the calculated RPA in many cases and where possible a greater distance should be protected. • Where veteran trees have been identified the RPA has been calculated in accordance with Natural England guidance i.e. 15x the stem diameter, uncapped.
Stem diameter – DBH. Diameter measured (mm) in accordance with Annex C of the BS5837	Semi-mature trees less than 1/3 life expectancy	Fair: Trees with minor rectifiable defects or in the early stages of stress from which it may recover	
Crown Spread - Measured using a digital laser clinometer radially from the main stem (m)	Early mature trees 1/3 – 2/3 life expectancy	Poor: Trees with major structural and/or physiological defects such that it is unlikely the tree will recover in the long term	
	Mature trees over 2/3 life expectancy	Dead: This could also apply to trees in an advanced state of decline and unlikely to recover	
	<p>Over mature declining or moribund trees of low vigor</p> <p>Veteran tree possessing certain attributes relating to veteran trees</p>	<p>The BS category particular consideration has been given to the following</p> <ul style="list-style-type: none"> • The health, vigor and condition of each tree • The presence of any structural defects in each tree/group and its future life expectancy • The size and form of each tree/group and its suitability within the context of a proposed development • The location of each tree relative to existing site features e.g. its screening value or landscape features • Age class and life expectancy 	

Abbreviations		BS cat: Category in accordance with Table 1 and section 4.5 of BS 5837.	
T – Tree	Feature surveyed as individual tree. Included multi stem trees	Category A	High quality and value (non-fiscal) with at least 40 years remaining life expectancy.
G – Group of trees	Land under a stand of trees with a maximum size of 0.25 hectare.	Category B	Moderate quality and value with at least 20 years remaining life expectancy.
W – Woodland	Land under a stand of trees with, or the potential to achieve, tree canopy cover of 20% or more. The minimum size of woodland Forestry Commission Scotland can grant-aid is 0.25 hectare.	Category C	Low quality and value with at least 10 years remaining life expectancy, or young trees with a stem diameter below 150 mm
H - Hedge	A hedgerow is a boundary line of bushes which can include trees and is protected if it's: more than 20m long with gaps of 20m or less in its length.	Category U	Unsuitable for retention. Existing condition is such that they cannot be realistically retained as living trees in the context of the current land use for longer than 10 years. Note, category U trees can have existing or potential conservation value which it might be desirable to preserve.
# - Estimated value.	See observation for further information	Subcategories	<ul style="list-style-type: none"> (1) - Mainly arboricultural values (2) - Mainly landscape values (3) - Mainly cultural values including conservation.
VTA – Visual Tree Assessment	Non-invasive method of examining the health and structural condition of individual trees.		

2.1 Appendix Summary

Table 3 BS5837 category summary with tree numbers

SUMMARY	Individual Trees	Total	Group of Trees	Total
Category U - Unsuitable		0		0
Category A (High Quality / Value)		0		0
Category B (Moderate Quality / Value)		0		0
Category C (Low Quality / Value)	T1, T5, T6, T7, T8, T9, T10, T12, T13, T14, T15, T16, T17, T18, T19, T20, T22, T23, T24, T25, T26, T28, T29, T31, T38, T39, T40, T42, T43, T44, T45, T46, T47, T48, T49, T51, T52, T53, T54, T56	40	H2, H3, G4, H11, H21, H27, H30, H32, H33, H34, H35, H36, H37, H41, H50, H55, H57	17

Table 4 Life stage and BS5837 category summary

SUMMARY	A	B	C	U	TOTAL
Young	0	0	21	0	21
Early Mature	0	0	3	0	3
Semi Mature	0	0	33	0	33
Mature	0	0	0	0	0
Post Mature	0	0	0	0	0
Late Mature	0	0	0	0	0
Ancient / Veteran	0	0	0	0	0
Dead	0	0	0	0	0
TOTAL	0	0	57	0	57

Appendix 3: Tree Survey Schedule

Client: Bellway Homes Limited
 Site: Pretyman Avenue, Bacton

Surveyed by: Geoff Clack

Weather: Clear and dry

Survey Date: 28th January 2021

Abbreviations	
# - Estimated value.	See observation for further information
com - Combined stem diameter	In accordance with BS5837:2012

Tree No.	Species	Life Stage	No of Stems	Stem Diameter - DBH (mm)	Height (m)	Crown Spread (m)								Structural Condition	Physiological Condition	Observations	Life Expectancy	BS5837 Category	RPA Radius (m)	RPA Area (m2)
						N	NE	E	SE	S	SW	W	NW							
T1	Chamaecyparis lawsoniana (Lawson Cypress)	Young	4	100 com	3	1.0		1.0		1.0		1.0		Fair	Fair	n/a	20+	C2	1.2	4.5
H2	Leylandii hedge	Young		See Observations	2.5	See Tree Survey Plan								Fair	Fair	Leylandii hedge maintained at 2.5m height. Hedge planted south of garden boundary fence, i.e. potentially within site.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
H3	Leylandii hedge	Young		See Observations	2.5	See Tree Survey Plan								Fair	Fair	Leylandii hedge maintained at 2.5m height.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
G4	Sour cherry, elder, Lawsons cypress.	Young		See Observations	2.5	See Tree Survey Plan								Fair	Fair	Sour cherry, elder, Lawsons cypress.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T5	Fraxinus excelsior (Ash)	Semi Mature	4	300 com	5.5		1.9		1.0		2.0		1.0	Poor	Fair	Offsite, behind fence on railway land. Multistem. Poor form, previously cut at 0.5m and 2m height. Flailed site side.	20+	C2	3.6	40.7
T6	Salix caprea (Goat Willow/Great Sallow)	Semi Mature	2	210 com	4		1.0		1.0		1.0		1.0	Poor	Fair	Offsite, behind fence on railway land. Multistem. Poor form, previously cut at 0.5m and 2m height. Flailed site side.	20+	C2	2.5	20.4
T7	Salix caprea (Goat Willow/Great Sallow)	Semi Mature	2	210 com	4		1.0		1.0		1.0		1.0	Poor	Fair	Offsite, behind fence on railway land. Multistem. Poor form, previously cut at 0.5m and 2m height. Flailed site side.	20+	C2	2.5	20.4
T8	Salix caprea (Goat Willow/Great Sallow)	Semi Mature	2	210 com	4		1.0		1.0		1.0		1.0	Poor	Fair	Offsite, behind fence on railway land. Multistem. Poor form, previously cut at 0.5m and 2m height. Flailed site side.	20+	C2	2.5	20.4
T9	Salix caprea (Goat Willow/Great Sallow)	Semi Mature	2	280 com	4		2.0		1.0		2.0		1.0	Poor	Fair	Offsite, behind fence on railway land. Multistem. Poor form, previously cut at 0.5m and 2m height. Flailed site side.	20+	C2	3.4	36.2

Tree Survey Schedule

Client: Bellway Homes Limited

Surveyed by: Geoff Clack

Weather: Clear and dry

Site: Pretyma Avenue, Bacton

Survey Date: 28th January 2021

Abbreviations	
# - Estimated value.	See observation for further information
com - Combined stem diameter	In accordance with BS5837:2012

Tree No.	Species	Life Stage	No of Stems	Stem Diameter - DBH (mm)	Height (m)	Crown Spread (m)								Structural Condition	Physiological Condition	Observations	Life Expectancy	BS5837 Category	RPA Radius (m)	RPA Area (m2)
						N	NE	E	SE	S	SW	W	NW							
T10	Salix caprea (Goat Willow/Great Sallow)	Semi Mature	2	280 com	4		2.0		1.0		2.0		1.0	Poor	Fair	Offsite, behind fence on railway land. Multistem. Poor form, previously cut at 0.5m and 2m height. Flailed site side.	20+	C2	3.4	36.2
H11	Dogwood, hawthorn, blackthorn, bramble.	Young		See Observations	2	See Tree Survey Plan								Fair	Fair	Hedge along fenceline consisting of dogwood, hawthorn, blackthorn, bramble. Average stem diameter 30mm.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T12	Fraxinus excelsior (Ash)	Semi Mature	4	400 com	7		2.6		1.0		2.5		1.0	Poor	Fair	Multistem. Previously reduced.	20+	C2	4.8	72.4
T13	Fraxinus excelsior (Ash)	Semi Mature	4	400 com	7		2.6		1.0		2.5		1.0	Poor	Fair	Multistem. Previously reduced.	20+	C2	4.8	72.4
T14	Fraxinus excelsior (Ash)	Semi Mature	2	350 com	8		3.0		2.5		1.0		2.5	Poor	Fair	Twinstem.	20+	C2	4.2	56.5
T15	Salix caprea (Goat Willow/Great Sallow)	Semi Mature	1	450	7		1.0		2.5		3.4		2.5	Poor	Fair	n/a	20+	C2	5.4	91.6
T16	Quercus robur (English Oak)	Early Mature	2	480 com	9		3.0		2.0		3.0		3.0	Poor	Fair	Twinstem.	20+	C2	5.9	108.1
T17	Acer campestre (Field Maple)	Semi Mature	4	500 com	7		4.0		1.0		2.8		1.0	Poor	Fair	Multistem.	20+	C2	6.0	113.1
T18	Fraxinus excelsior (Ash)	Semi Mature	2	440 # com	9		6.0		2.0		4.0		3.0	Poor	Fair	Twinstem.	20+	C2	5.4	90.2
T19	Acer campestre (Field Maple)	Semi Mature	4	400 com	6.5		3.0		1.0		4.0		2.5	Poor	Fair	Multistem.	20+	C2	4.8	72.4

Tree Survey Schedule

Client: Bellway Homes Limited

Surveyed by: Geoff Clack

Weather: Clear and dry

Site: Pretyma Avenue, Bacton

Survey Date: 28th January 2021

Abbreviations	
# - Estimated value.	See observation for further information
com - Combined stem diameter	In accordance with BS5837:2012

Tree No.	Species	Life Stage	No of Stems	Stem Diameter - DBH (mm)	Height (m)	Crown Spread (m)								Structural Condition	Physiological Condition	Observations	Life Expectancy	BS5837 Category	RPA Radius (m)	RPA Area (m2)
						N	NE	E	SE	S	SW	W	NW							
T20	Acer campestre (Field Maple)	Semi Mature	4	400 com	7		3.1		1.0		3.0		2.0	Poor	Fair	Multistem. Cut back railside.	20+	C2	4.8	72.4
H21	Hawthorn, elder and ivy.	Semi Mature		See Observations	5	See Tree Survey Plan								Fair	Fair	Field boundary hedge of hawthorn, elder and ivy. Average stem diameter 70mm. Stems located west of ditchline.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T22	Acer campestre (Field Maple)	Semi Mature	1	240 #	6.5	2.0		2.0		2.0		2.0		Fair	Fair	n/a	20+	C2	2.9	26.1
T23	Acer campestre (Field Maple)	Semi Mature	3	380 # com	6.5	2.0		4.0		4.0		4.0		Fair	Fair	Multistem.	20+	C2	4.6	65.7
T24	Acer campestre (Field Maple)	Semi Mature	3	380 # com	6.5		5.2		4.0		2.0		4.0	Fair	Fair	Multistem.	20+	C2	4.6	65.7
T25	Acer campestre (Field Maple)	Early Mature	3	430 # com	8		1.1		4.0		5.2		4.0	Fair	Fair	Multistem.	20+	C2	5.3	87.1
T26	Acer campestre (Field Maple)	Early Mature	3	430 # com	8		4.5		4.0		1.1		4.0	Fair	Fair	Multistem.	20+	C2	5.3	87.1
H27	Hawthorn and ivy.	Semi Mature		See Observations	5	See Tree Survey Plan								Fair	Fair	Field boundary hedge of hawthorn and ivy. Average stem diameter 70mm. Stems located west of ditchline.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T28	Fraxinus excelsior (Ash)	Semi Mature	3	290 com	8	3.0		3.0		3.0		3.0		Poor	Fair	Multistem.	20+	C2	3.5	39.2
T29	Acer campestre (Field Maple)	Semi Mature	5	330 com	4.5	3.0		3.0		3.0		3.0		Fair	Fair	Multistem. Pollarded to 4m beneath overhead wires.	20+	C2	4.0	50.9
H30	Maintained beech hedge. Average stem diameter 40mm.	Young		See Observations	2	See Tree Survey Plan								Fair	Fair	Beech hedge.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T31	Fraxinus excelsior (Ash)	Young	2	120 com	3.5	1.0		1.0		1.0		1.0		Poor	Fair	Stem bifurcates at 0.5m high.	20+	C2	1.5	7.3

Tree Survey Schedule

Client: Bellway Homes Limited

Surveyed by: Geoff Clack

Weather: Clear and dry

Site: Pretyman Avenue, Bacton

Survey Date: 28th January 2021

Abbreviations	
# - Estimated value.	See observation for further information
com - Combined stem diameter	In accordance with BS5837:2012

Tree No.	Species	Life Stage	No of Stems	Stem Diameter - DBH (mm)	Height (m)	Crown Spread (m)								Structural Condition	Physiological Condition	Observations	Life Expectancy	BS5837 Category	RPA Radius (m)	RPA Area (m2)
						N	NE	E	SE	S	SW	W	NW							
H32	0	Young		See Observations	2	See Tree Survey Plan								Fair	Fair	Maintained garden hedge and shrubs.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
H33	Maintained leylandii hedge.	Young		See Observations	2	See Tree Survey Plan								Fair	Fair	Leylandii hedge.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
H34	Field Maple and hawthorn. Average stem diameter 100mm.	Young		See Observations	3	See Tree Survey Plan								Fair	Fair	Field Maple and hawthorn.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
H35	Hawthorn hedge.	Young		See Observations	3	See Tree Survey Plan								Fair	Fair	Hawthorn hedge. Average stem diameter 100mm.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
H36	Cherry laurel and forsythia.	Young		See Observations	2	See Tree Survey Plan								Fair	Fair	Garden hedge of cherry laurel and forsythia.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
H37	Mixed conifers, Lawsons cypress, leylandii and yew.	Young		See Observations	3	See Tree Survey Plan								Fair	Fair	Row of mixed conifers, Lawsons cypress, leylandii and yew. Average stem diameter 100mm.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T38	Fraxinus excelsior (Ash)	Semi Mature	2	280 com	5	2.0		2.0		2.0		2.0		Fair	Fair	Offsite in private garden. 4.5m pollard.	20+	C2	3.4	36.2
T39	Acer platanoides (Norway Maple)	Semi Mature	1	300	6.5	4.0		4.0		2.0		4.0		Fair	Fair	Crown cut back on south side due to overhead wires.	20+	C2	3.6	40.7
T40	Quercus cerris (Turkey Oak)	Semi Mature	1	490	11	5.0		5.0		2.0		5.0		Fair	Fair	Bark wound on north side of stem from base to 1m high, 200mm wide.	20+	C2	5.9	108.6
H41	Hawthorn, ash and field maple.	Semi Mature		See Observations	5.5	See Tree Survey Plan								Fair	Fair	Field boundary hedge of hawthorn, ash and field maple. Average stem diameter 100mm.	20+	C2	See Tree Survey Plan	See Tree Survey Plan

Tree Survey Schedule

Client: Bellway Homes Limited

Surveyed by: Geoff Clack

Weather: Clear and dry

Site: Pretyman Avenue, Bacton

Survey Date: 28th January 2021

Abbreviations	
# - Estimated value.	See observation for further information
com - Combined stem diameter	In accordance with BS5837:2012

Tree No.	Species	Life Stage	No of Stems	Stem Diameter - DBH (mm)	Height (m)	Crown Spread (m)								Structural Condition	Physiological Condition	Observations	Life Expectancy	BS5837 Category	RPA Radius (m)	RPA Area (m2)
						N	NE	E	SE	S	SW	W	NW							
T42	Crataegus monogyna (Common Hawthorn/Quick/May)	Young	3	170 com	4	2.0		2.0		2.0		2.0		Fair	Fair	Part of hedgeline.	20+	C2	2.1	13.6
T43	Acer campestre (Field Maple)	Semi Mature	2	260	6	2.0		2.0		2.0		2.0		Fair	Fair	Part of hedgeline.	20+	C2	3.2	32.8
T44	Fraxinus excelsior (Ash)	Semi Mature	1	300 com	6	3.0		3.0		3.0		3.0		Fair	Fair	Part of hedgeline.	20+	C2	3.6	40.7
T45	Acer campestre (Field Maple)	Semi Mature	4	200	73	2.0		2.0		2.0		2.0		Fair	Fair	Part of hedgeline.	20+	C2	2.4	18.1
T46	Fraxinus excelsior (Ash)	Semi Mature	1	270 com	7	3.0		3.0		3.0		3.0		Fair	Fair	Part of hedgeline.	20+	C2	3.2	33.0
T47	Crataegus monogyna (Common Hawthorn/Quick/May)	Young	2	160	4	2.0		1.0		2.0		2.0		Fair	Fair	Part of hedgeline.	20+	C2	2.0	13.0
T48	Fraxinus excelsior (Ash)	Semi Mature	1	290	8	2.0		3.0		4.0		3.0		Poor	Fair	Part of hedgeline. Poor crossing, twisting limbs above crownbreak.	20+	C2	3.5	38.0
T49	Acer platanoides (Norway Maple)	Semi Mature	1	310	6	4.0		4.0		2.0		4.0		Fair	Fair	Part of hedgeline.	20+	C2	3.7	43.5
H50	Field maple	Semi Mature		See Observations	1	See Tree Survey Plan								Fair	Fair	2 field maple hedge stools recently cut to 1m height.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T51	Padus avium (Bird Cherry)	Semi Mature	1	320	6	4.0		4.0		4.0		4.0		Poor	Fair	Congested forks at crownbreak.	20+	C2	3.8	46.3

Tree Survey Schedule

Client: Bellway Homes Limited

Surveyed by: Geoff Clack

Weather: Clear and dry

Site: Pretyman Avenue, Bacton

Survey Date: 28th January 2021

Abbreviations	
# - Estimated value.	See observation for further information
com - Combined stem diameter	In accordance with BS5837:2012

Tree No.	Species	Life Stage	No of Stems	Stem Diameter - DBH (mm)	Height (m)	Crown Spread (m)								Structural Condition	Physiological Condition	Observations	Life Expectancy	BS5837 Category	RPA Radius (m)	RPA Area (m2)
						N	NE	E	SE	S	SW	W	NW							
T52	Chamaecyparis lawsoniana (Lawson Cypress)	Young	1	150	6	1.0		1.0		1.0		1.0		Fair	Fair	n/a	20+	C2	1.8	10.2
T53	Acer platanoides (Norway Maple)	Young	1	170	6	2.0		2.0		2.0		2.0		Fair	Fair	Previously reduced.	20+	C2	2.0	13.1
T54	Acer platanoides (Norway Maple)	Young	1	170	5	2.5		2.5		2.5		2.5		Fair	Fair	n/a	20+	C2	2.0	13.1
H55	Field maple	Young		See Observations	1	See Tree Survey Plan								Fair	Fair	Field maple hedge maintained at 1m height.	20+	C2	See Tree Survey Plan	See Tree Survey Plan
T56	Malus sp. (Apple sp.)	Young	1	200 #	4	2.0		2.0		2.0		2.0		Fair	Fair	n/a	20+	C2	2.4	18.1
H57	Hawthorn hedge.	Young		See Observations	1.5	See Tree Survey Plan								Fair	Fair	Hawthorn hedge.	20+	C2	See Tree Survey Plan	See Tree Survey Plan



Appendix 4: Tree Protection Plan (TPP)

See attached plan on the following page



Legend

- Category A - Trees of high quality with an estimated remaining life expectancy of at least 40 years
- Category B - Trees of moderate quality with an estimated remaining life expectancy of at least 20 years
- Category C - Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150 mm
- Category U - Trees unsuitable for retention
Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years
- Group of trees (G) / hedgerows (H) / woodlands (W) / shrub (S) - Colour coded according to categories above
- Root Protection Area (RPA)
- Trees to be removed
- Survey boundary line
- TPF - Tree Protective Fencing

Root Protection Area (RPA)

Tree reference number
Example Tree Representation

- Location of the stem (colour coded)
- Crown spread (colour coded)

This drawing was produced in colour - a monochrome copy should not be relied upon.
 Contractors must check all dimensions on site. Any discrepancies must be reported to the arboricultural consultant before proceeding.



Southern Ecological Solutions,
 Sudbury Stables Downham,
 Essex CM11 1LB
 Phone: 01268 711021
 Website: www.ses-eco.co.uk

Rev	Update	Date
B	BW233 Option 3 rev A1	23/08/21


Site: Pretyman Avenue, Bacton

Client: Bellway Homes Limited

Drawing title: Tree Protection Plan

Drawing no.	Scale	Date
TPP/Pretyman Ave/23-08-21	1/600@A1	23/08/21

Revision	Drawn by	Checked by
B	GC	GM



Appendix 5: Tree Protection Barriers & Ground Protection Design

Barriers should be fit for the purpose of excluding construction activity and appropriate to the degree and proximity of work taking place. The default specification will be in accordance with *Section 6.2.2.2 of BS 5837:2012*, as set out below.

5.1 Specifications

Barrier shall be a minimum 2 m high. It shall consist of a vertical and horizontal scaffold framework, well braced to resist impacts, as illustrated below. The vertical tubes should be spaced at a minimum interval of 3 m and driven securely into the ground. Onto this framework, welded mesh panels should be securely fixed. See Figure 2 overleaf.

Where site circumstances and the associated risk of damaging incursions into the RPA do not necessitate the default level of protection, an alternative specification may be used if agreed with the local authority. An example would be 'Heras' type welded mesh panels on rubber or concrete feet. The panels should be joined together using a minimum of two anti-tamper couplers, installed so that they can only be removed from inside the fence. The panels should be supported on the inner side by stabiliser struts. See Figure 3 overleaf. All-weather notices should be attached to the barrier with words such as 'TREE PROTECTION ZONE - NO ACCESS'.

5.2 Location

Barriers shall be positioned on the perimeter of the Root Protection Area to define the Construction Exclusion Zone or as specified in the Tree Protection Plan.

The Tree Protective Fencing is represented on the Tree Protection Plan by a black linetype containing the letters 'TPF'.

Figure 3 Example of welded mesh barriers in use

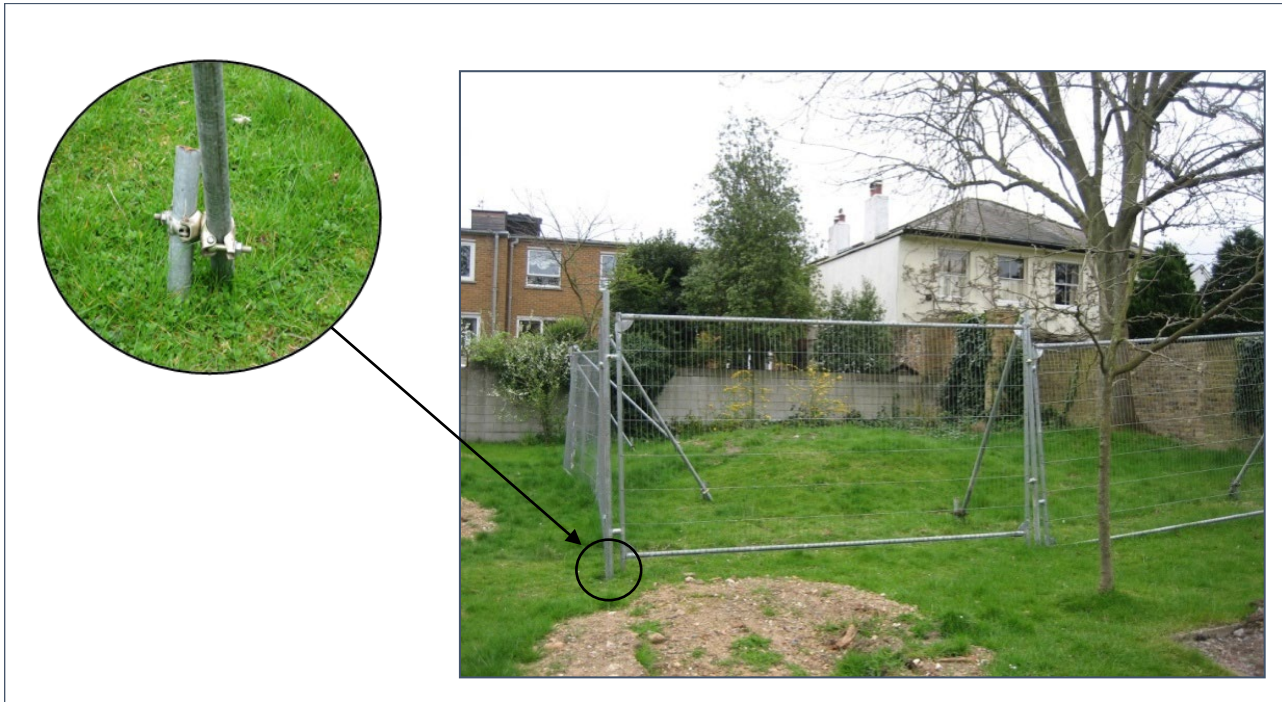


Figure 5 Default specification or protective barrier


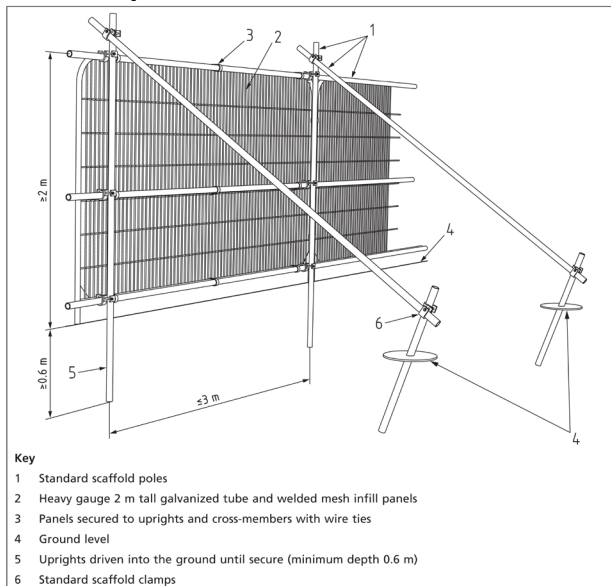


Figure 4 Examples of above-ground stabilizing system

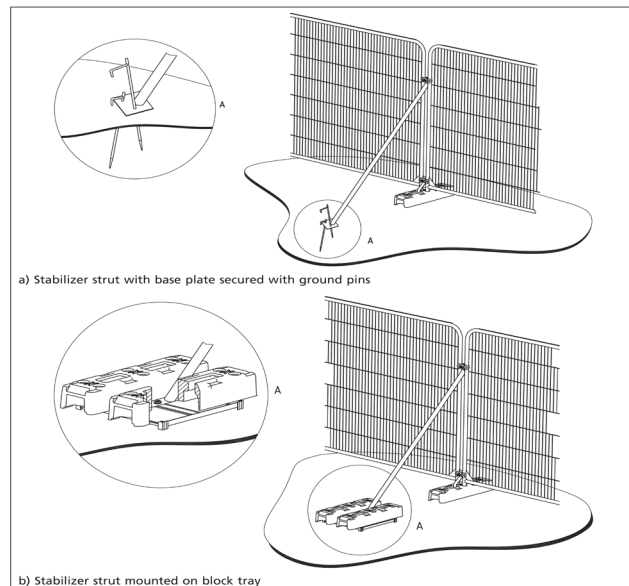

Figures above are reproduced with the permission of the British Standards Institute.

5.3 Ground protection

In areas where it is not possible to erect protective fencing, ground protection must be used to protect the CEZ of trees. Where it has been agreed during the design stage, and as shown on the tree protection plan, that vehicular or pedestrian access for the construction operation may take place within the CEZ, the possible effects of construction activity should be addressed by a combination of barriers and ground protection. The position of the barrier may be within the CEZ at the edge of the agreed working zone, but the soil structure beyond the barrier to the edge of the CEZ should be protected with ground protection. This must be installed before any site activity takes place to protect soil structure and tree roots.

Ground protection must be fit for the purpose of supporting any traffic entering or using the site without being distorted or causing compaction of underlying soil. It might comprise one of the following:

- *“for pedestrian movements or the erection of scaffolding within the RPA the installation of ground protection in the form of a single thickness of scaffold boards either on top of a driven scaffold frame, so as to form a suspended walkway, or on top of a compression-resistant layer (e.g. 100 mm depth of woodchip laid onto a geotextile;*
- *for pedestrian-operated plant up to a gross weight of 2 t, proprietary, inter-linked ground protection boards or panels placed on top of a compression-resistant layer (e.g. 150 mm depth of woodchip), laid onto a geotextile membrane; or for wheeled or tracked construction traffic exceeding 2 t gross weight, an alternative system (e.g. proprietary systems or pre-cast reinforced concrete slabs) to an engineering specification designed in conjunction with arboricultural advice, to accommodate the likely loading to which it will be subjected.*

The following is a list of suppliers of temporary ground protection including polymer, metal or wooden panels. Other companies supply similar products, and the following are given only as an example:

- www.ground-guards.co.uk
- www.trakmatseurope.com
- www.centriforce.com
- www.marwoodgroup.co.uk
- www.groundtrax.com

Cellular confinement no-dig systems can also be used.

Figure 6 Examples of proprietary ground protection panels



Appendix 6: Methods of Work Close to Trees

6.1.1 Guidance for working within RPAs

(This chapter sets out the general principles that must be followed when working in RPAs).

6.1.2 Removal of hard surfaces within RPAs

All structures including hard surfaces, walls and fences within CEZs must be removed following the methods detailed below to minimise damage to tree roots.

The use of conventional tracked and wheeled machinery causes damage to soil structure from compaction and damage to roots from excavation and must not be used within the CEZ. All areas of hard surfacing requiring removal within a CEZ will be broken up using a hand-held pneumatic drill or mounted hydraulic breaker attached to a digger located outside the CEZ. The broken rubble will then be removed by hand.

The only exception to this is where the hard surface is of such a size as not to be reachable from outside the CEZ. In this situation, a rubber tracked mini digger will be used. The maximum working height of the machine must be less than the lowest branch of any overhanging trees.

The mini digger will work from the existing hard surface pulling the debris away from the tree/s.

No excavation of existing soil beneath the hard surface will take place.

Immediately after removal of the hard surface, topsoil or sharp sand must be used to cover the soil surface and any roots to prevent drying out.

Upon completion, the protective fencing must be moved out to the edge of the CEZ or ground protection used if access is required.

6.1.3 Services

The location and direction of new services should be designed to allow for services to be routed away from the RPAs of retained trees.

If any services need to run through a CEZ, the main contractor must contact the project arboriculturist before any works are undertaken. The agreement will then be sought from the LPA tree officer on methodology. Works will only begin with the agreement of the LPA. The methodology used must comply with *NJUG Volume 4: Guidelines for the Planning, Installation and Maintenance of Utility Apparatus in Proximity to Trees*, which can be summarised as:

- *hand excavate only;*
- *work carefully around roots only cutting as a last resort;*
- *do not cut roots over 25 mm in diameter without referring to the project arboriculturist, and*
- *for roots, less than 25 mm in diameter use a sharp tool to make a clean cut leaving as small a wound as possible.” (BS5837:2012)*

6.1.4 New hard surfaces within RPAs

Where it has been agreed with the LPA that hard surfaces are acceptable within RPAs of retained trees, these will require designing to be of above ground, no-dig construction to minimise the impact on tree roots and soil structure. In addition, finished surfaces of the car parking and paved areas will need to be of a porous design to allow water and an air passage in and out.

An illustrative example of a cellular confinement no-dig system can be found below. The actual system will need to be designed by a structural engineer to accommodate the loadings anticipated

The principles to follow are:

- *“no excavation other than the removal of existing hard surfaces if required, or the removal of surface vegetation and no more than 50 mm of leaf litter, vegetation debris etc.;*
- *a method to spread and support the load of the hard surface and anticipated usage without causing compaction of the soil structure beneath;*
- *the use of a porous sub-base and finishing layer to allow water and air diffusion in and out of the soil;*
- *porosity must be designed to be long-term and not to block with fine particles in the short-term; therefore irregular, no-fines aggregate must be used; and*
- *the pH of the aggregate must be considered as many conventional road stones have very high pH values which can damage susceptible trees and therefore aggregates with a near neutral pH should be preferred.” (BS5837:2012)*

6.2 Examples of a Cellular Confinement System

Figure 7 Cellular Confinement System - Transition detail (Ramp)

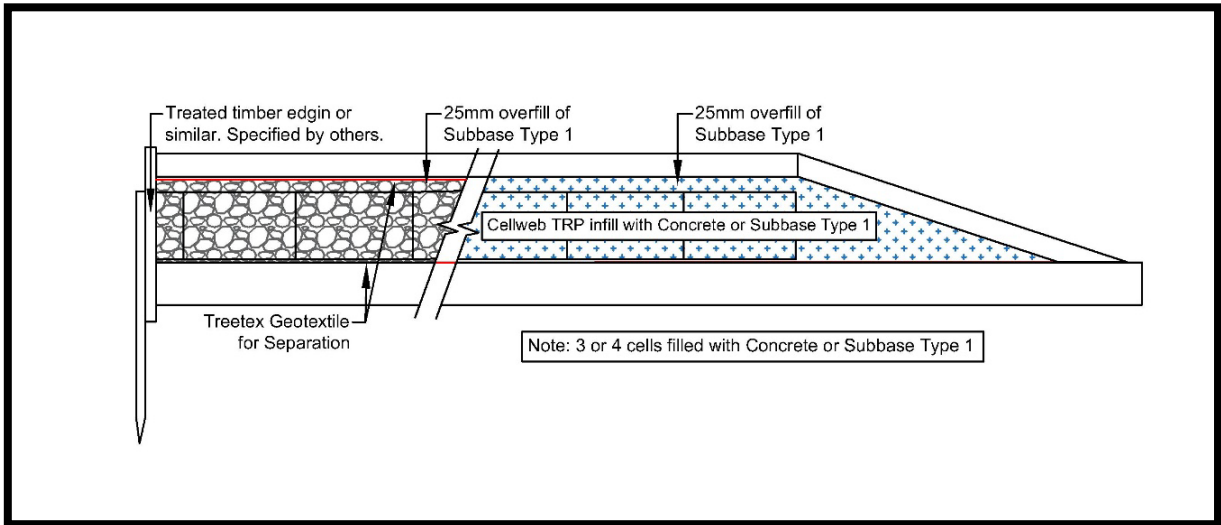


Figure 8 Cellular Confinement System - Transition detail (Flat)

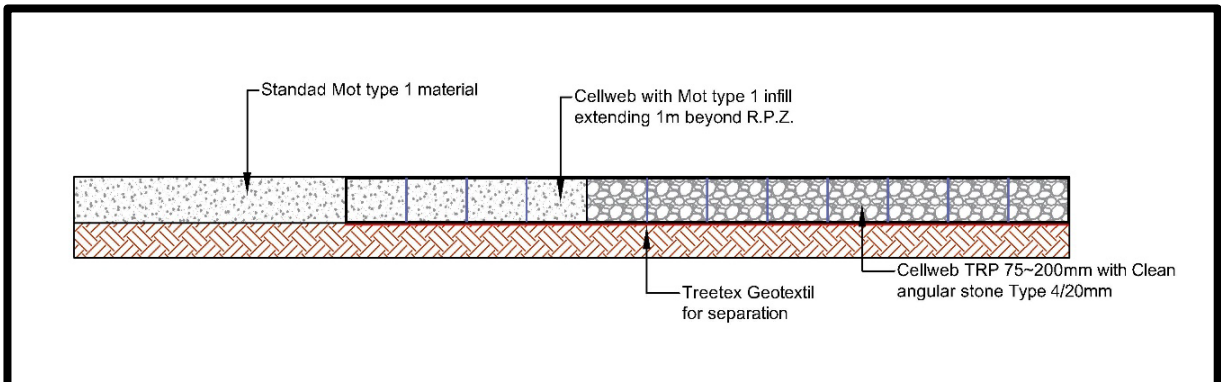


Figure 9 Cellular Confinement System - Kerb Edging

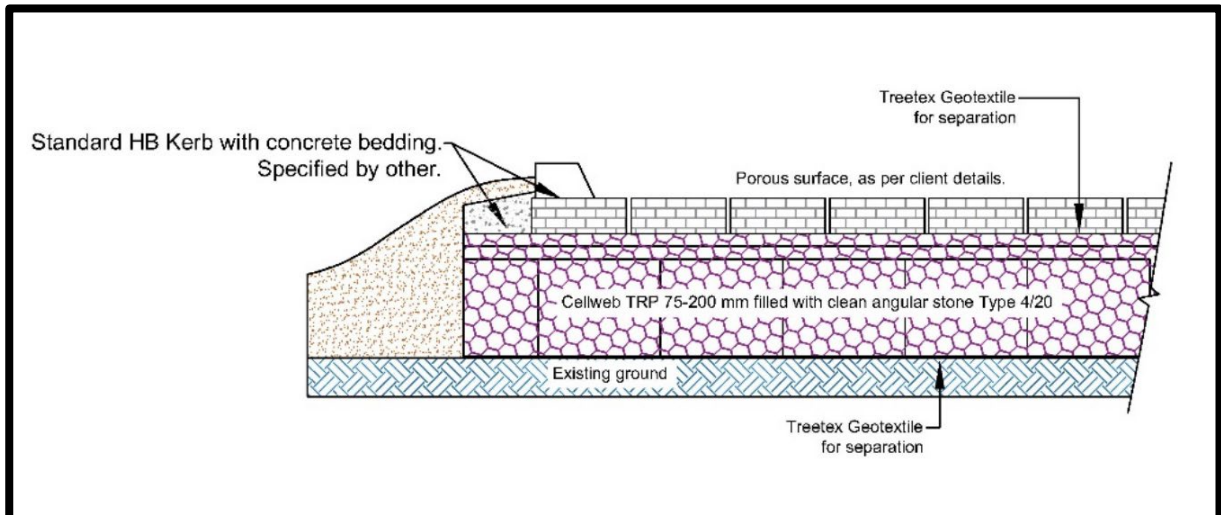


Figure 10 Cellular Confinement System - Timber Edging

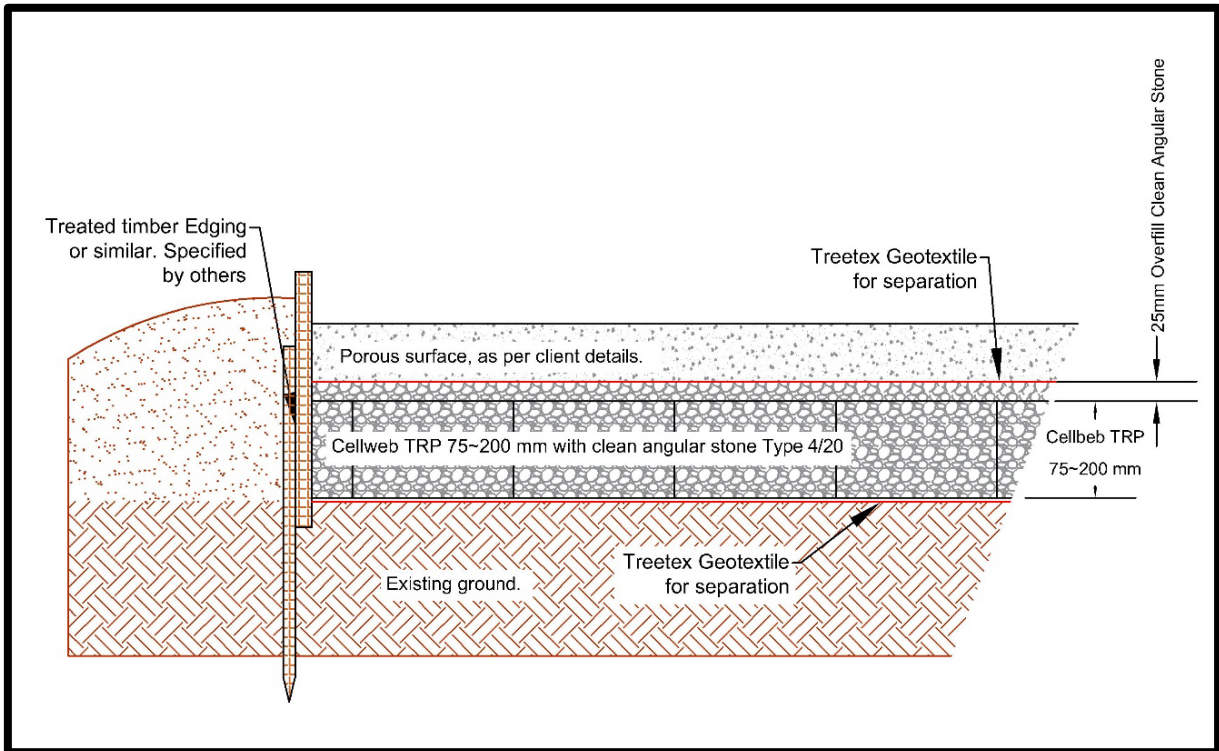


Figure 11 Examples of Cellweb filling with angular stone



6.3 Fencing within RPAs

Where posts are to be installed within RPAs, the holes must be dug carefully by hand. If roots with a diameter of 25 mm or greater are found, the position of the post must be moved. Roots smaller than 25 mm diameter can be cut with sharp tools leaving as small a wound as possible. The sides of the hole should be lined with an impermeable membrane such as plastic sheeting to prevent the caustic and toxic effects of wet cement in the concrete from damaging tree roots. In the event the of finding roots greater than 25 mm whereby the posts cannot be relocated, special construction methods will need to be used with onsite supervision. The detail of which will form part of the Arboricultural Method Statement.

6.4 Landscaping works within RPAs

Landscape operations within tree protection zones have the potential to damage trees if not carried out with care; in addition, the removal of protective fencing to carry out landscape operations may allow other contractors in previously protected areas.

If protective fencing is taken down to facilitate landscaping operations, the area of the CEZ must be delineated by pins and marker tape, spray paint, or some other method to clearly show the extent of the CEZ.

The preparation of soil for planting and turfing must be carried out by hand where within CEZs. Cultivation should be kept to a minimum and new topsoil added must not exceed 100mm in depth within 1m of the stem of any tree.

Topsoil and other materials must be transported by wheelbarrow on running boards when working within CEZs.

Appendix 7: Tree Work Schedule

Tree No.	Species	Proposed Works	Reason	BS5837 Category
H34	Field Maple and hawthorn. Average stem diameter 100mm.	Part removal	To accommodate the layout	C2
H41	Hawthorn, ash and field maple.	Part removal	To accommodate the layout	C2
T42	Crataegus monogyna (Common Hawthorn/Quick/May)	Removal	To accommodate the layout	C2
T43	Acer campestre (Field Maple)	Removal	To accommodate the layout	C2
T44	Fraxinus excelsior (Ash)	Removal	To accommodate the layout	C2
T45	Acer campestre (Field Maple)	Removal	To accommodate the layout	C2
T46	Fraxinus excelsior (Ash)	Removal	To accommodate the layout	C2
T47	Crataegus monogyna (Common Hawthorn/Quick/May)	Removal	To accommodate the layout	C2
T48	Fraxinus excelsior (Ash)	Removal	To accommodate the layout	C2
T49	Acer platanoides (Norway Maple)	Removal	To accommodate the layout	C2

Appendix 8: Specific Report Caveat and References

8.1 Specific report caveats

The survey was based on drawings provided by the client, a topographical plan identifying accurate tree locations was used for the survey.

No internal diagnostic equipment was used other than a sounding mallet and probe.

The survey is concerned solely with arboricultural issues.

Any work with trees will discharge the due diligence requirements of all relevant wildlife and countryside legislation.

Trees are dynamic living organisms whose health and the condition can change rapidly. Any changes to the tree or conditions close to the tree may change the stability and condition of the tree and a further examination would be required and may affect the validity of this report.

This report is valid for 12 months.

8.2 Copyright and non-disclosure

The content and layout of this report are subject to copyright owned by SES Ltd to the extent that copyright has been legally assigned to us by another party or is used by SES Ltd under license. This report may not be copied or used without a prior written agreement for any purpose other than the purpose indicated in this report.