

O - DENOTES GULLEY AS PICKED UP
ON TOPOGRAPHICAL SURVEY
CONNECTED TO EXISTING DRAINAGE
NETWORK.

↳ EXISTING DRAINAGE TO BE
RETAINED



© Survey Operations Limited 2019
Reproduction in whole or in part by any means
is prohibited without the prior permission of
Survey Operations Limited.

Note:
The survey is plotted on a plane local Grid. Orientation to National Grid.
All levels relate to Ordnance Datum, achieved using the OS National GPS Network.

Survey Control Markers established for
Mapping purposes only and should not be
used for Construction without the written
approval of Survey Operations Ltd.

Levels shown in parenthesis indicate

SURVEY STATIONS			
Name	Latitude	Longitude	Height
S01	395397.45	88131.71	136.98
S02	395353.99	88107.29	135.07
S03	395327.60	88083.62	136.07
S04	395264.28	88076.87	136.42
S05	395226.84	88069.84	136.84
S06	395254.89	88068.48	135.87
DP1	395355.31	88139.93	136.02
DP2	395329.54	88154.13	135.29
DP3	395313.76	88170.51	134.01
DP4	395348.08	88163.03	135.85

STANDARD REFERENCE & ABBREVIATIONS

Survey Operations

Smith Street, Skelmersdale, Lancs. WN8 8LN
Tel: 01695 725662 Fax: 01695 51816
Email: mail@survops.co.uk - www.survops.co.uk

Client
Holden & Lee

Drawing Title
**Topographical Survey of Land at:
Barchester Arbour Lodge
Buxton Lane, Marple**

Scale(s)	1:200	Surveyor	DP
Date	APR 19	Drawn	JR
Job Number	19D082	Checked	SO
Sheet Size & Org Number & Revision			
AO 19D082/001			

Table of contents

Project Name: 12639 SURVEY OPS ARBO	Project number: 12639	Date: 29/03/2019	Contact: Ian Thompson	
--	--------------------------	---------------------	--------------------------	--

SRMReport :	1
<i>Inspection: 1</i>	
Project Information	3
Section: 1, MH13 --- MH14	4
Section: 2, MH14 --- MH14J	8
Section: 3, MH07 --- MH13	10
Section: 4, MH12 --- MH15	12
Section: 5, MH08 --- MH12	15
Section: 6, MH09 --- MH7	17
Section: 7, PIPE A --- MH09	20
Section: 8, PIPE B --- MH09	22
Section: 9, PIPE C --- MH09	24
Section: 10, MH11 --- MH08	26
Section: 11, MH20 --- MH11	28
Section: 12, MH10 --- MH11	30
Section: 13, MH06 --- MH08	32
Section: 14, PIPE A --- MH06	34
Section: 15, MH02 --- MH06	38
Section: 16, MH03 --- MH02	40
Section: 17, MH01 --- MH07	42
Section: 18, PIPE A --- MH01	45
Section: 19, MH21 --- MH03	47
Section: 20, PIPE B --- MH03	49
Section: 21, MH04 --- MH04J	51
Section: 22, PIPE A --- MH04	53
Section: 23, PIPE B --- MH04	55
Section: 24, MH05 --- MH22	57
Section: 25, PIPE A --- MH05	59
Section: 26, PIPE B --- MH05	61
Section: 27, PIPE C --- MH07	63

Table of contents

Project Name: 12639 SURVEY OPS ARBO	Project number: 12639	Date: 29/03/2019	Contact: Ian Thompson	
--	--------------------------	---------------------	--------------------------	--

Section: 28, PIPE C --- MH08	-----	65
Section: 29, MH15 --- MH15J	-----	67

Service / Operational Defects (SRM 4)

Project name : 12639 SURVEY OPS ARBOUR LODG				Project Number : 12639			Contact : Ian Thompson			Date : 29/03/2019		
--	--	--	--	---------------------------	--	--	---------------------------	--	--	----------------------	--	--

No.	PLR	Dir.	Use	Shape / Size	Date	Mat.	Total Length	Insp. Length	Peak HWG	Peak Score	Grade	Mean Score	Total Score
1	MH13X	D	C	C 225	29/03/2019	VC	83.90	83.90	5	7	4	0.68	57.2
2	MH14X	D	C	C 225	29/03/2019	VC	11.58	11.58	3	2.5	3	1.38	16
3	MH07X	U	C	C 225	29/03/2019	VC	32.28	32.28	3	4	3	0.53	17
4	MH12X	D	F	C 150	29/03/2019	VC	84.65	84.65	-	0	1	0	0
5	MH08X	U	F	C 150	29/03/2019	VC	29.86	29.86	-	0	1	0	0
6	MH09X	D	F	C 150	29/03/2019	VC	27.13	27.13	3	7	4	2.14	58
7	PIPE AX	U	F	C 150	29/03/2019	PVC	13.03	13.03	-	0	1	0	0
8	PIPE BX	U	F	C 150	29/03/2019	PVC	12.34	12.34	3	2	3	0.65	8
9	PIPE CX	U	S	C 150	29/03/2019	PVC	4.00	2.40	-	0	1	0	0
10	MH11X	D	F	C 150	29/03/2019	PVC	33.31	33.31	-	0	1	0	0
11	MH20X	U	F	C 150	29/03/2019	PVC	7.60	7.60	-	0	1	0	0
12	MH10X	U	F	C 150	29/03/2019	PVC	10.00	0.66	-	0	1	0	0
13	MH06X	D	F	C 150	29/03/2019	PVC	17.01	17.01	2	4	3	0.24	4
14	PIPE AX	U	F	C 150	29/03/2019	PVC	60.00	55.17	-	5	4	0.3	18
15	MH02X	U	F	C 150	29/03/2019	PVC	22.50	22.50	-	0	1	0	0
16	MH03X	U	F	C 100	29/03/2019	PVC	10.14	10.14	-	0	1	0	0
17	MH01X	D	S	C 150	29/03/2019	PVC	34.15	34.15	3	4	3	0.49	16.6
18	PIPE A X	U	S	C 100	29/03/2019	PVC	3.72	3.72	-	0	1	0	0
19	MH21X	U	F	C 100	29/03/2019	PVC	23.45	23.45	-	0	1	0	0
20	PIPE B X	U	F	C 100	29/03/2019	PVC	10.00	9.93	-	2	3	0.2	2
21	MH04X	D	F	C 100	29/03/2019	PVC	0.99	0.99	-	0	1	0	0
22	PIPE A X	U	S	C 100	29/03/2019	PVC	3.41	3.41	-	0	1	0	0
23	PIPE B X	U	F	C 100	29/03/2019	PVC	7.02	7.02	-	2	3	0.48	3.4
24	MH05X	D	S	C 100	29/03/2019	PVC	19.11	19.11	3	2	3	0.33	6.4
25	PIPE A X	U	S	C 100	29/03/2019	PVC	23.59	23.59	3	1	2	0.04	1
26	PIPE B X	U	S	C 100	29/03/2019	PVC	1.58	1.58	-	0	1	0	0
27	PIPE CX	U	S	C 150	29/03/2019	VC	6.71	6.71	-	0	1	0	0
28	PIPE CX	U	S	C 100	29/03/2019	VC	10.00	0.01	-	0	1	0	0
29	MH15X	D	F	C 150	29/03/2019	VC	13.37	13.37	-	0	1	0	0

Structural Defects (SRM 4)

Project name : 12639 SURVEY OPS ARBOUR LODG				Project Number : 12639			Contact : Ian Thompson			Date : 29/03/2019		
--	--	--	--	---------------------------	--	--	---------------------------	--	--	----------------------	--	--

No.	PLR	Dir.	Use	Shape / Size	Date	Mat.	Total Length	Insp. Length	Peak HWG	Peak Score	Grade	Mean Score	Total Score
1	MH13X	D	C	C 225	29/03/2019	VC	83.90	83.90	2	2	1	0.02	2
2	MH14X	D	C	C 225	29/03/2019	VC	11.58	11.58	-	0	1	0	0
3	MH07X	U	C	C 225	29/03/2019	VC	32.28	32.28	-	0	1	0	0
4	MH12X	D	F	C 150	29/03/2019	VC	84.65	84.65	-	0	1	0	0
5	MH08X	U	F	C 150	29/03/2019	VC	29.86	29.86	-	0	1	0	0
6	MH09X	D	F	C 150	29/03/2019	VC	27.13	27.13	-	0	1	0	0
7	PIPE AX	U	F	C 150	29/03/2019	PVC	13.03	13.03	-	0	1	0	0
8	PIPE BX	U	F	C 150	29/03/2019	PVC	12.34	12.34	-	0	1	0	0
9	PIPE CX	U	S	C 150	29/03/2019	PVC	4.00	2.40	-	0	1	0	0
10	MH11X	D	F	C 150	29/03/2019	PVC	33.31	33.31	-	0	1	0	0
11	MH20X	U	F	C 150	29/03/2019	PVC	7.60	7.60	-	0	1	0	0
12	MH10X	U	F	C 150	29/03/2019	PVC	10.00	0.66	-	0	1	0	0
13	MH06X	D	F	C 150	29/03/2019	PVC	17.01	17.01	-	0	1	0	0
14	PIPE AX	U	F	C 150	29/03/2019	PVC	60.00	55.17	2	1	1	0.02	1
15	MH02X	U	F	C 150	29/03/2019	PVC	22.50	22.50	1	0.5	1	0.02	0.5
16	MH03X	U	F	C 100	29/03/2019	PVC	10.14	10.14	-	0	1	0	0
17	MH01X	D	S	C 150	29/03/2019	PVC	34.15	34.15	-	0	1	0	0
18	PIPE A X	U	S	C 100	29/03/2019	PVC	3.72	3.72	-	0	1	0	0
19	MH21X	U	F	C 100	29/03/2019	PVC	23.45	23.45	-	0	1	0	0
20	PIPE B X	U	F	C 100	29/03/2019	PVC	10.00	9.93	-	0	1	0	0
21	MH04X	D	F	C 100	29/03/2019	PVC	0.99	0.99	-	0	1	0	0
22	PIPE A X	U	S	C 100	29/03/2019	PVC	3.41	3.41	-	0	1	0	0
23	PIPE B X	U	F	C 100	29/03/2019	PVC	7.02	7.02	-	0	1	0	0
24	MH05X	D	S	C 100	29/03/2019	PVC	19.11	19.11	-	0	1	0	0
25	PIPE A X	U	S	C 100	29/03/2019	PVC	23.59	23.59	-	0	1	0	0
26	PIPE B X	U	S	C 100	29/03/2019	PVC	1.58	1.58	-	0	1	0	0
27	PIPE CX	U	S	C 150	29/03/2019	VC	6.71	6.71	-	0	1	0	0
28	PIPE CX	U	S	C 100	29/03/2019	VC	10.00	0.01	-	0	1	0	0
29	MH15X	D	F	C 150	29/03/2019	VC	13.37	13.37	-	0	1	0	0

Project-information

Project name : 12639 SURVEY OPS ARBOUR LODG	Project Number : 12639	Contact : Ian Thompson	Date : 29/03/2019
--	---------------------------	---------------------------	----------------------

Client: **Survey Operations**
Contact Name: **Ian Thompson**
Department:
Road: **Smith Street, Welbourne,**
Town: **Skelmersdale, WN8 8LN**
County: **Lancs**
Telephone: **01695 725662**
Fax:
Mobile:
E-mail:


Site: **Site Details**
Contact Name:
Department:
Road: **Arbour Lodge, Buxton Lane**
Town: **Marple, Stockport, SK6 7QL**
County:
Telephone:
Fax:
Mobile:
E-mail:

Contractor **Underground Surveys (UK) Limited**
Contact Name:
Department:
Road: **Unit CG17 Warrington Business Park**
Town: **Long Lane**
County:
Telephone: **01925 444664**
Fax: **01925 444663**
Mobile:
E-mail: **kelly@undergroundsurveys.co.uk**

Inspection report


Date : 29/03/2019	Job number : DW00000414	Weather : no rain or snow	Operator : DW	Section number : 1	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : IPEW ROVER CRAWLER	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : -	U/S MH : MH13
Road : BUXTON LANE		U/S Depth : 2.07
Location Road		D/S MH : MH14
Inspection MH13 (D/S) MH14	Pipe Length 2.00 m	D/S Depth : 2.7
Use: Combined	Pipe shape : Circular	
Year laid : Z	Pipe size : 225 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 83.90 m	Lining :	
Comment : CLIENT ON SITE		

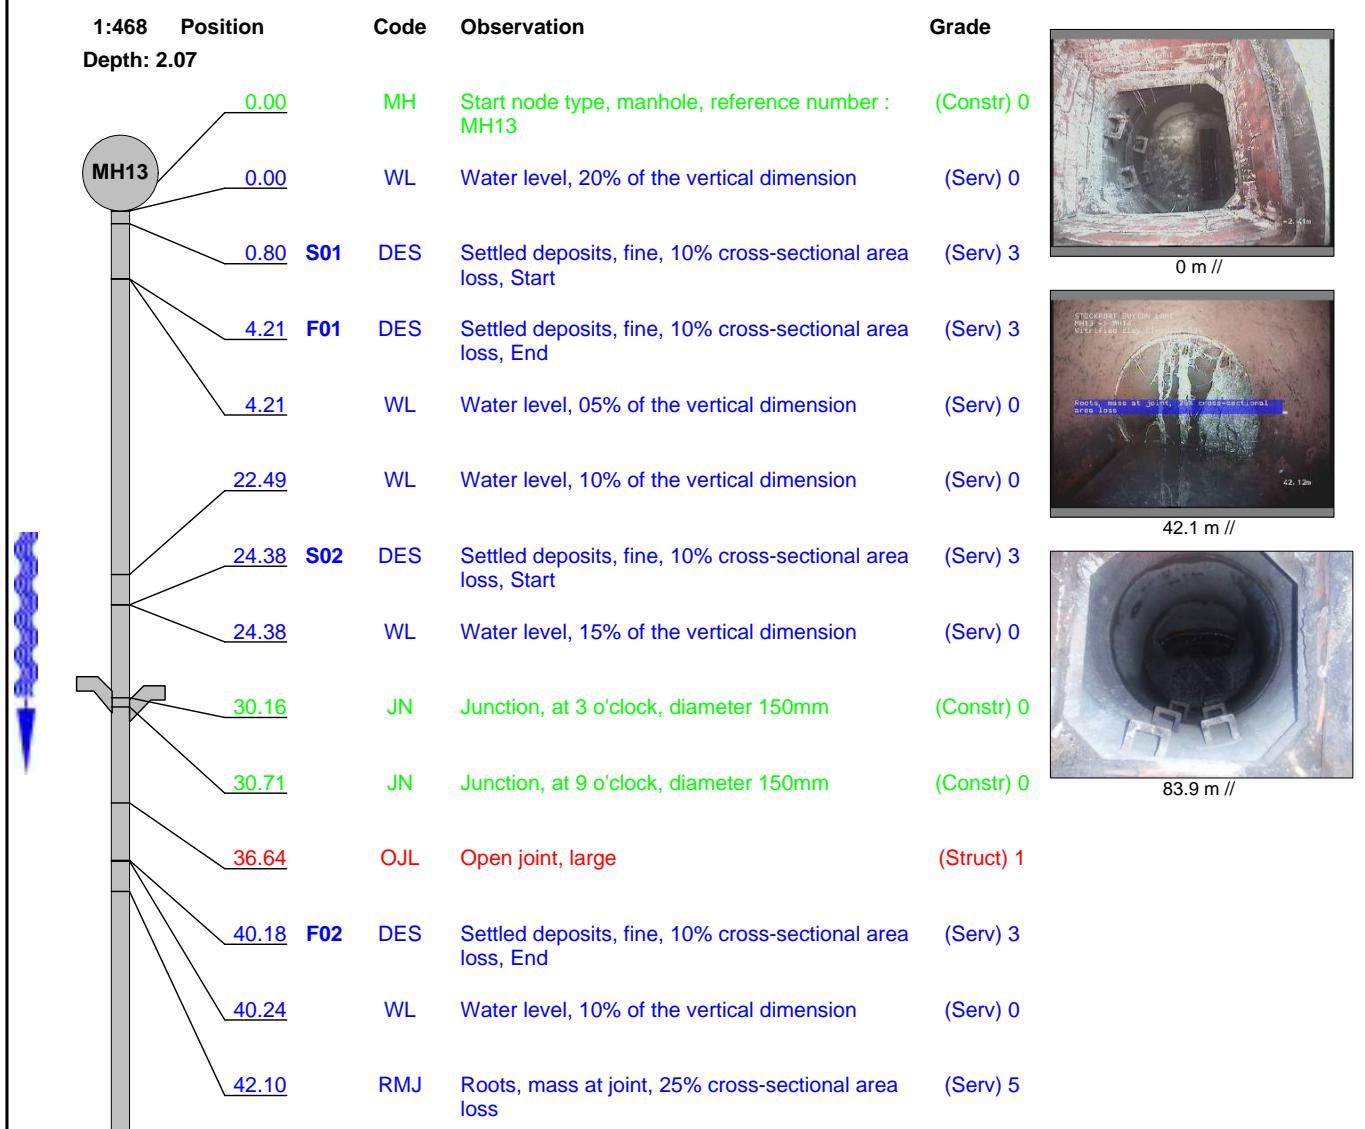

Inspection Report

Date : 29/03/2019	Job number : DW00000414	Weather : no rain or snow	Operator : DW	Section number : 1	PLR : X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : IPEW ROVER CRAWLER	Preset :	Cleaned : no	Grade:

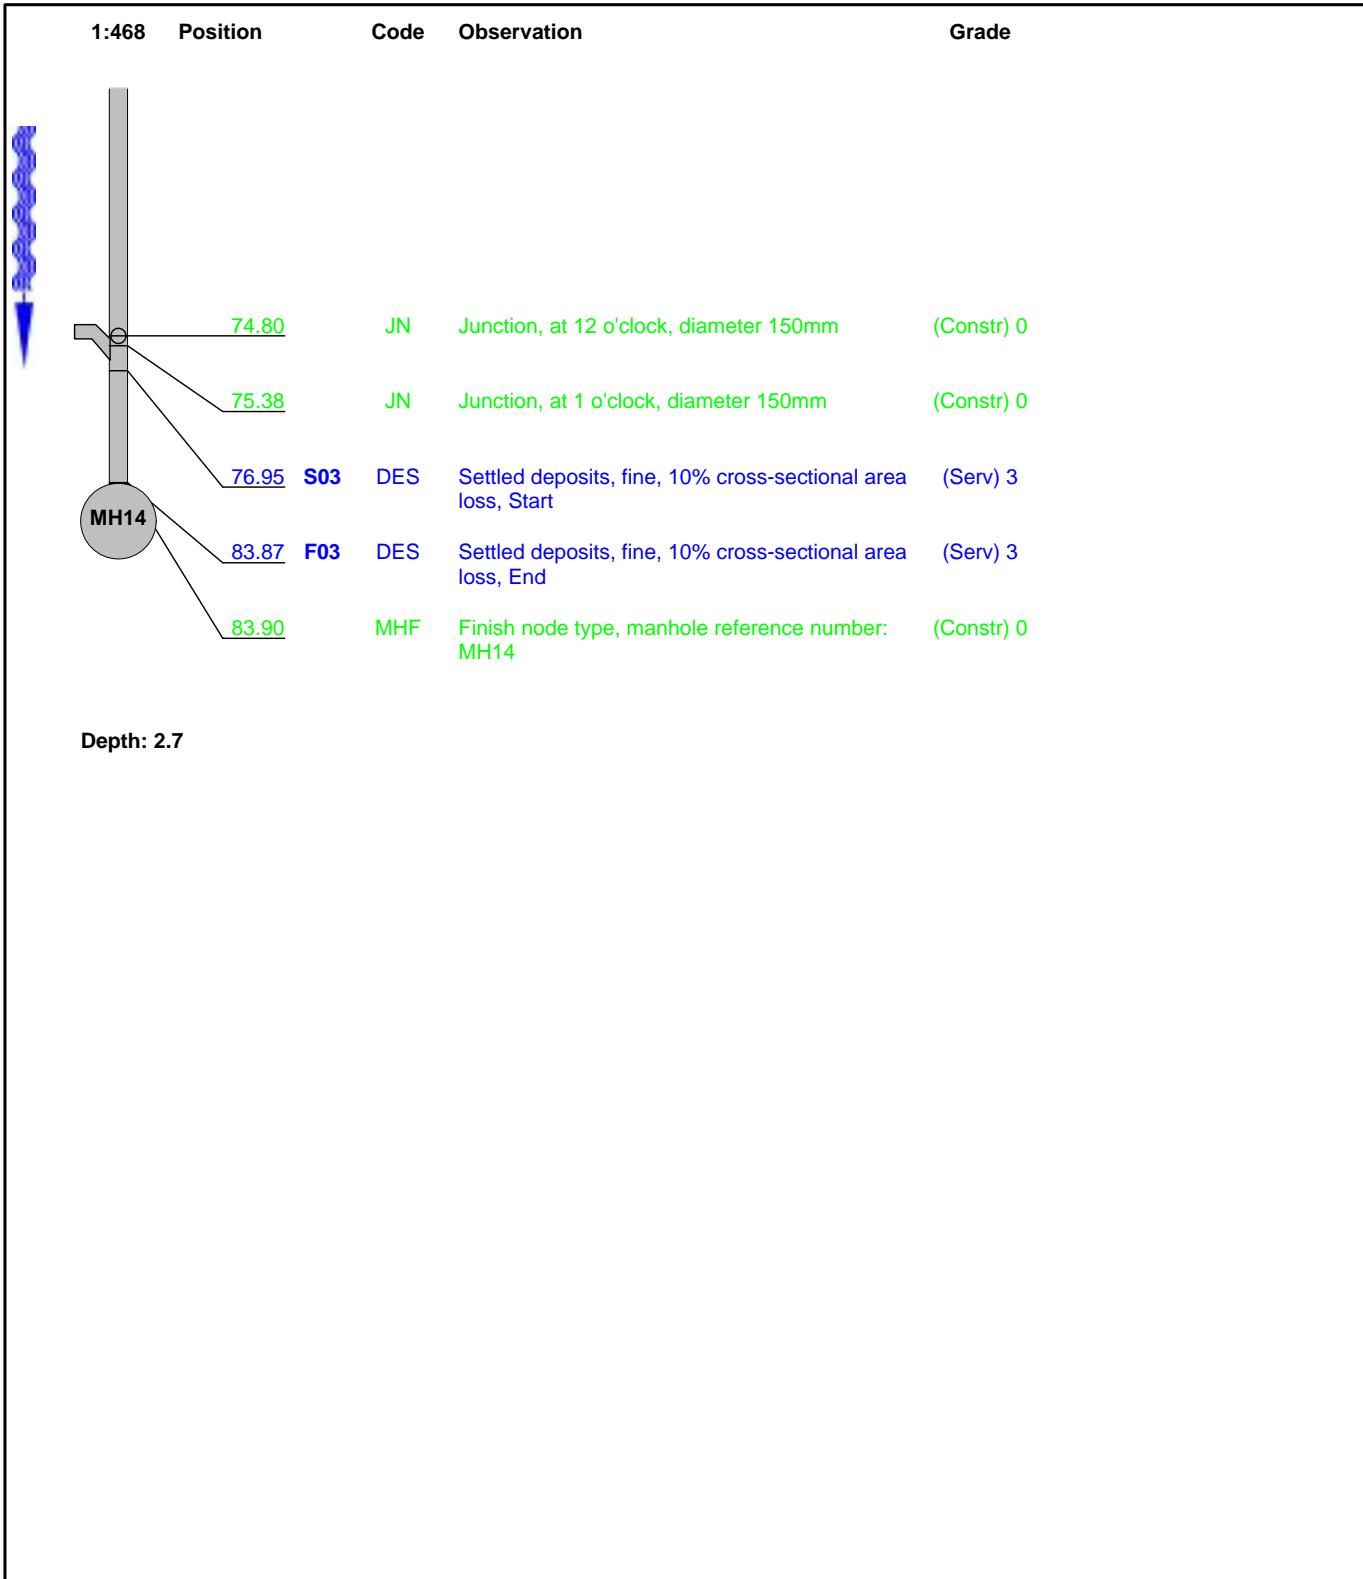

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
1	2	0.02	2	1	4	7	0.68	57.2	4

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
1PLR Suffix :
X

Photo: 001.JPG
0m, Start node type, manhole, reference number : MH13



Photo: 002.JPG
42.1m, Roots, mass at joint, 25% cross-sectional area loss

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
1

PLR Suffix :
X

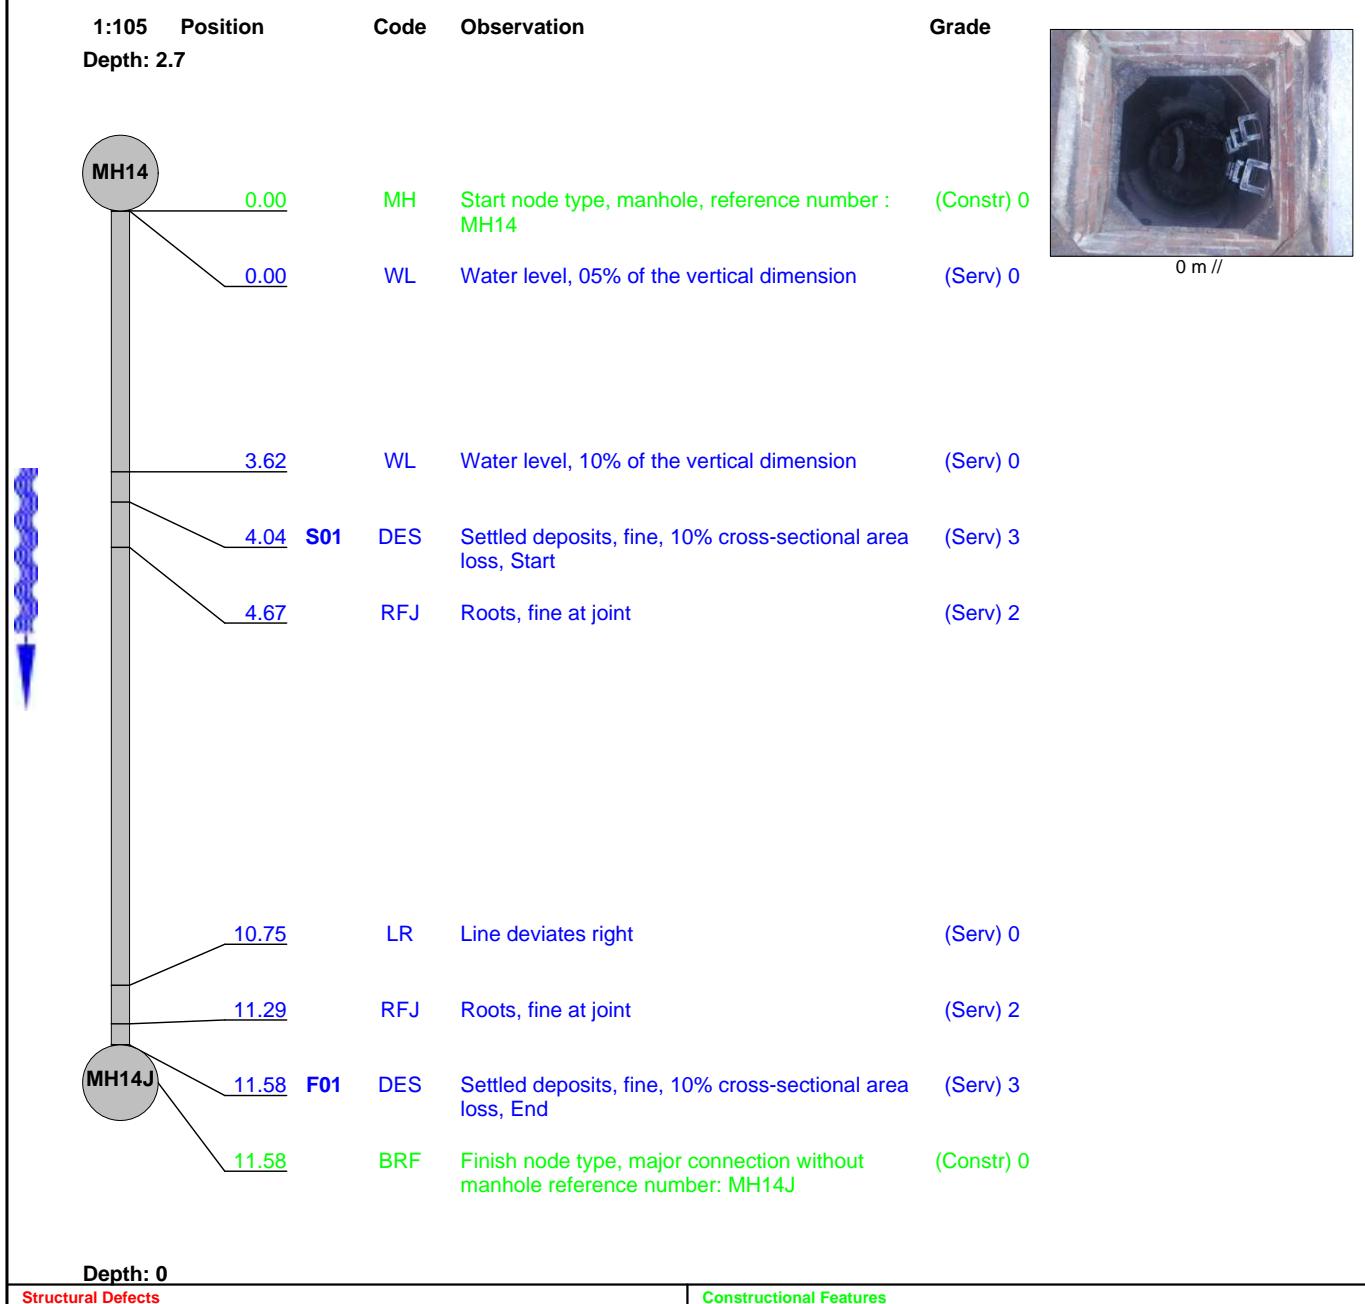


Photo: 003.JPG
83.9m, Finish node type, manhole reference number: MH14

Inspection report

Date : 29/03/2019	Job number : DW00000415	Weather : no rain or snow	Operator : DW	Section number : 2	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : IPEW ROVER CRAWLER	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : - Pipe Length 2.00 m	U/S MH : MH14
Road : BUXTON LANE		U/S Depth : 2.7
Location Road		D/S MH : MH14J
Inspection MH14 (D/S) MH14J		D/S Depth : 0
Use: Combined	Pipe shape : Circular	
Year laid : Z	Pipe size : 225 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 11.58 m	Lining :	
Comment : CLIENT ON SITE		



Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
2

PLR Suffix :
X

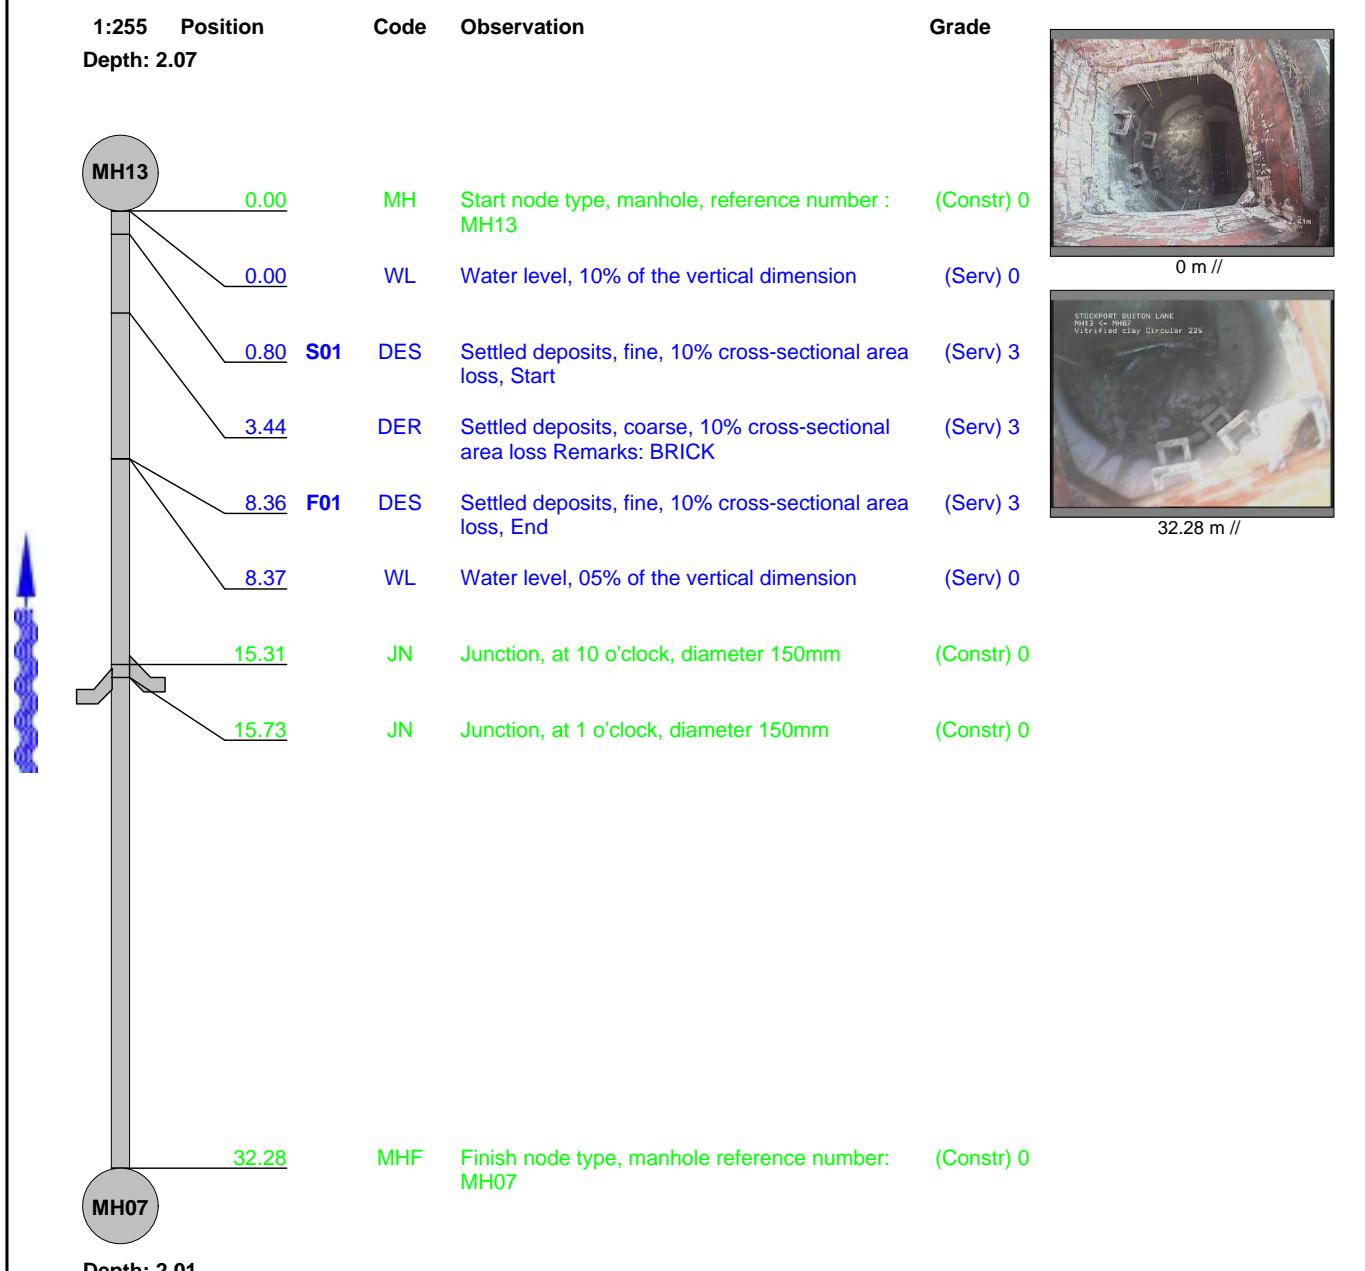


Photo: 004.JPG
0m, Start node type, manhole, reference number : MH14

Inspection report

Date : 29/03/2019	Job number : DW00000416	Weather : no rain or snow	Operator : DW	Section number : 3	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : IPEW ROVER CRAWLER	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH07
Road : BUXTON LANE	Catchment:	U/S Depth : 2.01
Location Road	Tape number : -	D/S MH : MH13
Inspection MH13 (U/S) MH07	Pipe Length 2.00 m	D/S Depth : 2.07
Use: Combined	Pipe shape : Circular	
Year laid : Z	Pipe size : 225 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 32.28 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	2	4	0.53	17	3

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
3PLR Suffix :
X

Photo: 005.JPG
0m, Start node type, manhole, reference number : MH13

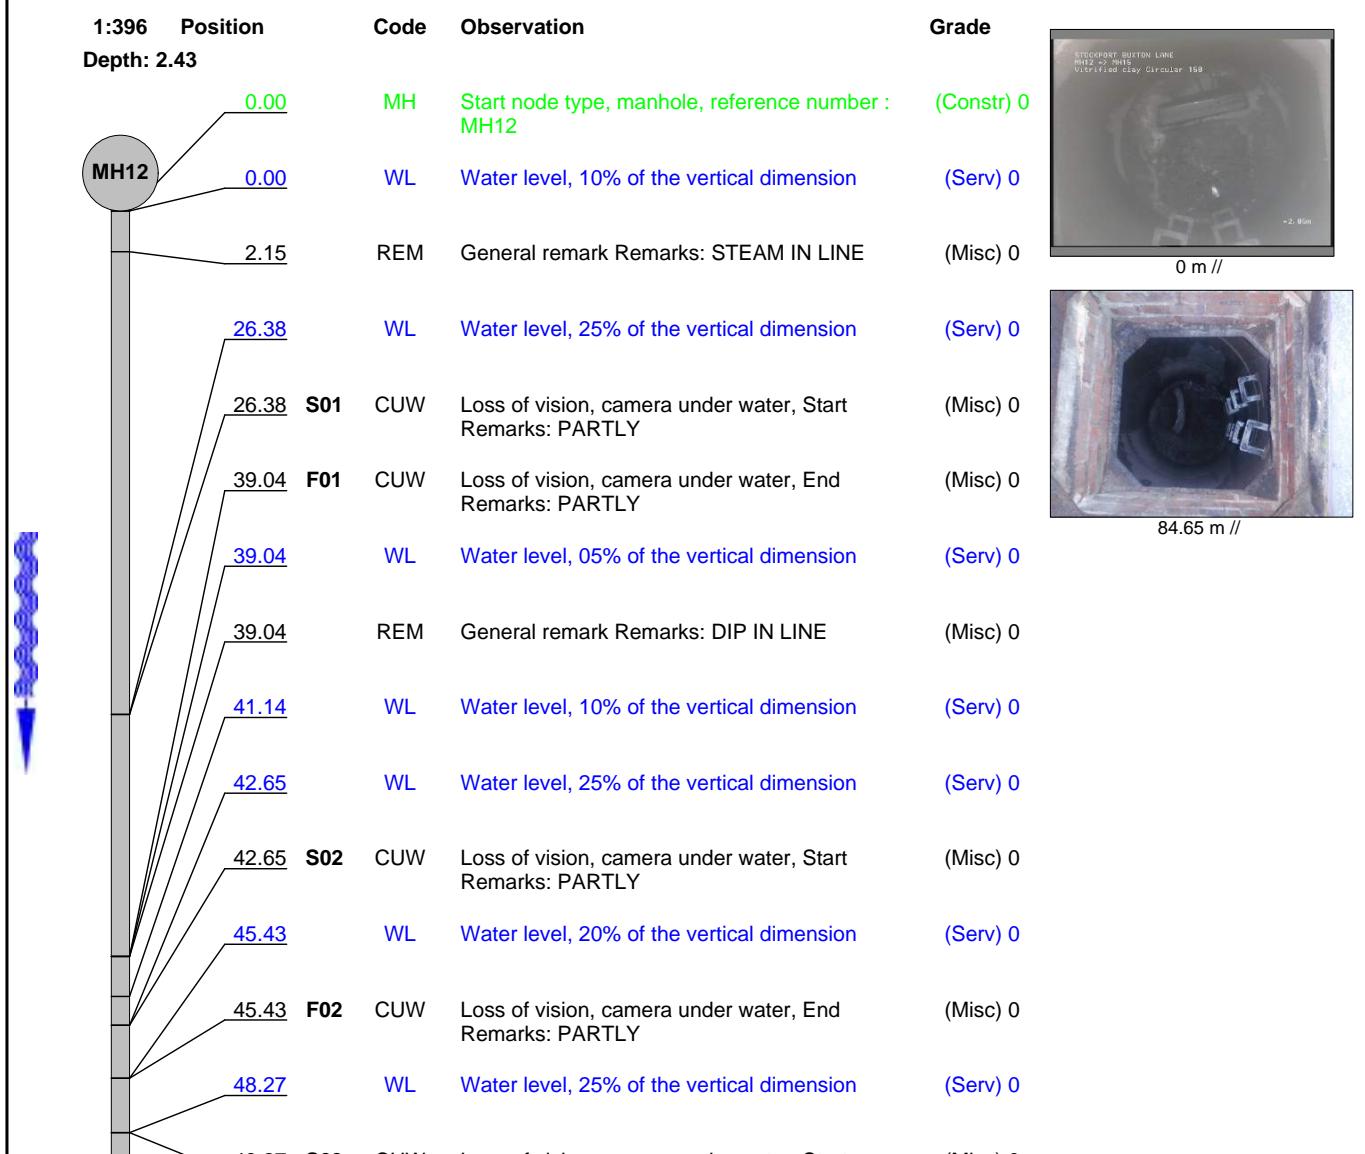


Photo: 006.JPG
32.28m, Finish node type, manhole reference number: MH07

Inspection report


Date : 29/03/2019	Job number : DW00000417	Weather : no rain or snow	Operator : DW	Section number : 4	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Road : BUXTON LANE	Location : Road	Inspection : MH12 (D/S) MH15	Location details: Catchment: Tape number : - Pipe Length 2.00 m	U/S MH : MH12 U/S Depth : 2.43 D/S MH : MH15 D/S Depth : 3.25
Use: Foul	Year laid : Z	Purpose : Sample survey to determine asset condition	Total length : 84.65 m	Pipe shape : Circular Pipe size : 150 mm Pipe material : Vitrified clay Lining :	
Comment : CLIENT ON SITE					



Inspection Report

Date : 29/03/2019	Job number : DW00000417	Weather : no rain or snow	Operator : DW	Section number : 4	PLR : X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Grade:

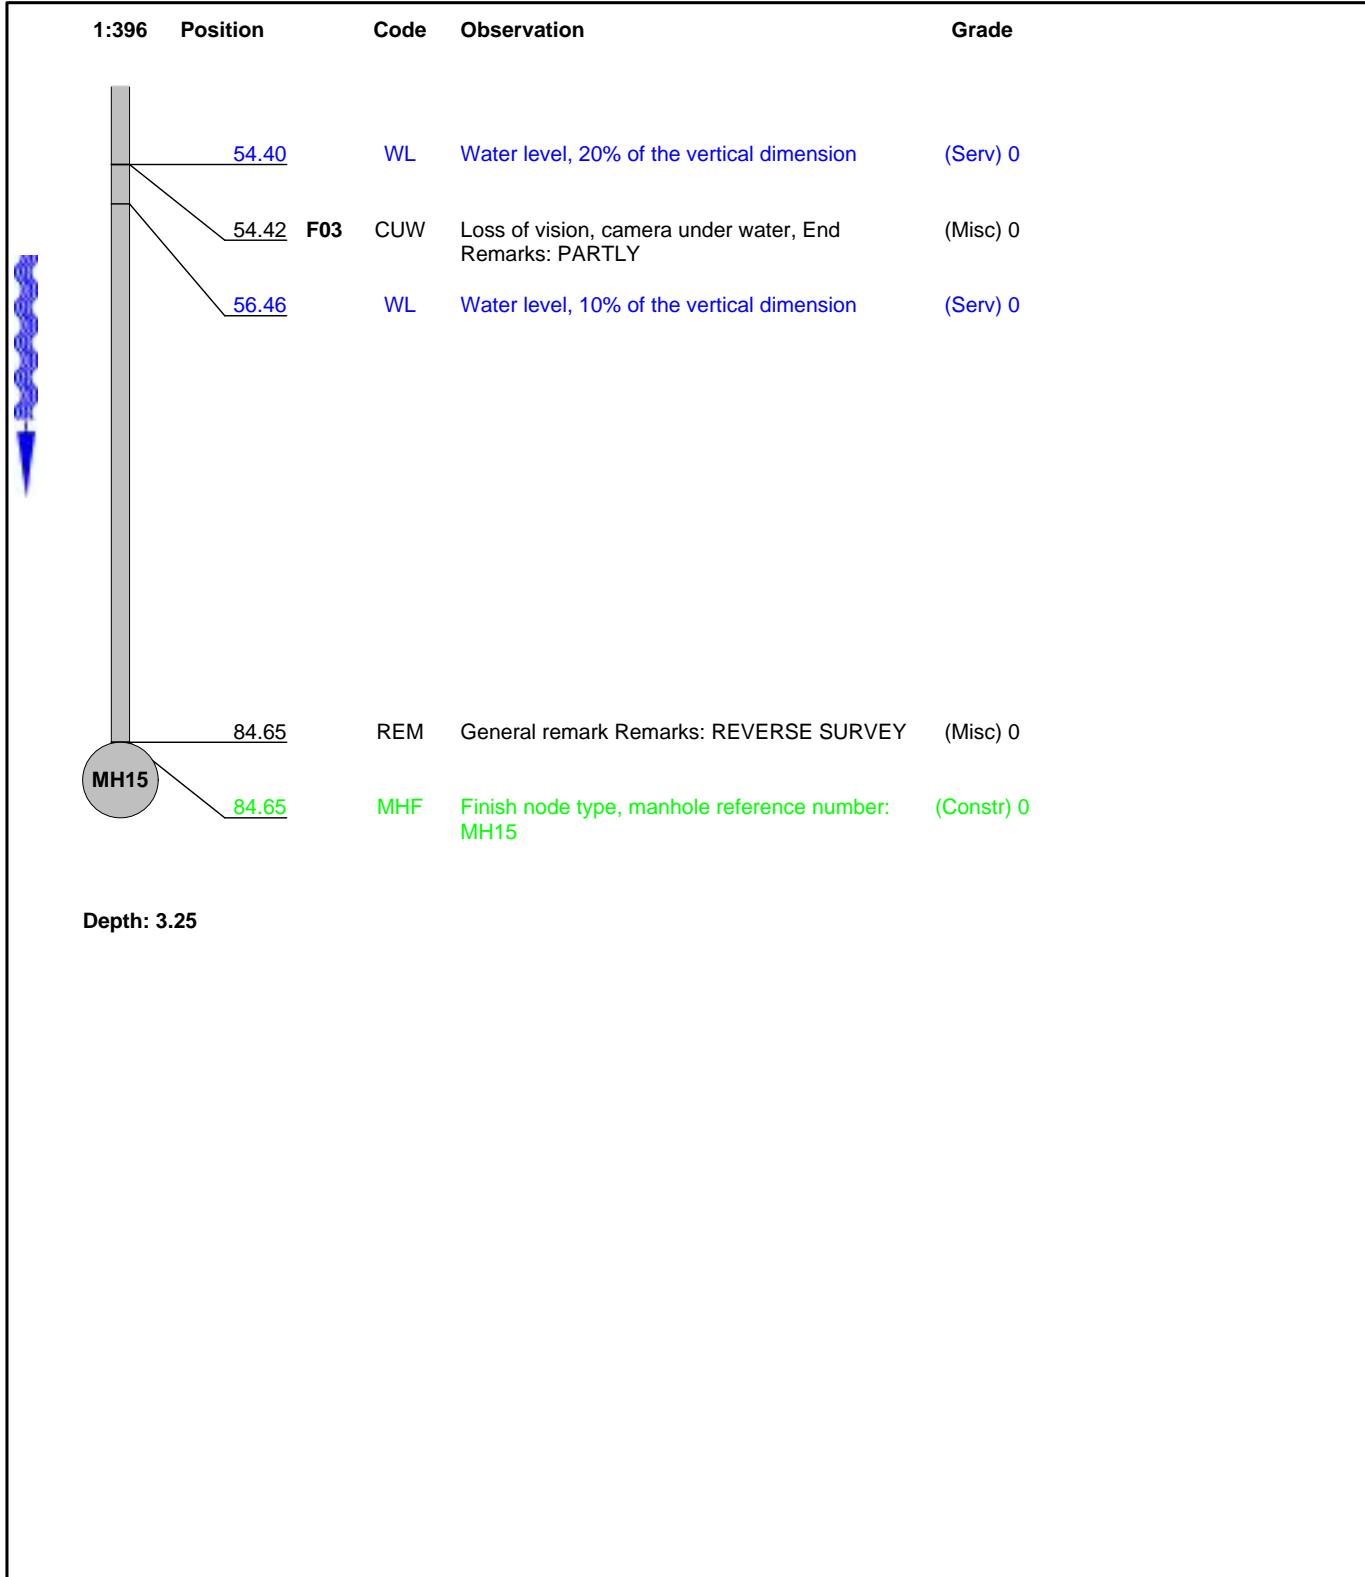

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
4

PLR Suffix :
X



Photo: 007.JPG
0m, Start node type, manhole, reference number : MH12

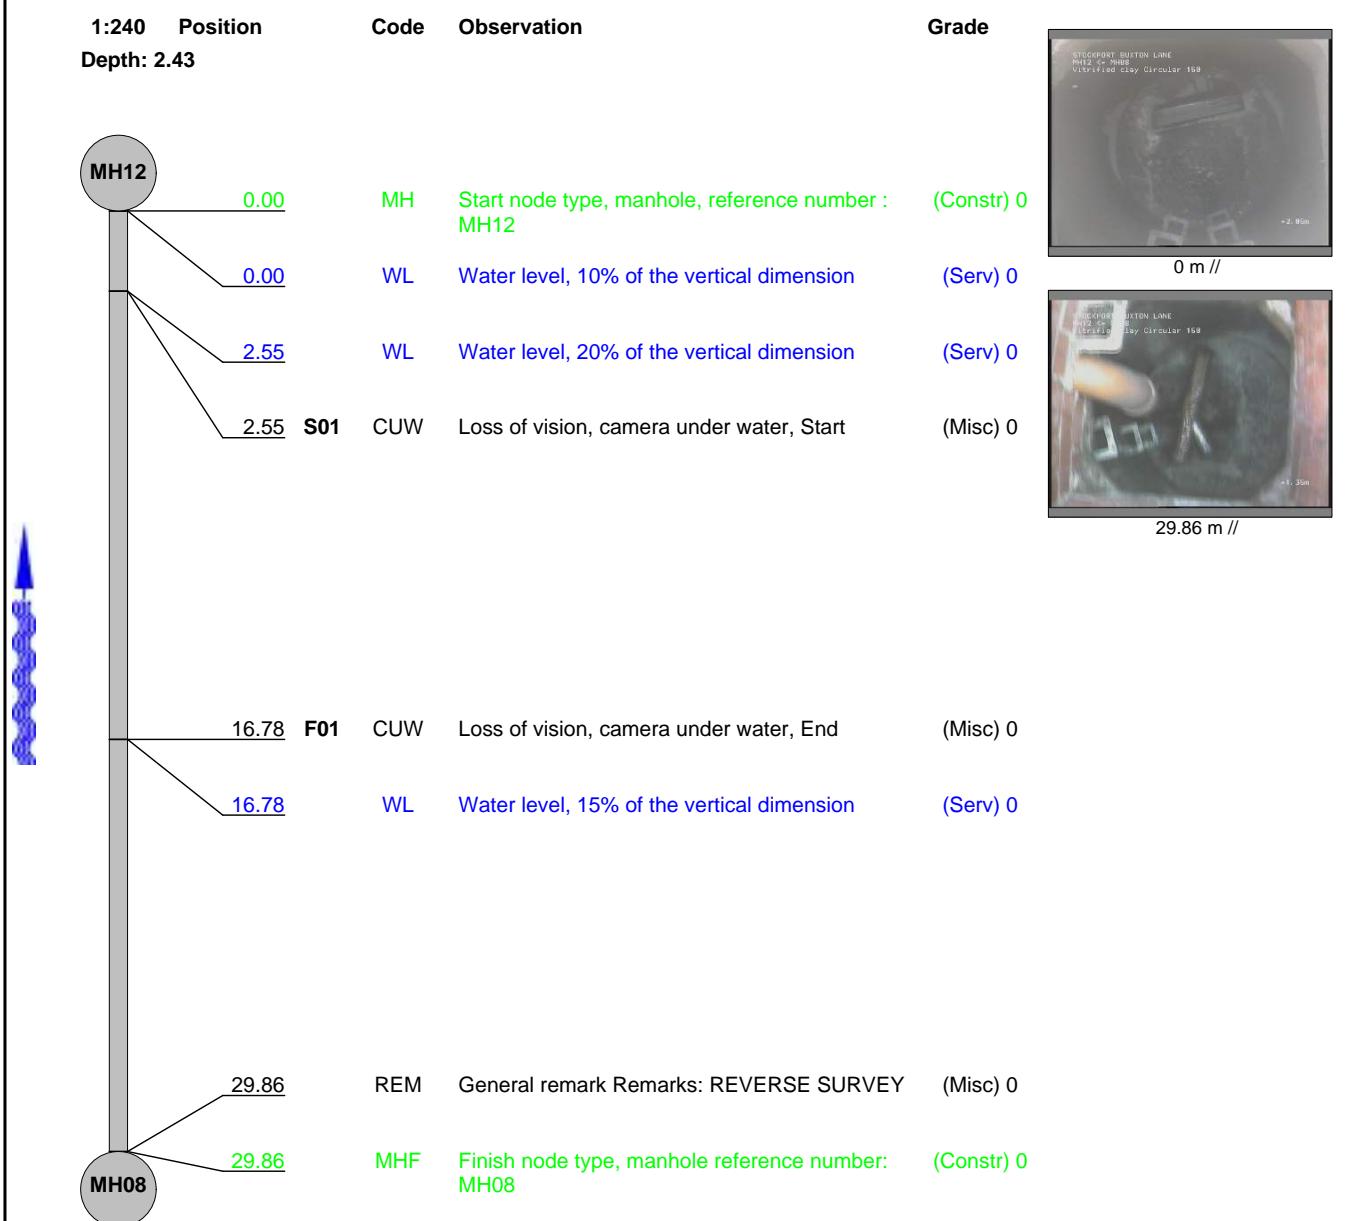


Photo: 008.JPG
84.65m, Finish node type, manhole reference number: MH15

Inspection report

Date : 29/03/2019	Job number : DW00000418	Weather : no rain or snow	Operator : DW	Section number : 5	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : -	U/S MH : MH08
Road : BUXTON LANE	Pipe Length 2.00 m	U/S Depth : 2.3
Location Road		D/S MH : MH12
Inspection MH12 (U/S) MH08		D/S Depth : 2.43
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 29.86 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Inspection picturesPlace :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
5PLR Suffix :
X

Photo: 009.JPG
0m, Start node type, manhole, reference number : MH12

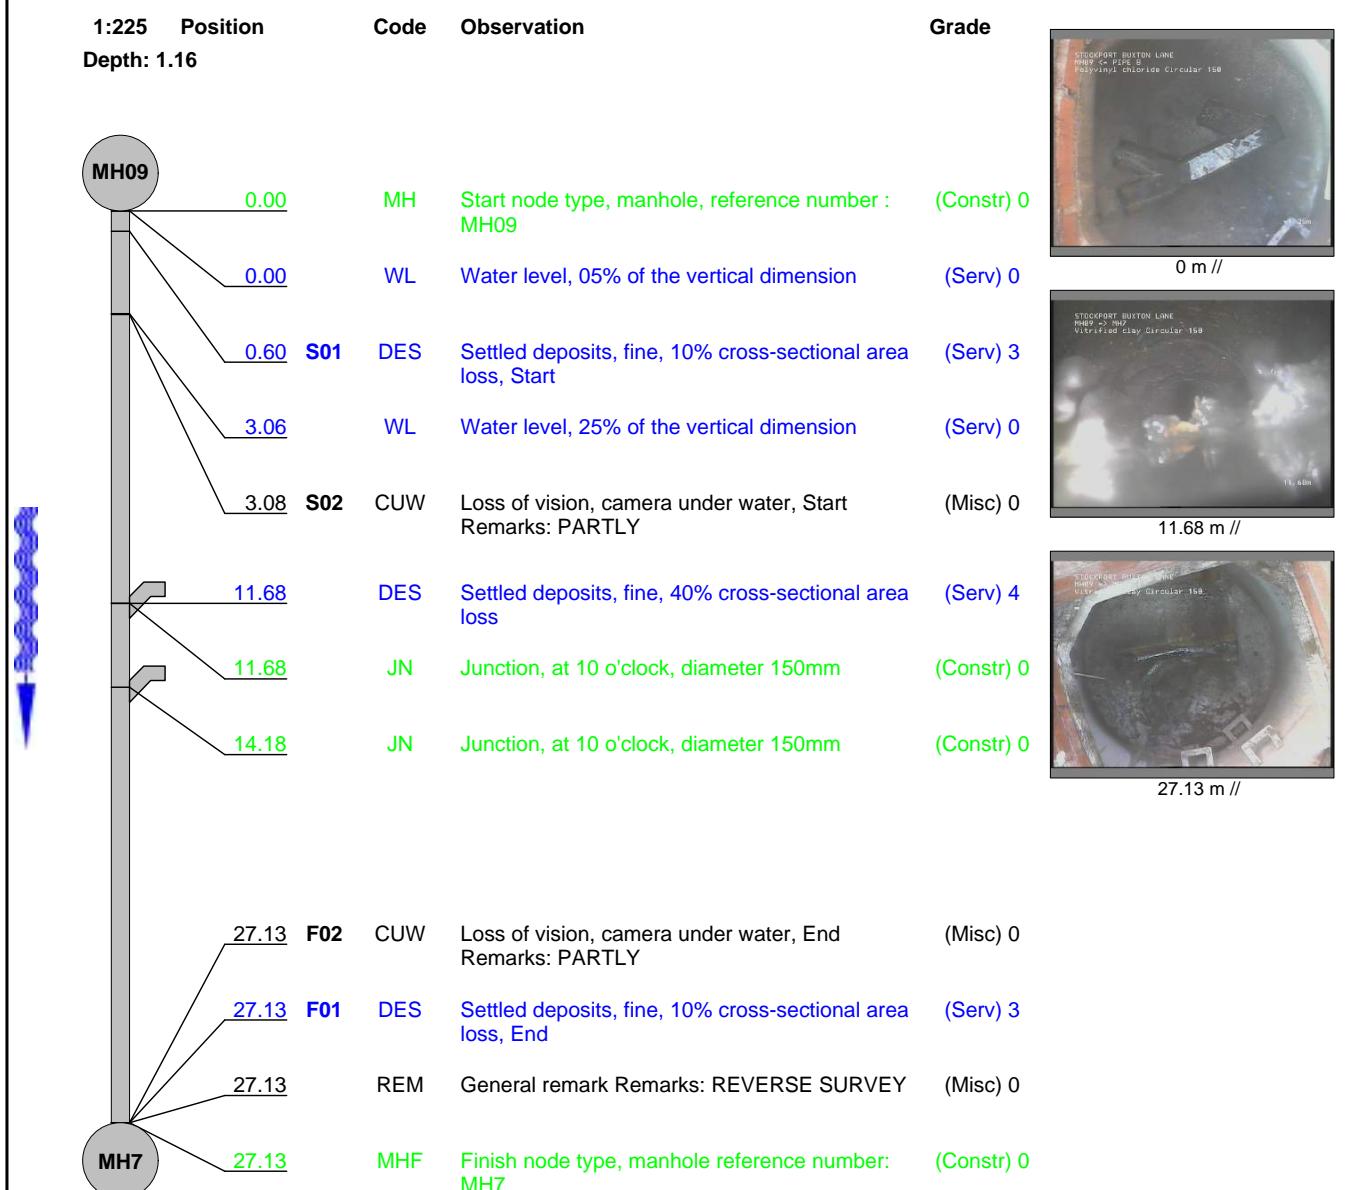


Photo: 010.JPG
29.86m, Finish node type, manhole reference number: MH08

Inspection report

Date : 29/03/2019	Job number : DW00000419	Weather : no rain or snow	Operator : DW	Section number : 6	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH09
Road : BUXTON LANE	Catchment:	U/S Depth : 1.16
Location Road	Tape number : -	D/S MH : MH7
Inspection MH09 (D/S) MH7	Pipe Length 2.00 m	D/S Depth : 2.01
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 27.13 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	2	7	2.14	58	4

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
6PLR Suffix :
X

Photo: 011.JPG
0m, Start node type, manhole, reference number : MH09



Photo: 012.JPG
11.68m, Settled deposits, fine, 40% cross-sectional area loss

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
6

PLR Suffix :
X

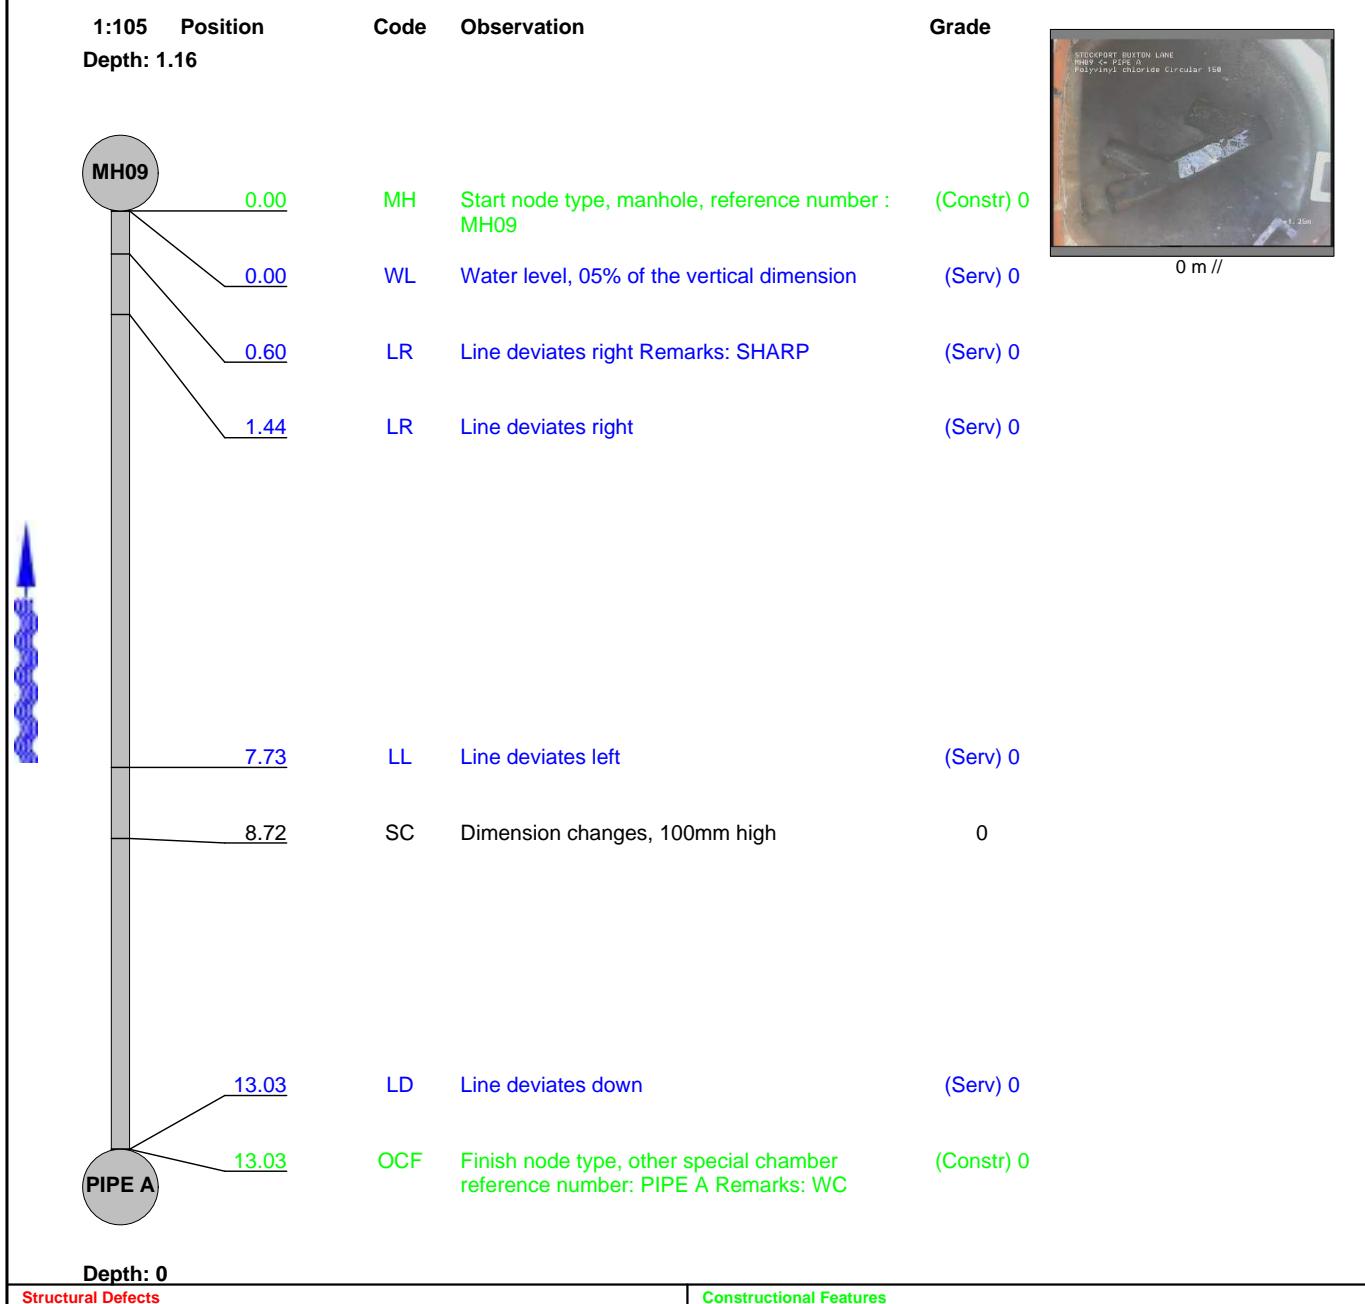


Photo: 013.JPG
27.13m, Finish node type, manhole reference number: MH7

Inspection report

Date : 29/03/2019	Job number : DW00000420	Weather : no rain or snow	Operator : DW	Section number : 7	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : Pipe Length	U/S MH : PIPE A
Road : BUXTON LANE		U/S Depth : 0
Location : Road		D/S MH : MH09
Inspection : MH09 (U/S) PIPE A		D/S Depth : 1.16
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 13.03 m	Lining :	
Comment : CLIENT ON SITE		



Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
7

PLR Suffix :
X

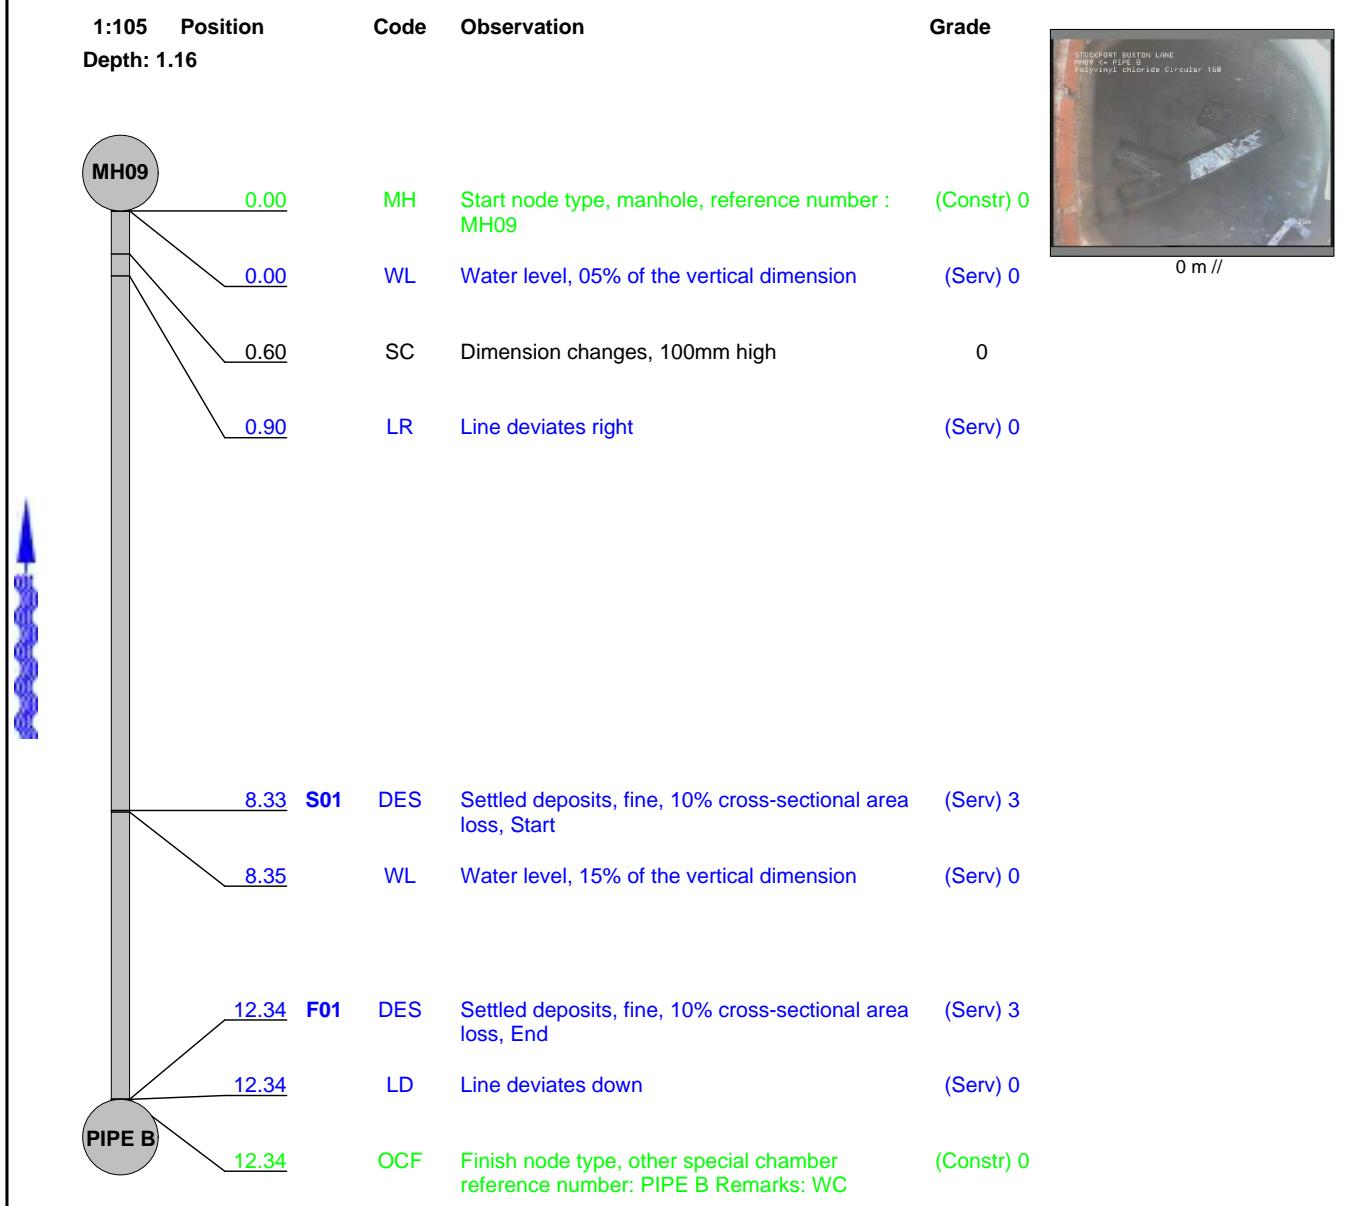


Photo: 014.JPG
0m, Start node type, manhole, reference number : MH09

Inspection report

Date : 29/03/2019	Job number : DW00000421	Weather : no rain or snow	Operator : DW	Section number : 8	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : Pipe Length	U/S MH : PIPE B
Road : BUXTON LANE		U/S Depth : 0
Location Road		D/S MH : MH09
Inspection MH09 (U/S) PIPE B		D/S Depth : 1.16
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 12.34 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	1	2	0.65	8	3

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place : STOCKPORT	Road : BUXTON LANE	Date : 29/03/2019	Section number : 8	PLR Suffix : X
-----------------------------	------------------------------	-----------------------------	------------------------------	--------------------------

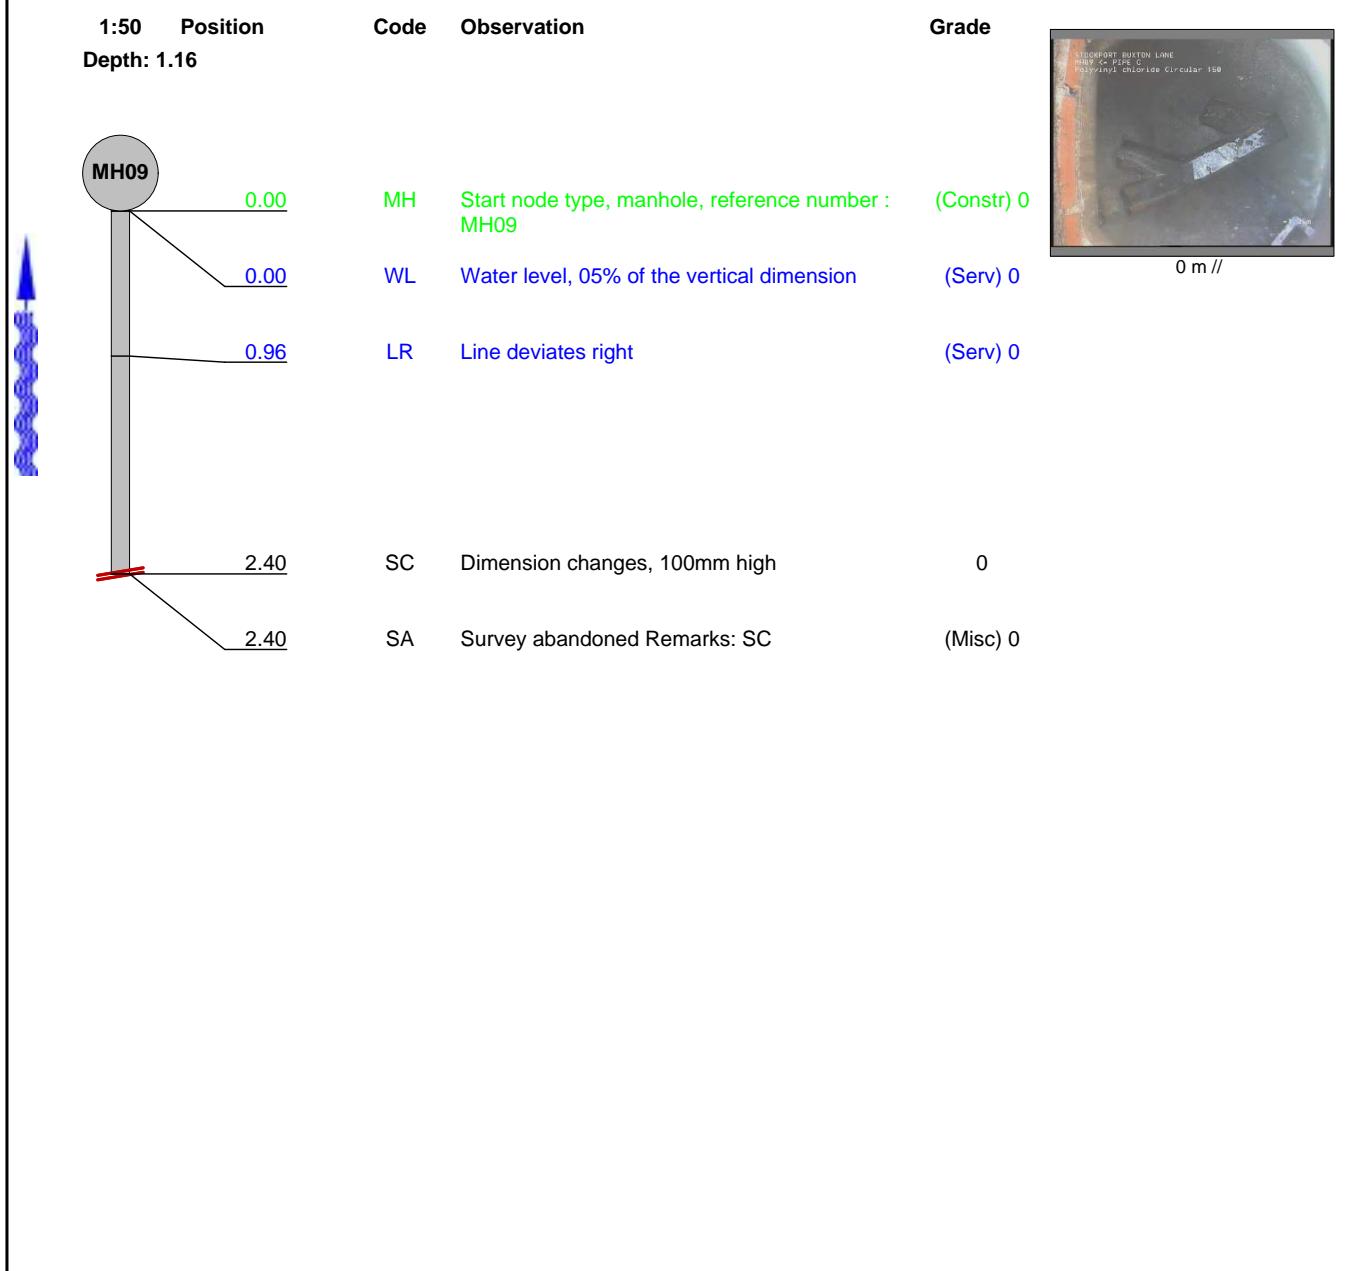


Photo: 015.JPG
0m, Start node type, manhole, reference number : MH09

Inspection report

Date : 29/03/2019	Job number : DW00000422	Weather : no rain or snow	Operator : DW	Section number : 9	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE C
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Road	Tape number : -	D/S MH : MH09
Inspection MH09 (U/S) PIPE C	Pipe Length 2.00 m	D/S Depth : 1.16
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 4.00 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :	Road :	Date :	Section number :	PLR Suffix :
STOCKPORT	BUXTON LANE	29/03/2019	9	X

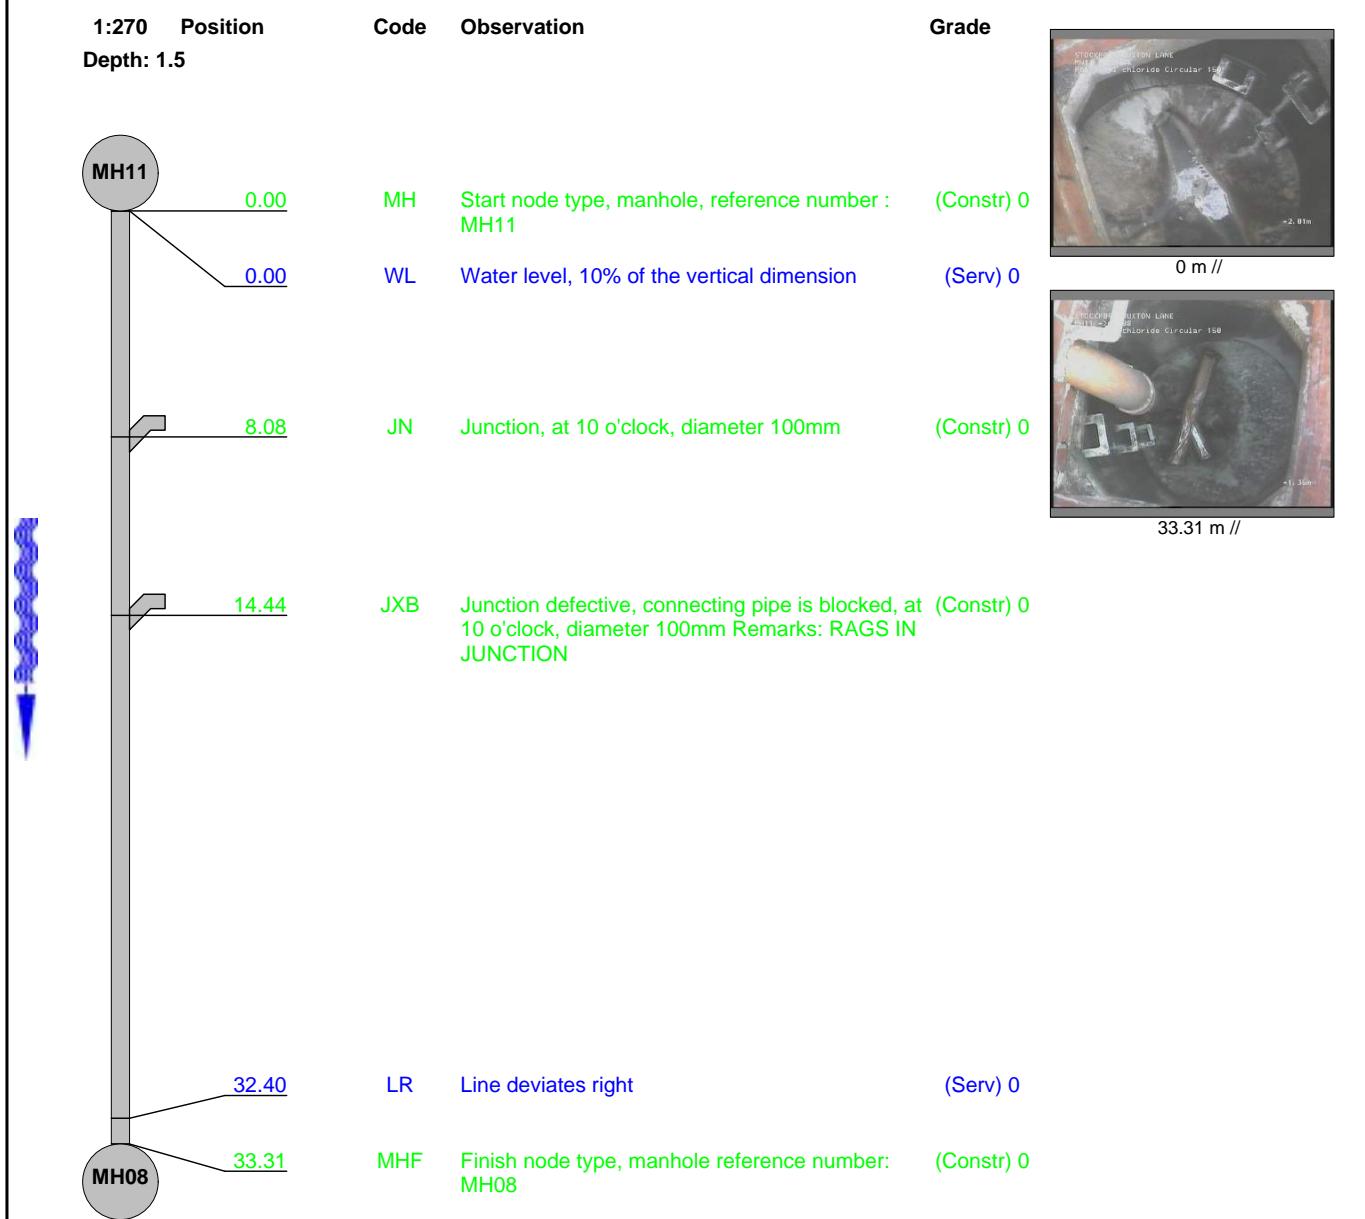


Photo: 016.JPG
0m, Start node type, manhole, reference number : MH09

Inspection report

Date : 29/03/2019	Job number : DW00000423	Weather : no rain or snow	Operator : DW	Section number : 10	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH11
Road : BUXTON LANE	Catchment:	U/S Depth : 1.5
Location Other Pedestrian area	Tape number : -	D/S MH : MH08
Inspection MH11 (D/S) MH08	Pipe Length 2.00 m	D/S Depth : 2.3
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 33.31 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
10PLR Suffix :
X

Photo: 017.JPG
0m, Start node type, manhole, reference number : MH11

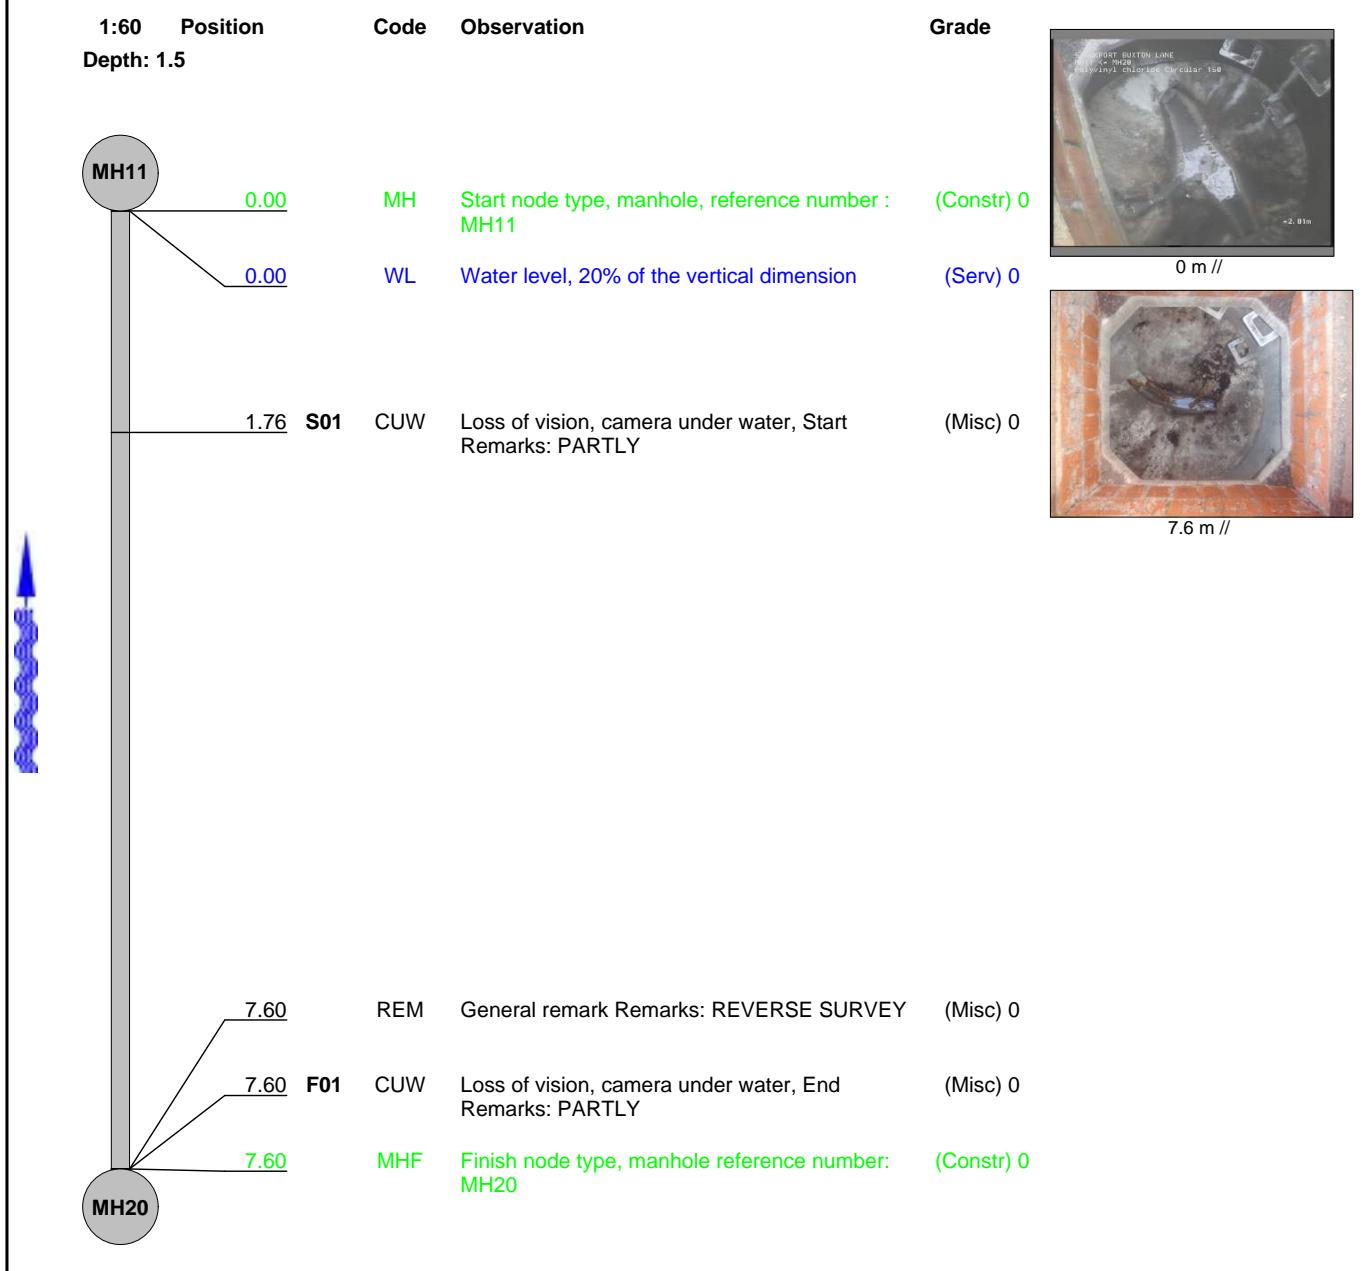


Photo: 018.JPG
33.31m, Finish node type, manhole reference number: MH08

Inspection report

Date : 29/03/2019	Job number : DW00000424	Weather : no rain or snow	Operator : DW	Section number : 11	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH20
Road : BUXTON LANE	Catchment:	U/S Depth :
Location Other Pedestrian area	Tape number : -	D/S MH : MH11
Inspection MH11 (U/S) MH20	Pipe Length 2.00 m	D/S Depth : 1.5
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 7.60 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
11PLR Suffix :
X

Photo: 019.JPG
0m, Start node type, manhole, reference number : MH11

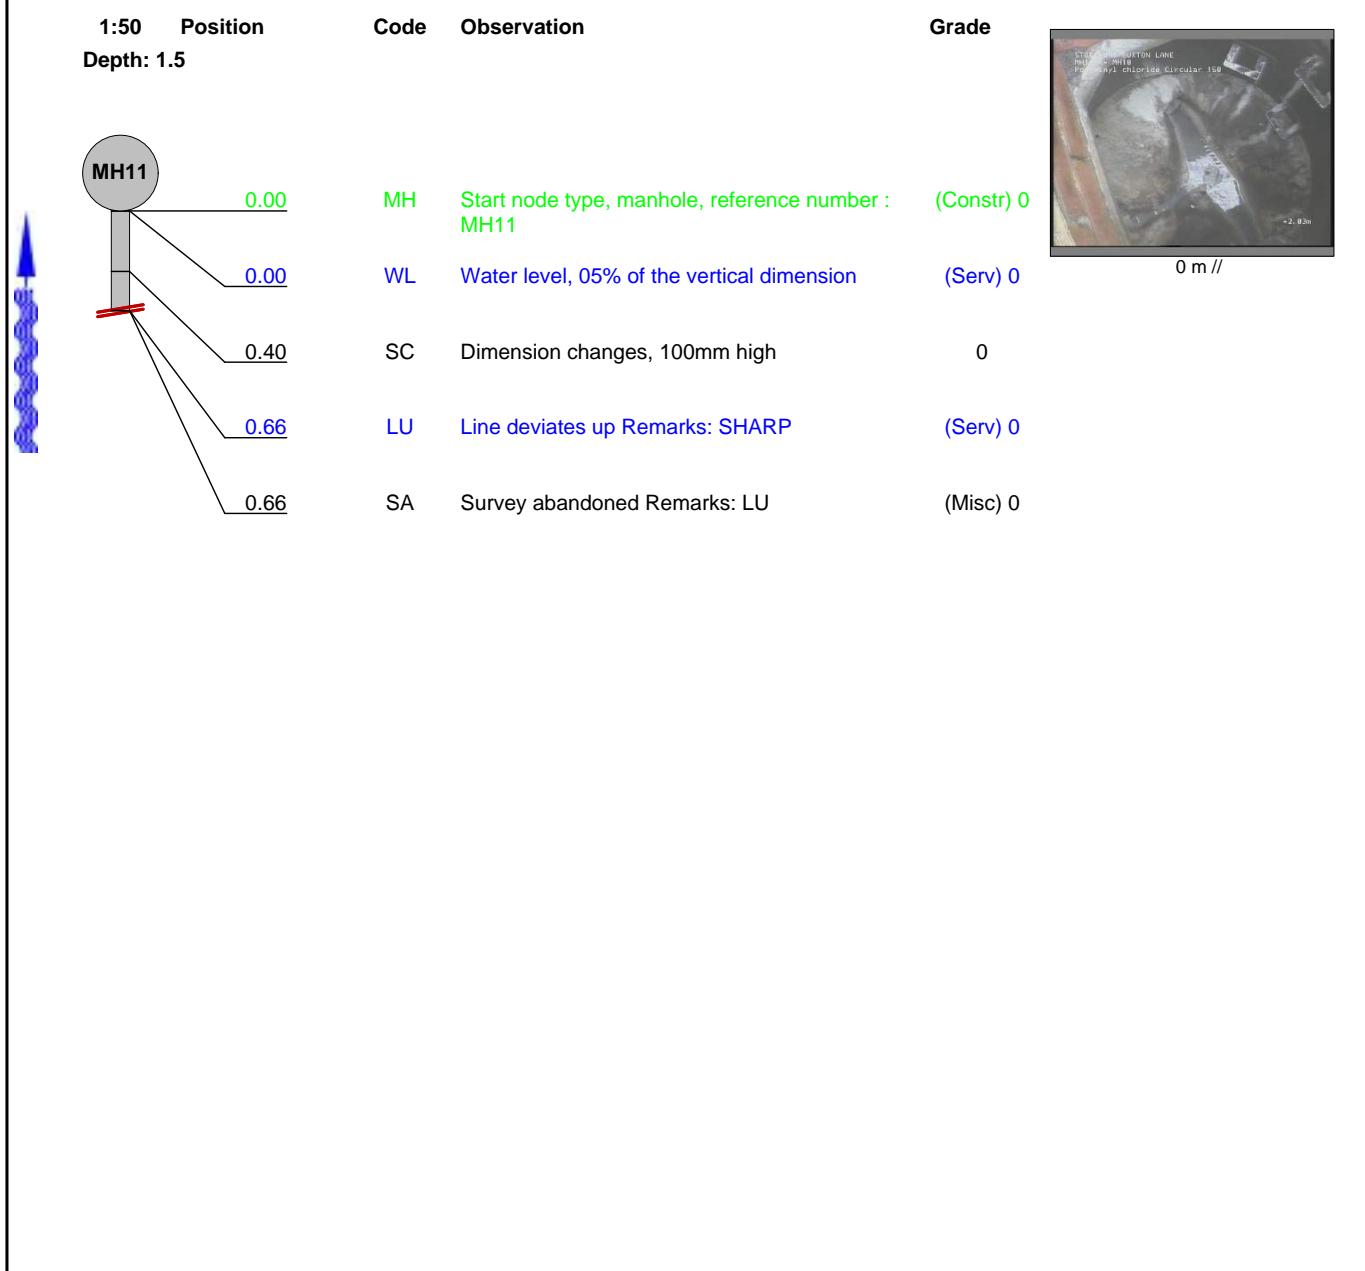


Photo: 020.JPG
7.6m, Finish node type, manhole reference number: MH20

Inspection report

Date : 29/03/2019	Job number : DW00000425	Weather : no rain or snow	Operator : DW	Section number : 12	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH10
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Other Pedestrian area	Tape number : -	D/S MH : MH11
Inspection MH11 (U/S) MH10	Pipe Length 2.00 m	D/S Depth : 1.5
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 10.00 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
12

PLR Suffix :
X

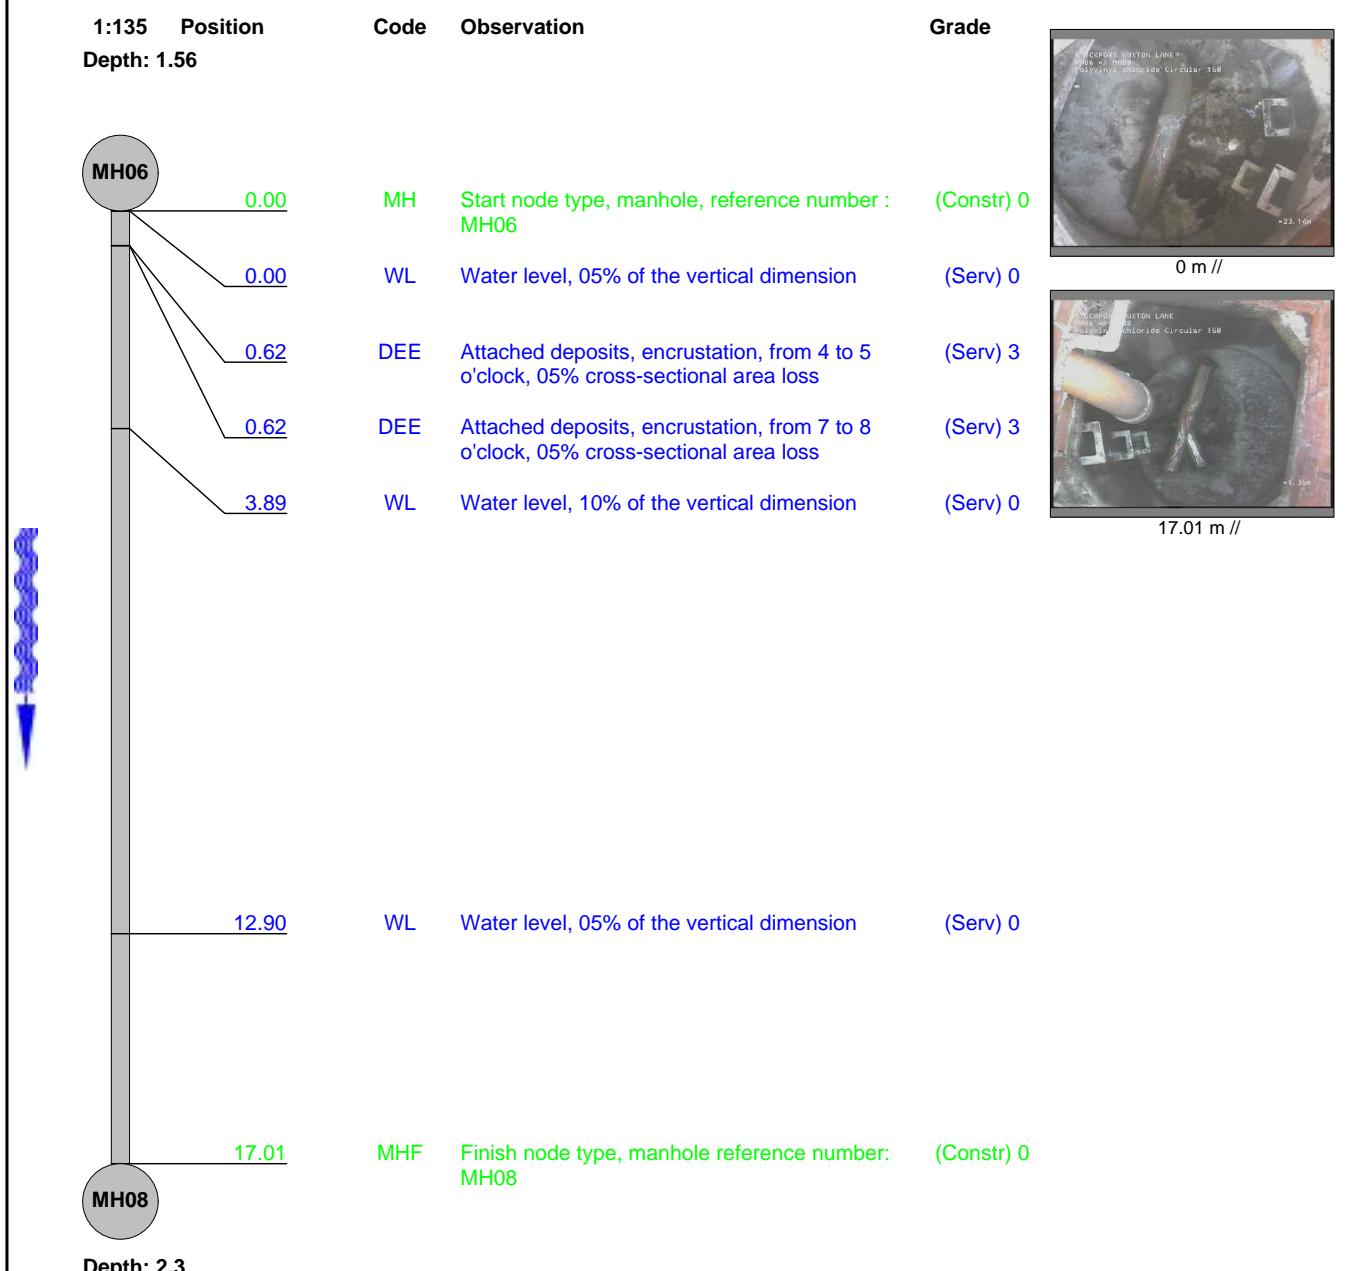


Photo: 021.JPG
0m, Start node type, manhole, reference number : MH11

Inspection report

Date : 29/03/2019	Job number : DW00000426	Weather : no rain or snow	Operator : DW	Section number : 13	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : -	U/S MH : MH06
Road : BUXTON LANE		U/S Depth : 1.56
Location Other Pedestrian area		D/S MH : MH08
Inspection MH06 (D/S) MH08	Pipe Length 2.00 m	D/S Depth : 2.3
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 17.01 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	2	4	0.24	4	3

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
13PLR Suffix :
X

Photo: 022.JPG
0m, Start node type, manhole, reference number : MH06

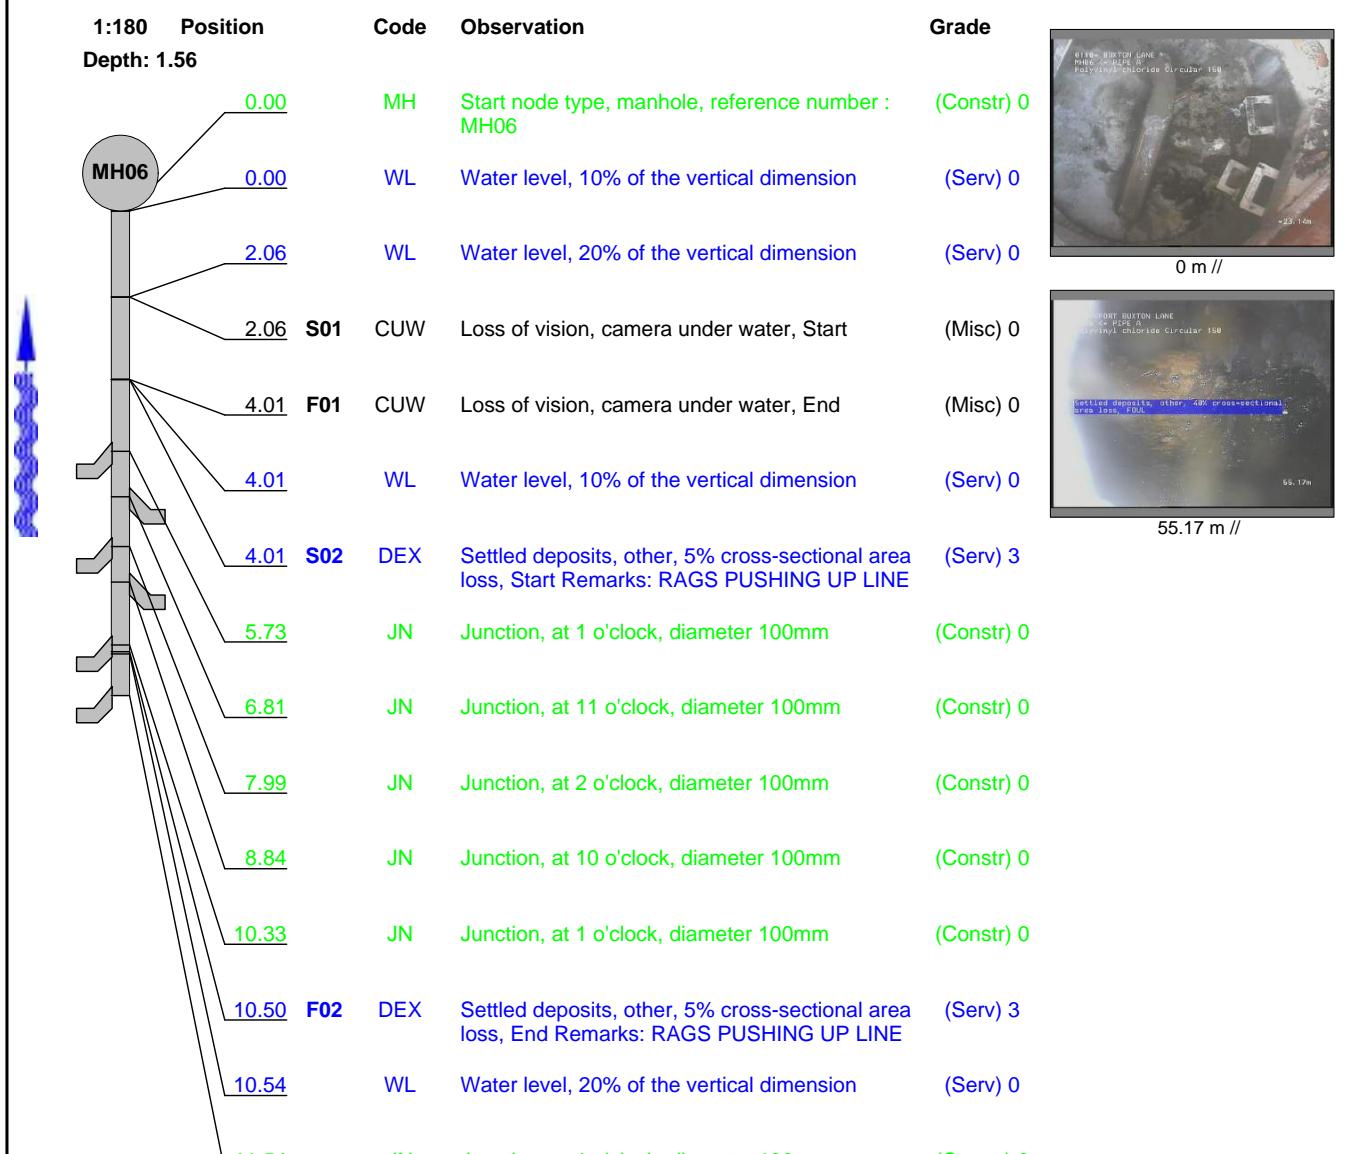


Photo: 023.JPG
17.01m, Finish node type, manhole reference number: MH08

Inspection report

Date : 29/03/2019	Job number : DW00000427	Weather : no rain or snow	Operator : DW	Section number : 14	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : Pipe Length	U/S MH : PIPE A
Road : BUXTON LANE		U/S Depth : 0
Location Other Pedestrian area		D/S MH : MH06
Inspection MH06 (U/S) PIPE A		D/S Depth : 1.56
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 60.00 m	Lining :	
Comment : CLIENT ON SITE		




Inspection Report

Date : 29/03/2019	Job number : DW00000427	Weather : no rain or snow	Operator : DW	Section number : 14	PLR : X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Grade:

1:180	Position	Code	Observation	Grade
	13.20	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	15.26	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	17.17	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	18.80	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	19.40	JN	Junction, at 2 o'clock, diameter 100mm	(Constr) 0
	20.12	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	20.98	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	21.11	WL	Water level, 10% of the vertical dimension	(Serv) 0
	21.54	JN	Junction, at 2 o'clock, diameter 100mm	(Constr) 0
	22.65	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	23.18	JN	Junction, at 1 o'clock, diameter 100mm	(Constr) 0
	25.92	WL	Water level, 05% of the vertical dimension	(Serv) 0
	28.52	LL	Line deviates left	(Serv) 0
	28.87	JN	Junction, at 1 o'clock, diameter 100mm	(Constr) 0
	30.78	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0
	36.24	JN	Junction, at 1 o'clock, diameter 100mm	(Constr) 0
	37.51	JN	Junction, at 1 o'clock, diameter 100mm	(Constr) 0
	39.11	JN	Junction, at 10 o'clock, diameter 100mm	(Constr) 0

Inspection Report

Date : 29/03/2019	Job number : DW00000427	Weather : no rain or snow	Operator : DW	Section number : 14	PLR : X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Grade:

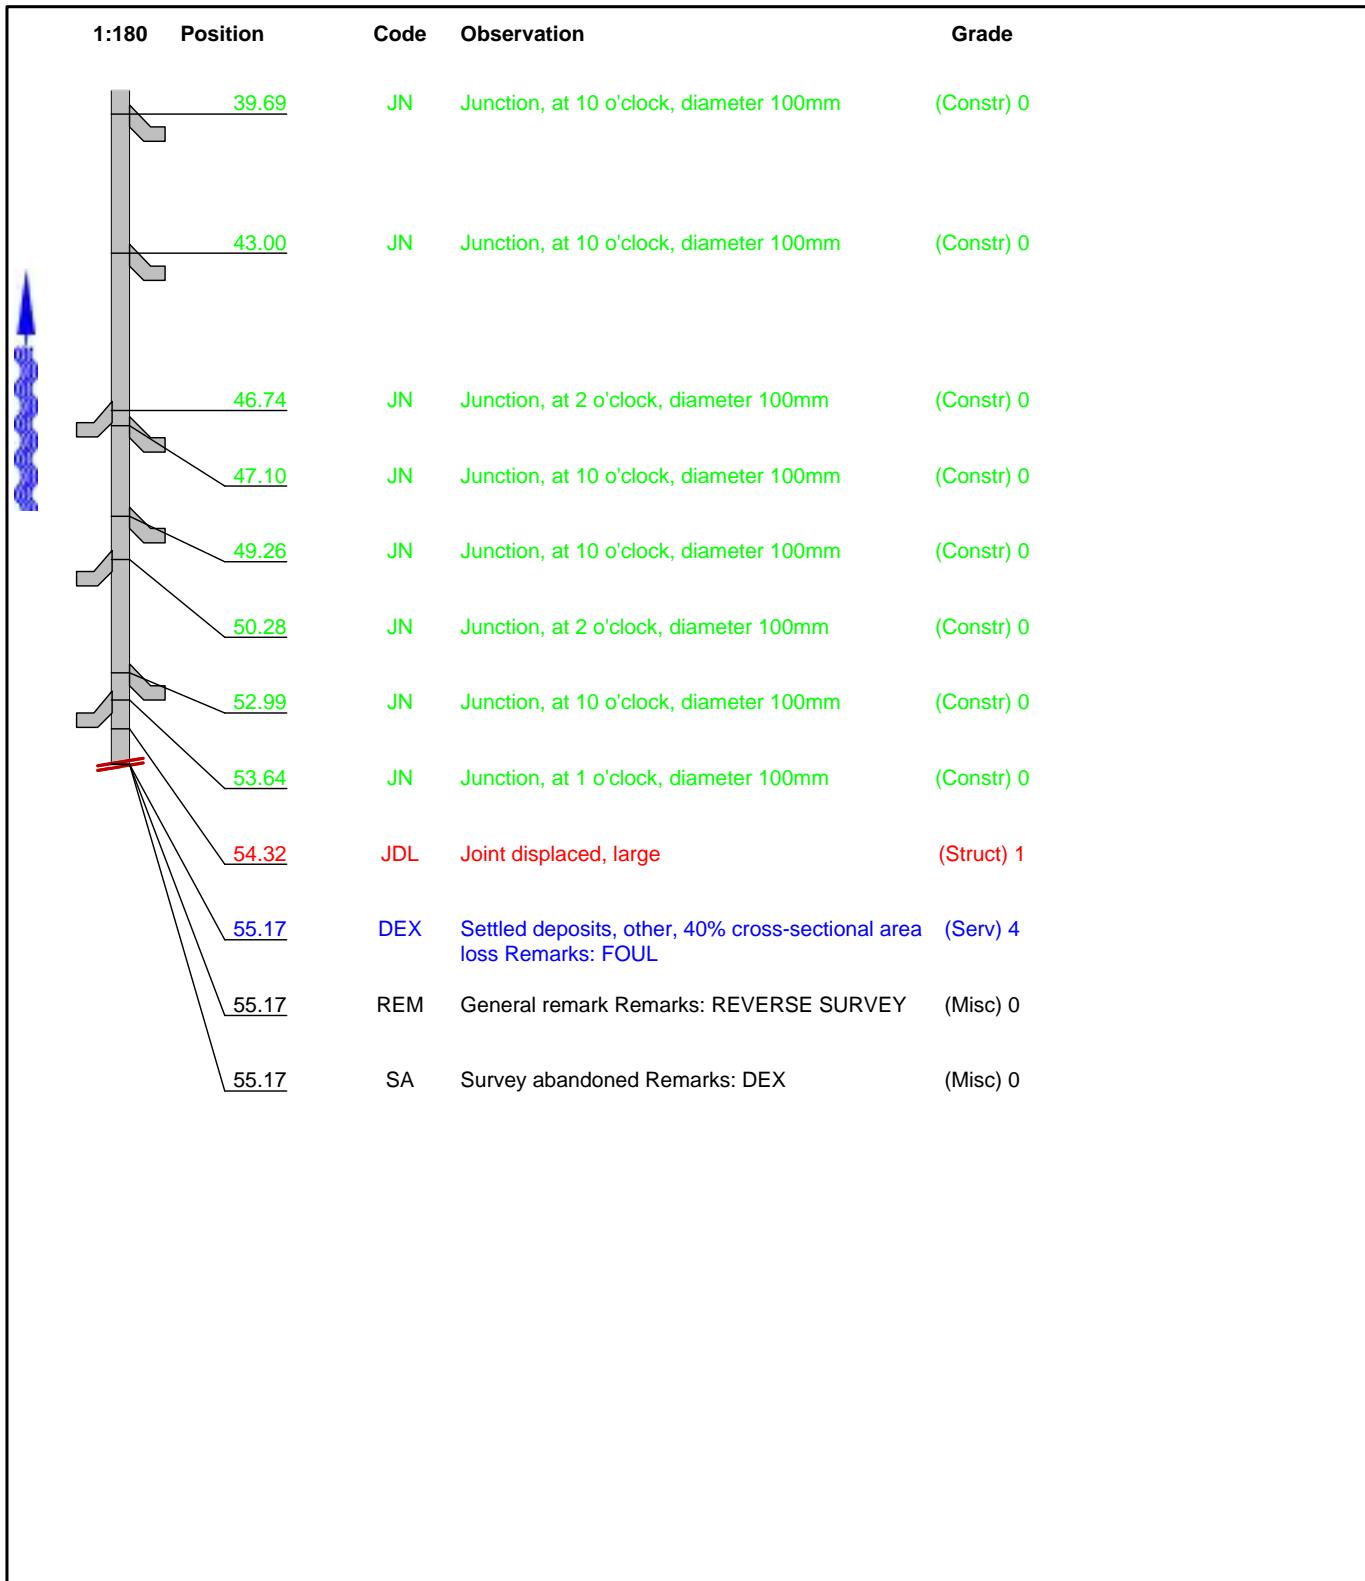

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
1	1	0.02	1	1	2	5	0.3	18	4

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
14

PLR Suffix :
X



Photo: 024.JPG
0m, Start node type, manhole, reference number : MH06

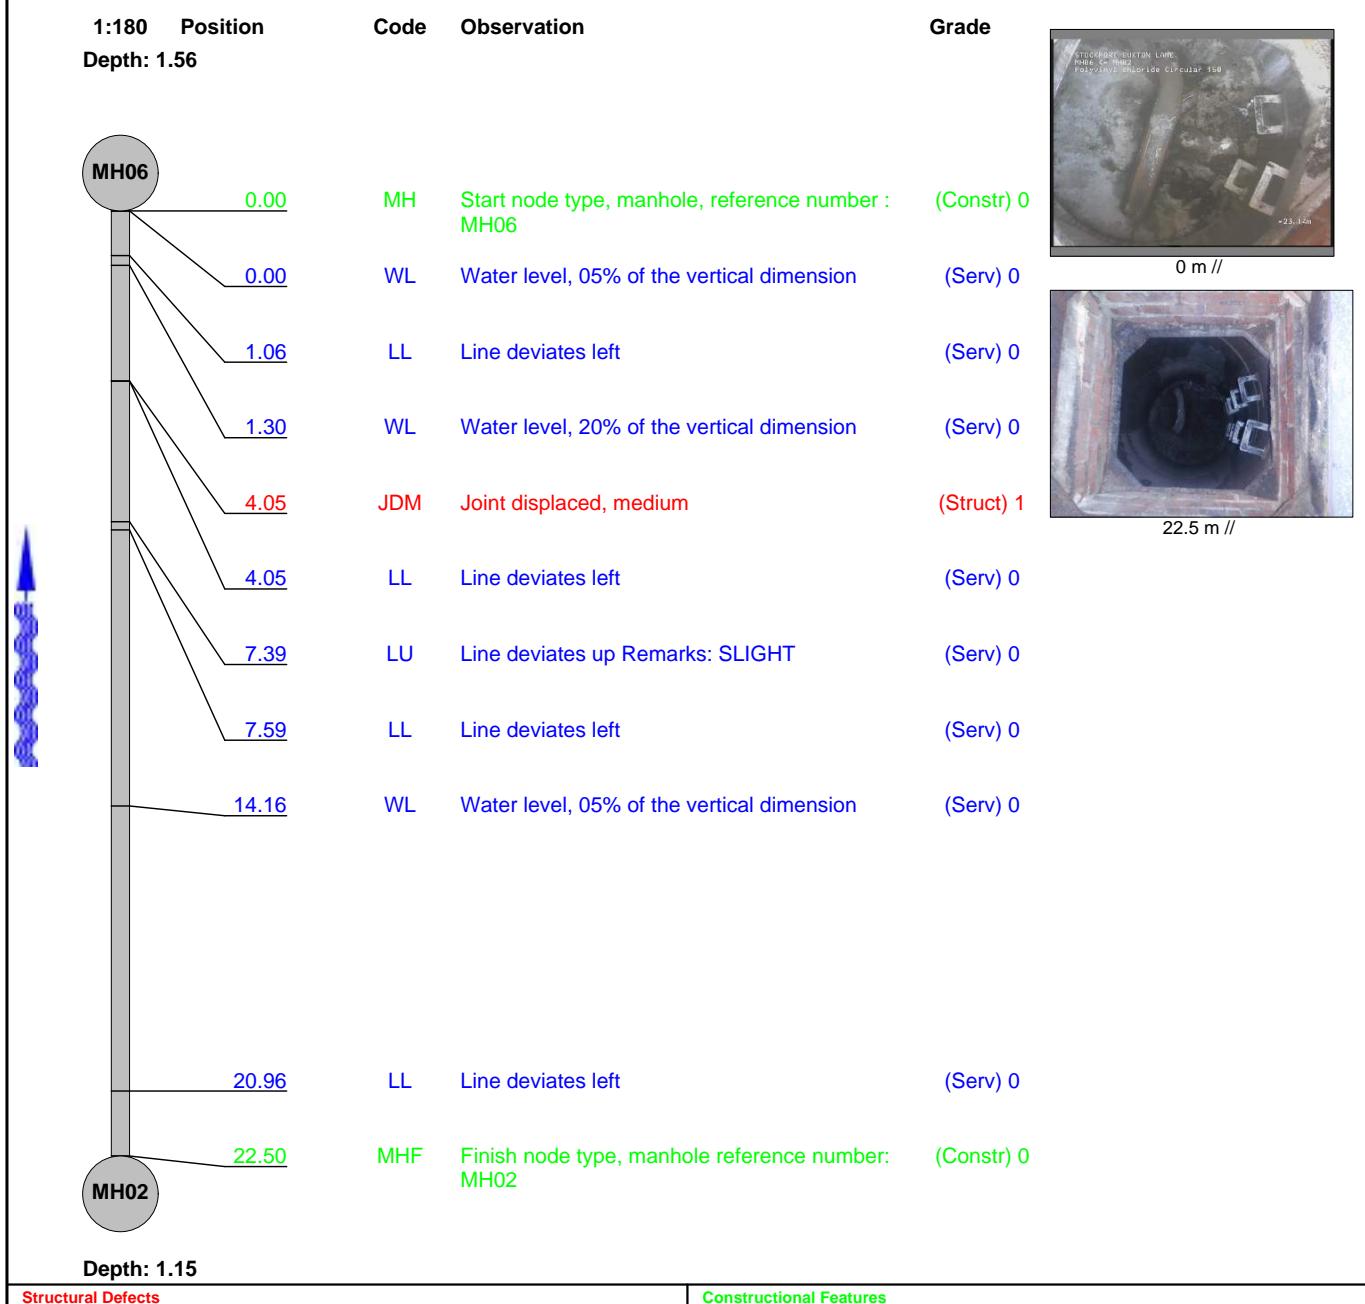


Photo: 025.JPG
55.17m, Settled deposits, other, 40% cross-sectional area loss Remarks: FOUL

Inspection report

Date : 29/03/2019	Job number : DW00000428	Weather : no rain or snow	Operator : DW	Section number : 15	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : -	U/S MH : MH02
Road : BUXTON LANE		U/S Depth : 1.15
Location Other Pedestrian area		D/S MH : MH06
Inspection MH06 (U/S) MH02	Pipe Length 2.00 m	D/S Depth : 1.56
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 22.50 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
1	0.5	0.02	0.5	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
15

PLR Suffix :
X



Photo: 026.JPG
0m, Start node type, manhole, reference number : MH06

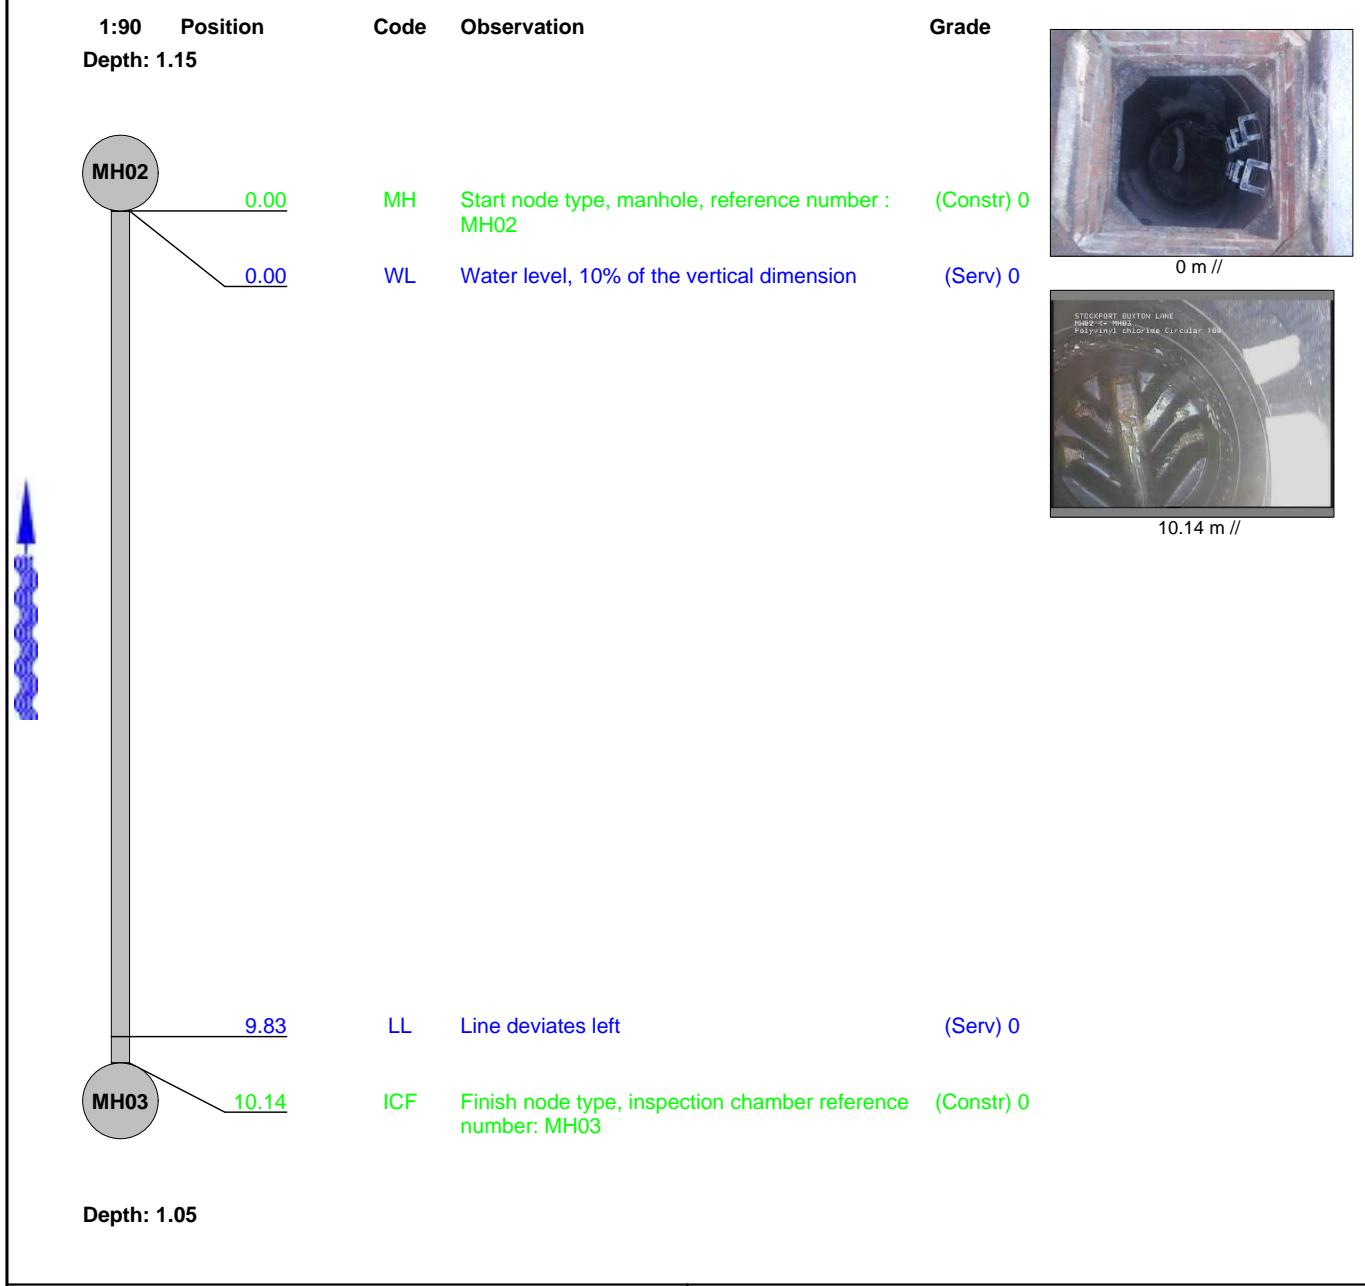


Photo: 027.JPG
22.5m, Finish node type, manhole reference number: MH02

Inspection report

Date : 29/03/2019	Job number : DW00000429	Weather : no rain or snow	Operator : DW	Section number : 16	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH03
Road : BUXTON LANE	Catchment:	U/S Depth : 1.05
Location Other Pedestrian area	Tape number : -	D/S MH : MH02
Inspection MH02 (U/S) MH03	Pipe Length 2.00 m	D/S Depth : 1.15
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 10.14 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
16PLR Suffix :
X

Photo: 028.JPG
0m, Start node type, manhole, reference number : MH02

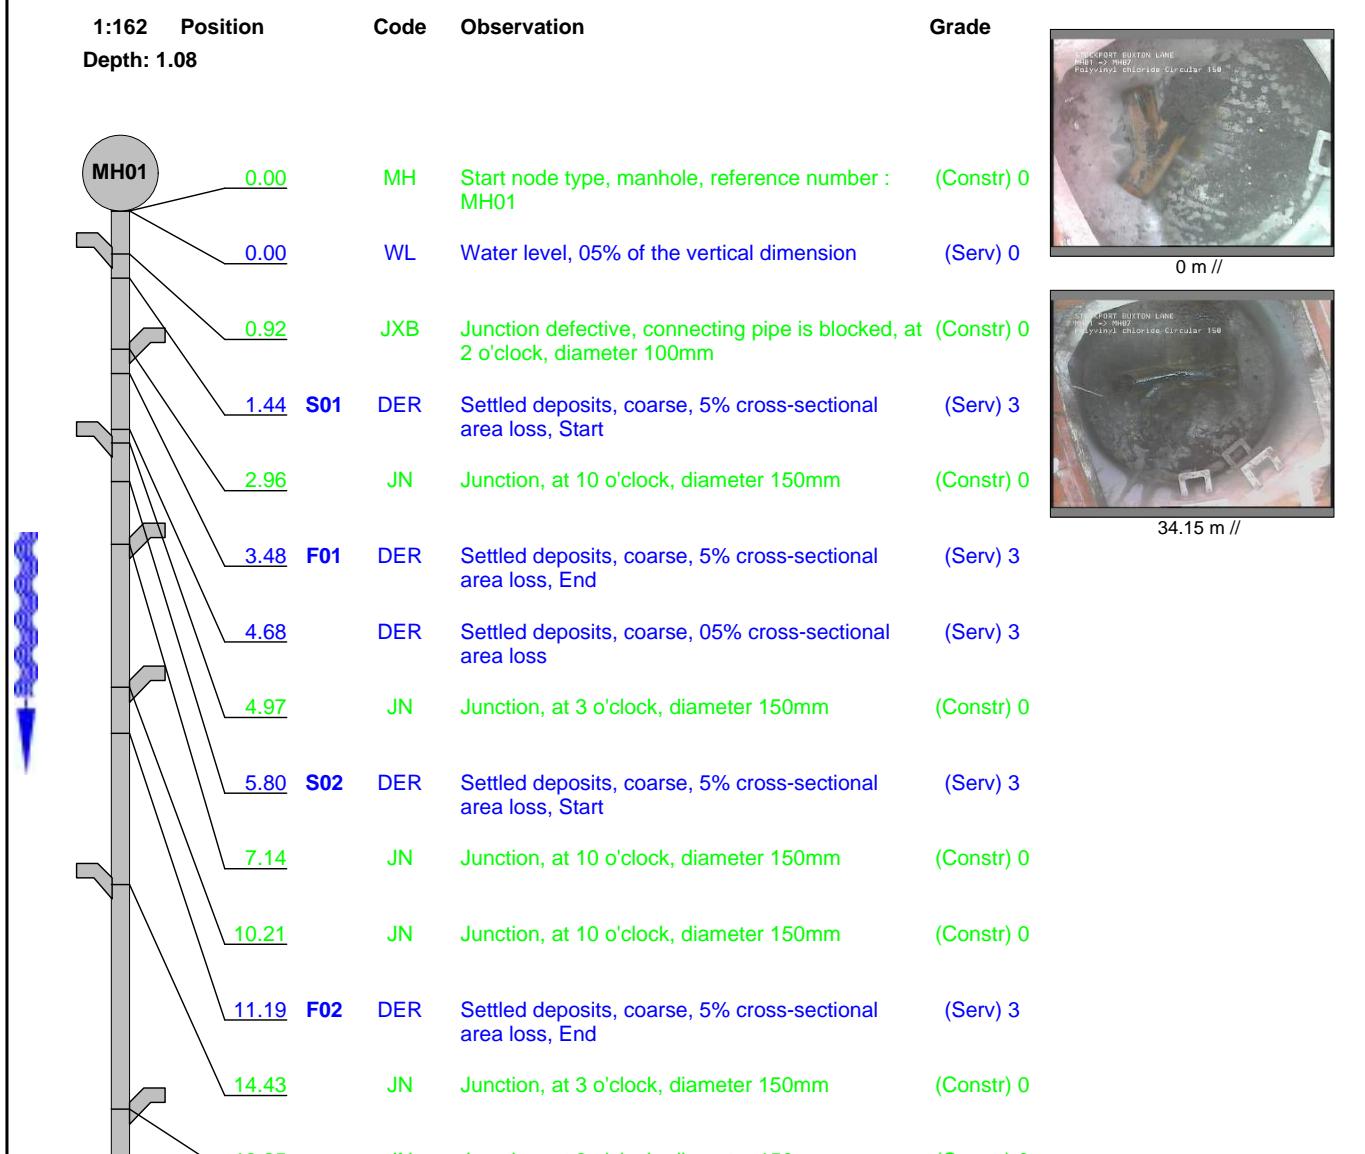


Photo: 029.JPG
10.14m, Finish node type, inspection chamber reference number: MH03

Inspection report


Date : 29/03/2019	Job number : DW00000430	Weather : no rain or snow	Operator : DW	Section number : 17	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH01
Road : BUXTON LANE	Catchment:	U/S Depth : 1.08
Location Other Pedestrian area	Tape number : -	D/S MH : MH07
Inspection MH01 (D/S) MH07	Pipe Length 2.00 m	D/S Depth : 2.01
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 34.15 m	Lining :	
Comment : CLIENT ON SITE		



Inspection Report

Date : 29/03/2019	Job number : DW00000430	Weather : no rain or snow	Operator : DW	Section number : 17	PLR : X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Grade:

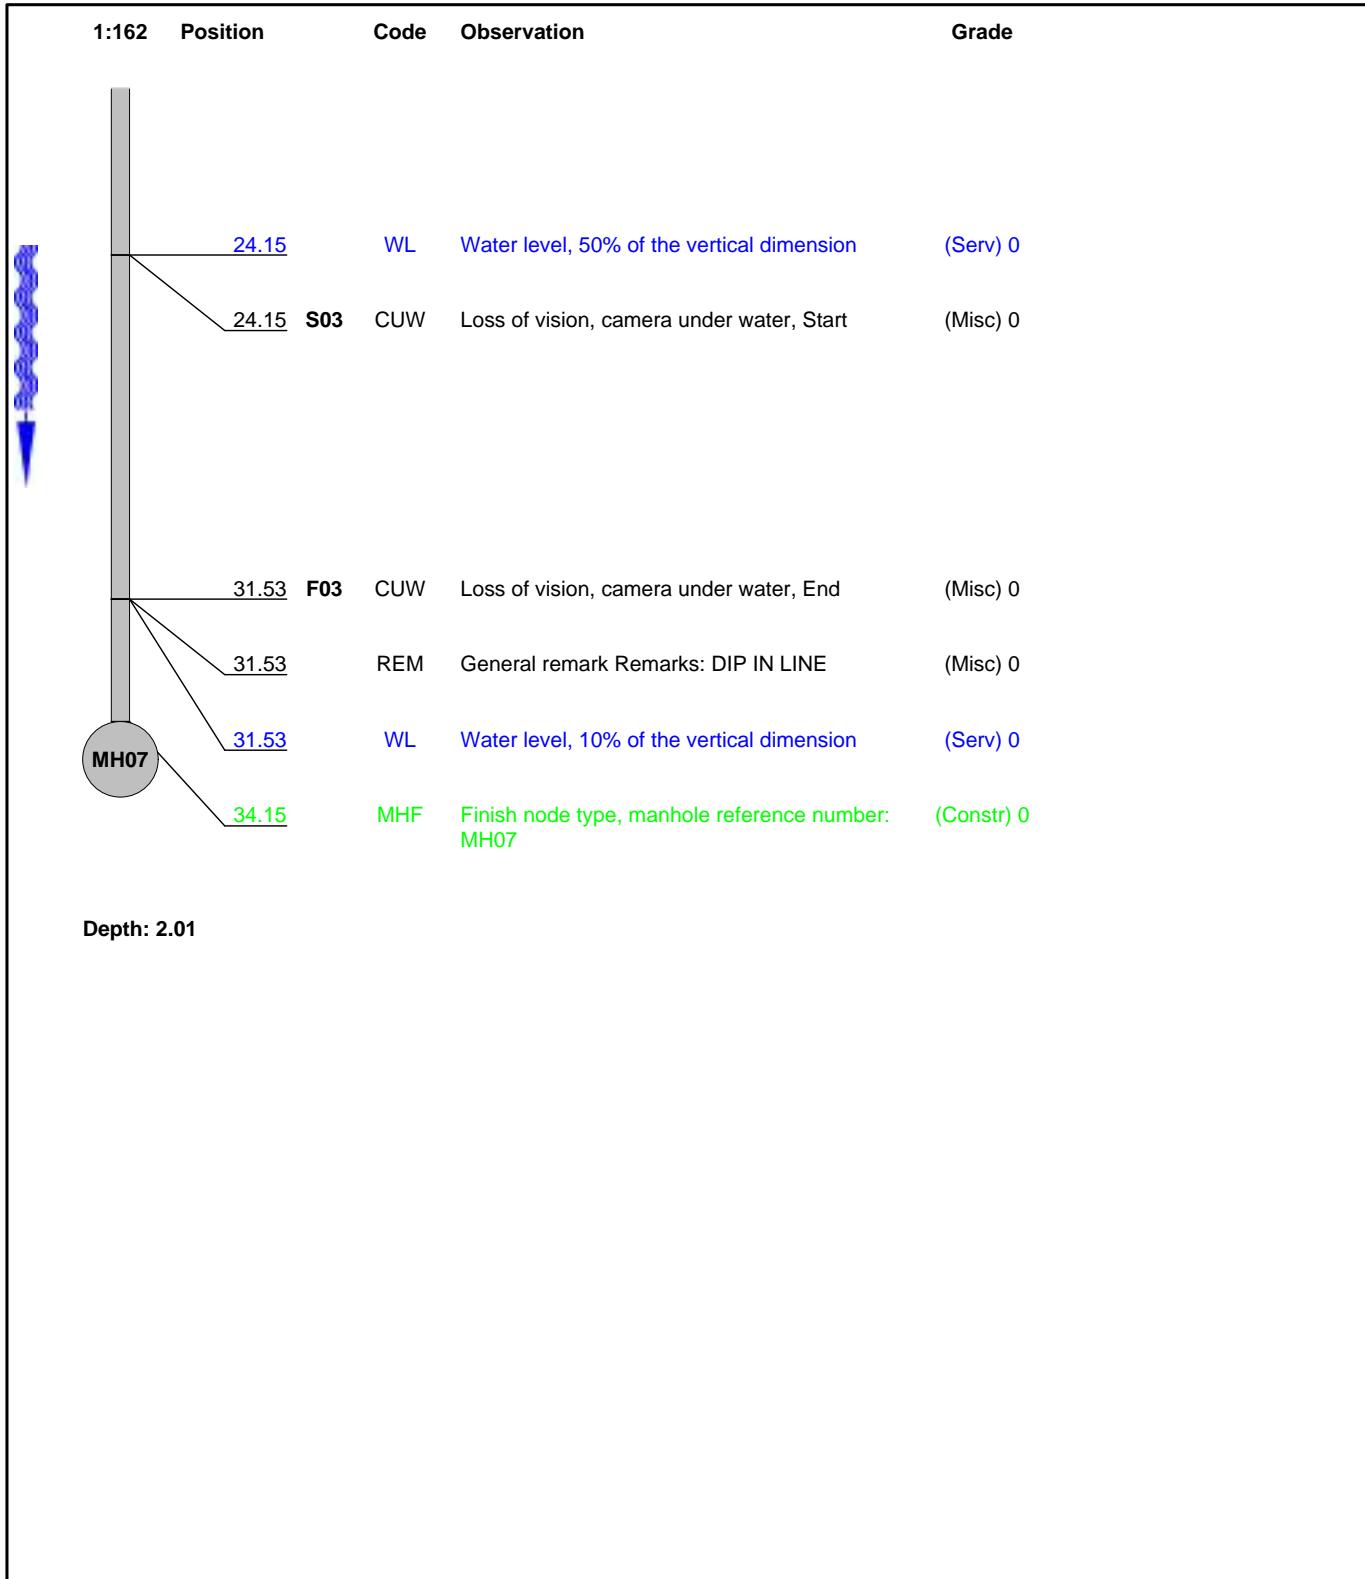

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	3	4	0.49	16.6	3

Inspection pictures

Place :
STOCKPORTRoad :
BUXTON LANEDate :
29/03/2019Section number :
17PLR Suffix :
X

Photo: 030.JPG
0m, Start node type, manhole, reference number : MH01

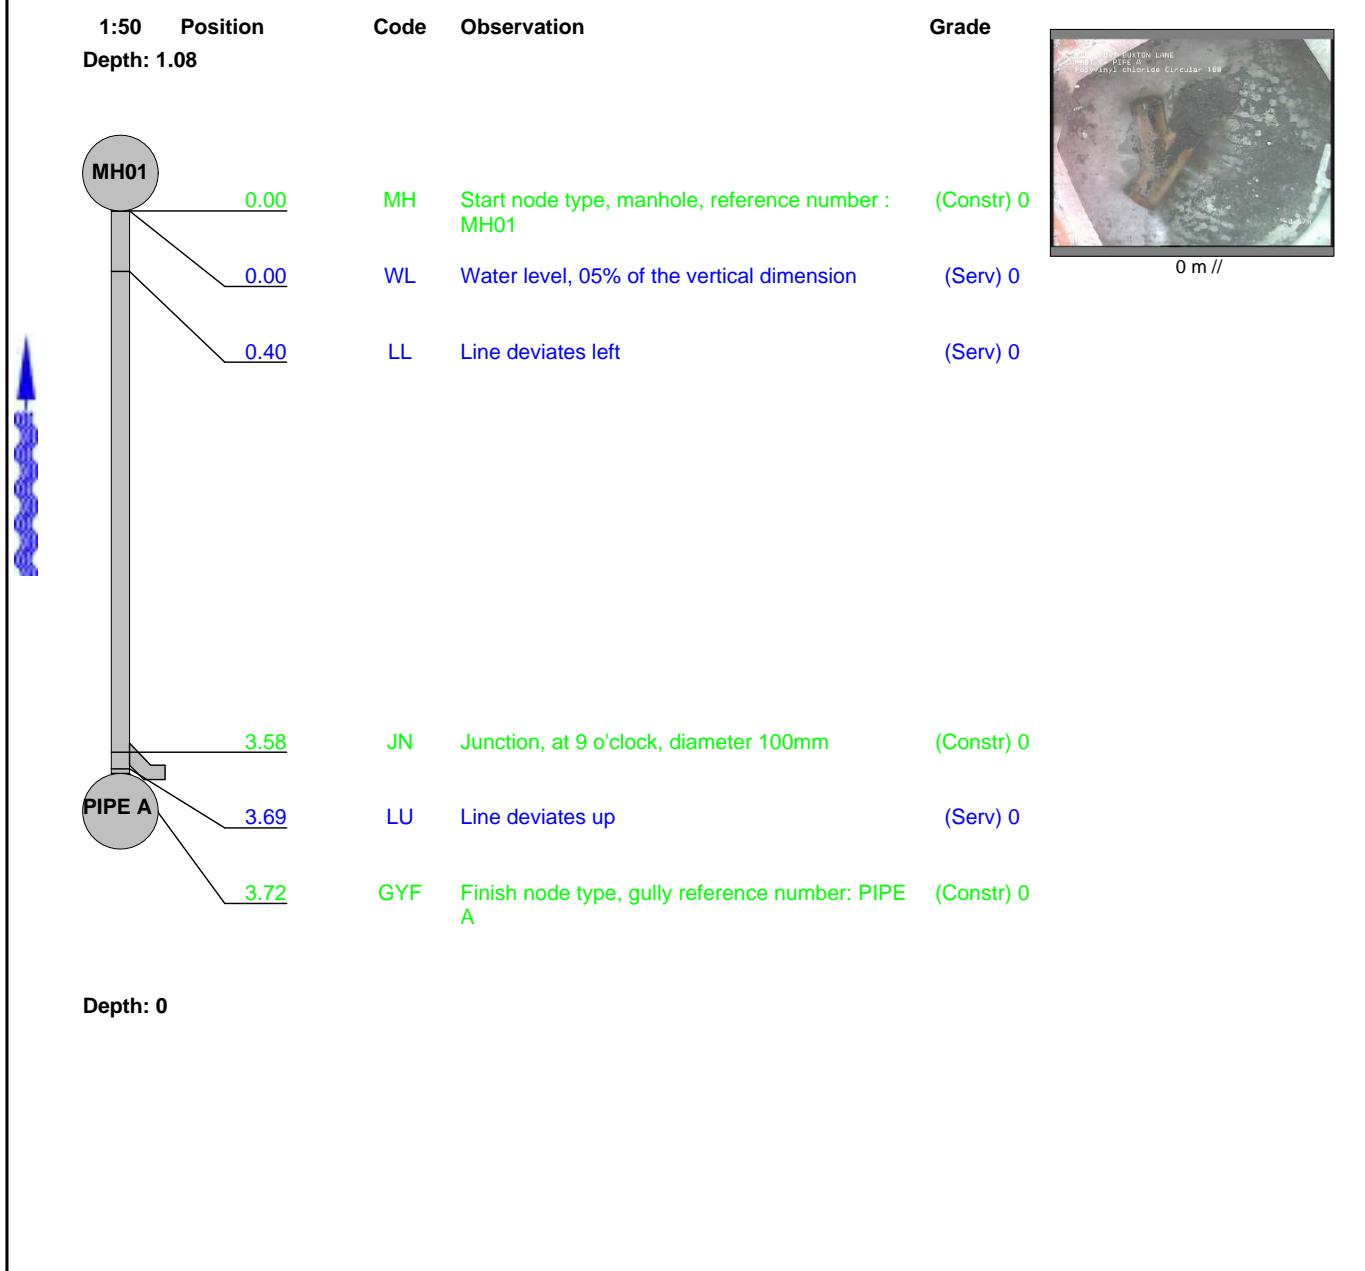


Photo: 031.JPG
34.15m, Finish node type, manhole reference number: MH07

Inspection report

Date : 29/03/2019	Job number : DW00000431	Weather : no rain or snow	Operator : DW	Section number : 18	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE A
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Other Pedestrian area	Tape number : -	D/S MH : MH01
Inspection MH01 (U/S) PIPE A	Pipe Length 2.00 m	D/S Depth : 1.08
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 3.72 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place : STOCKPORT	Road : BUXTON LANE	Date : 29/03/2019	Section number : 18	PLR Suffix : X
-----------------------------	------------------------------	-----------------------------	-------------------------------	--------------------------

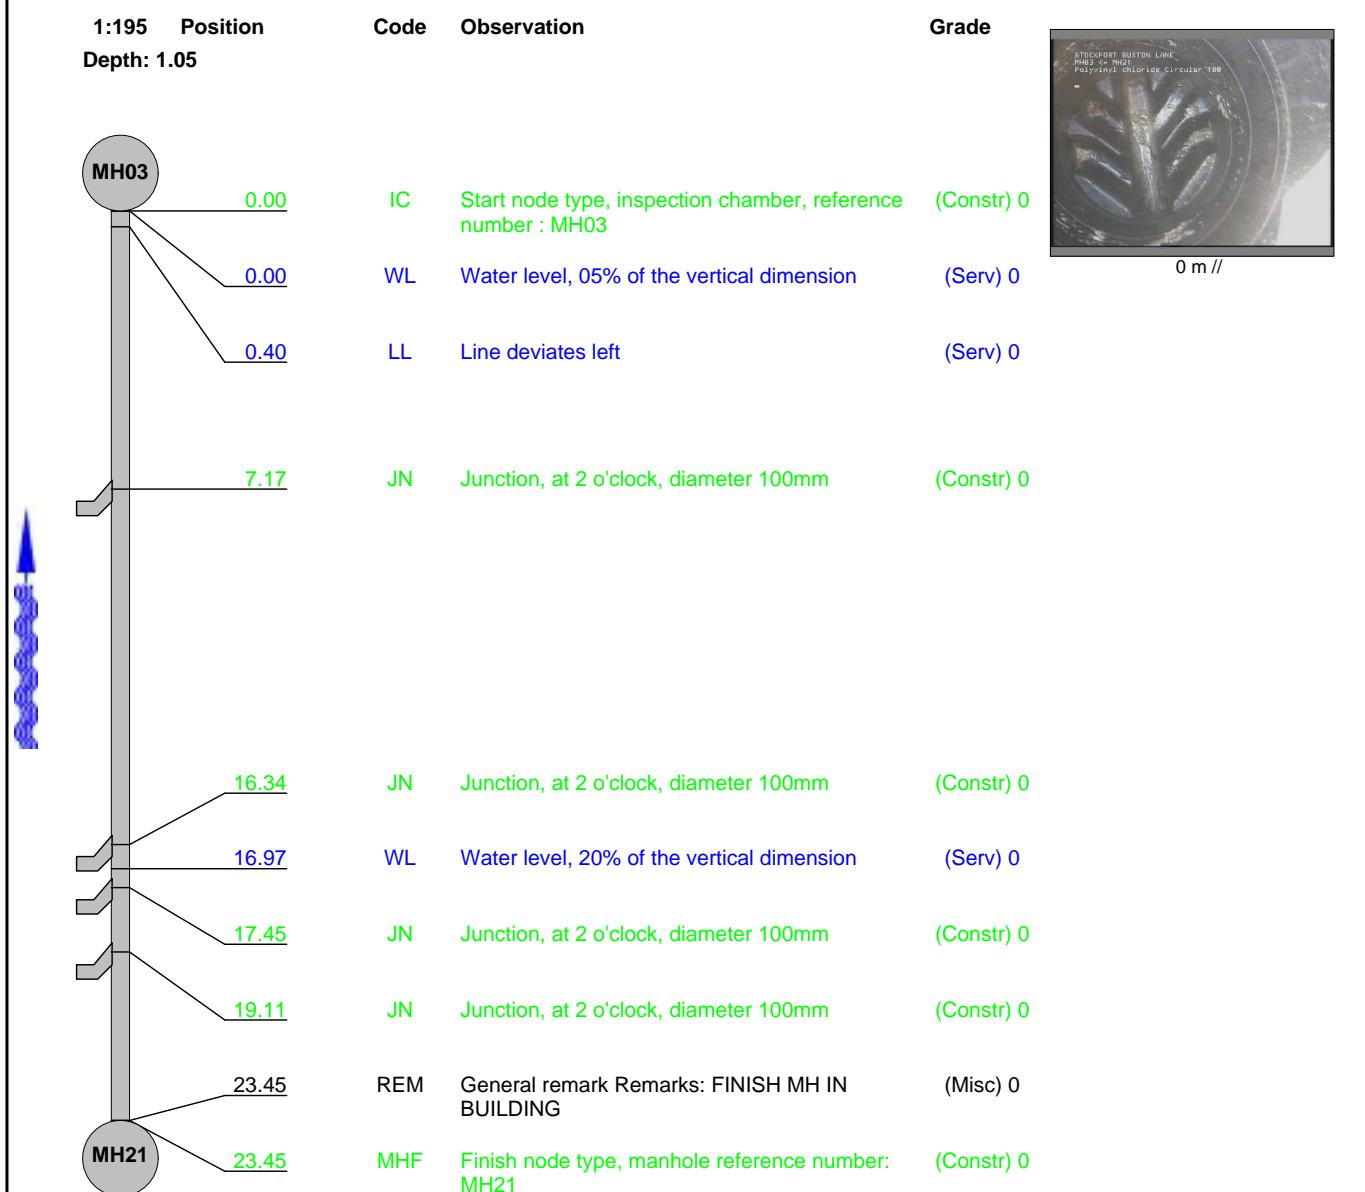


Photo: 032.JPG
0m, Start node type, manhole, reference number : MH01

Inspection report

Date : 29/03/2019	Job number : DW00000432	Weather : no rain or snow	Operator : DW	Section number : 19	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH21
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Other Pedestrian area	Tape number : -	D/S MH : MH03
Inspection MH03 (U/S) MH21	Pipe Length 2.00 m	D/S Depth : 1.05
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 23.45 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :	Road :	Date :	Section number :	PLR Suffix :
STOCKPORT	BUXTON LANE	29/03/2019	19	X

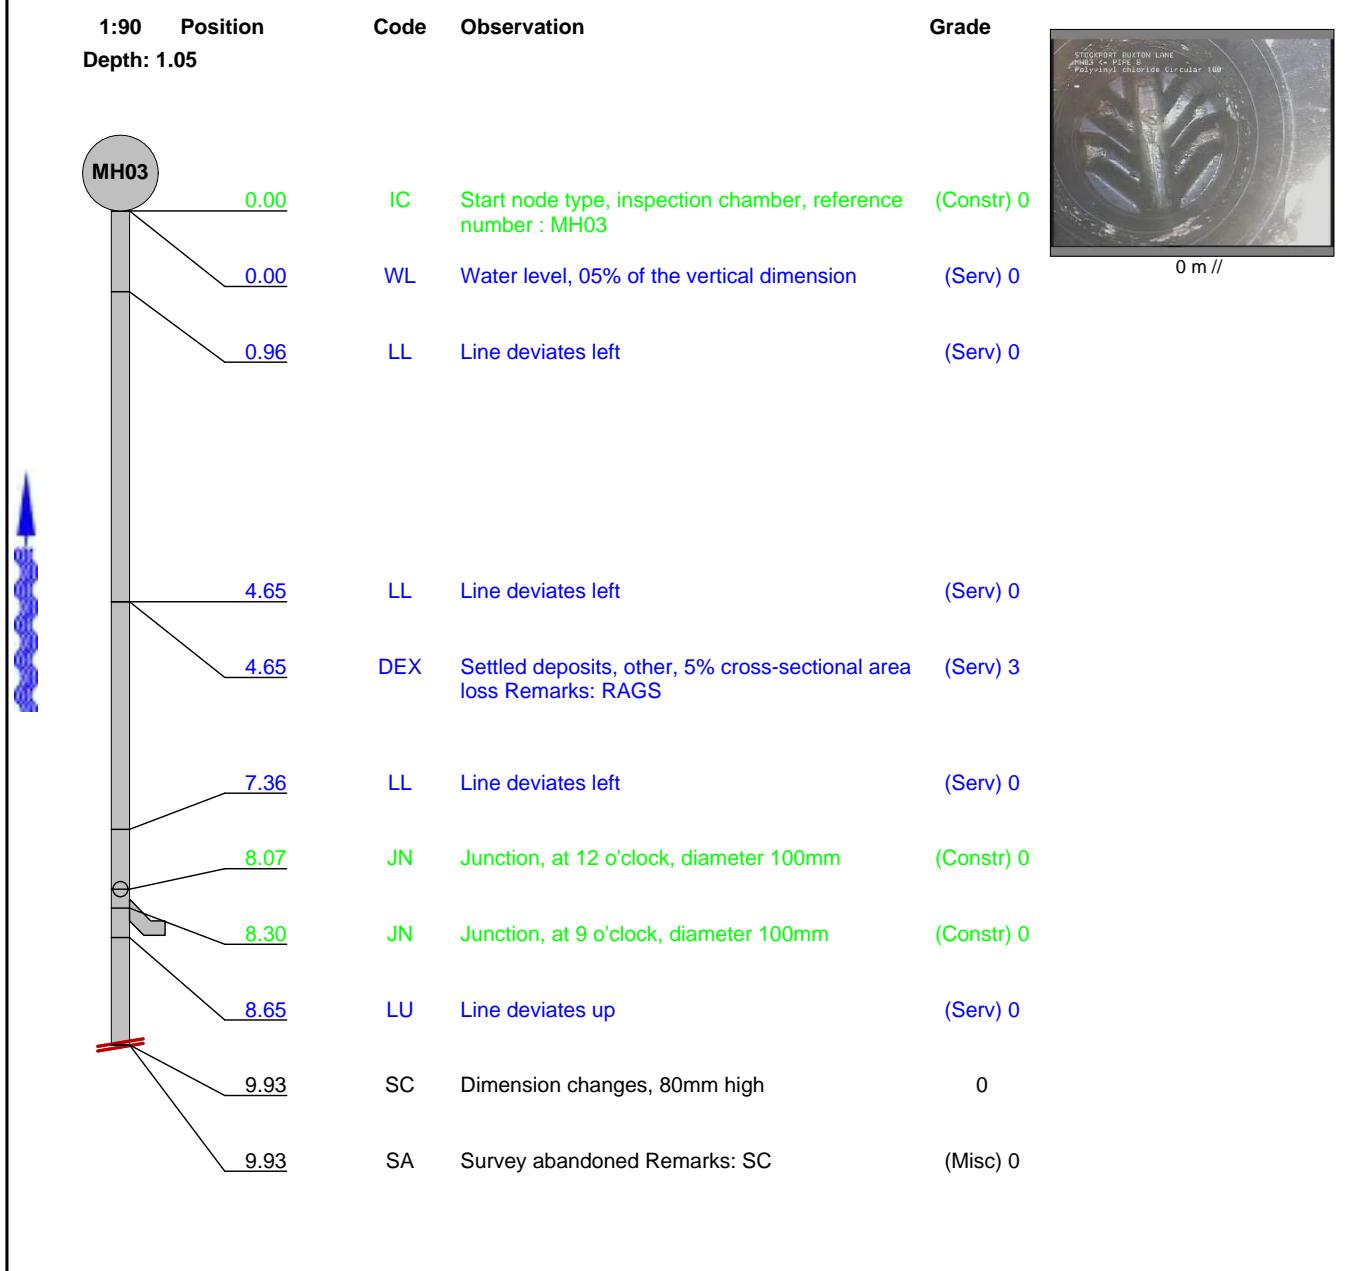


Photo: 033.JPG
0m, Start node type, inspection chamber, reference number : MH03

Inspection report

Date : 29/03/2019	Job number : DW00000433	Weather : no rain or snow	Operator : DW	Section number : 20	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE B
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Other Pedestrian area	Tape number : -	D/S MH : MH03
Inspection MH03 (U/S) PIPE B	Pipe Length 2.00 m	D/S Depth : 1.05
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 10.00 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	1	2	0.2	2	3

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place : STOCKPORT	Road : BUXTON LANE	Date : 29/03/2019	Section number : 20	PLR Suffix : X
-----------------------------	------------------------------	-----------------------------	-------------------------------	--------------------------

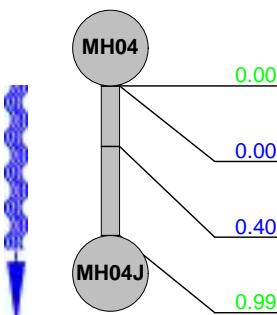


Photo: 034.JPG
0m, Start node type, inspection chamber, reference number : MH03

Inspection report

Date : 29/03/2019	Job number : DW00000434	Weather : no rain or snow	Operator : DW	Section number : 21	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : MH04
Road : BUXTON LANE	Catchment:	U/S Depth : 0.64
Location Other Pedestrian area	Tape number : -	D/S MH : MH04J
Inspection MH04 (D/S) MH04J	Pipe Length 2.00 m	D/S Depth : 0
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 0.99 m	Lining :	
Comment : CLIENT ON SITE		

1:50 Position	Code	Observation	Grade	
Depth: 0.64				
	IC	Start node type, inspection chamber, reference number : MH04	(Constr) 0	
	WL	Water level, 05% of the vertical dimension	(Serv) 0	0 m //
	LD	Line deviates down	(Serv) 0	
	BRF	Finish node type, major connection without manhole reference number: MH04J	(Constr) 0	
Depth: 0				

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
21

PLR Suffix :
X


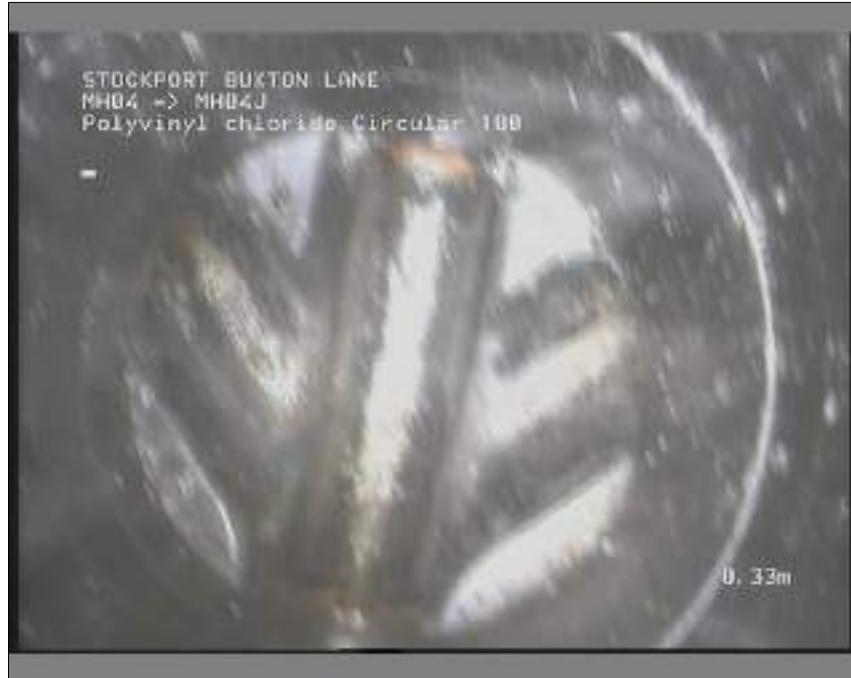


Photo: 035.JPG
0m, Start node type, inspection chamber, reference number : MH04

Inspection report

Date : 29/03/2019	Job number : DW00000435	Weather : no rain or snow	Operator : DW	Section number : 22	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE A
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Other Pedestrian area	Tape number : -	D/S MH : MH04
Inspection MH04 (U/S) PIPE A	Pipe Length 2.00 m	D/S Depth : 0.64
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 3.41 m	Lining :	
Comment : CLIENT ON SITE		

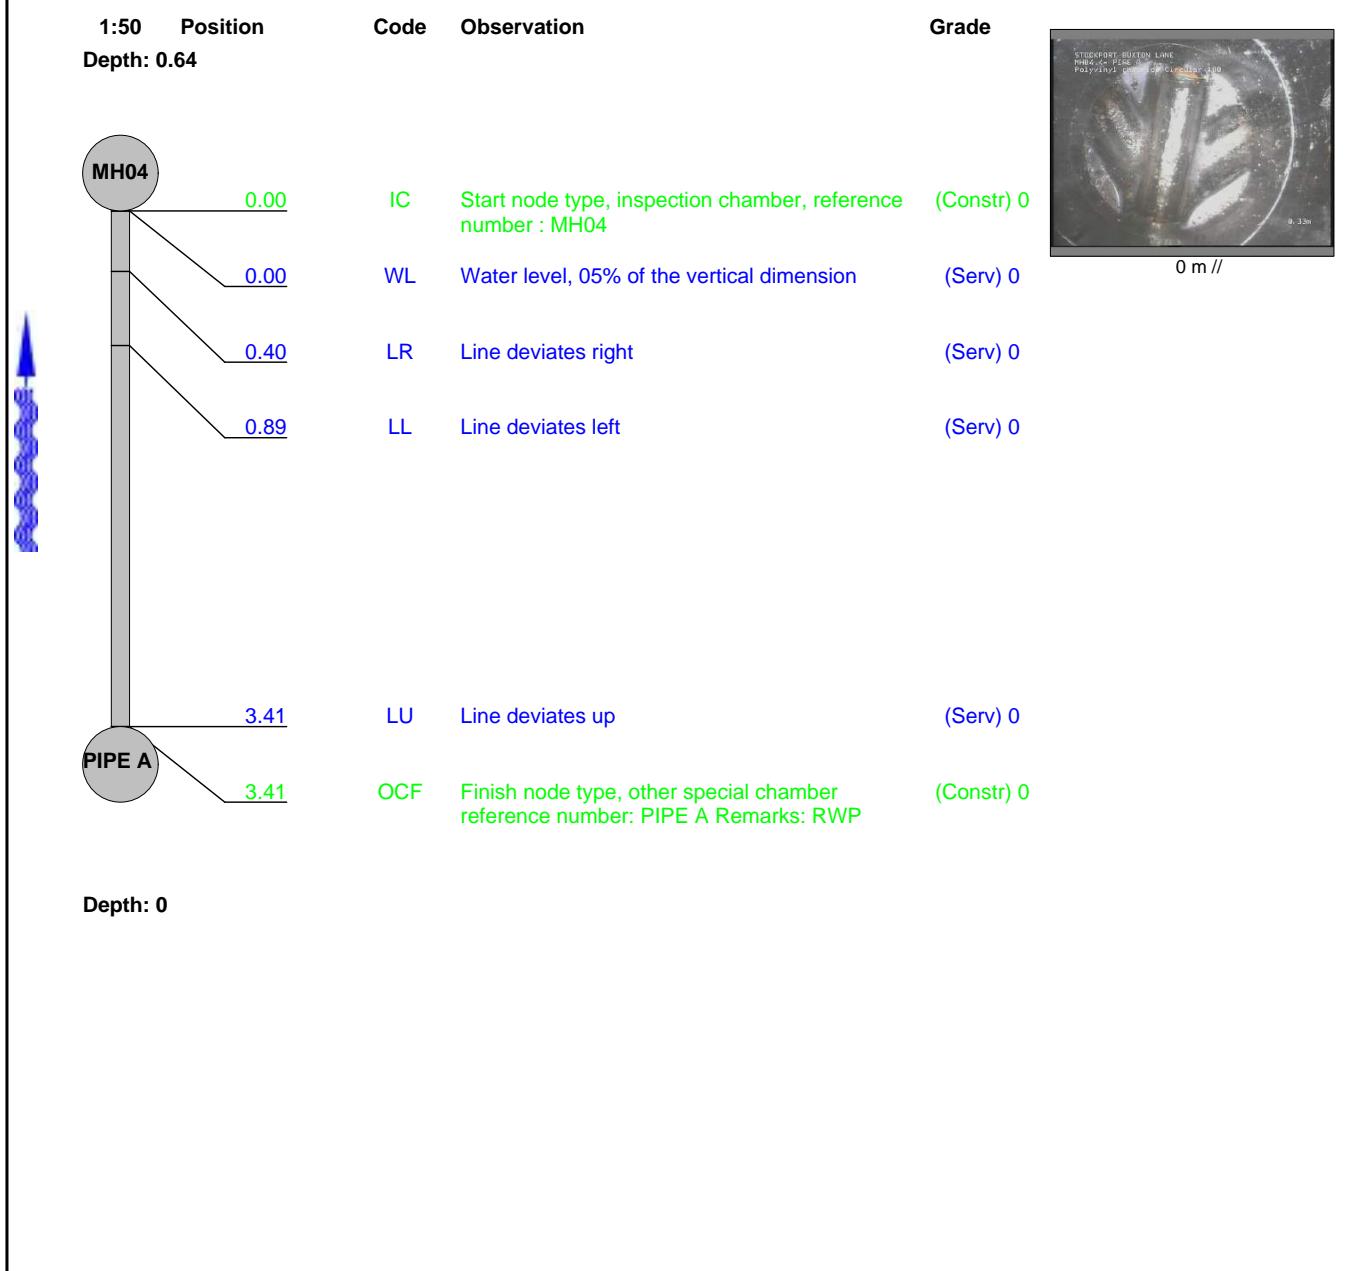

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
22

PLR Suffix :
X


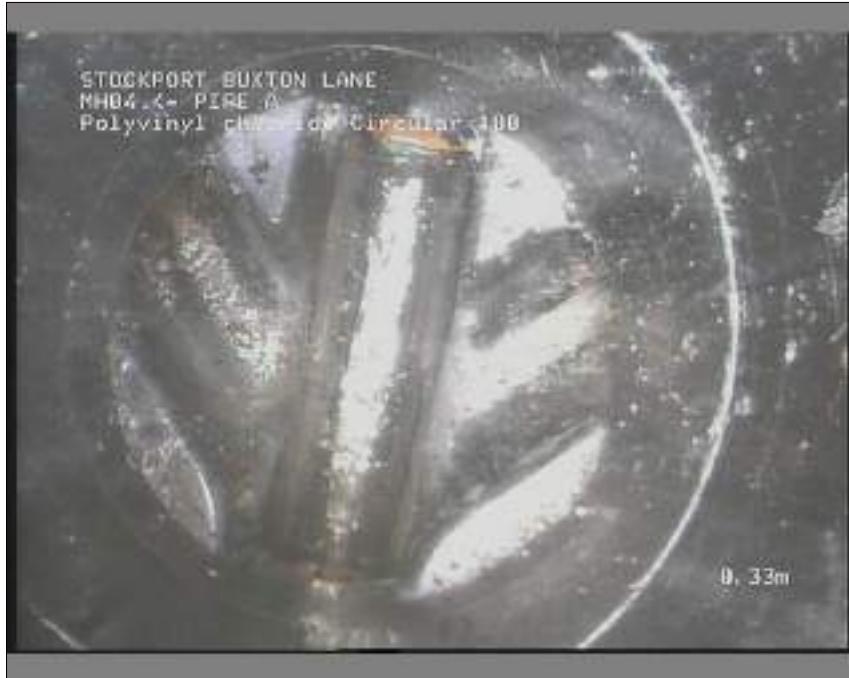


Photo: 036.JPG
0m, Start node type, inspection chamber, reference number : MH04

Inspection report

Date : 29/03/2019	Job number : DW00000436	Weather : no rain or snow	Operator : DW	Section number : 23	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE B
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Other Pedestrian area	Tape number : -	D/S MH : MH04
Inspection MH04 (U/S) PIPE B	Pipe Length 2.00 m	D/S Depth : 0.64
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 7.02 m	Lining :	
Comment : CLIENT ON SITE		

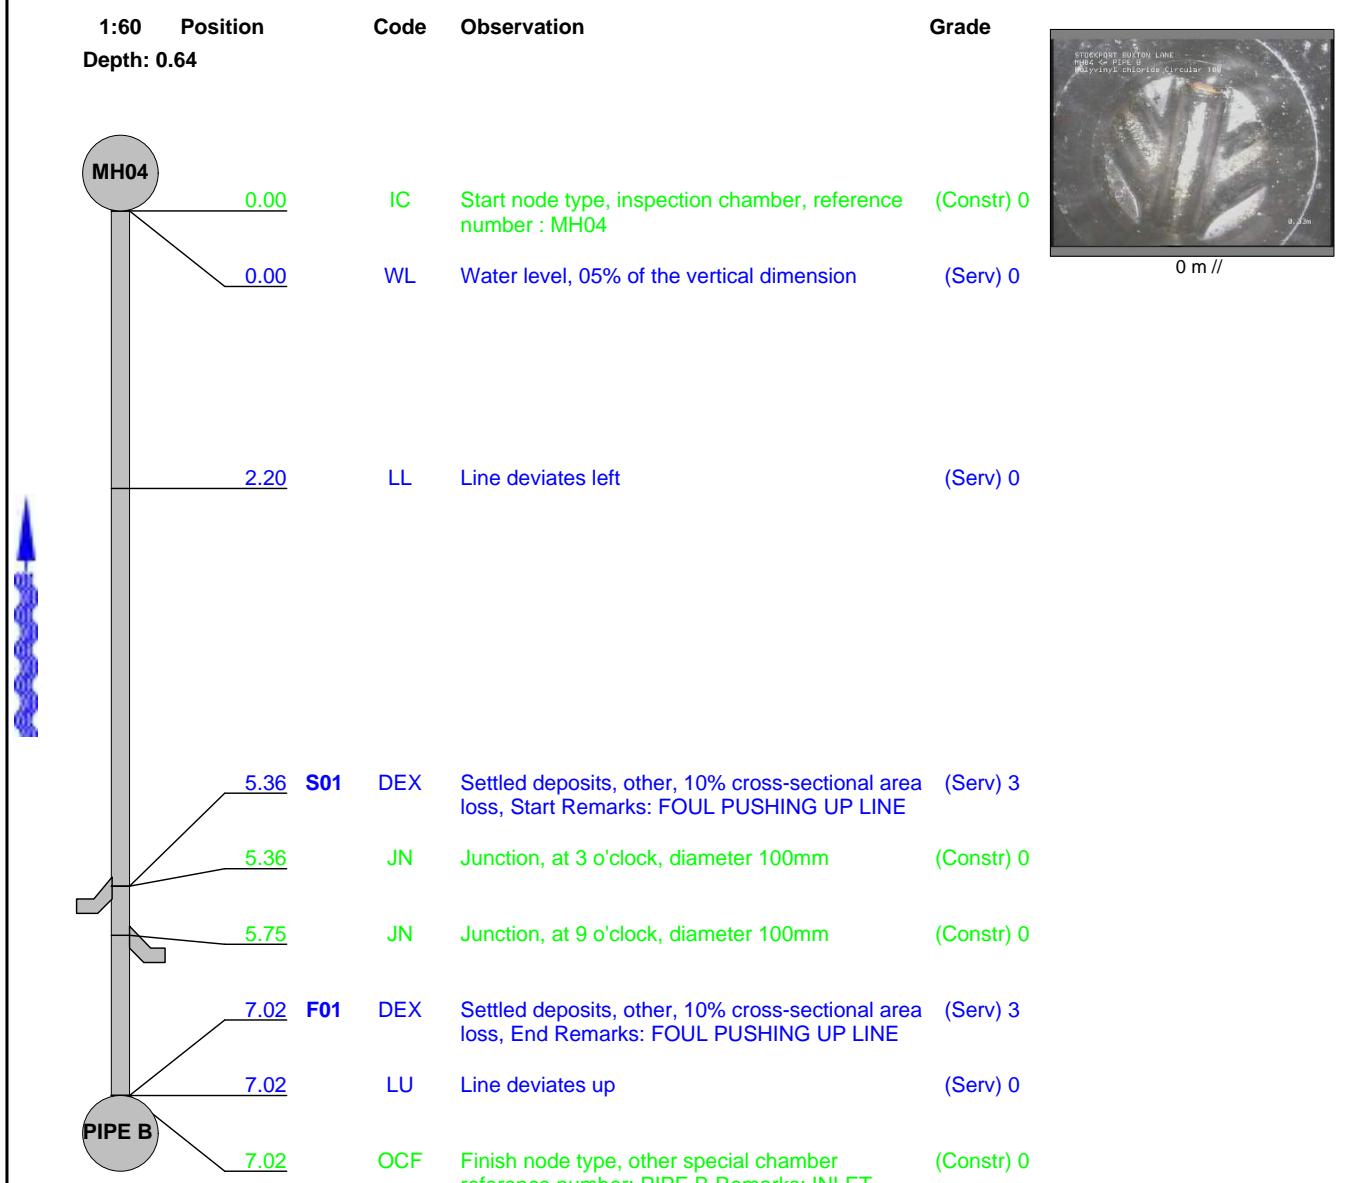

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	1	2	0.48	3.4	3

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
23

PLR Suffix :
X


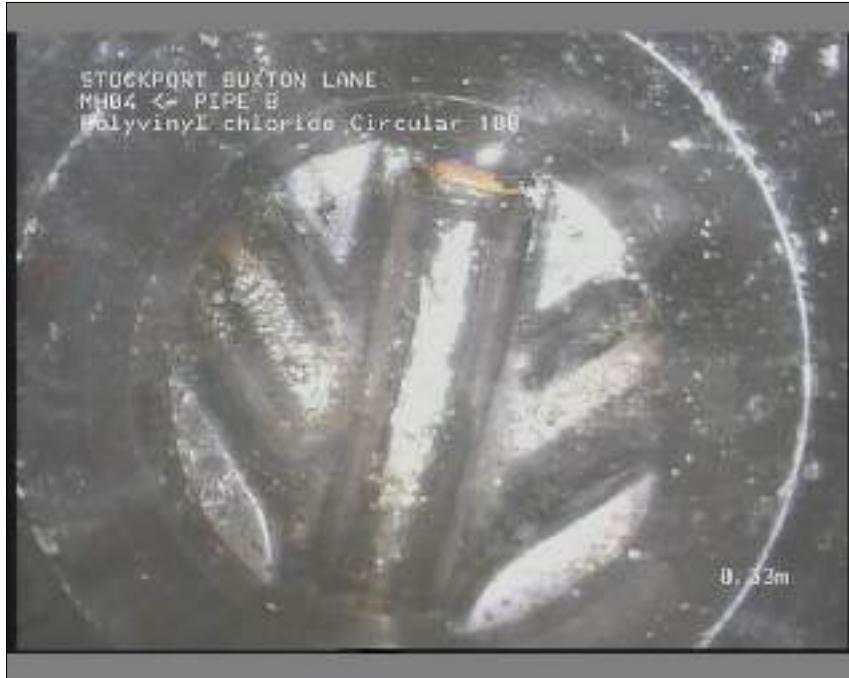


Photo: 037.JPG
0m, Start node type, inspection chamber, reference number : MH04

Inspection report

Date : 29/03/2019	Job number : DW00000437	Weather : no rain or snow	Operator : DW	Section number : 24	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : -	U/S MH : MH05
Road : BUXTON LANE	Pipe Length 2.00 m	U/S Depth : 0.31
Location Gardens		D/S MH : MH22
Inspection MH05 (D/S) MH22		D/S Depth : 0.42
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 19.11 m	Lining :	
Comment : CLIENT ON SITE		

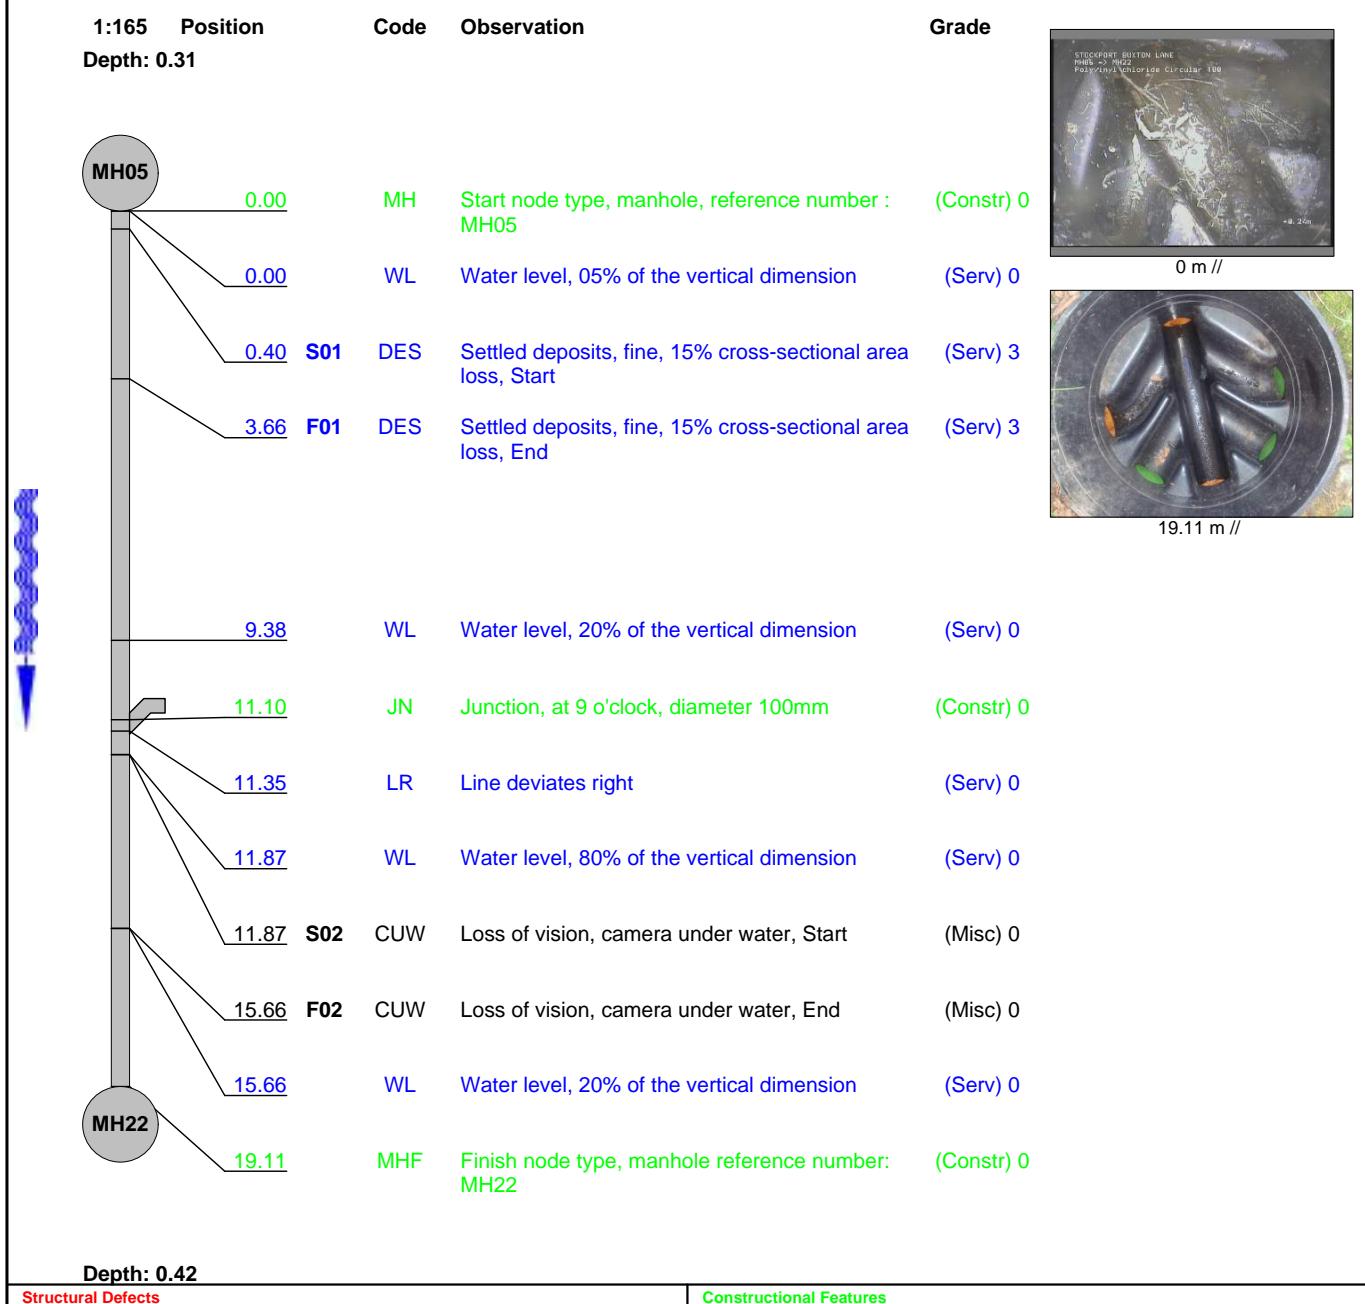

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	1	2	0.33	6.4	3

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
24

PLR Suffix :
X



Photo: 038.JPG
0m, Start node type, manhole, reference number : MH05

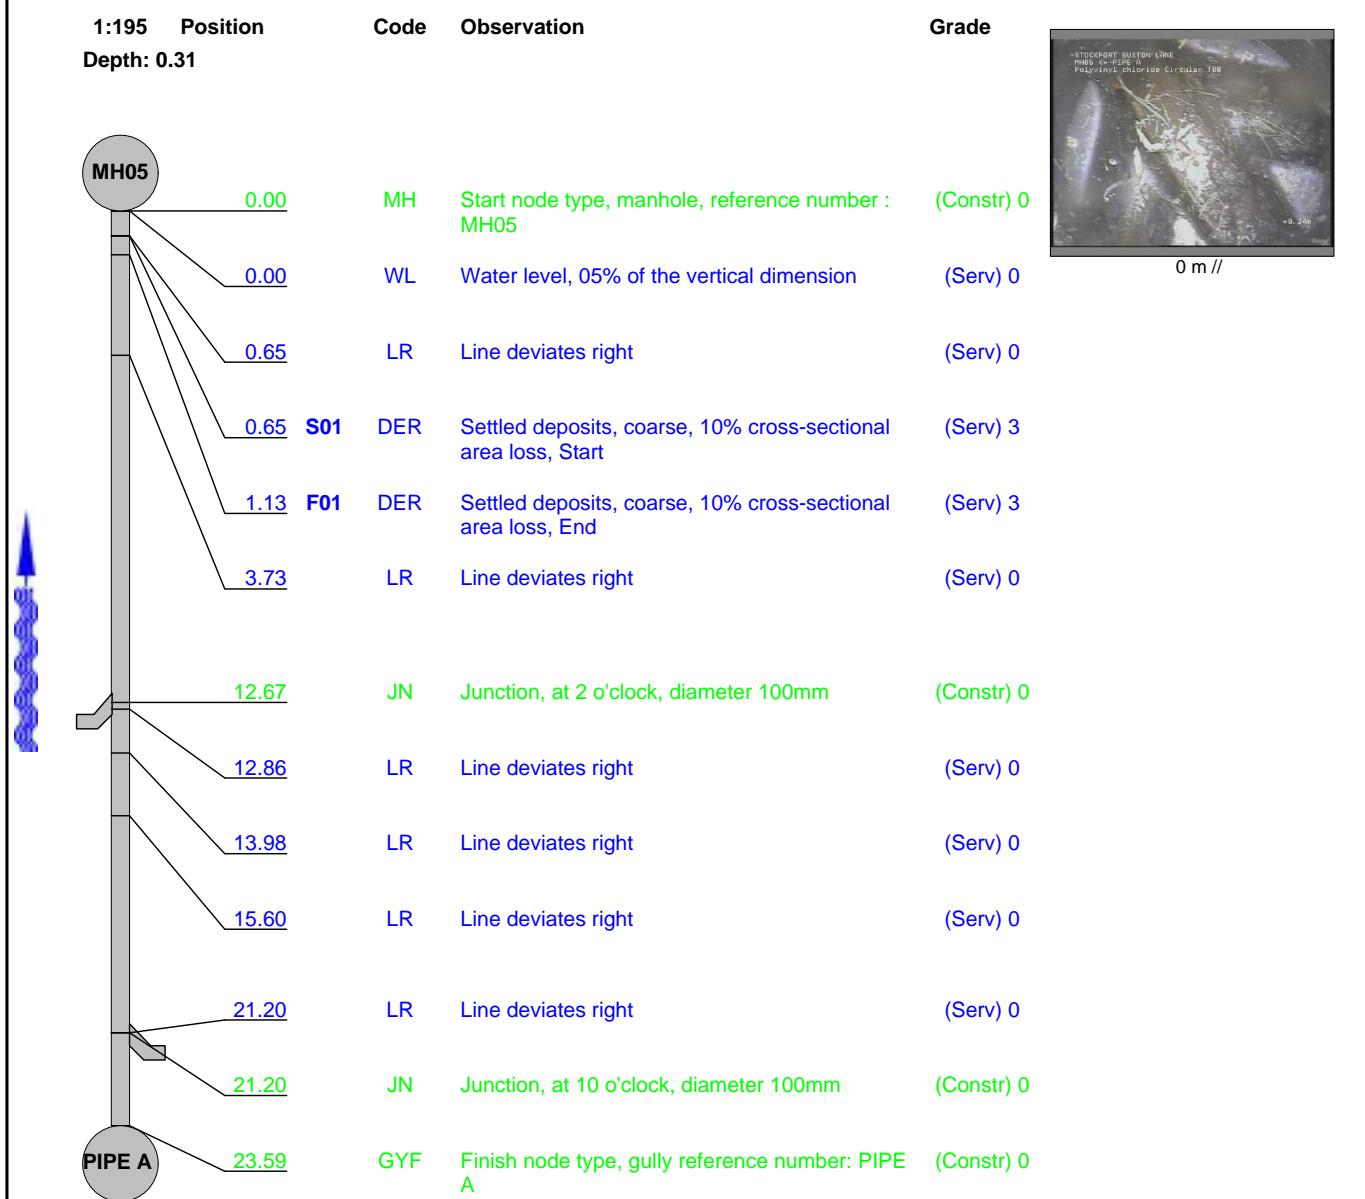


Photo: 039.JPG
19.11m, Finish node type, manhole reference number: MH22

Inspection report

Date : 29/03/2019	Job number : DW00000438	Weather : no rain or snow	Operator : DW	Section number : 25	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE A
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location : Gardens	Tape number : -	D/S MH : MH05
Inspection : MH05 (U/S) PIPE A	Pipe Length 2.00 m	D/S Depth : 0.31
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 23.59 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	1	1	0.04	1	2

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place : STOCKPORT	Road : BUXTON LANE	Date : 29/03/2019	Section number : 25	PLR Suffix : X
-----------------------------	------------------------------	-----------------------------	-------------------------------	--------------------------

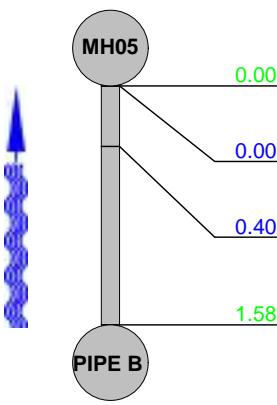


Photo: 040.JPG
0m, Start node type, manhole, reference number : MH05

Inspection report

Date : 29/03/2019	Job number : DW00000439	Weather : no rain or snow	Operator : DW	Section number : 26	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details:	U/S MH : PIPE B
Road : BUXTON LANE	Catchment:	U/S Depth : 0
Location Gardens	Tape number : -	D/S MH : MH05
Inspection MH05 (U/S) PIPE B	Pipe Length 2.00 m	D/S Depth : 0.31
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Polyvinyl chloride	
Total length : 1.58 m	Lining :	
Comment : CLIENT ON SITE		

1:50 Position	Code	Observation	Grade
Depth: 0.31			
			
MH05	IC	Start node type, inspection chamber, reference number : MH05	(Constr) 0
0.00	WL	Water level, 05% of the vertical dimension	(Serv) 0
0.40	LR	Line deviates right	(Serv) 0
1.58	GYF	Finish node type, gully reference number: PIPE B	(Constr) 0
Depth: 0			
			0 m //

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :	Road :	Date :	Section number :	PLR Suffix :
STOCKPORT	BUXTON LANE	29/03/2019	26	X

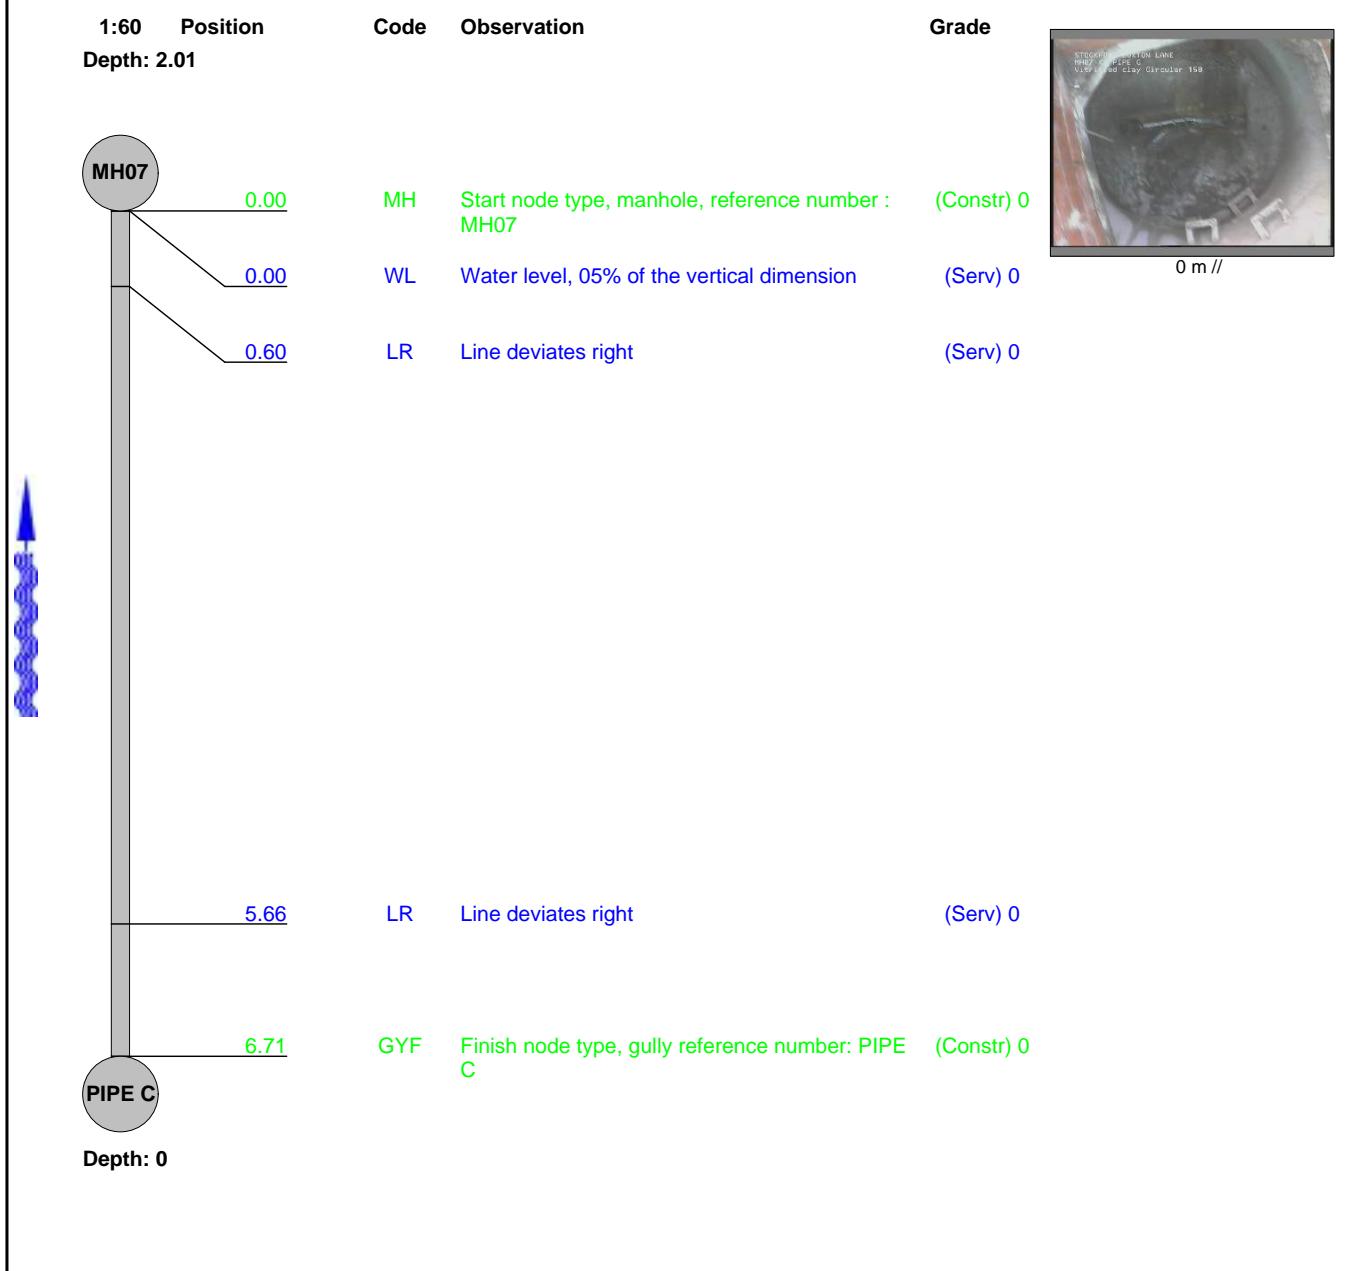


Photo: 041.JPG
0m, Start node type, inspection chamber, reference number : MH05

Inspection report

Date : 29/03/2019	Job number : DW00000440	Weather : no rain or snow	Operator : DW	Section number : 27	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : Pipe Length	U/S MH : PIPE C
Road : BUXTON LANE		U/S Depth : 0
Location : Gardens		D/S MH : MH07
Inspection : MH07 (U/S) PIPE C		D/S Depth : 2.01
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 6.71 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :
STOCKPORT

Road :
BUXTON LANE

Date :
29/03/2019

Section number :
27

PLR Suffix :
X

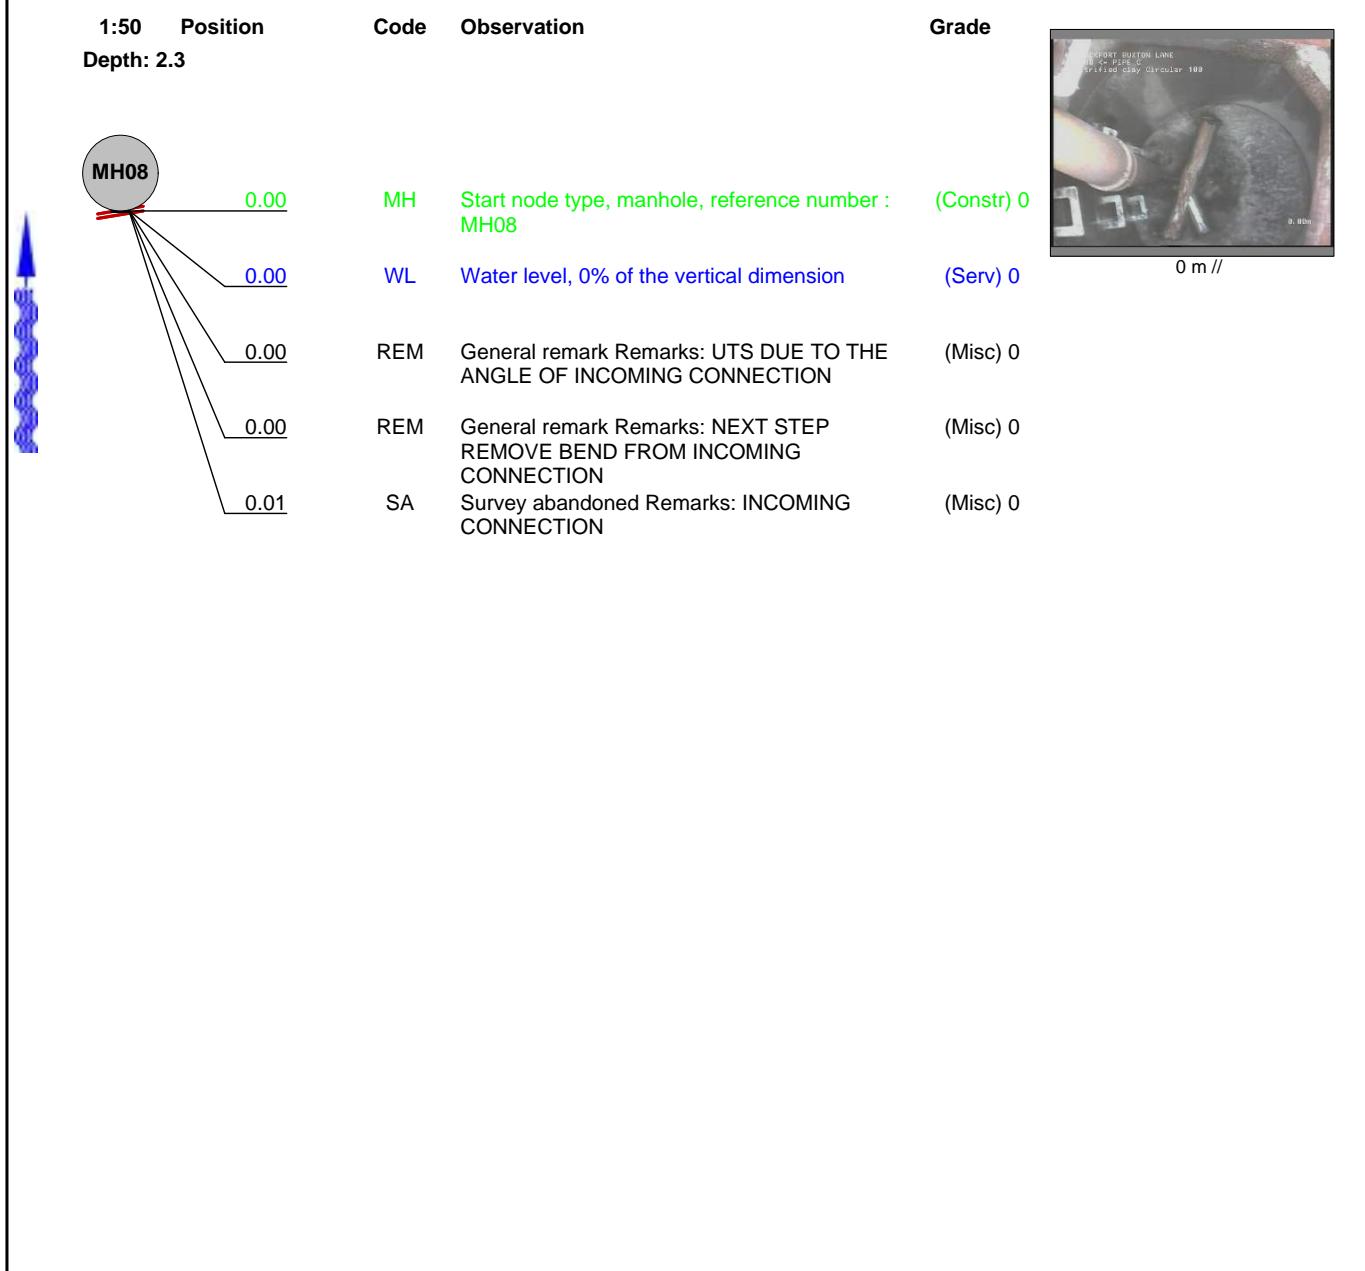


Photo: 042.JPG
0m, Start node type, manhole, reference number : MH07

Inspection report

Date : 29/03/2019	Job number : DW00000441	Weather : no rain or snow	Operator : DW	Section number : 28	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : Pipe Length	U/S MH : PIPE C
Road : BUXTON LANE		U/S Depth : 0
Location Road		D/S MH : MH08
Inspection MH08 (U/S) PIPE C		D/S Depth : 2.3
Use: Surface water	Pipe shape : Circular	
Year laid : Z	Pipe size : 100 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 10.00 m	Lining :	
Comment : CLIENT ON SITE		



Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place : STOCKPORT	Road : BUXTON LANE	Date : 29/03/2019	Section number : 28	PLR Suffix : X
-----------------------------	------------------------------	-----------------------------	-------------------------------	--------------------------

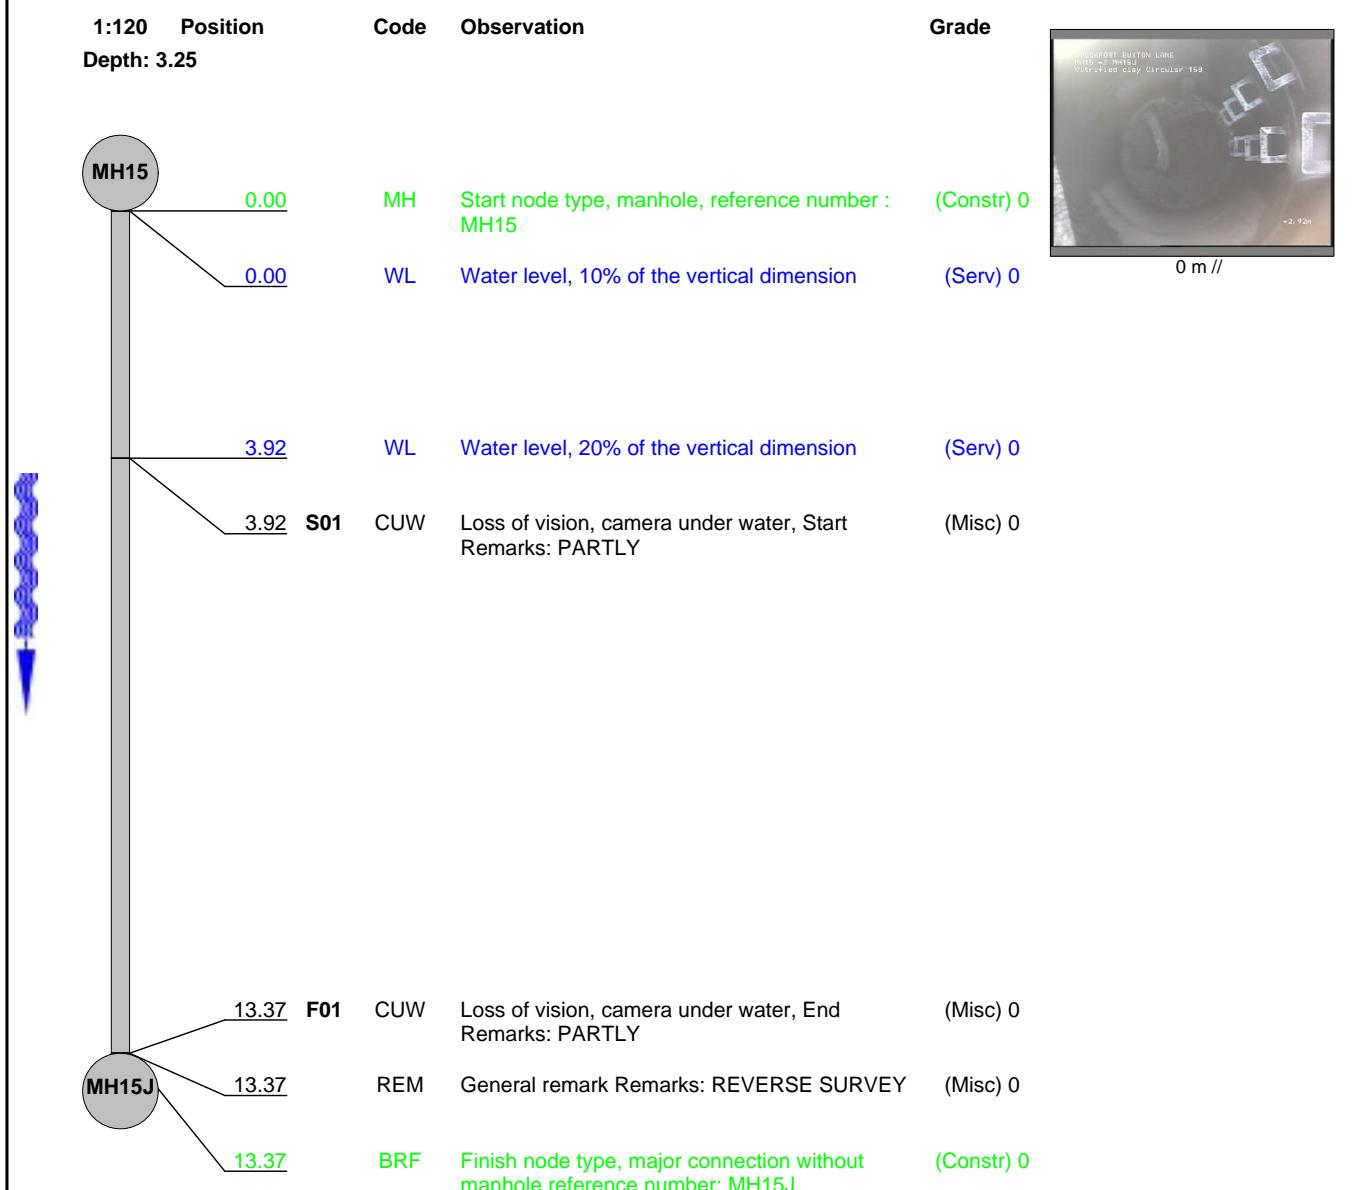


Photo: 043.JPG
0m, Start node type, manhole, reference number : MH08

Inspection report

Date : 29/03/2019	Job number : DW00000442	Weather : no rain or snow	Operator : DW	Section number : 29	PLR SUFFIX: X
Weather no rain or snow	Vehicle : MJ60OBB	Camera : MINI CAM	Preset :	Cleaned : no	Operator : DW

Place : STOCKPORT	Location details: Catchment: Tape number : -	U/S MH : MH15
Road : BUXTON LANE		U/S Depth : 3.25
Location Road		D/S MH : MH15J
Inspection MH15 (D/S) MH15J	Pipe Length 2.00 m	D/S Depth : 0
Use: Foul	Pipe shape : Circular	
Year laid : Z	Pipe size : 150 mm	
Purpose : Sample survey to determine asset condition	Pipe material : Vitrified clay	
Total length : 13.37 m	Lining :	
Comment : CLIENT ON SITE		



Depth: 0

Structural Defects					Constructional Features				
Service Defects					Miscellaneous Features				
STR no def	STR peak	STR mean	STR total	STR grade	SER no def	SER peak	SER mean	SER total	SER grade
0	0	0	0	1	0	0	0	0	1

Place :



Underground Surveys (UK) Limited
Unit CG17 Warrington Business Park
Long Lane
Tel: 01925 444664
Fax: 01925 444663
Email: kelly@undergroundsurveys.co.uk

Inspection pictures

Place :	Road :	Date :	Section number :	PLR Suffix :
STOCKPORT	BUXTON LANE	29/03/2019	29	X

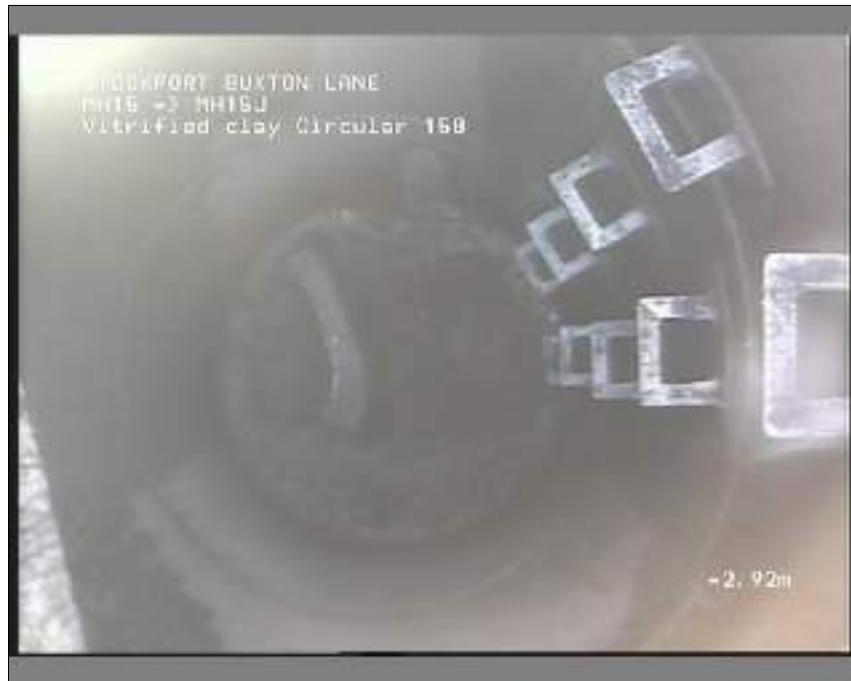


Photo: 044.JPG
0m, Start node type, manhole, reference number : MH15