

Your ref LIV-SN-22-005818

Our ref 09526GLOB

**Geo-Serv Limited**  
17 Hoveden Road  
London NW2 3XE

tel: 020 8208 0343

email: mon@geo-serv.com

**Subsidence  
Monitoring  
Services**



**GEO-SERV**

360Globalnet Ltd  
Regus House, Herald Way,  
Pegasus Business Park,  
Castle Donnington, Leicestershire,  
DE74 2TZ

Issue date: 23/11/2023

Monitoring visit 3 of 7

### Monitoring Plus Report

Owners name	Mr Reynolds	Suspected cause	to be advised	Monitoring type	levels & cracks
Address	1a Durley Avenue Waterlooville  PO8 8XA	Principal area of damage	to be advised	Installed	24/05/2023
Comment		Damage category	to be advised	Frequency (weeks)	8.7
Max movement	27.7 mm	Surface geology	to be advised	Completion date	tbc
Focal area	Pts 5, 6, 7, 8,	Feedback from last visit		Status	open
0		Feedback from this visit	no feedback for this visit		
		Sketch showing location of monitoring points			

# Level Monitoring Results

Survey:	1		2		3		4		5	
By:	VV		VV		VV		#N/A		#N/A	
Date:	24/05/2023		31/08/2023		23/11/2023		#N/A		#N/A	
Point ID	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
1	<b>1000.00</b>	<b>0.0</b>	<b>1000.00</b>	<b>0.0</b>	<b>1000.00</b>	<b>0.0</b>		#N/A		#N/A
2	1094.38	<b>0.0</b>	1094.82	<b>0.4</b>	1094.58	<b>0.2</b>		#N/A		#N/A
3	1065.60	<b>0.0</b>	1056.45	<b>-9.2</b>	1061.94	<b>-3.7</b>		#N/A		#N/A
4	1068.28	<b>0.0</b>	1052.82	<b>-15.5</b>	1064.59	<b>-3.7</b>		#N/A		#N/A
5	1079.18	<b>0.0</b>	1057.63	<b>-21.6</b>	1072.90	<b>-6.3</b>		#N/A		#N/A
6	1112.23	<b>0.0</b>	1084.49	<b>-27.7</b>	1103.17	<b>-9.1</b>		#N/A		#N/A
7	1093.92	<b>0.0</b>	1067.44	<b>-26.5</b>	1088.42	<b>-5.5</b>		#N/A		#N/A
8	1070.62	<b>0.0</b>	1048.76	<b>-21.9</b>	1067.44	<b>-3.2</b>		#N/A		#N/A

closing error (mm)

0.37


0.23

0.37

#REF!

#REF!

# Precise level monitoring related to Point 1

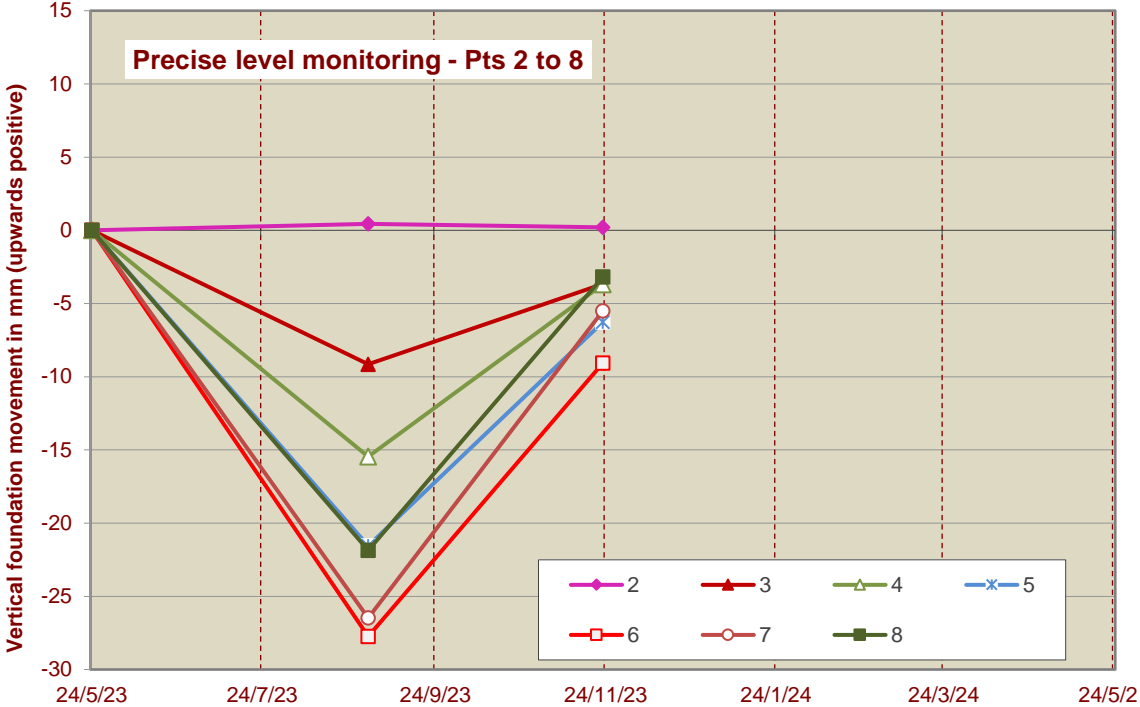

# Crack monitoring results


Survey:		1		2		3		4		5	
By:		VV		VV		VV					
Date:	initial	24/05/2023		31/08/2023		23/11/2023		#N/A		#N/A	
Crack ID	width mm	sprtn mm	chngs mm	sprtn mm	chngs mm	sprtn mm	chngs mm	sprtn mm	chngs mm	levels mm	chngs mm
A (horiz)	4.10	60.27	0.0	49.68		49.76	0.1		#N/A		#N/A
A (diag)		71.93	0.0	58.11	new	58.56	0.5		#N/A		#N/A
A (check)		40.85	0.0	41.06		41.00	-0.1		#N/A		#N/A
B	3.00	54.37	0.0	53.95	-0.4	55.03	0.7		#N/A		#N/A

all measurements made with internal jaws unless marked with asterisk, ^ = angle bracket, \$ = measurement with butt end of calipers

## crack descriptions

A (horiz)	Demec triplet, external, garage LHS wall
B	Demec pair, external, garage rear wall

# Crack monitoring

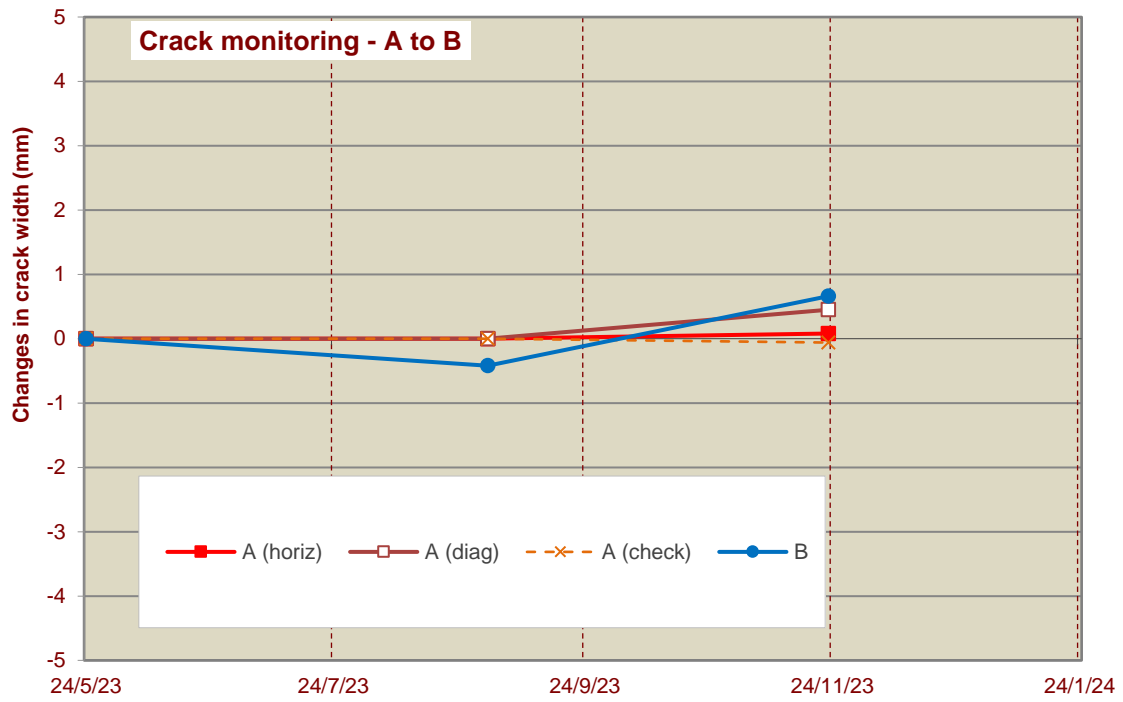

**Photos from visit on 23/11/2023**

