



1:100

S

- (1) Brick chimney with clay pots
- (2) Clay tiled roof
- (3) Lead dormer side walls
- (4) Painted timber dentil eaves
- (5) Refurbished timber frame windows with leaded lights - secondary glazing to north elevation

- (6) Defective render to be replaced
- (7) Decorative stone columns
- (8) Brickwork
- (9) Infill brickwork
- (10) New door installed

(11) New window installed to match existing style

GENERAL NOTES

External Walls

- Strip off all unnecessary services.
- Repoint where necessary, clean brickwork. Make good exposed existing walls following
- demolition. • New areas of external wall/infill to be in brick
- reclaimed from elsewhere on the building/site.

Render Walls

• Patch repair render where necessary and paint.

Ironwork

• Overhaul and redecorate.

<u>Roof</u>

• Make like for like repairs with clay tiles/slates to match on pitches, hips etc. Strip off flat roof and replace with single ply membrane with applied lead rolls.

- Renew all leadwork, flashings etc.
- Cap chimney. Overhaul rainwater goods replace like for like where necessary.
- Vent tiles to be added where necessary.

<u>Doors</u>

• Assess condition of existing doors and where necessary carry out like for like repairs or replace with period appropriate replacements.

<u>Windows</u>


• Assess on individual basis. Overhaul, carry out like for like repairs or replace with similar existing windows to be draught stripped, new windows to be double glazed.

loinery

• Overhaul, carry out like for like repairs.

Services

Ventilation via opening windows.

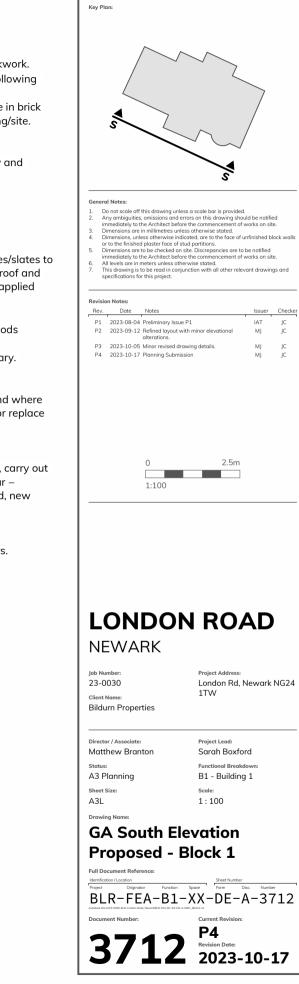

JC JC

JC IC

FRANKLIN ELLIS