


All existing oak members forming roof to be inspected + defective members replaced and connected as detailed on drawings

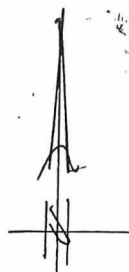

End bay collapsed fully

oak wallplate retained

trim around flue pipe

trim around proposed rooflights

* Note: It may be possible that rooflights may not be installed

Continuous wallplate


Purlins retained

Ridge board retained

Purlins retained

existing continuous oak beam retained

rebuild wall in conc. block core with nat stone both sides + S/B wall ties (also total thickness) (new position)

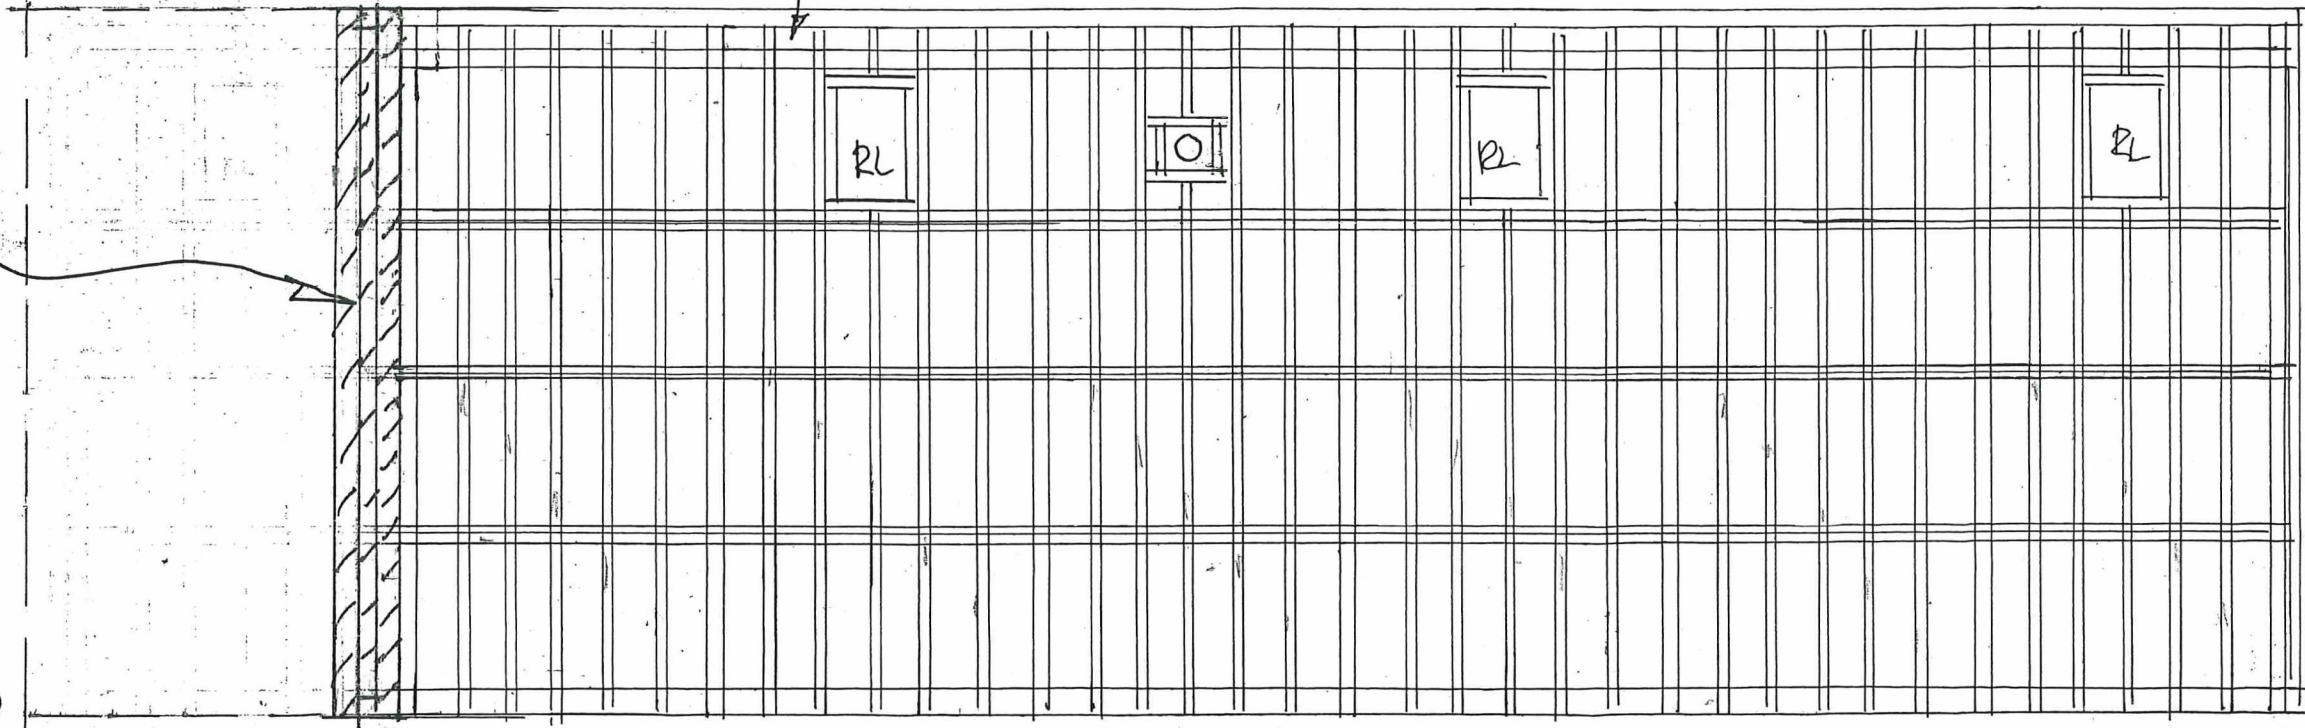

① to ⑦ are positions of posts/stake stones and trusses.

5 No common rafters between each truss + truss to end stone will

* note all roof timbers are generally in reasonable condition and if any members are to be replaced then existing timbers from collapsed bay will be used

Received
21 FEB 2024
Tewkesbury Borough Council
g and Development Services

THE FARM - GOPSHILL LANE, GRETTON, GLOS. GL54 5ET
BUILDING 'B' ROOF STRUCTURE PLAN.
21: 1935: 17A OCTOBER 2023 1:50
DENIS L RAYTON TEL 01242 620818

Revision

A West end bay collapsed / nat stone gable end wall rebuilt in new position } Feb 2024