


Click links to open Lidar images

- Corrosion noted on lower piles
- ☁ Local delamination (at orange square - cloud added for ease of visibility)
- 'Bubbling' of surface observed



Pile No.	Height (m)	Thickness (mm)
34	0.6	11
39	1.4	14.8
44	1.8	8.8
49	0.6	18.6
54	1.4	16.6
59	1.8	13.7
64	0.6	17.5
69	1.4	15.2
74	1.8	14.8
79	0.6	16.2
84	1.4	12
89	1.8	13.5
94	0.6	14.5
99	1.4	10.8
104	1.8	15.8
109	0.6	15
114	1.4	10.8
119	1.8	8.1
124	0.6	17.5
129	1.4	16
134	1.8	15.4
139	0.6	15.8
144	1.4	15

149	1.8	15.7
154	0.6	16.6
159	1.4	16.3
164	1.8	13.9
169	0.6	17.5
174	1.4	12.5
179	1.8	12.9
184	0.6	14.4
189	1.4	13.8
194	1.8	13.2
199	0.6	12.8
204	1.4	13.8
209	1.8	13.5
214	0.6	16.8
219	1.4	10.7
224	1.8	15.8
229	0.6	14.7
234	1.4	14.1
239	1.8	12.9
244	0.6	12.2

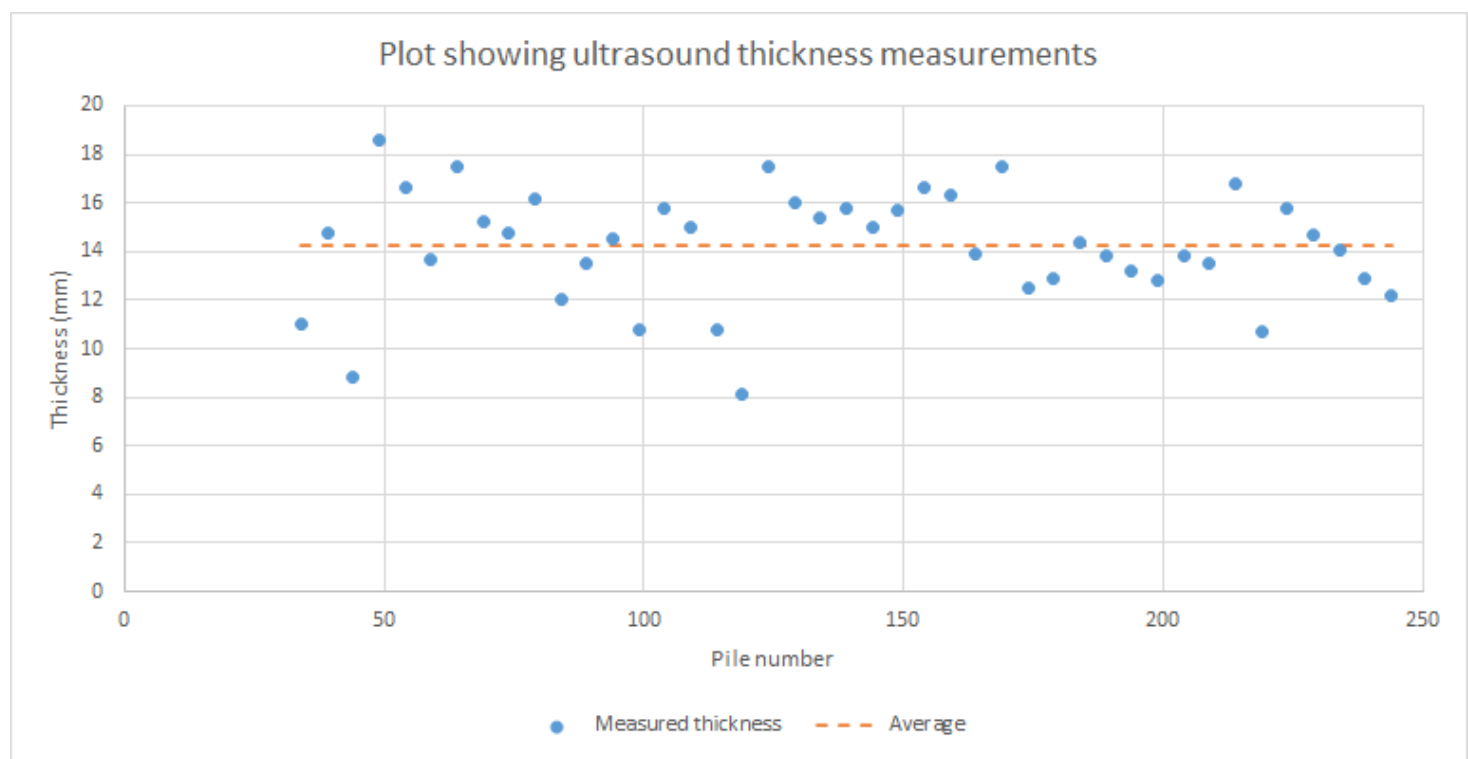

A	First issue	AM	GL	KB	18.03.2022
REV	DESCRIPTION	PREP	CHKD	APPD	DATE
 environmental • geotechnical • building fabric					
PROJECT					
Red Lion Court, London					
TITLE					
Exploratory hole plan (current layout)					
PROJECT NO.	SCALE AT A3	DRAWING NO.			
STT5486	1:500	02			

APPENDIX 04