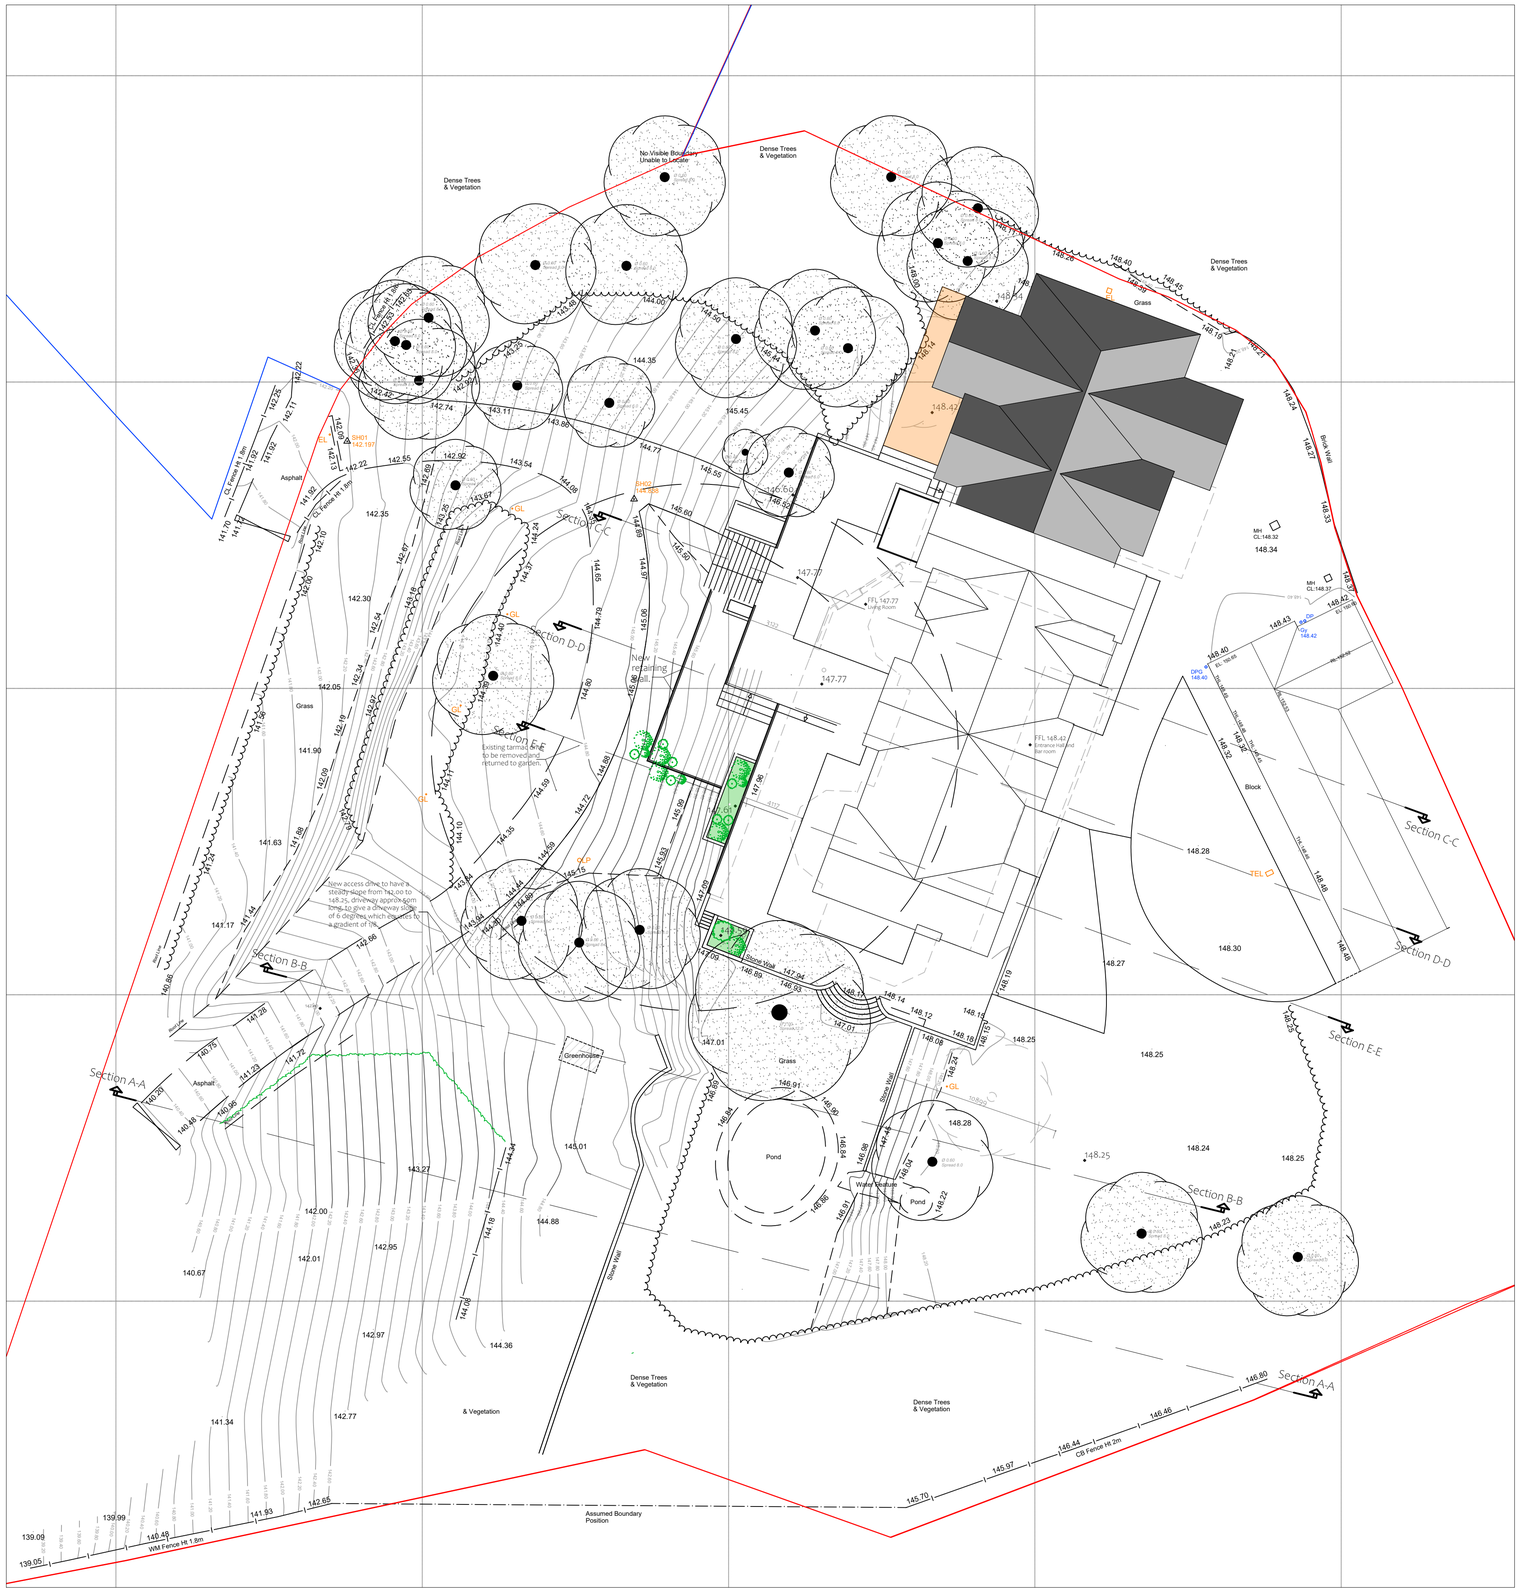
No Visible Boundary
Unable to Locate
Dense Trees & Vegetation
Dense Trees & Vegetation
Dense Trees & Vegetation
Grass
Asphalt
Asphalt
Grass
Block
Block Wall
Stone Wall
Stone Wall
Greenhouse
Pond
Pond
Water Feature
Existing tarmac to be removed and returned to garden
New access drive to have a steady slope from 142.00 to 148.25, driveway approx 40m long, to give a driveway slope of 6 degrees which equates to a gradient of 1:9
New retaining wall
Section A-A
Section B-B
Section C-C
Section D-D
Section E-E
Section A-A
Section B-B
Section C-C
Section D-D
Section E-E
Assumed Boundary Position
Dense Trees & Vegetation
Dense Trees & Vegetation
& Vegetation
Wall Fence Ht 1.8m
CB Fence Ht 2m
SH01 142.197
SH02 145.886
BH01
BH02
Mh CL:148.32
Mh CL:148.37
DPC 148.40
DPC 148.40
CL 148.42
FFL 147.77 Living Room
FFL 148.42 Entrance hall and sun room
TEL
GL
GL
GL
GL
GLP
GLP
GLP
GLP
Ø1.80 Spread 8.0
Ø1.80 Spread 8.0
Ø1.80 Spread 8.0