



DETAIL 07:

ANCHOR FOR PURLINS BEARING ONTO MASONRY

SCALE 1:10

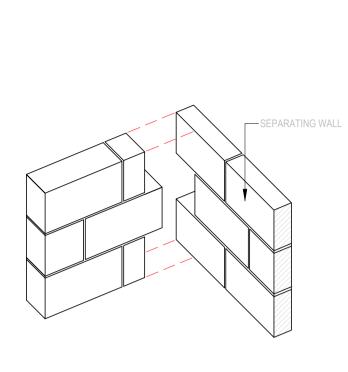


DETAIL 08:
TOOTH BONDED WALL CONNECTION
SCALE 1:20

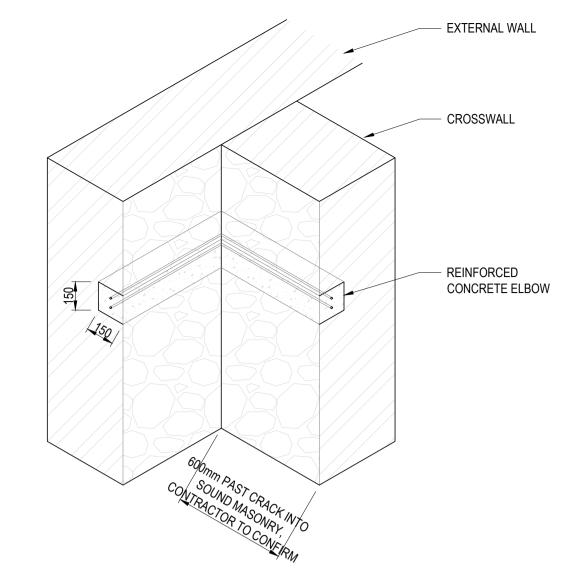

DETAIL 09:
TYPICAL ELBOW CROSSWALL BOND REPAIR
SCALE 1:20

## GENERAL NOTES:

- THIS DRAWING IS TO BE READ IN CONJUNCTION WITH ALL RELEVANT ARCHITECTS AND ENGINEERS DRAWINGS AND SPECIFICATIONS.
- 2. DO NOT SCALE THIS DRAWING. ANY AMBIGUITIES, OMISSIONS AND ERRORS ON DRAWINGS SHALL BE BROUGHT TO THE ENGINEERS ATTENTION IMMEDIATELY. ALL DIMENSIONS MUST BE CHECKED / VERIFIED ON SITE.
- 3. ALL DIMENSIONS ARE IN MILLIMETRES UNLESS NOTED OTHERWISE.
- 4. FOR GENERAL NOTES REFER TO DRAWING.

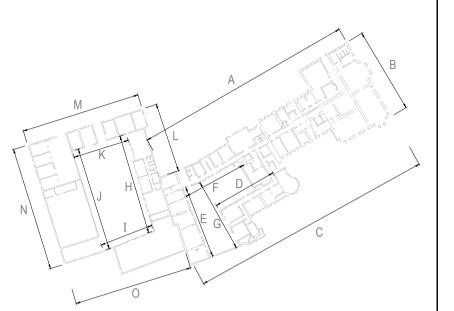



Rev: Description: Date: By: Chkd:

28 Lowther St Kendal, Cumbria, LA9 4DF 01539 724823 kendal@curtins.com www.curtins.com

Structures • Civils • Environmental • Infrastructure • Transport Planning • Sustainability • Expert Advisory Services mingham • Bristol • Cardiff • Douglas • Dublin • Edinburgh • Glasgow • Kendal • Leeds • Liverpool • London • Manchester • Nottingham

FOR COORDINATION

\_\_\_\_\_

SHENTON GROUP

\_.

CUERDEN HALL

TYPICAL REPAIR DETAILS, MASONRY

| Project No:   | Size:       | Date: |              | Drawn By: |           | Designed By:            | Checked By: |      |
|---------------|-------------|-------|--------------|-----------|-----------|-------------------------|-------------|------|
| 077572        | A1          | 15/03 | 15/03/2021   |           |           | SJ                      | DC          |      |
|               | Scale:      | 1:10  | 1:10         |           |           |                         |             |      |
| Project Code: | Originator: | Zone: | Zone: Level: |           | Disciplin | e: Category / Number: R |             | Rev: |
|               |             |       |              |           |           |                         |             |      |

077572 - CUR - ZZ - ZZ - DR - S - 27002 - 01