

BRITISH STANDARD 5837

TREE INVENTORIES AND RISK ASSESSMENTS

TREE SURVEYS ARBORICULTURAL IMPLICATION STUDIES

WOODLAND MANAGEMENT PLANS

TPO/PLANNING ADVICE/ PROJECT MANAGEMENT

TREE PLANTING SCHEMES

TPO RE-SURVEY



ARBORICULTURAL IMPLICATIONS ASSESSMENT

PROPOSED DEVELOPMENT

AT

23 PATCH LANE
BRAMHALL

Author: C. Salisbury
Date: 11 May 2022
Ref: TRE/23PL



Mulberry

Adamson House, Towers Business Park, Wilmslow Road, Didsbury, M20 2YY

T 0161 955 3628
F 0161 955 4201
E info@mulberrytmc.co.uk

www.mulberrytmc.co.uk

1.0 Introduction

- 1.1 Mulberry Tree Management were instructed by Alderley Edge Building Company Ltd, to carry out an arboricultural survey of trees at their site in Patch Lane, Bramhall.
- 1.2 This report details the arboricultural implications of developing the site, including:
 - a survey of the trees on and near the development which may impact the proposal from ground level, noting their location, species and all relevant parameters, i.e. stem diameter, height, crown spread, condition etc;
 - providing advice on the removal, retention and management of trees;
 - assessment of the potential effects of the proposal on retained trees and vice versa;
 - assessment of the requirement for tree protection for the duration of the works;
 - mitigation for any loss;
 - preparation of a tree schedule;
 - and report on the above matters.
- 1.3 The survey was carried out on 23 March 2022 by means of inspection from ground level by an experienced and qualified arboriculturalist. The inspection can be restricted in cases where trees were Ivy clad or surrounded by vegetation.
- 1.4 Under *BS5837: 2012 Trees in Relation to Construction - Recommendations*, the assessment of trees is made objectively. The tree categorisation method identifies the quality and value of the existing tree stock, allowing informed decisions to be made concerning development design layout.
- 1.5 The following documents have been made available by the client:
 - Drawing- plan prop.dwg
 - Drawing- site prop.dwg
- 1.6 The supplied drawing included some tree positions plotted. Any dimensions regarding tree positions and protective fencing must be checked on site.
- 1.7 Weather conditions during the survey were dry and still.
- 1.8 The survey was carried out noting the conditions of the trees at the time of inspection. As trees are part of the natural environment, conditions can naturally change; therefore the contents of this report are valid for one year only. After this period, re-inspection may be necessary.

2.0 Survey Methodology

- 2.1 The trees were surveyed (prefixed T, or G for group) and recorded in the tree schedule in appendix one. Where groups are recorded, average height and diameter at breast height (DBH) of the trees in the group are reported. Where access to the base of any trees was limited, stem size was estimated.
- 2.2 All the trees were assessed using: a grading A to C (retention) and U (removal); condition and age class as defined in appendix two.
- 2.3 Where appropriate, canopy spread for each tree was recorded at four cardinal points in order to reproduce an accurate representation of the crown shape of the tree on the tree plan in appendix three.
- 2.4 The survey included all trees within the proposal area and trees near to the proposal.

3.0 Development Proposals

- 3.1 Due to the proposed development and its associated infrastructure there are a number of locations where the proposals are in close proximity to the trees surveyed. The Site Layout Plan within appendix three identifies the trees in relation to the proposed development.
- 3.2 In order to fully assess the impact of the proposals an Impact Table has been created detailing each tree, which shows the proximity of the associated works to the tree.
- 3.3 This can then be assessed in accordance with BS 5837:2012 to determine whether the development will have a detrimental impact on the health of each tree. Once this has been determined remedial measures can be detailed to reduce the impact the proposals will have on the treescape.

3.4 Impact Table:-

Tree No.	Root Protection Area identified in Table 2 of BS 5837:2012	Distance to Proposed Hard Standing (m)	Distance to Proposed Development (m)	Can the Tree/s be Successfully Retained
T1	222m ²	5.90	9.90	Yes as outlined in section 5.0
T2	88m ²	1.90	7.80	Yes as outlined in section 5.0
T3	55m ²	1.90	8.60	Yes as outlined in section 5.0
T4	Fell Due to Development			
T5	Fell Due to Development			
T6	147m ²	14.40	17.40	Yes
G1	Fell Due to Development			
G2	59m ²	16.30	19.30	Yes
H1	2m ²	1.00	6.80	Yes
H2	2m ²	1.00	3.40	Yes except for a section
H3	2m ²	1.00	2.20	Yes except for a section

4.0 Impact Assessment

4.1 To assess the implications of the Impact Table each tree can be categorised in the following way: -

	Trees to be retained		Trees to be removed	
	With No Impact	With detailed construction	Due to Condition	Due to Development
Tree No.	T1, T2, T3, T6, G2, H1, H2(Part) & H3(Part)	N/A	N/A	T4, T5, G1, H2(Part) & H3(Part)

5.0 Mitigation Proposals

5.1 Car Parking

5.1.1 The impact table below shows the proposed car parking having a minor encroachment into the root protection area of T1, T2 & T3. It is felt that due to the species, condition and limited extent of encroachment the proposal will not have a detrimental impact on the safe useful life expectancy of these trees.

5.1.2 Section 7.4.2.3 of BS 5837:2012 advises that new permanent hard surfacing should not exceed 20% of any existing unsurfaced ground within the RPA. The table below details the amount of new surface proposed within the RPA of each tree.

Tree No	Total Area m2 of RPA	Total m2 of New Hard Surfacing within the RPA	Percentage of Hard Surfacing within the RPA
T1	222	6.30	2.90%
T2	88	17.50	19.90%
T3	55	10.30	18.80%

5.1.3 As you can see from the table the proposed hard surfacing does not exceed 20% for each of the RPA's. It is therefore felt that the proposed driveway will not have a detrimental impact upon the existing trees.

6.0 Conclusions and Arboricultural Recommendations

- 6.1 The tree categorisation method identifies the quality and value of the existing tree stock but it is not meant to be interpreted rigidly and is presented in order to form a balanced judgement on tree retention and removal.
- 6.2 A precautionary method of working near trees is detailed in the accompanying Arboricultural Method Statement.
- 6.3 Following site development, regular (annual or biannual) inspections of all retained trees should be undertaken by a qualified Arboricultural Consultant.
- 6.4 It is considered that in following the advice in this document, any negative factors affecting trees on the site will be minimised.

Appendix One

Tree Survey Schedule

TREE SURVEY SCHEDULE

Arboricultural Data Sheet:					Date of Survey: 23/03/22				Surveyor: C. Salisbury				
Tree No.	Species	DBH (mm)	Height (m)	Age	Crown Spread (m)				Crown clearance	Condition rating	Comments and preliminary management recommendations	Estimated remaining contribution	Tree quality category rating
					N	E	S	W					
T1	Oak	700	14.80	FM	7.5	3.5	7.5	7.5	1.50	B	A co-dominant specimen with reasonable form situated adjacent to a highway.	80+	A2
T2	Oak	440	14.80	FM	4.0	4.0	7.0	5.5	4.00	B	A co-dominant specimen with reasonable form situated adjacent to a highway.	80+	A2
T3	Oak	350	8.40	EM	0.0	0.5	6.0	4.5	4.00	B/C	An ivy-clad heavily suppressed specimen situated adjacent to a highway.	60 – 80	C2
T4	Hornbeam	210	4.80	SM	1.0	3.5	3.5	3.5	1.00	B/C	A suppressed specimen situated in the front garden of the property.	40 – 60	C2
T5	Pear	190	4.20	FM	1.5	0.5	1.0	1.0	1.00	B	An individual specimen with reasonable form situated in the front garden of the property.	10 – 20	C2
T6	Willow	570	13.60	FM	5.5	5.0	5.5	5.5	2.50	B	A dominant specimen situated in the rear garden.	20 – 40	B2
G1	2 x Beech, 1 x Hawthorn & 1 x Birch	410<	9.80	SM/E M	-	-	-	-	4.00	B/C	A linear belt situated on the property boundary. One of the Beech has been heavily reduced. – Fell dead Birch	40 – 60	C2
G2	1 x Yew, 1 x Cherry & 1 x Conifer	360<	10.20	SM/F M	-	-	-	-	0.50	B/C	A mixed species group situated on the rear boundary of the property.	80+	C2
H1	Hawthorn	60 avg.	2.40	EM	-	-	-	-	0.00	B/C	A well-maintained boundary hedge.	40 – 60	C2

Arboricultural Data Sheet:					Date of Survey: 23/03/22				Surveyor: C. Salisbury				
Tree No.	Species	DBH (mm)	Height (m)	Age	Crown Spread (m)				Crown clearance	Condition rating	Comments and preliminary management recommendations	Estimated remaining contribution	Tree quality category rating
					N	E	S	W					
H2	Conifer, Holly & Cotoneaster	60 avg.	3.40	SM/E M	-	-	-	-	0.00	B/C	A well-maintained boundary hedge.	40 – 60	C2
H3	Beech	90 avg.	4.40	M	-	-	-	-	0.00	B/C	A well-maintained boundary hedge.	20 – 40	C2

Appendix Two

Tree Survey Key

Trees for removal				
Category and definition		Criteria		
Category U Those in such a condition that any existing value would be lost within 10 years and which should, in the current context, be removed for reasons of sound arboricultural management		Trees that have a serious, irremediable, structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other R category trees (i.e. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning) Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline Trees infected with pathogens of significance to the health and/or safety of other trees nearby (e.g. Dutch elm disease), or very low quality trees suppressing adjacent trees of better quality Note – Habitat reinstatement may be appropriate (e.g. R category tree used as a bat roost: installation of bat box in nearby tree).		
Trees to be considered for retention				
Category and definition		Criteria - Subcategories		
		1 Arboriculture values	2 Landscape values	3 Conservation values
Category A Those of high quality and value: in such a condition as to be able to make a substantial contribution (a minimum 40 years is suggested)		Trees that are particularly good examples of their species, especially if rare or unusual, or essential components of groups, or of formal or semi-formal arboriculture features (e.g. the dominant and/or principal trees within an avenue)	Trees, groups or woodlands which provide a definite screening or softening effect to the locality in relation to views into or out of the site, or those of particular visual importance (e.g. avenues or other arboricultural features assessed as groups)	Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or wood pasture)
Category B Those of moderate quality and value: those in such a condition as to make a significant contribution (a minimum of 20 years is suggested)		Trees that might be included in the high category, but are downgraded because of impaired condition (e.g. presence of remediable defects including unsympathetic past management and minor storm damage)	Trees present in numbers, usually as groups or woodlands, such that they form distinct landscape features, thereby attracting a higher collective rating than they might as individuals but which are not, individually, essential components of formal or semi-formal arboriculture features (e.g. trees of moderate quality within avenue that includes better, A category specimens), or trees situated mainly internally to the site, therefore individually having little impact on the wider locality	Trees with clearly identifiable conservation or other cultural benefits
Category C Those of low quality and value: currently in adequate condition to remain until new planting could be established (a minimum of 10 years is suggested), or young trees with a stem diameter below 150 mm		Trees not qualifying in higher categories	Trees present in groups or woodlands, but without this conferring on them significantly greater landscape value, and/or trees offering low or only temporary screening benefit	Trees with very limited conservation or other cultural benefits
Note - Whilst C category trees will usually not be retained where they would impose a significant constraint on development, young trees with a stem diameter of less than 150 mm should be considered for relocation				

Age Class






Y	Young	Trees that have not yet established
SM	Semi-Mature	Established trees up to 1/3 of expected height and crown
EM	Early mature	Between 1/3 and 2/3 expected height and crown
M	Mature	Between 2/3 and full expected height and crown
FM	Fully Mature	Full expected height and crown
OM	Over-Mature	Crown beginning to break up and decrease in size
S	Senescent	Crown in advanced stage of break-up


Condition

A	Good
B	Fair
C	Poor
D	Dead

Appendix Three

Plans

-  Category A Trees
-  Category B Trees
-  Category C Trees
-  Category U Trees
-  Root protection area

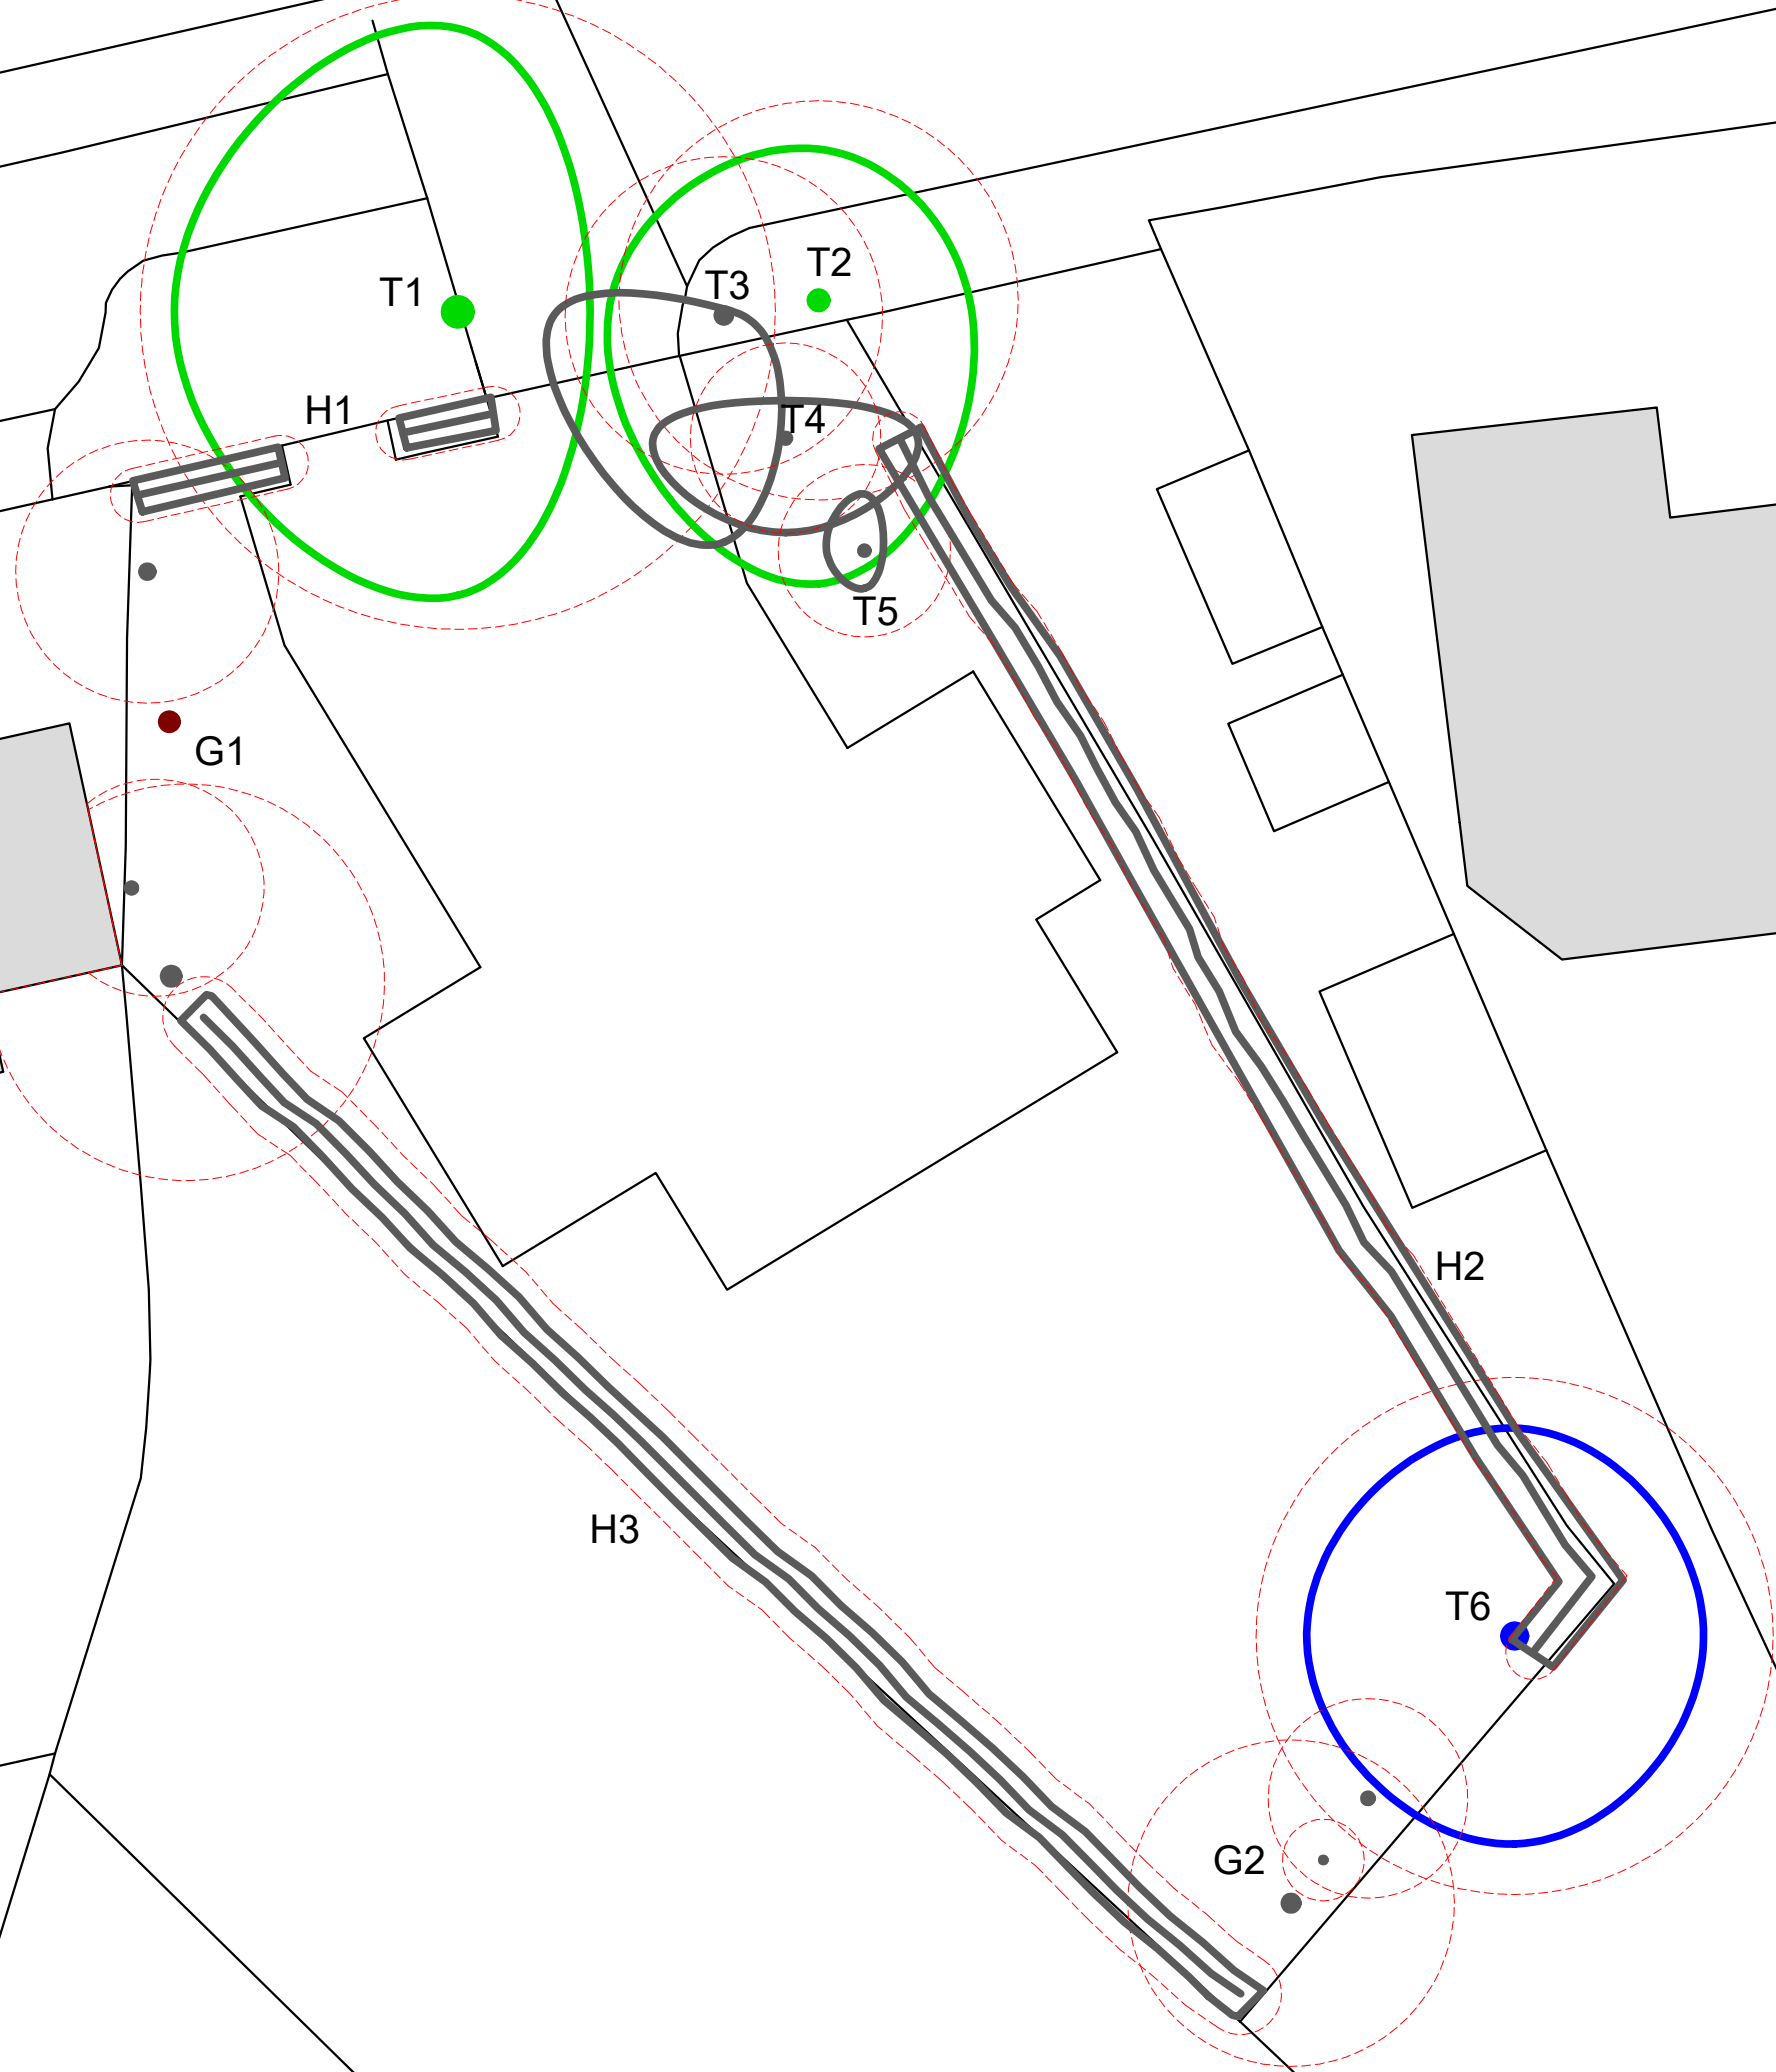

Mulberry TMC
Adamson House
Towers Business Park
Wilmslow Road
Didsbury
M20 2YY

Tel: 0161 955 3628
Email: info@mulberrytmc.co.uk



mulberry

Site Address:
23 Patch Lane
Bramhall

Drawing Title:
BS5837 Plan






Drawing No:
23PLB/BS/01


Date:
28/04/2022

Scale:
1:200@A2

Drawn by:
CS

Note: Dimensions are not to be scaled from this drawing.
All written measurements are to be checked on site by
the contractor. Copyright Mulberry TMC.
Note: All rights described in Chapter IV of the Copyright
Design & Patents Act 1988 have generally been asserted.

-  Category A Trees
-  Category B Trees
-  Category C Trees
-  Category U Trees
-  Root protection area

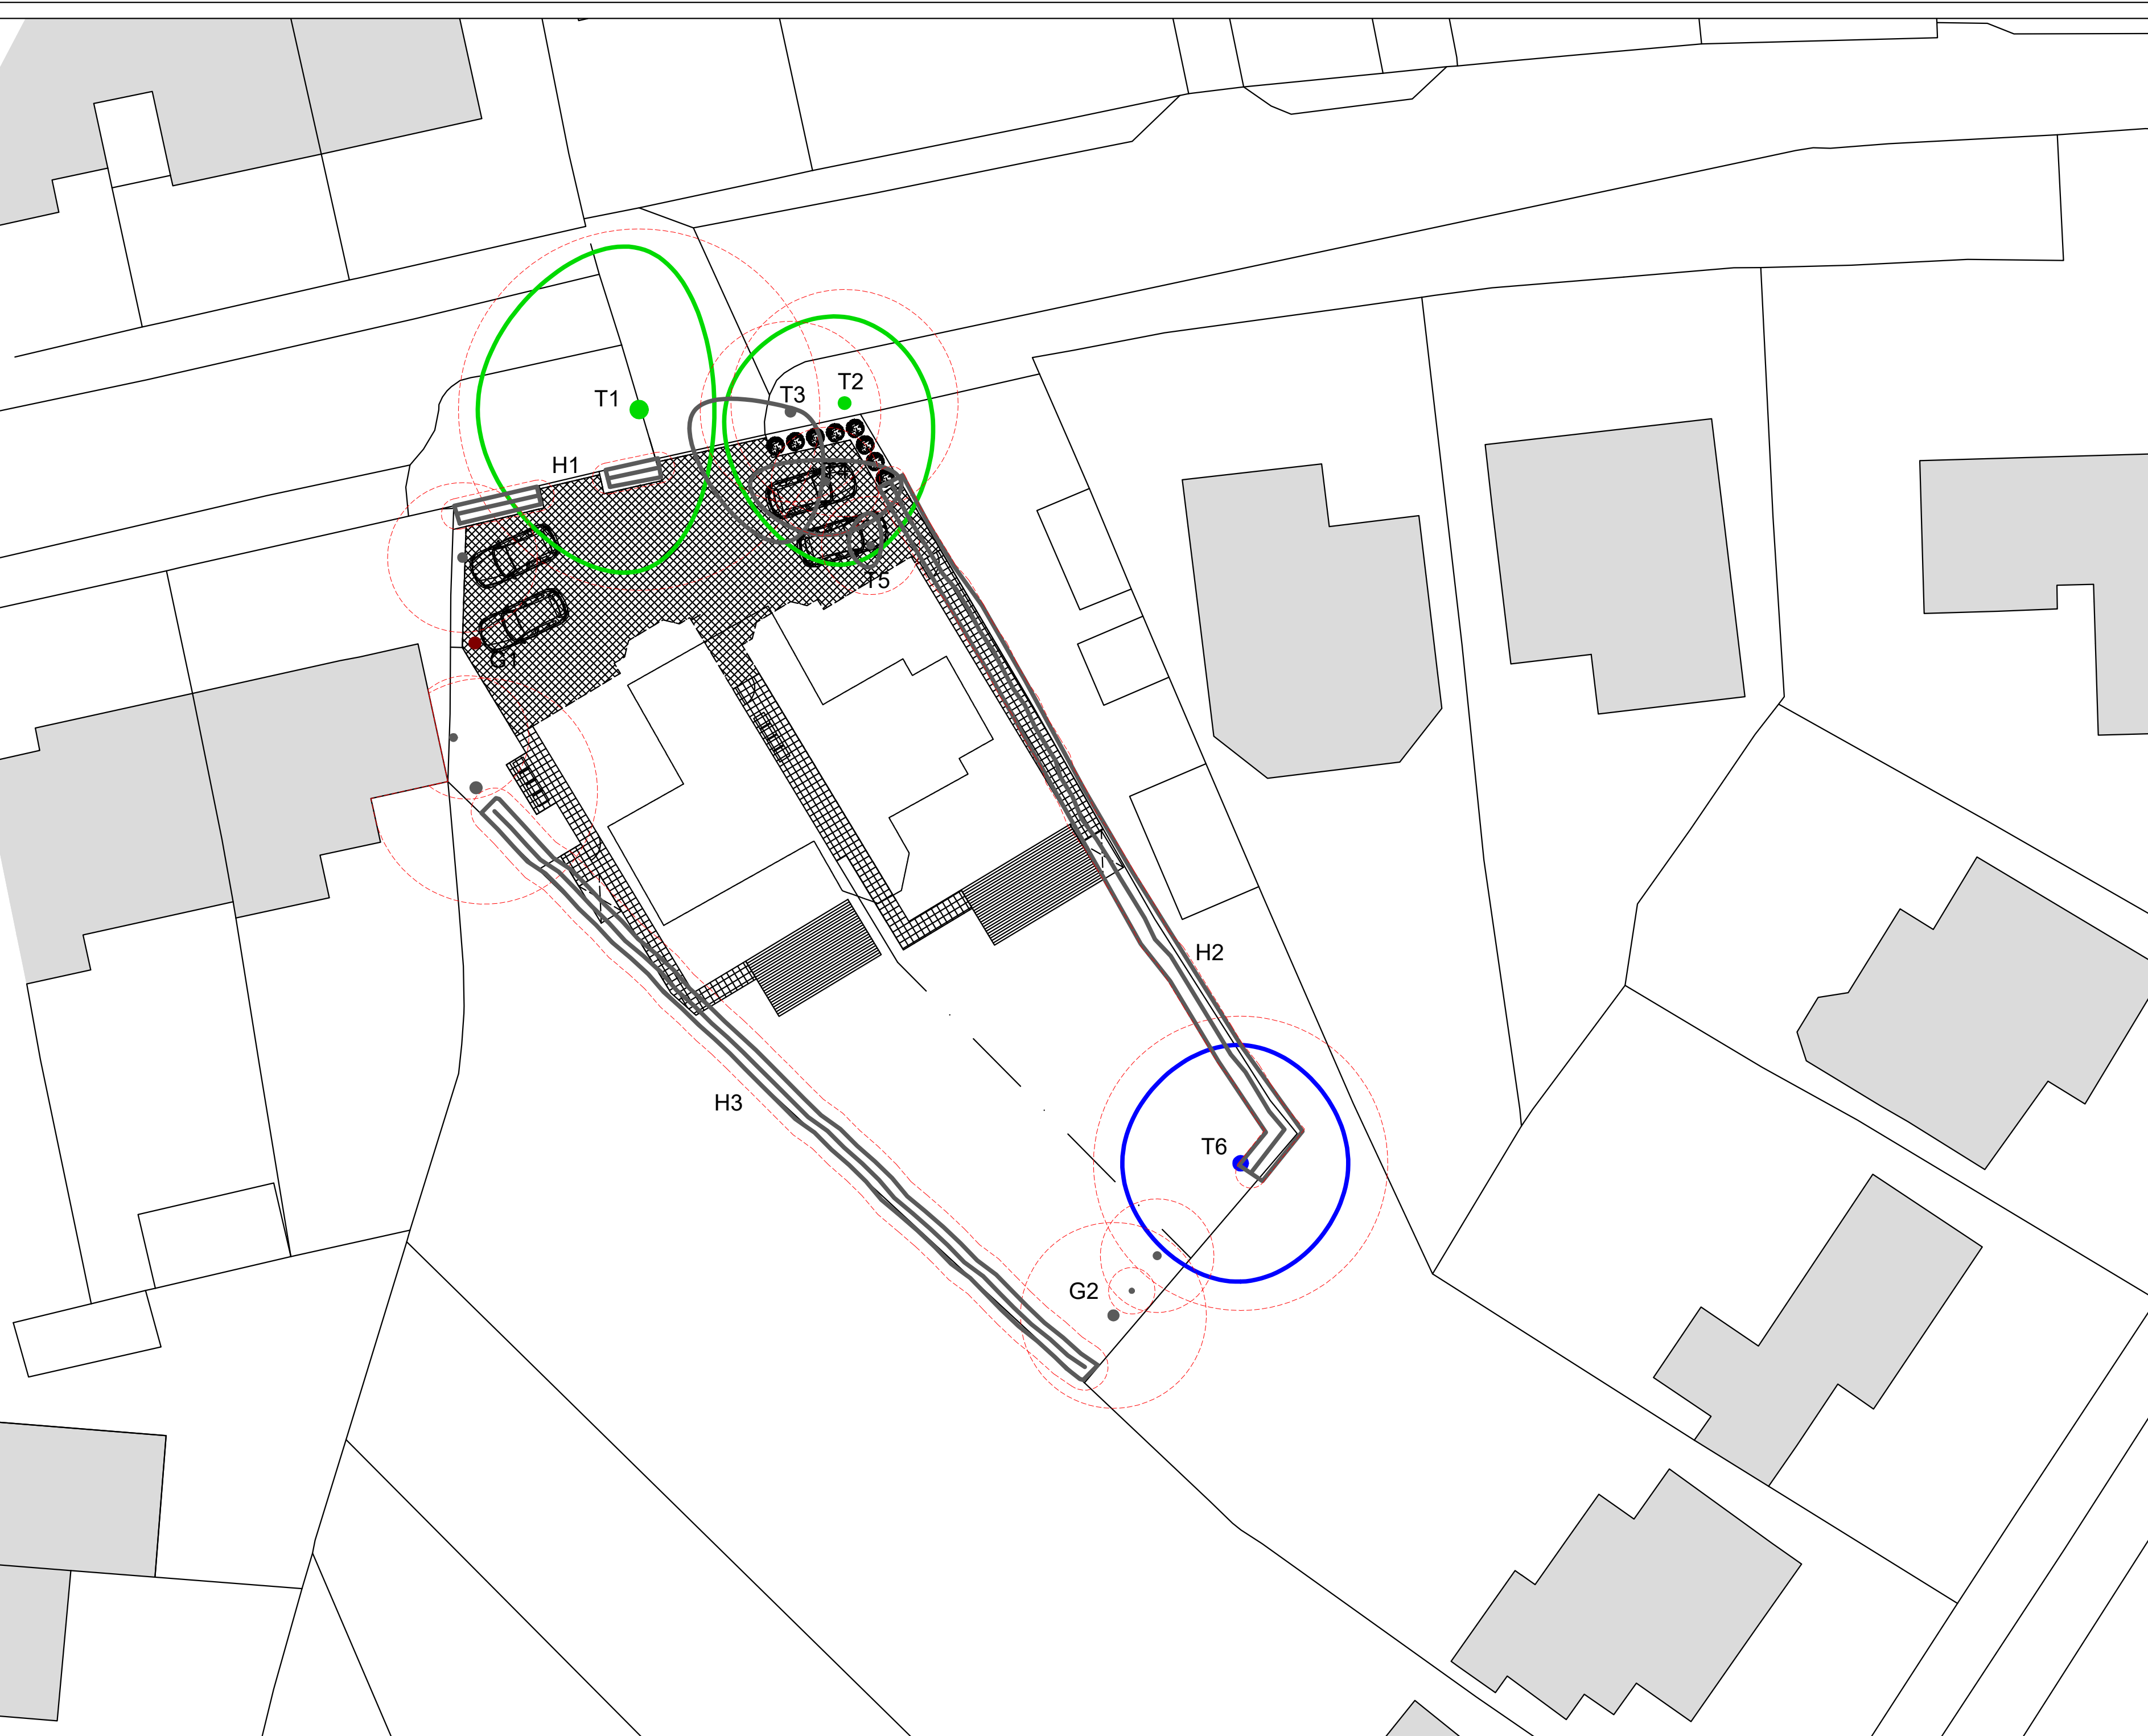

Mulberry TMC
Adamson House
Towers Business Park
Wilmslow Road
Didsbury
M20 2YY

Tel: 0161 955 3628
Email: info@mulberrytmc.co.uk



Site Address:
23 Patch Lane
Bramhall

Drawing Title:
AIS Plan

Drawing No:
23PLB/AIS/01

Date:
28/04/2022

Scale:
1:200@A2

Drawn by:
CS

Note: Dimensions are not to be scaled from this drawing.
All written measurements are to be checked on site by
the contractor. Copyright Mulberry TMC.
Note: All rights described in Chapter IV of the Copyright
Design & Patents Act 1988 have generally been asserted.