
These drawings show the elevation of the McLaren Wall on the outside of the park boundary. Refer to drawings 5001 to 5016 for details of the repairs.



Part Elevation of McLaren Wall
5019 NTS



Part Elevation of McLaren Wall 5019 NTS

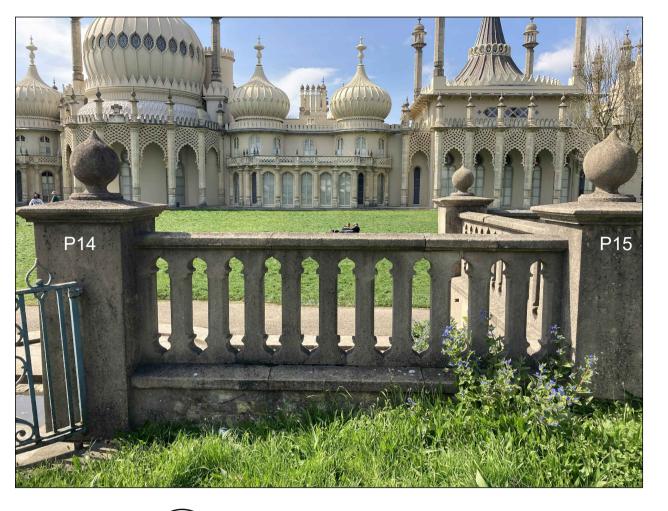

Part Elevation of McLaren Wall
5019 NTS



3. It is likely that the majority of the

McLaren wall has horizontal cracking

mortar to brickwork core. Allow for

repairs than this are likely to be

noted on the drawings.


repairing cracks and new sacrificial

carried and can be seen, these are

coat throughout. Where more intrusive

due to the contentious render and lime

Part Elevation of McLaren Wall
5019 NTS

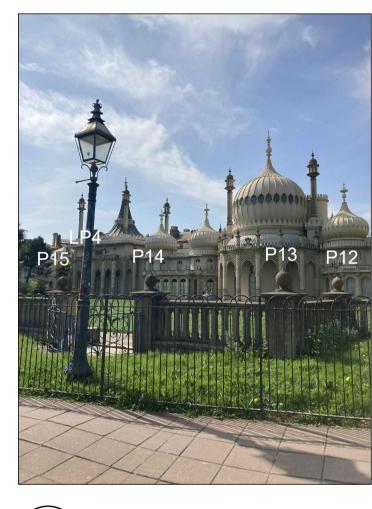


Part Elevation of McLaren Wall NTS



Part Elevation of McLaren Wall



Part Elevation of McLaren Wall

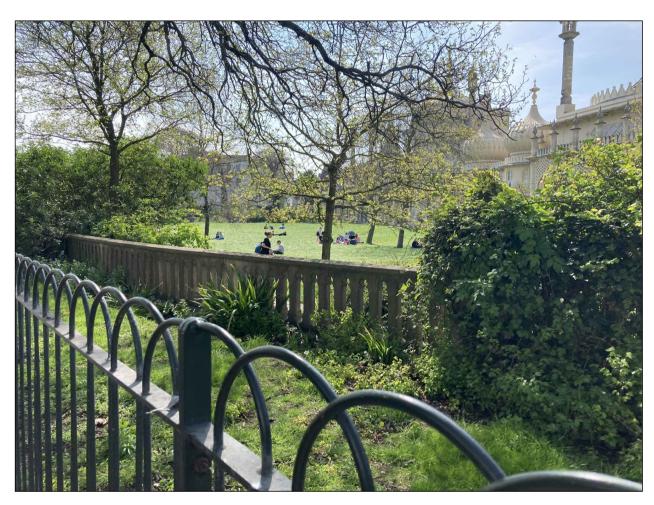

General works:

1. All plant growth locally to boundary walls to be removed as needed to

2. Allow for all open joints to be pointed.

plant growth covering the wall.

out gardeners on site.

enable access. Assumed to be carried

Unknown extent due to the extent of

Part Elevation of McLaren Wall
5019 NTS



9 Part Elevation of McLaren Wall 5019 NTS



Part Elevation of McLaren Wall
5019 NTS



Part Elevation of McLaren Wall
5019 NTS



Part Elevation of McLaren Wall
5019 NTS

This drawing is not to be scaled. The architect is to be informed of any errors before work proceeds. The general contractor is responsible for checking all dimensions

Notes

General notes:
1. Refer to drawing
P1154-RHP-ZZ-00-DR-A-1000

Site Key Plan for locations.

2. Condition varies and in some cases, extensive plant growth has prevented full access and survey. It may be that the condition deteriorates further.

3. Original condition survey carried out in

April 2022.
4. To be read in conjunction with RHP P1154-RHP-ZZ-ZZ-SC-A-8200 Brighton Pavilion Gardens Schedule

of works.

5. Refer to schedule of works for testing

and sample requirements.Refer to CTP for details of any structural works.

the conservation works are part of the overall plans for the Garden.
Details of the proposals can be see in the following Allen Scott drawings: 725-101_General Arrangement East 725-102_General Arrangement North 725-102_General Arrangement West The Park and Garden are registered

Grade II with listed structures. Refer to CMP by for further details.

9. All dimensions to be confirmed,

 All dimensions to be confirmed, indicative heights given for information purposes only.

LEGEND

SE = Structural Engineer

Remove cracked render, carry out brickwork repairs and new lime render render.

Lime leeching from retaining wall behind. Consider new french drainage system behind. See drawing P1154-RHP-ZZ-00-DR-DR-A-5000

for typical details.

Lime render patch repair and sacrificial coating

Cut out existing cracked/
damaged stone and carry out
stone indent repair. Sized to suit,
profile and type to match existing.

Provide stone sample for each type of stone sample for approval.

New stone coping. Sized to suit, profile and type to match existing.

Provide stone sample for each type of stone sample for approval.

F Localised motar patch repair profiled and colour matched to existing. Provide sample for approval.

0 07:08:2023 First Issue

TP PN

Rev Date + notes

r h partnership architects
30-31 Foundry Street Brighton BI
T 01273 645220
www.rhpartnership.co.uk

Reawakening Brighton Royal Estate
Phase 2

McLaren Boundary Wall Details

Job Ref Dwg No Revision
P1154-RHP-ZZ-00-DR-A-5019 P

status

Preliminary