Carefully apply protection measures and apply biocide to plinth to remove moss




Part Elevation of McLaren Wall 5015 NTS



5 Part Elevation of McLaren Wall



9 Part Elevation of McLaren Wall 5015 NTS

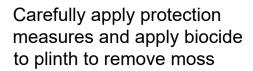

Check integrity of previous repair. Provisionally allow for replacement subject to CA instruction



2 Part Elevation of McLaren Wall 5015 NTS







Part Elevation of McLaren Wall √5015 NTS





10 Part Elevation of McLaren Wall

6 Part Elevation of McLaren Wall



SE = Structural Engineer

Remove cracked render, carry out brickwork repairs and new lime render render.

Lime leeching from retaining wall behind. Consider new french drainage system behind. See P1154-RHP-ZZ-00-DR-DR-A-5000

Lime render patch repair and sacrificial coating

for typical details.

Cut out existing cracked/ damaged stone and carry out stone indent repair. Sized to suit, profile and type to match existing. Provide stone sample for each type of stone sample for approval.

> New stone coping. Sized to suit, profile and type to match existing. Provide stone sample for each type of stone sample for approval.

Localised motar patch repair profiled and colour matched to existing. Provide sample for approval.

0 07:08:2023

This drawing is not to be scaled. The architect is to be informed of any errors before work proceeds. The general contractor is responsible for checking all dimensions

P1154-RHP-ZZ-00-DR-A-1000

2. Condition varies and in some cases,

extensive plant growth has prevented

full access and survey. It may be that

the condition deteriorates further. 3. Original condition survey carried out in

4. To be read in conjunction with RHP P1154-RHP-ZZ-ZZ-SC-A-8200 Brighton Pavilion Gardens Schedule

5. Refer to schedule of works for testing and sample requirements. Refer to CTP for details of any

The conservation works are part of the overall plans for the Garden. Details of the proposals can be see in the following Allen Scott drawings: 725-101\_General Arrangement East 725-102\_General Arrangement North 725-102\_General Arrangement North 725-104\_General Arrangement West 8. The Park and Garden are registered Grade II with listed structures. Refer

to CMP by for further details. 9. All dimensions to be confirmed,

All plant growth locally to boundary walls to be removed as needed to enable access. Assumed to be carried

2. Allow for all open joints to be pointed. Unknown extent due to the extent of

plant growth covering the wall. 3. It is likely that the majority of the

McLaren wall has horizontal cracking due to the contentious render and lime mortar to brickwork core. Allow for repairing cracks and new sacrifical

coat throughout where exposed.
Where more intrusive repairs than this

are likely to be carried and can be seen, these are noted on the

purposes only.

out gardeners on site.

General works:

drawings.

indicative heights given for information

Site Key Plan for locations.

Notes

General notes:

Refer to drawing

April 2022.

of works.

structural works.

Phase 2

r h partnership architects 30-31 Foundry Street Brighton BN1 4AT T 01273 645220

www.rhpartnership.co.uk

brighton@rhpartnership.co.uk

TP PN

Reawakening Brighton Royal Estate

McLaren Boundary Wall Details

Preliminary

Part Elevation of McLaren Wall



Part Elevation of McLaren Wall



8 Part Elevation of McLaren Wall