

Potential location for outfall 1 Part Elevation of McLaren Wall for any new drainage 5011 NTS through brickwork below railings




2 Part Elevation of McLaren Wall 5011 NTS



3 Part Elevation of McLaren Wall 5011 NTS




Part Elevation of McLaren Wall

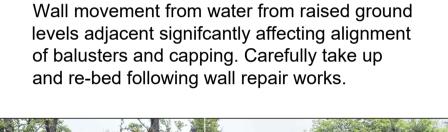



 $\sqrt{5}$ Part Elevation of McLaren Wall 5011 NTS

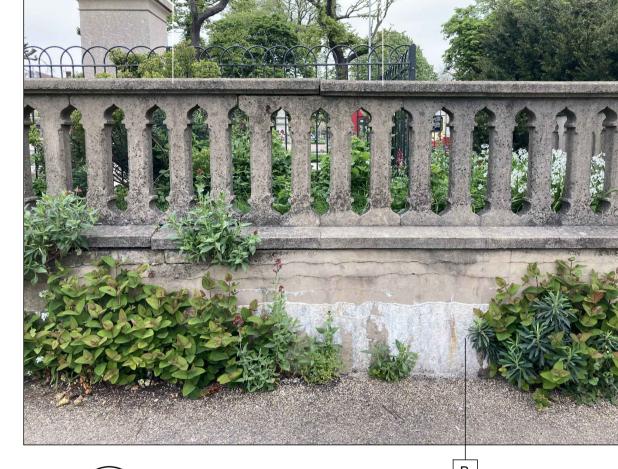

6 Part Elevation of McLaren Wall 5011 NTS



7 Part Elevation of McLaren Wall 5011 NTS



11 Part Elevation of McLaren Wall



8 Part Elevation of McLaren Wall 5011 NTS

Crack





12 Part Elevation of McLaren Wall

This drawing is not to be scaled. The architect is to be informed of any errors before work proceeds. The general contractor is responsible for checking all dimensions

LEGEND

drawing

C sacrificial coating

approval.

approval.

SE = Structural Engineer

A out brickwork repairs and new

lime render render.

behind. Consider new french drainage system behind. See

Cut out existing cracked/

stone indent repair. Sized to suit,

type of stone sample for

type of stone sample for

damaged stone and carry out

Provide stone sample for each

New stone coping. Sized to suit,

profile and type to match existing.
Provide stone sample for each

profile and type to match existing.

Remove cracked render, carry

Lime leeching from retaining wall

General notes:

1. Refer to drawing P1154-RHP-ZZ-00-DR-A-1000 Site Key Plan for locations.

2. Condition varies and in some cases, extensive plant growth has prevented full access and survey. It may be that the condition deteriorates further.

3. Original condition survey carried out in

P1154-RHP-ZZ-00-DR-DR-A-5000 April 2022. for typical details. 4. To be read in conjunction with RHP P1154-RHP-ZZ-ZZ-SC-A-8200 Lime render patch repair and

Brighton Pavilion Gardens Schedule of works.

5. Refer to schedule of works for testing and sample requirements. 6. Refer to CTP for details of any structural works.

7. The conservation works are part of the overall plans for the Garden. Details of the proposals can be see in the following Allen Scott drawings: 725-101_General Arrangement East 725-102_General Arrangement North 725-102_General Arrangement North 725-104_General Arrangement West

8. The Park and Garden are registered Grade II with listed structures. Refer to CMP by for further details. 9. All dimensions to be confirmed,


Localised motar patch repair profiled and colour matched to F profiled and colour materied to existing. Provide sample for indicative heights given for information purposes only. approval.

General works: 1. All plant growth locally to boundary walls to be removed as needed to enable access. Assumed to be carried

out gardeners on site. 2. Allow for all open joints to be pointed. Unknown extent due to the extent of plant growth covering the wall.

3. It is likely that the majority of the

McLaren wall has horizontal cracking due to the contentious render and lime mortar to brickwork core. Allow for repairing cracks and new sacrifical coat throughout where exposed. Where more intrusive repairs than this are likely to be carried and can be seen, these are noted on the drawings.

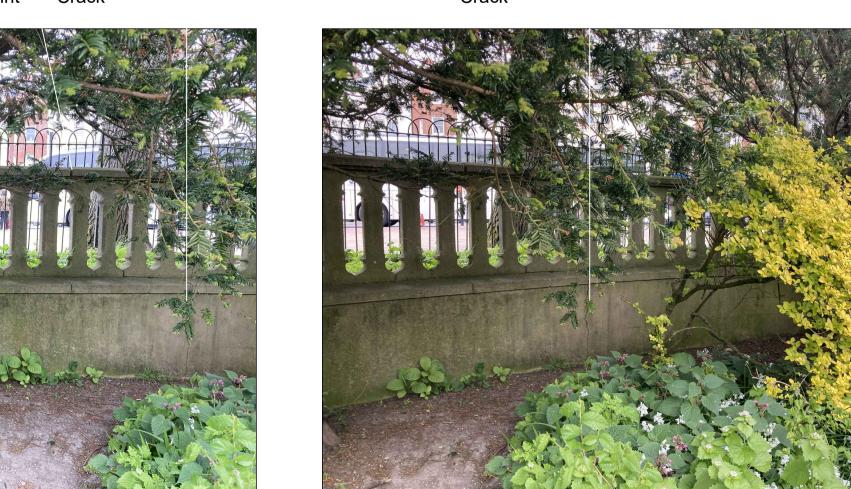

McLaren Boundary Wall Details

07:08:2023

Reawakening Brighton Royal Estate

Preliminary



9 Part Elevation of McLaren Wall



10 Part Elevation of McLaren Wall