These drawings show the elevation of the McLaren Wall on the outside of the park boundary. Refer to drawings 5001 to 5016 for details of the repairs.



1 \ Part Elevation of McLaren Wall 5018 NTS



2 Part Elevation of McLaren Wall




3 Part Elevation of McLaren Wall



4 Part Elevation of McLaren Wall




5 Part Elevation of McLaren Wall

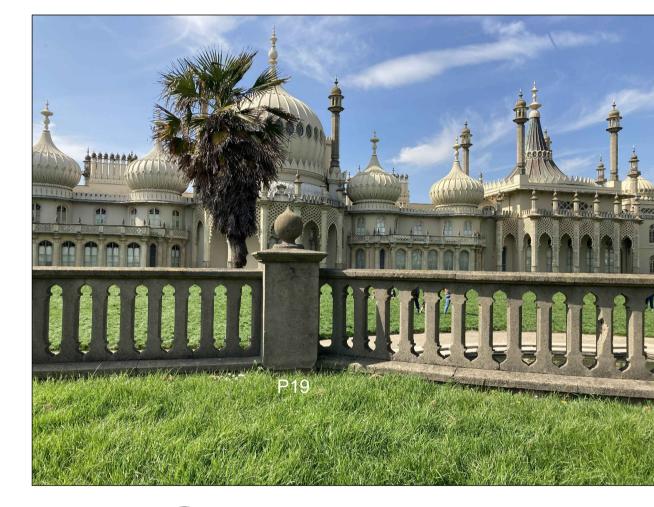

6 Part Elevation of McLaren Wall 5018 NTS



Part Elevation of McLaren Wall 5018 NTS

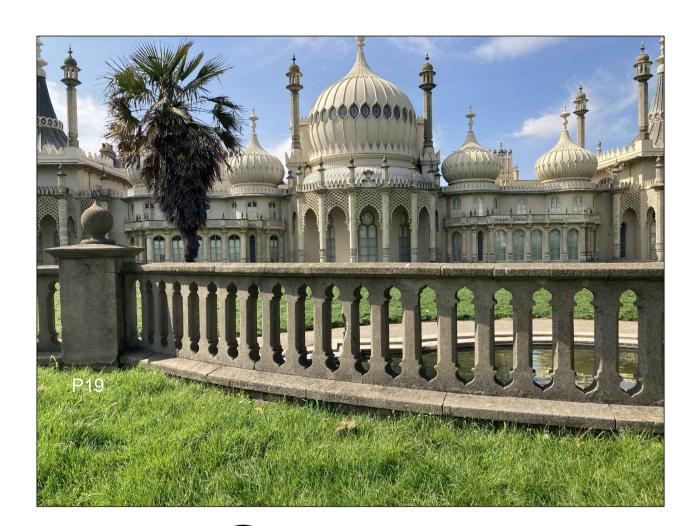


8 Part Elevation of McLaren Wall 5018 NTS



9 Part Elevation of McLaren Wall



10 Part Elevation of McLaren Wall

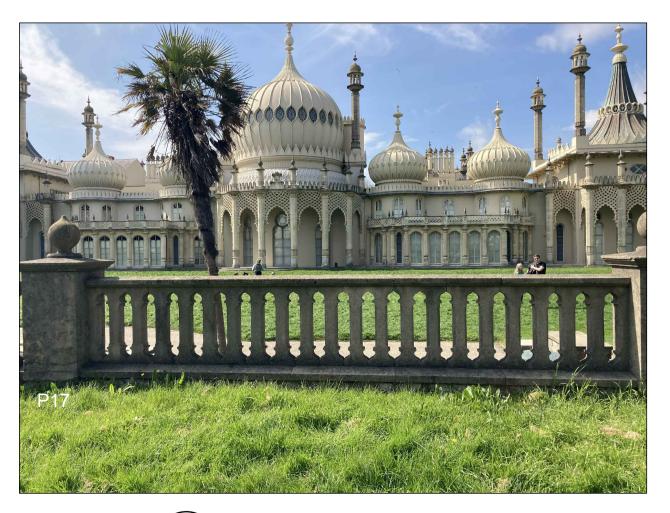

11 Part Elevation of McLaren Wall 5018 NTS

LEGEND

SE = Structural Engineer

Remove cracked render, carry out brickwork repairs and new lime render render.

Lime leeching from retaining wall behind. Consider new french drainage system behind. See drawing P1154-RHP-ZZ-00-DR-DR-A-5000 for typical details.

Lime render patch repair and sacrificial coating

Cut out existing cracked/ damaged stone and carry out stone indent repair. Sized to suit, profile and type to match existing. Provide stone sample for each

type of stone sample for

approval.

New stone coping. Sized to suit, profile and type to match existing. Provide stone sample for each type of stone sample for approval.

Localised motar patch repair profiled and colour matched to existing. Provide sample for

0 07:08:2023 First Issue

This drawing is not to be scaled. The architect is to be informed of any errors before work proceeds. The general contractor is responsible for checking all dimensions

> P1154-RHP-ZZ-00-DR-A-1000 Site Key Plan for locations.

2. Condition varies and in some cases,

4. To be read in conjunction with RHP P1154-RHP-ZZ-ZZ-SC-A-8200 Brighton Pavilion Gardens Schedule

5. Refer to schedule of works for testing

The conservation works are part of the overall plans for the Garden. Details of the proposals can be see in the following Allen Scott drawings: 725-101_General Arrangement East 725-102_General Arrangement North 725-102_General Arrangement North 725-104_General Arrangement West The Park and Garden are registered Grade II with listed structures. Refer

and sample requirements. Refer to CTP for details of any

to CMP by for further details. 9. All dimensions to be confirmed,

1. All plant growth locally to boundary walls to be removed as needed to enable access. Assumed to be carried

2. Allow for all open joints to be pointed. Unknown extent due to the extent of

> repairs than this are likely to be carried and can be seen, these are

noted on the drawings.

McLaren wall has horizontal cracking due to the contentious render and lime mortar to brickwork core. Allow for repairing cracks and new sacrificial coat throughout. Where more intrusive

plant growth covering the wall.

3. It is likely that the majority of the

out gardeners on site.

purposes only.

General works:

indicative heights given for information

structural works.

extensive plant growth has prevented full access and survey. It may be that the condition deteriorates further. 3. Original condition survey carried out in

Notes

General notes:

Refer to drawing

April 2022.

of works.

Drwn Chkd

r h partnership architects 30-31 Foundry Street Brighton BN1 4AT T 01273 645220 www.rhpartnership.co.uk brighton@rhpartnership.co.uk

TP PN

Reawakening Brighton Royal Estate Phase 2

McLaren Boundary Wall Details

P1154-RHP-ZZ-00-DR-A-5018 P1

Preliminary

approval.