


# EAST LODGE, DYRHAM PARK – PROPOSED MASONRY REPAIRS TO SCREEN WALL

8 no. damaged Bath Stone coping stones to be renewed at top of wall and mortar repairs to upper surface of 2 no. to prevent water ponding.

All coping stones to be repointed in lime mortar

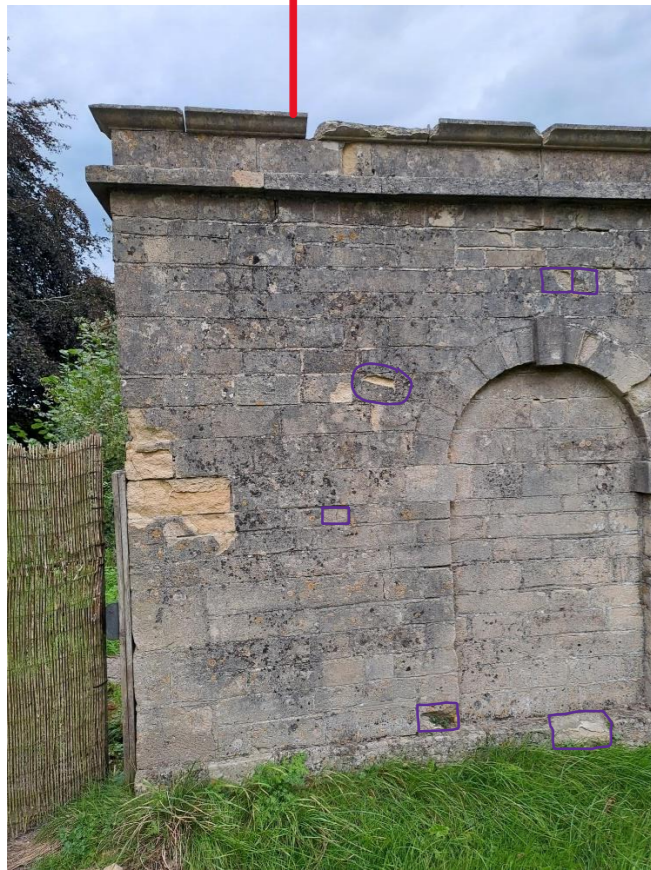

Piecing in to damaged Bath Stone quoins



Piecing in to damaged Bath Stone parapet stone



Mortar repairs to upper face of lower copings to prevent water ponding





New Bath Stone to be pieced into voussoir and repointed in lime mortar



Piecing in new Bath Stone to replace 15 no. damaged facing stones (purple squares shown on pg 1 above) and 8 no. lime mortar repairs (purple circles shown on pg 1 above) across face of wall to prevent water ponding.

Selective repointing in lime mortar where missing/loose especially at base of wall



Damaged render to parapet stones to be renewed in 2-coat lime render

Tree sapling growing in wall head to be removed

Damaged Bath Stone parapet stones to be renewed

Lower coping bed joints to be repointed in lime mortar

Vegetation in wall to be removed and wall repointed in lime mortar where mortar missing or loose

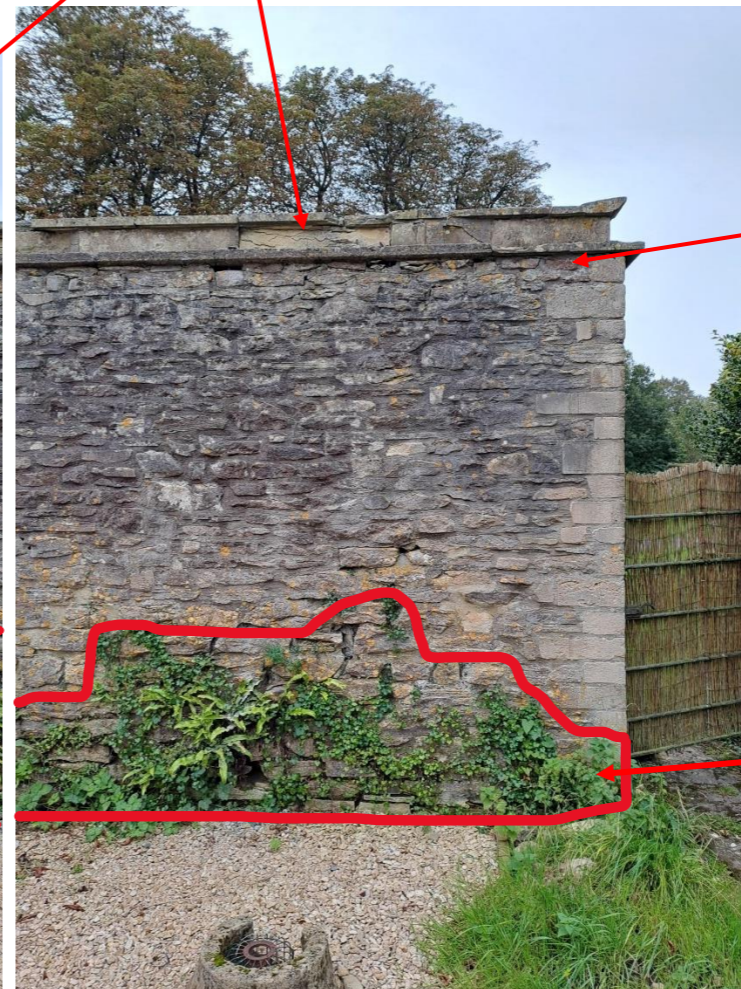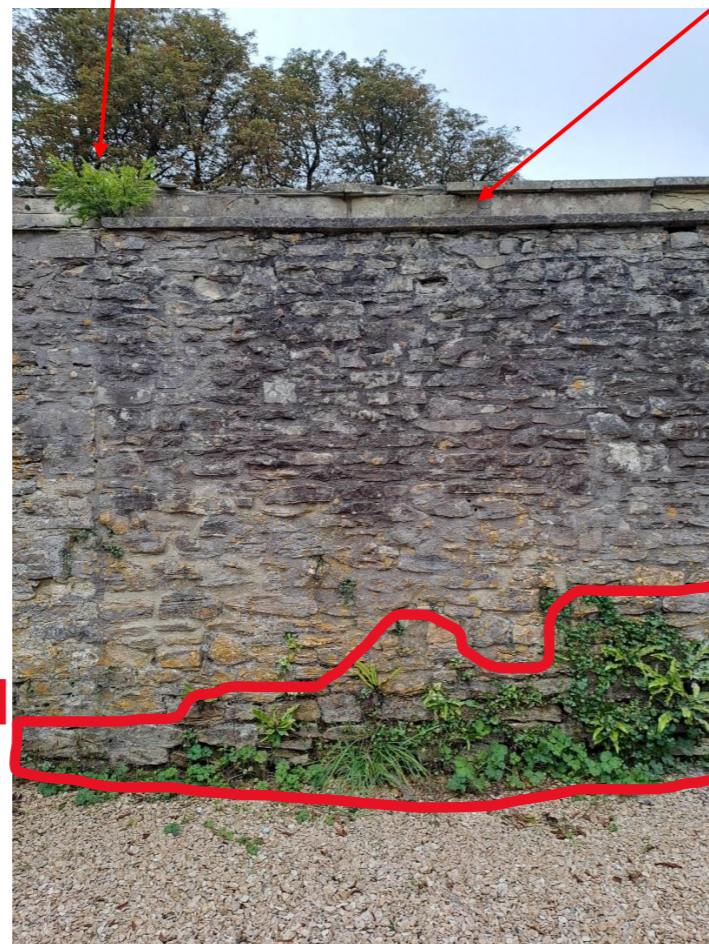

Small section of damaged Bath Stone coping below lead to be renewed

Masonry below lead weathering to be repointed in lime mortar where existing pointing loose/missing

Hollow and cracked render to be removed and renewed in 2-coat lime render



Lower Bath Stone coping edges to be cut back and renewed