


# **GA Plan Level 01 First Floor**

- Windows. Secondary glazing installed to windows facing London Road.
- Walls. Replace defective render across all elevations and replace to match.

# Floor. Install raised floor over existing where floor levels differ with

apartments.

# **Wall Key**

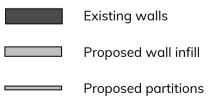

Proposed wall lining

#### **GENERAL NOTES**

#### **External Walls**

- Strip off all unnecessary services.
- Repoint where necessary, clean brickwork.
- Make good exposed existing walls following demo.
- New areas of external wall/infill to be in brick reclaimed from elsewhere on the building/site. Brick bond, mortar colour, joint width and pointing to match.

#### **Doors**

 Assess condition of existing doors and where necessary replace with period appropriate replacements.

#### **Windows**

- Assess on individual basis.
- · Overhaul, carry out like for like repairs or replace with similar – existing windows to be draught stripped, new Refurbish windows to be double glazed.
  - Timberwork Overhaul, carry out like for like repairs.
  - Windows facing London Road to be secondary glazed.
  - Trickle vents provided to all existing windows.

### **Internal Floors**

- Ground suspended floors lift floorboards, insulate below, replace floorboards, and reinstate skirtings other joinery or renew with age appropriate replacements.
- Upper floors lift floorboards, upgrade acoustic Refurbish performance and fire separation above existing ceilings between joists, replace floorboards.
  - $\circ~$  Upper floors raised to accommodate service void and insulation, new timber skirtings to match existing profile, reinstate existing joinery, architraves and features or renew with age appropriate replacements.

- Perimeter walls / party walls remove plaster finishes, line with insulated plasterboard and retain coving, or renew with age appropriate replacements.
- · Retain existing fireplace surrounds.
- · Generally, strip out all unnecessary services.
- Set back infill to existing openings to retain feature where possible.

#### **Ceilings**

- · Overboard damaged ceilings. Redecorate covings.
- · Carefully remove covings where new partitions meet ceiling, reinstate coving.

#### Joinery


· Overhaul, carry out like for like repairs.

#### Stairs/balustrades

· Overhaul, repair like for like.

#### **Services**

- Services to be restricted to new partitions where possible.
- Services to existing walls to be chased in plasterwork/walls or run in baton zone behind plasterboard.
- Ventilation via opening windows.
- Heating via localised gas boilers feeding wall mounted radiators.

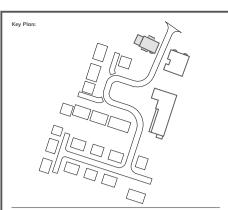

Revision Notes:				
Rev.	Date	Notes	Issuer	Checker
P1	2023-08-04	Preliminary Issue P1	IAT	JC
P2	2023-09-12	Refined layout with minor elevational alterations.	MJ	JC
P3	2023-09-18	Revised layout to retain existing stair.	MJ	JC
P4	2023-10-05	Revised subject to comments from conservation officer.	MJ	JC
P5	2023-10-09	Internal partition wall and furniture slight adjustment.	MJ	JC
P6	2023-10-17	Planning Submission	MJ	JC





# **LONDON ROAD**

## **NEWARK**

Project Address: 23-0030 London Rd, Newark NG24 Bildurn Properties

Director / Associate Sarah Boxford Matthew Branton A3 Planning B1 - Building 1 1:100

A3L

## **GA First Floor Plan Proposed - Block 1**

BLR-FEA-B1-01-DP-A-2212

