
Zinc pitched roofs	
Zinc flat roof with 3 degree fall to recessed guttering New frameless glass rooflight in back hall flat roof	
New Back Hall with insulated flat roof and stone screening wall	
Recessed guttering Overhanging flat roof to rear door to provide adequate shelter	



10 M

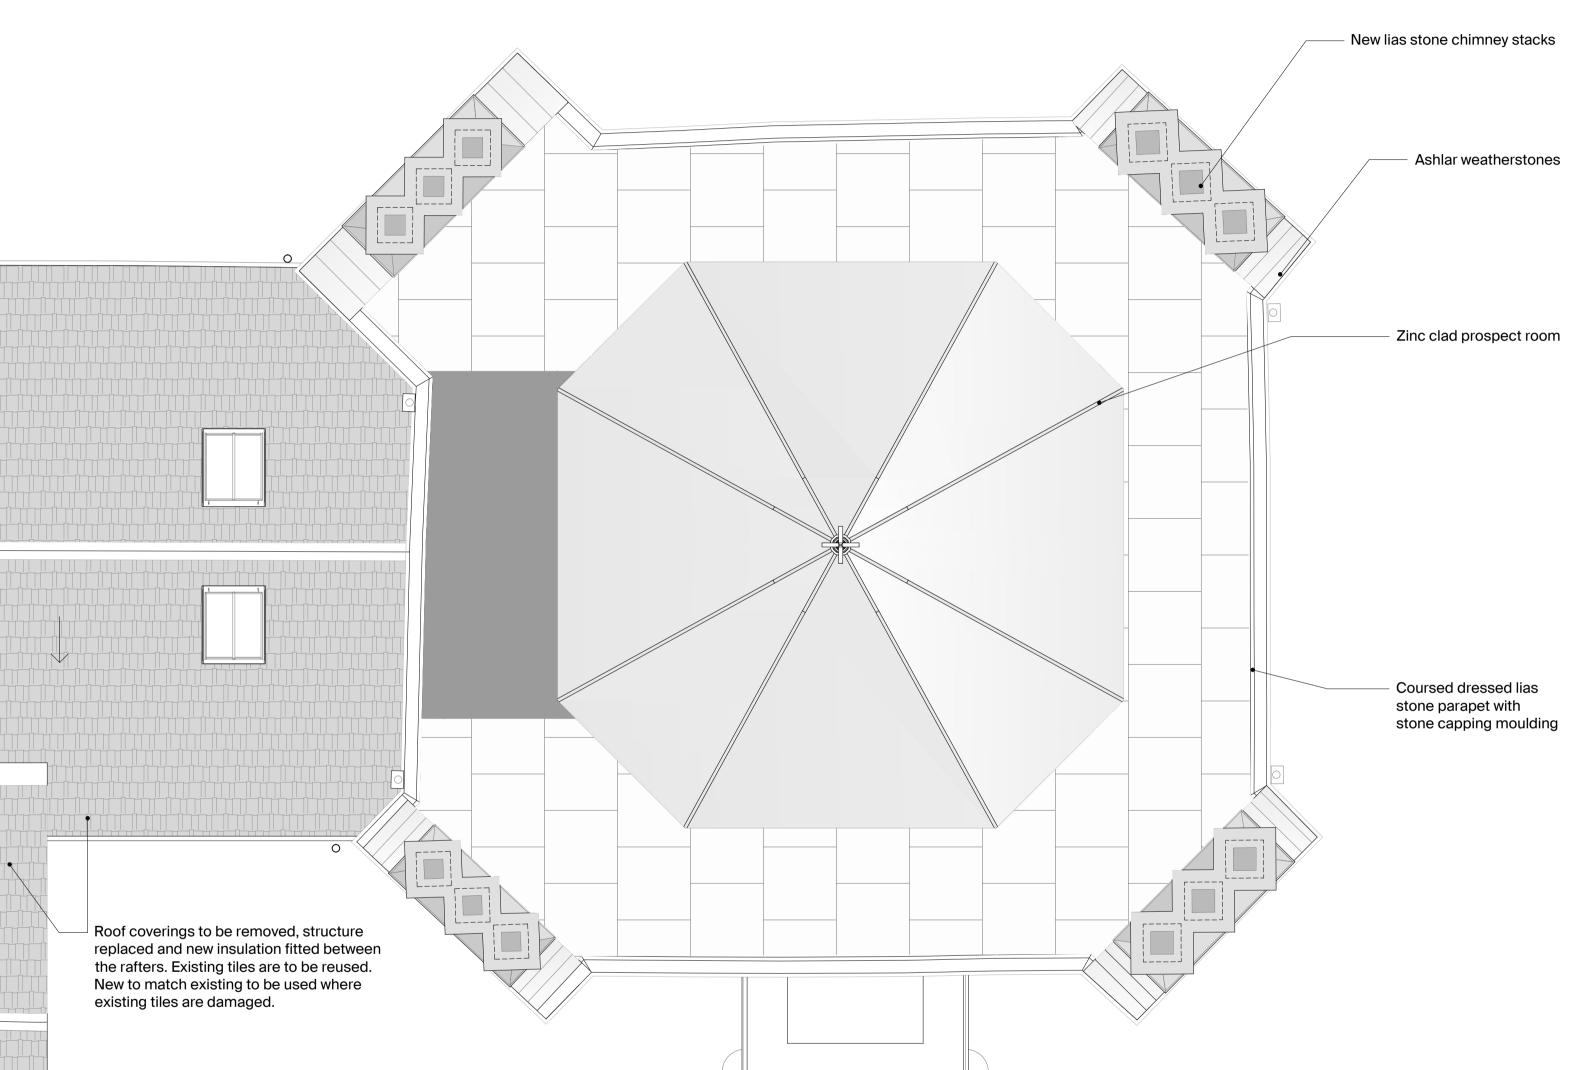

General Notes:

 Building to be subject to full service upgrade including elements alled through existing walls, floors and ceilings where a Redundant surface mounted services and boxing to be reins and an externations to windows and doors to be carried including shutters and shutter boxes to be inspected for dextg to be reinstated where missing. All extg windows and external doors to be fully draught-pi Modern joinery and wall panelling to be removed in genera. Localised repair works to be carried out as required on fur Rain water goods replaced with heritage cast iron goods. All building materials to be locally sourced where possible All new stone elements, including new stone steps, plinths Structural steel and timbers to be checked and replaced with a store elements in be record survey. Original skirting's to be repaired and reinstated. In case of All chimney flues and draws to be inspected for defects All extg stone walls and all stone elements including sills, inspected for defects and damage, repaired accordingly are elements to be replaced with new stone sections to match 2. 	




Job No **315**

Project West Bradley House

Title Proposed Roof Plan - Main House

Drg No
Scale
Date of First Issue
Status

315-315-MH-00-114.1-P1 1:50@A1,1:100@A3 March 2024 Planning

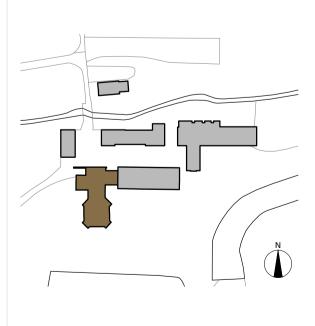

ASSOCIATES

studio@richardparr.com +44 (0)1453 860200 richardparr.com @richardparrassociates

COUNTRY Easter Park Nympsfield, Stonehouse Gloucestershire GL10 3UL

TOWN The People's Hall Studio 5, 2 Olaf Street London W11 4BE

ding electric, lighting, plumbing, drainage etc. New SVPs, mechanical and electrical services to be where required using chases, penetrations and risers, made good to match existing finishes. o be removed. carried out as required to match existing where retained. All retained window and door sets, ed for defect and damage and refurbished accordingly. New panelled timber shutters to match

ught-proofed and thermally upgraded.

general. d on further inspection to match existing materials and details.

bossible. All removed stonework and bricks to be set aside to store for potential reuse. s, plinths and cornices to be made from salvaged stonework as far as reasonably practicable. laced where necessary.

ch existing. and carefully lifted to allow installation of new insulated floor slab and waterproofing. Flagstones

case of damage/defect,skirtings to be replaced to match extg. ally and externally for defects and damage and repaired accordingly. All chimney pieces, hearths, efects and damage, repaired accordingly and cleaned. g sills, steps, plinths, cornices, decorations, mouldings, stone/concrete/timber lintels, etc. to be rdingly and lightly steam cleaned taking care of retaining historic patina. All missing/damaged to match extg. Any damaged or loose stone to be repointed with lime mortar to match extg. d defect and structurally strengthened or replaced where necessary.