Existing roof tiles and ridge tiles to be New stainless steel flue to new fireplace New roof to Apple Barn replaces failed New conservation double glazed rooflights carefully removed, inspected and reused existing structure - refer to S.E report installed flush with tiles where possible. New tiles to match to be used where required.

This drawing is to be used for planning purposes only. Not for construction.

This drawing is the property of Richard Parr Associates. Copyright is reserved by them and the drawing is issued on the condition that it is not copied, reproduced, retained or disclosed to any unauthorised person, either wholly or in part without written consent.

© Copyright Richard Parr Associates

-

Date ----

Rev

Job No **315**


West Bradley House

Proposed Roof Plan - Apple Barn

315-315-MH-00-114.2-P1 1:50@A1,1:100@A3

Status Planning

Date of First Issue March 2024

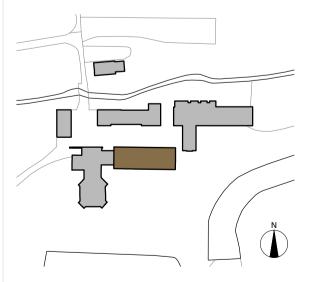

General Notes:

- Building to be subject to full service upgrade including electric, lighting, plumbing, drainage etc. New SVPs, mechanical and electrical services to be
 RICHARD PARR installed through existing walls, floors and ceilings where required using chases, penetrations and risers, made good to match existing finishes.
- Redundant surface mounted services and boxing to be removed. • Repairs or alterations to windows and doors to be carried out as required to match existing where retained. All retained window and door sets, including shutters and shutter boxes to be inspected for defect and damage and refurbished accordingly. New panelled timber shutters to match
- extg to be reinstated where missing. All extg_windows and external doors to be fully draught-proofed and thermally upgraded.
- Modern joinery and wall panelling to be removed in general.
- Localised repair works to be carried out as required on further inspection to match existing materials and details.
- Rain water goods replaced with heritage cast iron goods.
 All building materials to be locally sourced where possible. All removed stonework and bricks to be set aside to store for potential reuse.
- All new stone elements, including new stone steps, plinths and cornices to be made from salvaged stonework as far as reasonably practicable. • Structural steel and timbers to be checked and replaced where necessary. Areas around demolition to be made good to match existing.
- All ground floor flagstones to be labeled, recorded and carefully lifted to allow installation of new insulated floor slab and waterproofing. Flagstones to be relayed in original location as per record survey.
- Original skirting's to be repaired and reinstated. In case of damage/defect, skirtings to be replaced to match extg.
 All chimney flues and draws to be inspected internally and externally for defects and damage and repaired accordingly. All chimney pieces, hearths, mantels and chimney breasts to be inspected for defects and damage, repaired accordingly and cleaned.
- All extg stone walls and all stone elements including sills, steps, plinths, cornices, decorations, mouldings, stone/concrete/timber lintels, etc. to be inspected for defects and damage, repaired accordingly and lightly steam cleaned taking care of retaining historic patina. All missing/damaged
- elements to be replaced with new stone sections to match extg. Any damaged or loose stone to be repointed with lime mortar to match extg. All floor structures to be inspected for damage and defect and structurally strengthened or replaced where necessary. All floors to be acoustically upgraded.


ASSOCIATES


studio@richardparr.com +44 (0)1453 860200 richardparr.com @richardparrassociates

COUNTRY Easter Park Nympsfield, Stonehouse Gloucestershire GL10 3UL

The People's Hall Studio 5, 2 Olaf Street London W11 4BE

Proposed Roof Plan - Apple Barn 1:50@A1, 1:100@A3

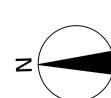

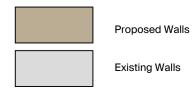

LEGEND