


KEY

Extent of existing entrance to be planed off and resurfaced



50mm of existing surface to be planed off. Following completion of planing existing surface to be inspected and loose material broken out.

Manhole covers to be readjusted and made good where necessary. Damaged kerbs caused by planing to be removed and replaced.

A bond coat shall be applied to all surfaces prior to overlaying. Bond coat to comply with BS EN 594987 and MCHW Vol 1 Series 900 (2018) Cl 920. The surface shall be dry prior to application.

Regulating layer to be applied where necessary, HRA 50/10 reg (regulating mixture).


Asphalt reinforcement layer (CE Marked) to be laid along trenches (min lap 600mm over existing). Asphalt reinforcement to be laid in conjunction with bond coat (in accordance with manufacturers guidelines) prior to laying surface course.


50mm HRA Surface Course (HRA 30/14 F) applied

White lining with thermoplastic paint to BS 3262 and NCC requirements

SITE ENTRANCE WORKS



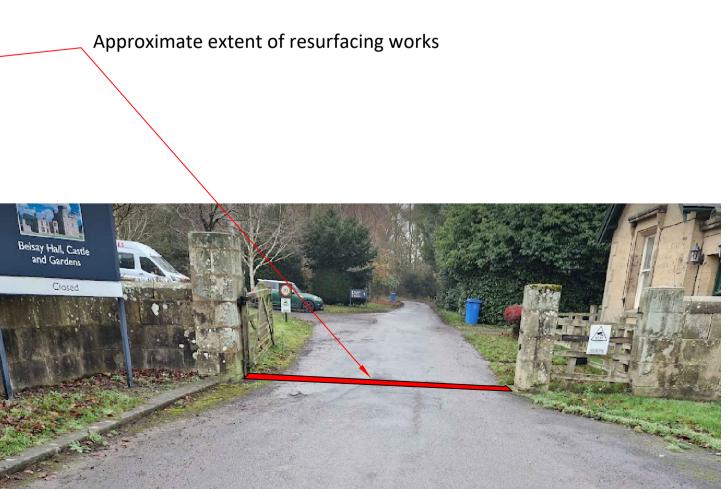

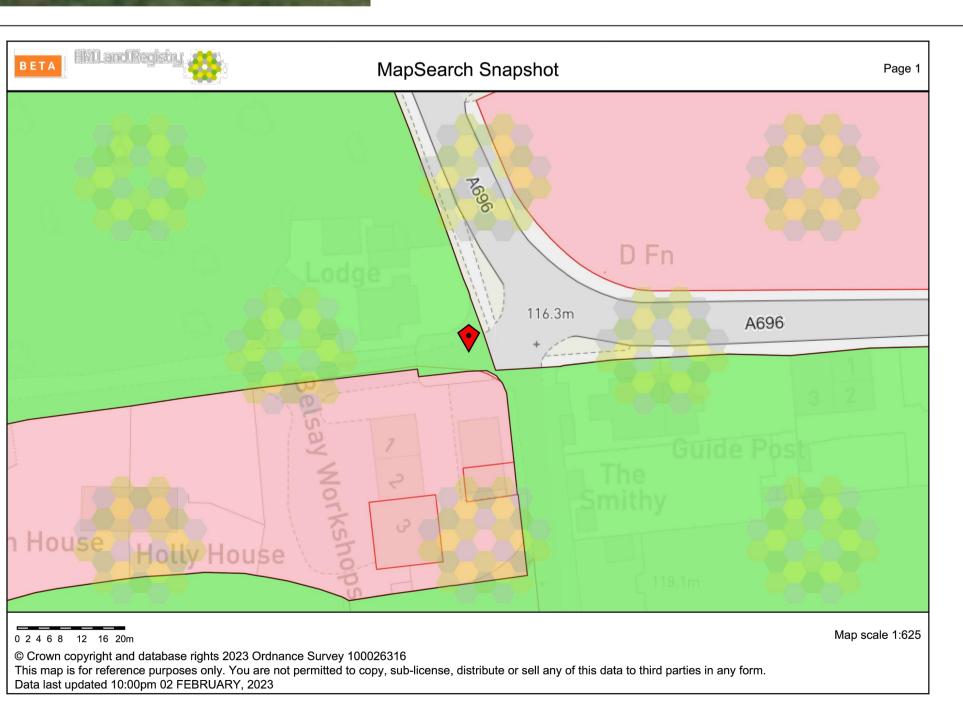

LAND REGISTRY PLAN

Do Not Scale **DESIGN REVIEW** Checked by: Design review by: Residual hazards:

> Health, Safety & Environmental Notes <a>!\]

All works within adopted highway to meet Northumberland County Council highways specification

21.03.23 Initial Issue Web: www.adeptcsce.com

Email: inbox@adeptcsce.com

1912 Mills, Sunny Bank Mills, Tel: 0113 239 4518 (Head Office) Farsley, Leeds, LS28 5UJ Tel: 0113 239 4518

Belsay Hall, Northumberland

Estate Entrance Works

English Heritage

Preliminary 00.18149

00.18149-ACE-00-ZZ-DR-C-0191 P1