



Geo-Environmental Consultants

**SITE B,
GLASGOW BUSINESS PARK,
GLASGOW**

**PHASE I
COAL MINING
RISK ASSESSMENT**

DATE

April 2021

CLIENT

Hermiston Securities

APPROVED BY

Patrick Barry
Director

Hermiston Securities

**Site B,
Glasgow Business Park,
Glasgow**

Phase I Coal Mining Risk Assessment

Date of Issue: April 2021

Report Status: First Edition

Project Reference: PI7/478

Prepared by: Scott Armstrong – Geo-Environmental Scientist

Reviewed and Approved by: Patrick Barry – Director

Mason Evans Partnership Limited

The Piazza

95 Morrison Street

GLASGOW

G5 8BE

CONTENTS

	PAGE NO
EXECUTIVE SUMMARY	
1.0 INTRODUCTION	1
1.1 General	1
1.2 General Methodology	1
1.3 Context	1
2.0 SITE LOCATION AND DESCRIPTION	4
2.1 Site Details	4
2.2 Local Context	4
3.0 HISTORICAL BACKGROUND	5
3.1 General	5
3.2 Historical Background	5
4.0 SITE GEOLOGY AND MINING	7
4.1 Superficial Soils	7
4.2 Solid Geology	7
4.3 Mining History	7
4.4 Mineral Investigations (2018)	14
4.5 Conclusions	15
5.0 MINING	17
5.1 Past Mining	17
5.2 Present Mining	17
5.3 Mining Methods	17
5.4 General Principles of Surface Instability for Underground Mine Workings	18
5.5 Surface Instability Due to Underground Mining	18
5.6 Mine Entries	18
5.7 Opencast Mining	18
5.8 Potential for Future Mineral Extraction	18
5.9 Mine Gas	18
6.0 IDENTIFICATION AND ASSESSMENT OF SITE-SPECIFIC COAL MINING RISKS	19
6.1 Mason Evans Risk Assessment	19
6.2 Conclusions	20

LIST OF DRAWINGS

	PAGE NO
Drawing No. P17/478/CMRA/F/01	2
Drawing No. P17/478/CMRA/F/02	3
Drawing No. P17/478/CMRA/F/03	8
Drawing No. P17/478/CMRA/F/04	9
Drawing No. P17/478/CMRA/F/05	10
Drawing No. P17/478/CMRA/F/06	12
Drawing No. P17/478/CMRA/F/07	13
Drawing No. P17/478/CMRA/F/08	16
Location of Mineral Bores	

APPENDICES

Appendix A	Historical Ordnance Survey Maps
Appendix B	Historical Borehole Records
Appendix C	Information from The Coal Authority
Appendix D	Records of Mineral Borehole Logs

EXECUTIVE SUMMARY

We understand that Hermiston Securities (the Client) are proposing the development of a new commercial/industrial unit with associated areas of parking and road infrastructure. at a site located at 'Site B, Glasgow Business Park, Glasgow'.

The site lies within an area defined by The Coal Authority as a 'Development High Risk Area', Glasgow City Council have advised that a Coal Mining Risk Assessment Report is required to be submitted in support of the planning application. We were appointed by the Client to undertake the necessary examinations and this report provides an account of our assessments with advice on the risks to the proposed development from mining related impacts.

The report presents available information on the geological and mining conditions within the site. The object of the report is to demonstrate to Glasgow City Council that the application site is, or can be made, safe and stable to meet the requirements of national planning policy with regard to development on unstable land.

The report has established:

- a) The Virgin Coal (0.64 m thick) has been worked at minimum depths of approximately 17 m bgl. However, as rockhead was encountered at 5 m bgl, we consider that there is sufficient rock cover (minimum of 12.0 m) to ensure no future ground stability issues.
- b) The younger Glasgow Splint Coal (0.60 m thick) underlies the site at minimum depths of 12 m bgl. There was no indication that this coal seam had been worked below the site. However, if unrecorded workings were to exist within this seam, given the depth to rockhead below the northern area (i.e. 5 m) plus the seam thickness, we consider that there would still be sufficient rock cover to ensure no future ground stability issues. It is also considered that the adjacent shallow igneous intrusion may have burnt this coal seam to remove any economic value.
- c) The Coal Authority did not record any mine entries within the site or immediate surrounding area. Note that as in all areas of historical mining, unrecorded mine entries could still exist.
- d) Based on our desktop researches and intrusive mineral investigations, we consider that shallow mine workings and recorded mine entries do not pose a risk to future development within the site.

1.0 INTRODUCTION

1.1 General


- 1.1.1 We understand that Hermiston Securities (the Client) are proposing the development of a new commercial/industrial unit with associated areas of parking and road infrastructure at a site titled 'Site B, Glasgow Business Park, Glasgow' (refer to Drawing Nos. P17/478/CMRA/F/01 and 02). In relation to the proposed development, the Client has requested a Coal Mining Risk Assessment be undertaken in support of the development. As a specialist geo-environmental consultancy firm with experience of impacts related to shallow mine workings, we were subsequently requested to advise accordingly.
- 1.1.2 The purpose of the Coal Mining Risk Assessment Report is to present available information on the coal mining issues which are relevant to the site, and to identify and assess any potential risk to the proposed development, the result of Coal Mining.
- 1.1.3 The object of the report is to demonstrate that the application site is or can be made safe and stable to meet the requirements of national planning policy with regard to development on unstable land.
- 1.1.4 This report provides the findings of our examinations of the site, which have been based on researches of available geological and mining maps, plans and information provided by the Coal Authority. The scope of the investigations has been restricted to fulfil the necessary enquiry regarding the mining context of the site alone. Whilst in the course of our examinations we have identified other aspects of the geology relevant to the development, we anticipate that these will be considered in separate investigations dedicated to the wider geo-environmental impacts.

1.2 General Methodology

- 1.2.1 Our examinations involved researches of various published documents on the geological and historical background of the site, in-house sources and reports, and consultations with The Coal Authority. In assessing the potential site instability impacts, we considered typical mine stability assessment criteria and have reviewed the area relative to our expectations of the geological conditions. Our confidence on the geology and the potential impacts of mining are discussed relative to the quality of the data available to us, with recommendations provided on the scope of future intrusive investigations (if required).

1.3 Context

- 1.3.1 It should be recognised that the report is prepared in accordance with current recommended practice and existing legislation.

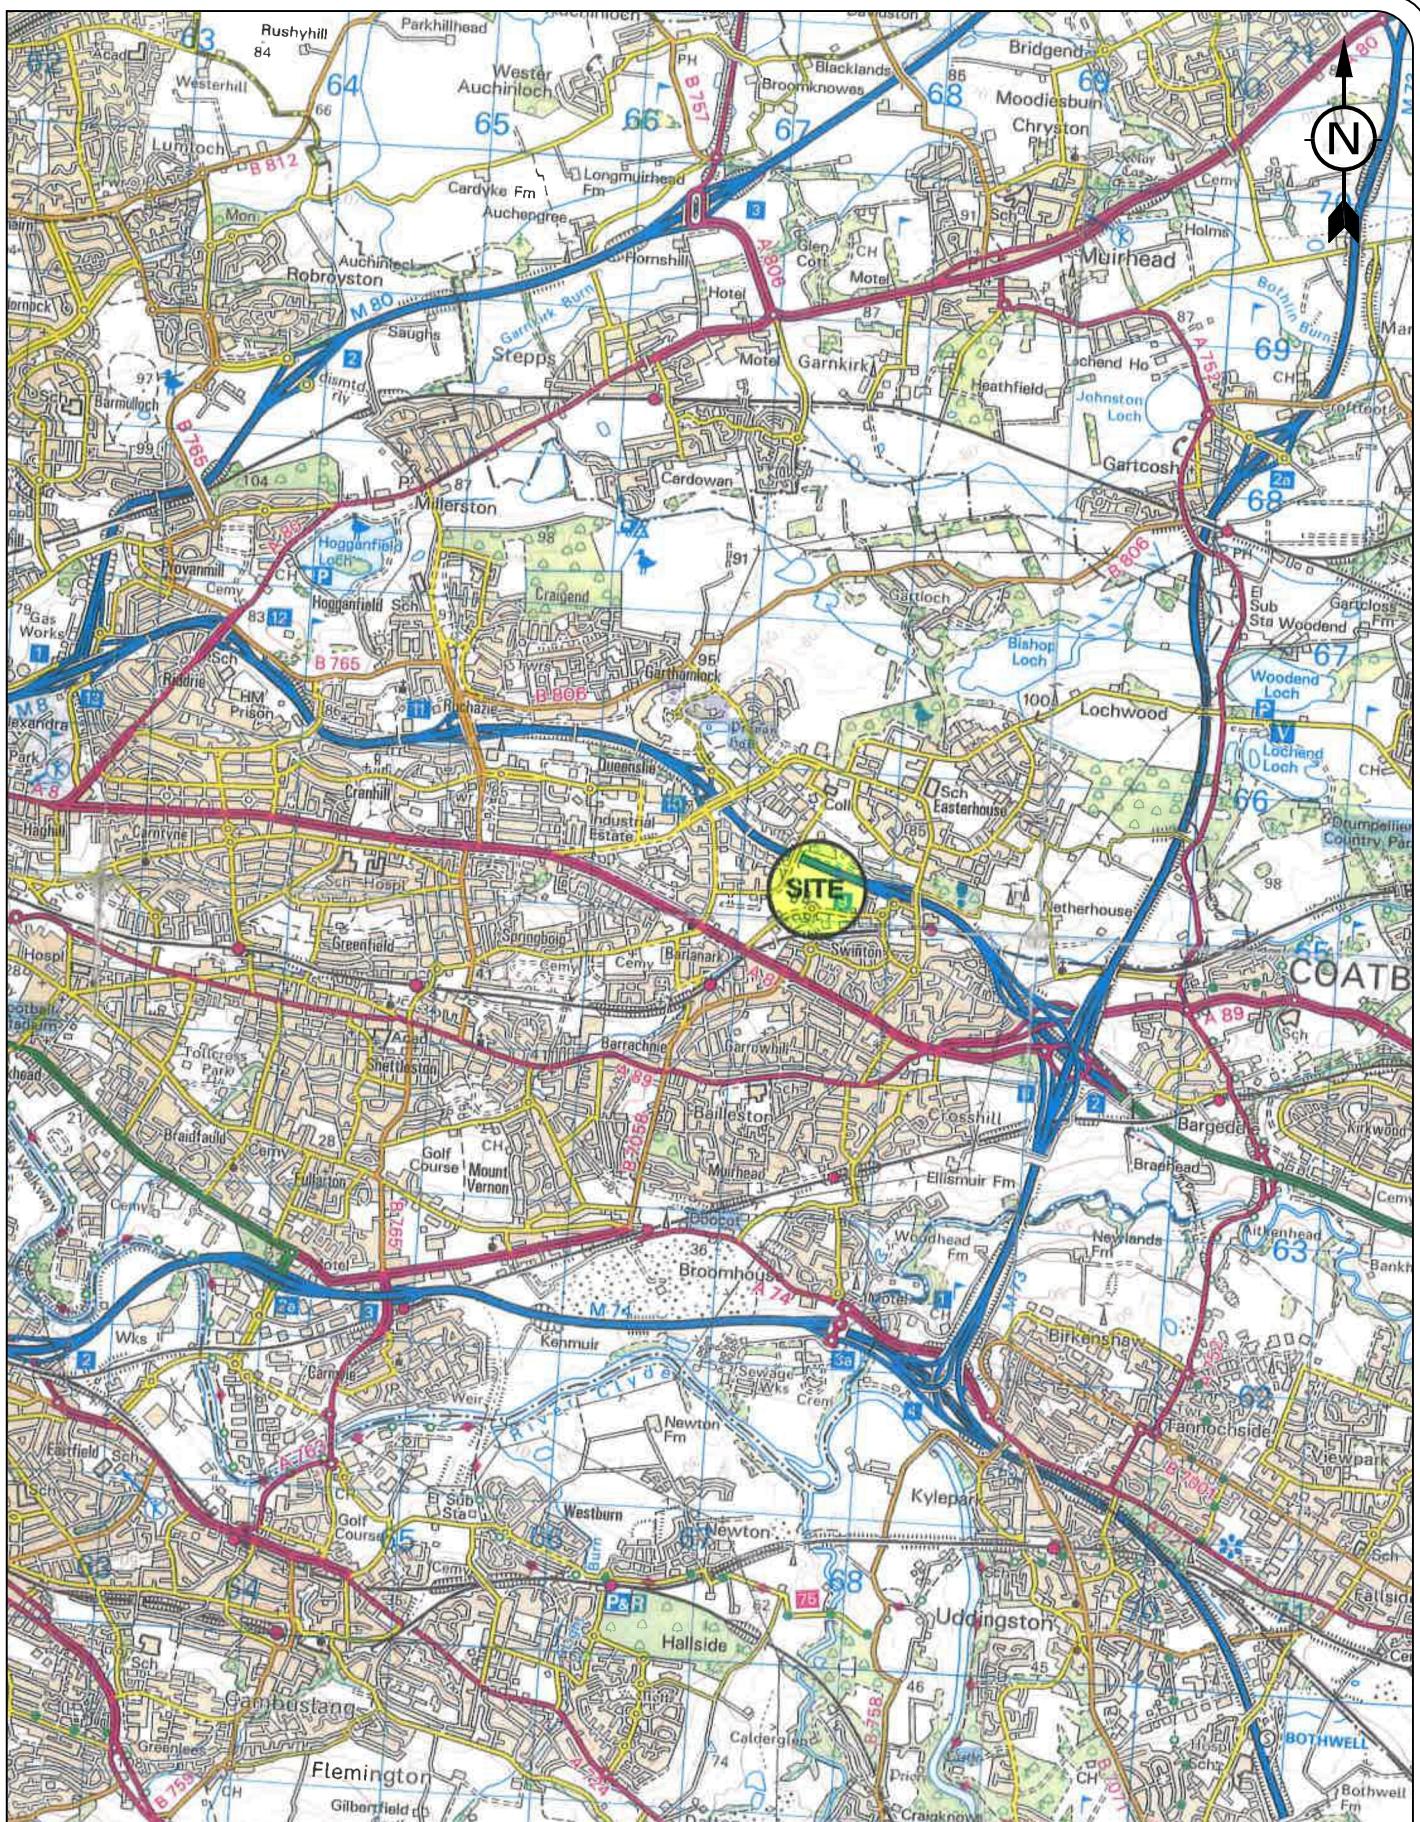

**MASON
EVANS**

Geo-Environmental Consultants

t: 0141 420 2025 e: mail@masenevans.co.uk

The Piazza, 95 Morrison Street, Glasgow, G5 8BE

client details:

HERMISTON SECURITIES
MUIR HOUSE, BELLENOWES INDUSTRIAL ESTATE
FIFE, KY11 1HY

project title:

SITE B, GLASGOW BUSINESS PARK
GLASGOW

drawing title:

SITE LOCATION PLAN

project no:
PI7/478


drawing no:
PI7/478/CMRA/R/F/01

revision:
date: 12.04.21

drawn by:
RC

approved by:
PB

scale:
1:50,000

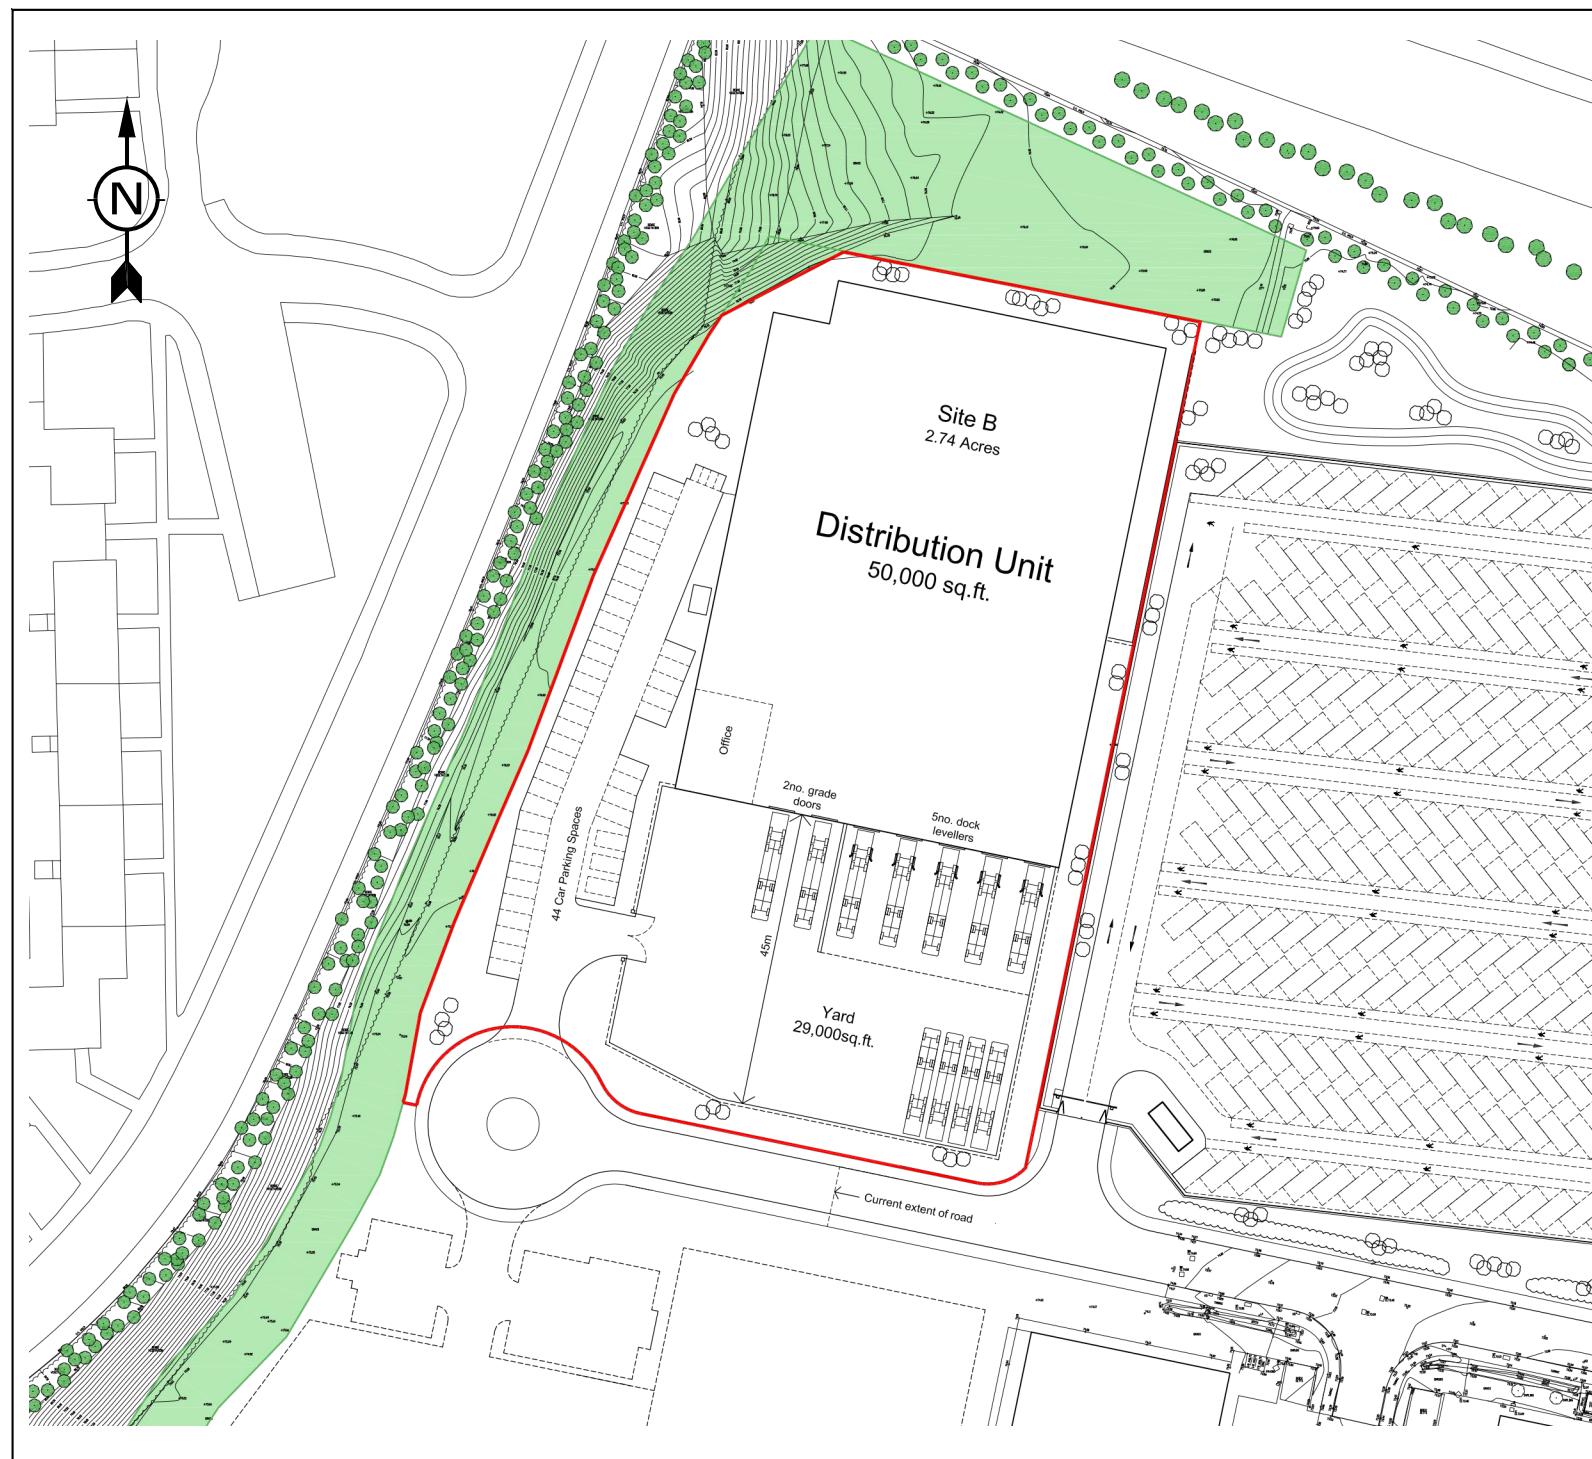

NO

Site boundary

Note:
Proposed development plan supplied by Struer Consulting Engineers Ltd,
December 2020.

HERMISTON SECURITIES
MUIR HOUSE
BELLEKNOWES INDUSTRIAL ESTATE
FIFE, KY11 1HY

PROJECT TITLE

SITE B, GLASGOW BUSINESS PARK GLASGOW

PROPOSED DEVELOPMENT LAYOUT PLAN

DRAWN BY RC	CHK'D BY SA	APP'D BY PB	DATE 12.04.21	SCALE Not to Scale
PROJECT No. P17/478	DRAWING No.	P17/478/(CMRA/R/F/02)		
		REVISION		

The logo for Mason Evans consists of the company name in a large, bold, sans-serif font. The letters 'M' and 'E' are stylized with internal green triangles pointing upwards, while the remaining letters 'A', 'S', 'O', 'N' and 'V', 'A', 'N', 'S' are in dark blue.

2.0 SITE LOCATION AND DESCRIPTION

2.1 Site Details

2.1.1 The summary details of the site as understood from supplied survey information are as follows:

- Existing Site Name - Site B, Glasgow Business Park, Glasgow
- Local Authority - Glasgow City Council.
- Site Area - Approx. 1.55 Ha.
- Location - The site is located to the immediate south of the M8 motorway and to the north of Springhill Parkway.
- Current Usage - Unoccupied land.
- Topography - The ground level within the site was noted to be gently sloping from north (75.88 mAOD) to south (74.42 mAOD)

2.2 Local Context

2.2.1 The context of the site is indicated on Plate 01, which showed it to be bound by the M8 motorway to the north and commercial units to the south-east. Our recent walkover survey showed that the construction of a commercial warehouse was ongoing within the land to the immediate east. The main access route into the site was from Springhill Drive North located to the south, as shown below.

Plate 01 – Aerial Photograph of the Site (courtesy of Google Maps, approximately dated 2019)



3.0 HISTORICAL BACKGROUND

3.1 General

- 3.1.1 An examination of the past history of a site can often provide valuable information in relation to potential constraints to its development. In this particular instance, our focus has been to establish evidence of any mining within the site or its immediate environs. To facilitate these investigations past copies of Ordnance Survey maps and other historical data were examined dating back to the middle of the nineteenth century. It should be noted that considerable periods elapsed between successive Ordnance Survey map editions and the possibility that mining activities took place on the land in the intervening years and were not therefore recorded by the maps, cannot be discounted. In these circumstances, while we have tried to ascertain the complete record of the site history, the possibility that historical mining activities took place but were undisclosed by our researches, cannot be discounted.

3.2 Historical Background

- 3.2.1 A summary of the history of the site and surrounding area is presented in Table 01 below and a copy of the maps are included in Appendix A.

Table 01 – Summary of History (Ordnance Survey Map Records)

Ordnance Survey Map Edition (scale)	The Site	The Surrounding Area
1864 (1:0,560 scale)	<ul style="list-style-type: none"> The site was unoccupied land. 	<ul style="list-style-type: none"> Monkland Canal was located approximately 100 m to the north of the site, running in a north-west to south-east direction. East Hallhill cottages were located to the immediate south of the site. Hallhill Basin was located 50 m to the north-west. Occasional coal pits were recorded within a 1 km radius. The surrounding area generally comprised unoccupied land with occasional residential properties, schools and roads.
1899 (1:0,560 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> Railway line was developed approximately 250 m to the south running east to west. Development within Easterhouse approximately 350 m to the east. Expansion of Ballieston 1 km to the south-east. Springhill Nurseries were developed 500 m to the south of the site.
1914 (1:0,560 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> No significant changes were recorded.
1922 (1:10,560 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> Wilderness Plantation located within forested area approximately 100 m to the north. No other significant changes were recorded.
1938 (1:10,560 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> Edinburgh Road developed 500 m to the south running north-west to south-east. Significant expansion within Ballieston to the south including housing, roads and schools.
1957 - 1958 (1:10,000 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> Monkland Canal disused. Residential development approximately 100 m to the west. Slight expansion to the settlement of Swinton to the south-east.
1967 (1:10,000 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> Significant residential development to the west and north of the site (Easterhouse) as well as schools and road networks.
1980 - 1982 (1:10,000 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> M8 motorway under construction in place of the former canal to the north. Further expansion to Easterhouse.

Table 01 – Summary of History (Ordnance Survey Map Records) continued...

1994 – 1996 (1:10,000 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> M8 constructed to the north. Slight residential expansion to the south.
1999 (1:10,000 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> No significant changes were recorded.
2018 (1:10,000 scale)	<ul style="list-style-type: none"> No changes were recorded. 	<ul style="list-style-type: none"> Industrial units developed to the immediate south of the site area. Several other units developed across Springhill Parkway to the south. Further (presumed office) development 300 m to the east of the site.

3.2.2 In summary, no evidence of mining or quarrying activities were recorded within the site. However, there was evidence of mineral extraction within the surrounding area (i.e. old coal pits and shafts).

4.0 SITE GEOLOGY AND MINING

4.1 Superficial Soils

- 4.1.1 Anecdotal evidence from historical ground investigations (Ref: Thorburn Colquhoun, 1997) suggests the potential for fill material to have been deposited in an engineered manner within the site (up to 3.50 m thick).
- 4.1.2 The BGS Drift Lithology Maps (Drawing Nos. P17/478/CMRA/R/F/04 and 05) indicated the site to be underlain by SAND and GRAVEL deposits with MADE GROUND recorded along the northern site boundary. The thickness of these deposits was noted to be between 5 m and 10 m.
- 4.1.3 Historical boreholes from within the site and immediate surrounding area recorded SAND and GRAVEL underlain by GLACIAL TILL, proven to depths of between 2.50 m bgl (to the north) and 14.20 m bgl (to the south-east). Bedrock was generally described as SANDSTONE or MUDSTONE with seams of COAL plus igneous (dolerite) intrusions.
- 4.1.4 Historical borehole information is included in Appendix B.

4.2 Solid Geology

- 4.2.1 The BGS Solid Map (Drawing No. P17/478/CMRA/F/05) indicated the underlying solid strata to belong to the Carboniferous aged Lower and Middle Coal Measures, comprising sequences of SANDSTONE, SILTSTONE and MUDSTONE with seams of COAL, recorded to be dipping to the south at an unknown angle.
- 4.2.2 The BGS map indicated an igneous intrusion comprising dolerite outcropping to the immediate north-east of the site.
- 4.2.3 The BGS Map conjectured the 'Virgin Coal' and the 'Glasgow Splint Coal' to outcrop in an east-west direction approximately 40 m to the north of site, dipping to the south (i.e. below the site). Based on the information from The Coal Authority report and mine abandonment plans (Appendix C) the thicknesses of these seams are recorded to be 0.64 m (Virgin) and 0.60 m (Splint), respectively.
- 4.2.4 The BGS Solid Map also conjectured the 'Glasgow Main Coal' / 'Pytshaw Coal' to outcrop in an east-west direction, 100 m to the south of the site, dipping to the south (i.e. away from the site).

4.3 Mining History

- 4.3.1 According to The Coal Authority Interactive Viewer map (refer to Appendix C), the site is located within a 'Development High Risk Area'.
- 4.3.2 In April 2021, MEP received a report from The Coal Authority (refer to Appendix C), which stated that the site is within a surface area that could be affected by underground mining in 2 seams of coal from shallow (i.e. the Virgin Coal) to 122 m (i.e. the Kiltongue Coal) depth, last worked in 1885.