



Your ref DLG-SN-20-002038

Our ref ZBM07026GLOB

tel: 020 8208 0343

email: mon@geo-serv.com

360Globalnet Ltd
 Regus House, Herald Way,
 Pegasus Business Park,
 Castle Donnington,
 Leicestershire
 DE74 2TZ

Issue date: 24/04/2021

Monitoring Visit: 4 of 4

Monitoring Plus Report

Owners name	Mrs. Julia Oakley	Suspected cause	To be advised	Monitoring type	Levels & Cracks
Address	9 Rudlands Ipswich Suffolk IP8 3RQ	Principal area of damage	To be advised	Installed	24/10/2020
Home phone		Damage category	To be advised	No of visits / weeks	4 @ 8.7
Work phone		Surface geology	To be advised	Completion date	
Correspondence address		Feedback from last visit	0		
Comment	Max movement 23.7 Focal area 24/4/21 - Visits completed as instructed.	Sketch showing location of monitoring points			
		<p>Points 7 & 8 Long screws</p> <p>Conservatory</p> <p>Garage</p> <p>Crack B</p> <p>Crack A</p> <p>EXT</p> <p>No 9</p> <p>1 (ref)</p> <p>Front Elevation</p>			

Level monitoring results

Survey: By: Date:	1 CV 24/10/2020		2 CV 23/12/2020		3 CV 27/02/2021		4 CV 24/04/2021		5	
Point ID	levels mm	chngs mm	levels mm	chngs mm	levels mm	chngs mm	levels mm	chngs mm	levels mm	chngs mm
1	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0		
2	1007.17	0.0	1007.32	0.1	1007.46	0.3	1007.38	0.2		
3	1004.08	0.0	1005.02	0.9	1005.26	1.2	1004.88	0.8		
4	996.67	0.0	998.99	2.3	999.26	2.6	998.95	2.3		
5	990.52	0.0	994.79	4.3	995.00	4.5	994.98	4.5		
6	993.63	0.0	998.99	5.4	999.30	5.7	998.65	5.0		
7	963.16	0.0	984.60	21.4	986.84	23.7	986.67	23.5		
8	806.36	0.0	824.94	18.6	825.78	19.4	825.61	19.2		
9	738.12	0.0	742.22	4.1	742.41	4.3	741.93	3.8		
10	1093.81	0.0	1103.66	9.9	1103.97	10.2	1103.68	9.9		
11	1119.77	0.0	1122.52	2.8	1122.39	2.6	1121.88	2.1		
12	1085.02	0.0	1099.04	14.0	1099.48	14.5	1099.25	14.2		
13	1180.03	0.0	1189.74	9.7	1190.06	10.0	1189.51	9.5		

closing error (mm)



0.30

0.44

-0.09

-0.01


0.00

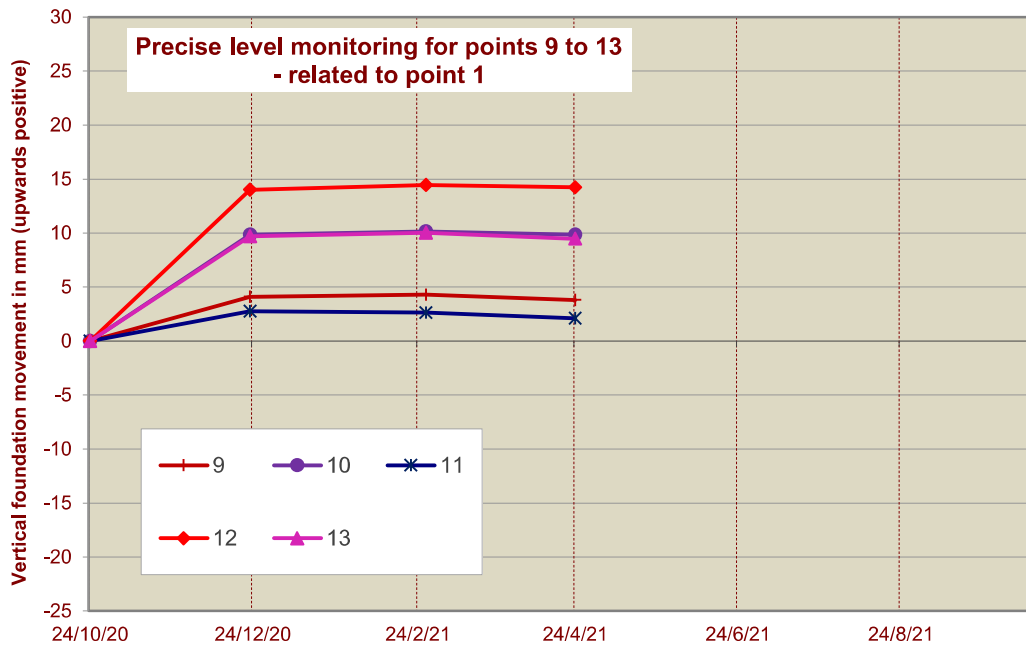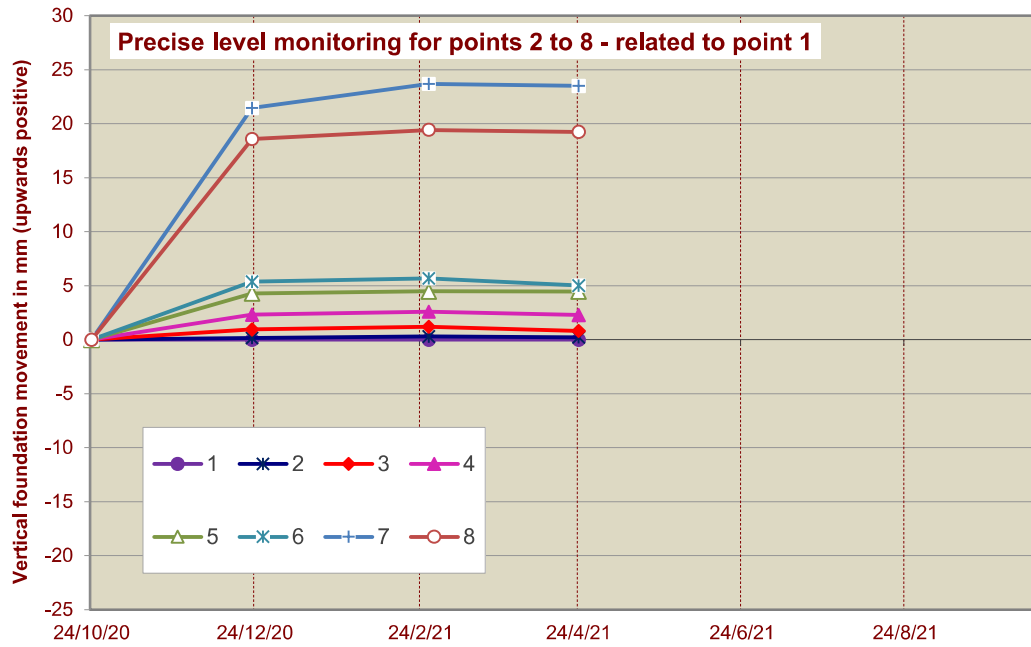

Crack monitoring results

Survey: By: Date:		1 CV 24/10/2020	2 CV 23/12/2020	3 CV 27/02/2021	4 CV 24/04/2021	5	
Point ID	Initial widths mm	<i>chngs</i> <i>mm</i>	<i>chngs</i> <i>mm</i>	<i>chngs</i> <i>mm</i>	<i>chngs</i> <i>mm</i>	<i>chngs</i> <i>mm</i>	
A (horiz)	4.5	100.91	0.0	99.15	-1.8	#N/A	#N/A
A (diag)		129.80	0.0	128.42	-1.4	#N/A	#N/A
A (chck)		77.13	0.0	77.10	0.0	#N/A	#N/A
B (horiz)	2.8	78.66	0.0	77.80	-0.9	#N/A	#N/A
B (vert)		73.68	0.0	73.66	0.0	#N/A	#N/A
B (chck)		108.29	0.0	108.29	0.0	#N/A	#N/A

A (horiz)	Demec triplet, internal, crack below landing window
B (horiz)	Demec triplet, internal, crack above landing window

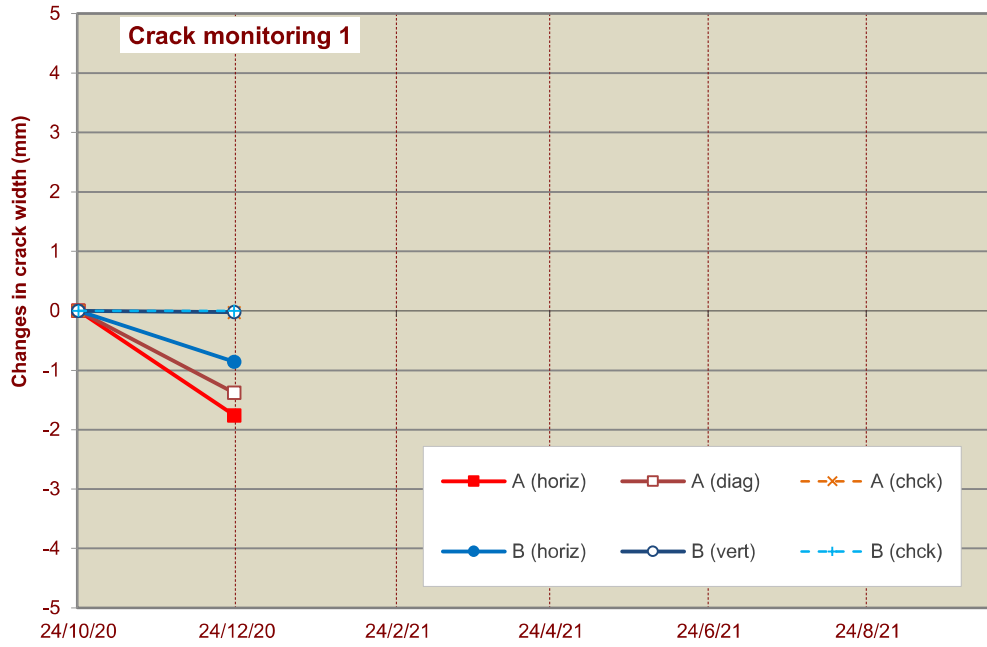

Date 24/04/2021

Comment

