



Your ref DLG-SN-20-002038

Our ref **ZBM07026GLOB**

tel: **020 8208 0343**

email: **mon@geo-serv.com**

360Globalnet Ltd
 Regus House, Herald Way,
 Pegasus Business Park,
 Castle Donnington,
 Leicestershire
 DE74 2TZ

Issue date: **23/12/2020**

Monitoring Visit: **2** of **4**

Monitoring Plus Report

Owners name	Mrs. Julia Oakley	Suspected cause	To be advised	Monitoring type	Levels & Cracks
Address	9 Rudlands Ipswich Suffolk IP8 3RQ	Principal area of damage	To be advised	Installed	24/10/2020
Home phone		Damage category	To be advised	No of visits / weeks	4 @ 8.7
Work phone		Surface geology	To be advised	Completion date	
Correspondence address		Feedback from last visit	0		
Comment	Max movement 21.4 Focal area 0	Sketch showing location of monitoring points			
		<p>Points 7 & 8 Long screws</p> <p>Conservatory</p> <p>Garage</p> <p>Crack B</p> <p>Crack A</p> <p>EXT</p> <p>No 9</p> <p>Front Elevation</p>			

Level monitoring results

Survey: By: Date:	1 CV 24/10/2020		2 CV 23/12/2020		3		4		5	
Point ID	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
1	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0
2	1007.17	0.0	1007.32	0.1						
3	1004.08	0.0	1005.02	0.9						
4	996.67	0.0	998.99	2.3						
5	990.52	0.0	994.79	4.3						
6	993.63	0.0	998.99	5.4						
7	963.16	0.0	984.60	21.4						
8	806.36	0.0	824.94	18.6						
9	738.12	0.0	742.22	4.1						
10	1093.81	0.0	1103.66	9.9						
11	1119.77	0.0	1122.52	2.8						
12	1085.02	0.0	1099.04	14.0						
13	1180.03	0.0	1189.74	9.7						

closing error (mm)



0.30

0.44

0.00

0.00



0.00

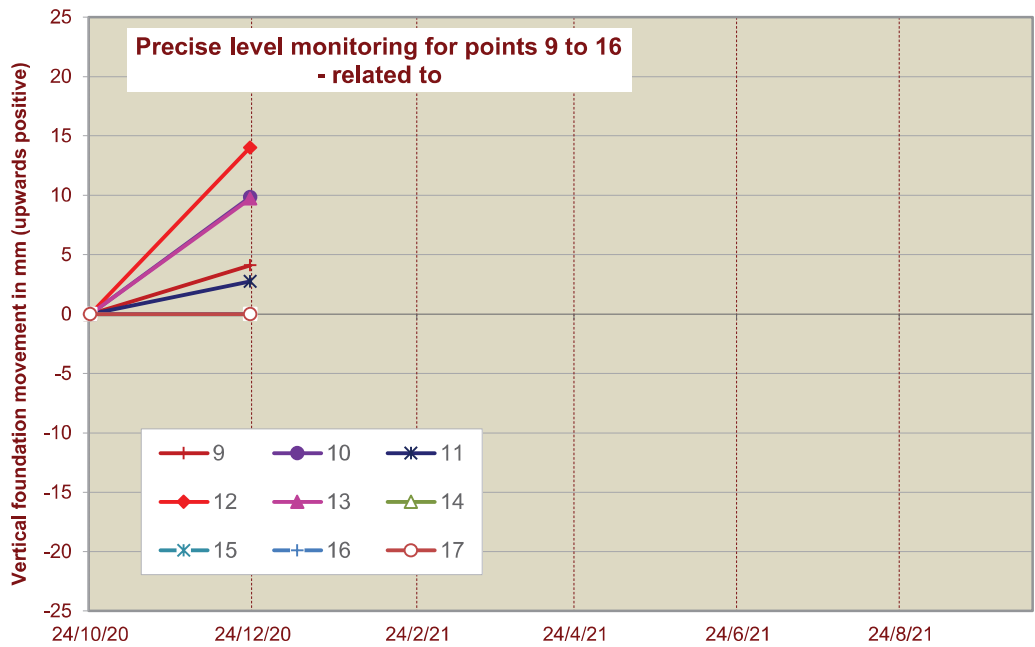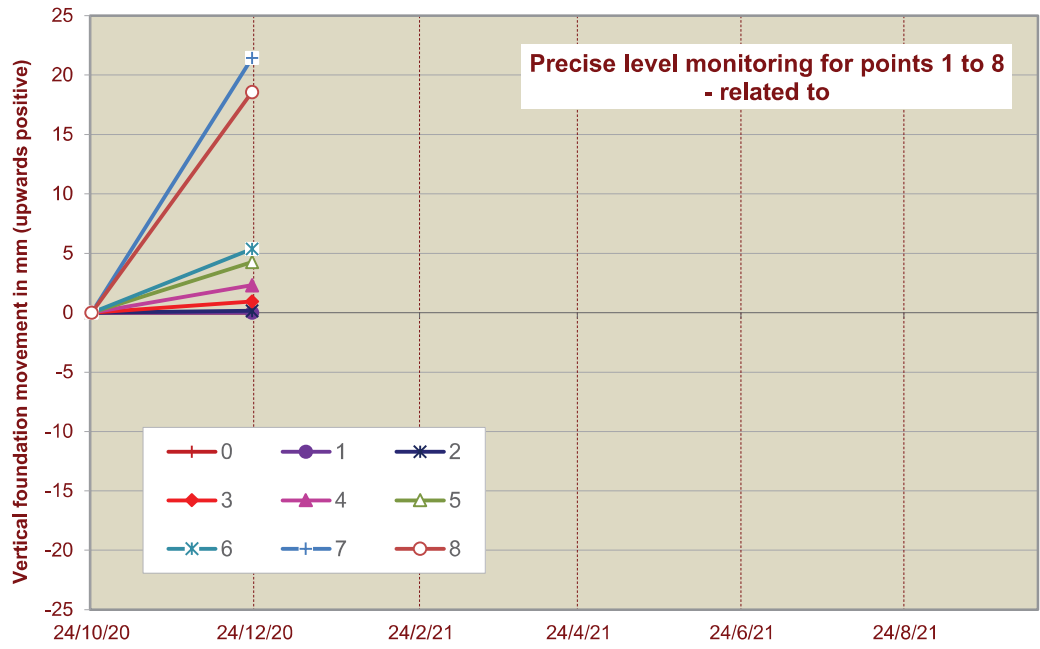

Crack monitoring results

Survey: By: Date:		1 CV 24/10/2020		2 CV 23/12/2020		3	4	5
Point ID	Initial widths mm		<i>chngs mm</i>		<i>chngs mm</i>	<i>chngs mm</i>	<i>chngs mm</i>	<i>chngs mm</i>
A (horiz)	4.5	100.91	0.0	99.15	-1.8			
A (diag)		129.80	0.0	128.42	-1.4			
A (chck)		77.13	0.0	77.10	0.0			
B (horiz)	2.8	78.66	0.0	77.80	-0.9			
B (vert)		73.68	0.0	73.66	0.0			
B (chck)		108.29	0.0	108.29	0.0			

A (horiz)	Demec triplet, internal, crack below landing window
B (horiz)	Demec triplet, internal, crack above landing window

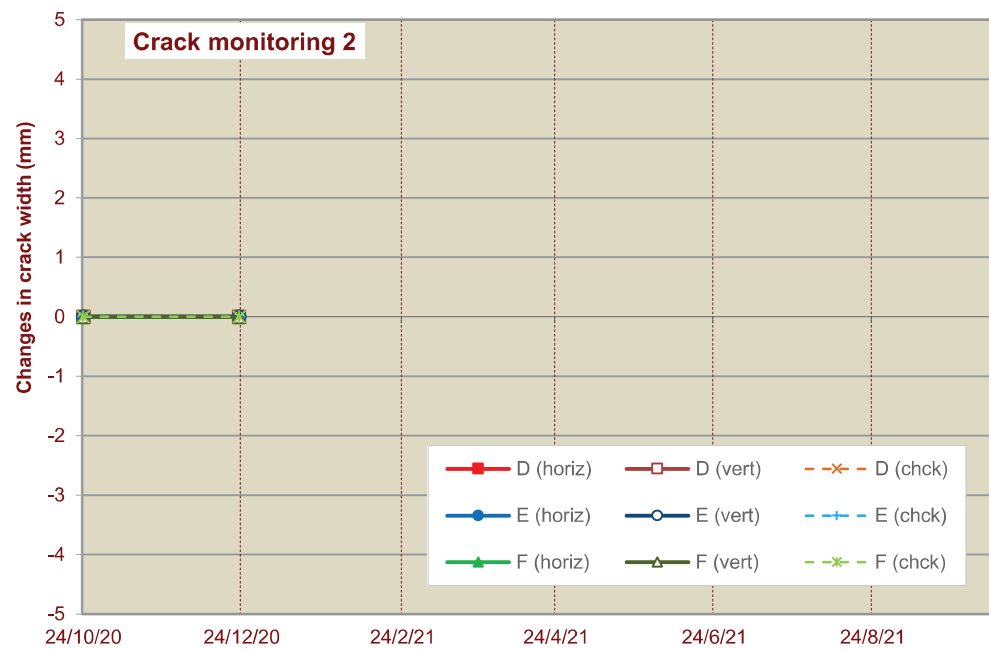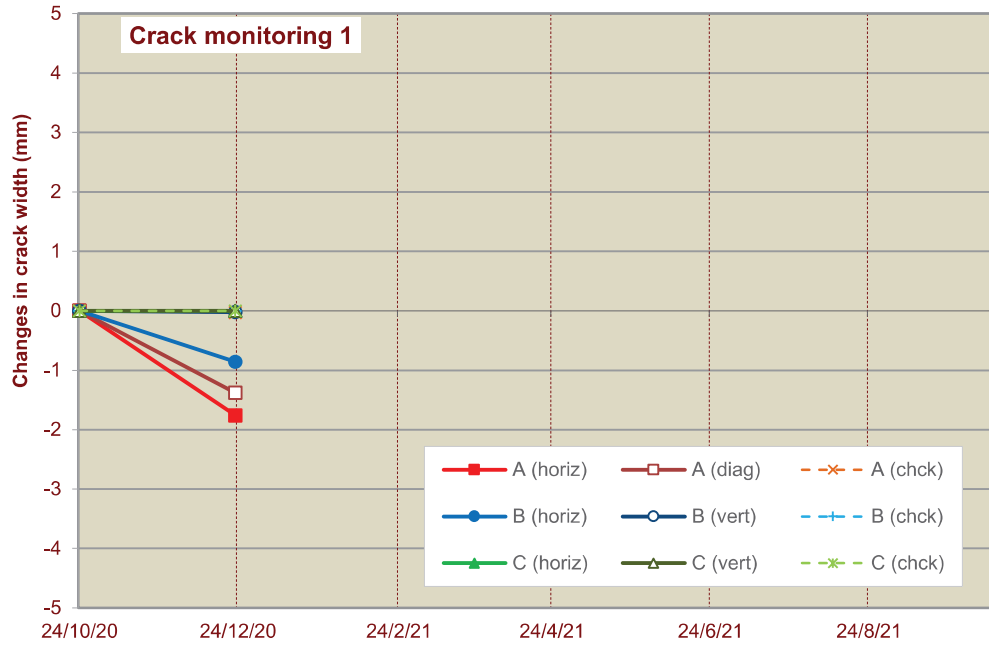

Date 23/12/2020

Comment

