

Your ref DLG-SN-20-002038

Our ref ZBM07026GLOB

tel: 020 8208 0343

email: mon@geo-serv.com

360Globalnet Ltd
Regus House, Herald Way,
Pegasus Business Park,
Castle Donnington,
Leicestershire
DE74 2TZ

Issue date: 27/02/2021

Monitoring Visit: 3 of 4

Monitoring Plus Report

Owners name	Mrs. Julia Oakley	Suspected cause	To be advised	Monitoring type	Levels & Cracks
Address	9 Rudlands Ipswich Suffolk IP8 3RQ	Principal area of damage	To be advised	Installed	24/10/2020
		Damage category	To be advised	No of visits / weeks	4 @ 8.7
		Surface geology	To be advised	Completion date	
		Feedback from last visit	0		
Home phone		Sketch showing location of monitoring points			
Work phone					
Correspondence address					
Comment					
Max movement	23.7				
Focal area					
	0				

Level monitoring results

Survey:	1		2		3		4		5	
By:	CV		CV		CV					
Date:	24/10/2020		23/12/2020		27/02/2021					
Point ID	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
1	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0
2	1007.17	0.0	1007.32	0.1	1007.46	0.3				
3	1004.08	0.0	1005.02	0.9	1005.26	1.2				
4	996.67	0.0	998.99	2.3	999.26	2.6				
5	990.52	0.0	994.79	4.3	995.00	4.5				
6	993.63	0.0	998.99	5.4	999.30	5.7				
7	963.16	0.0	984.60	21.4	986.84	23.7				
8	806.36	0.0	824.94	18.6	825.78	19.4				
9	738.12	0.0	742.22	4.1	742.41	4.3				
10	1093.81	0.0	1103.66	9.9	1103.97	10.2				
11	1119.77	0.0	1122.52	2.8	1122.39	2.6				
12	1085.02	0.0	1099.04	14.0	1099.48	14.5				
13	1180.03	0.0	1189.74	9.7	1190.06	10.0				

closing error (mm)



0.30

0.44

-0.09

0.00


0.00

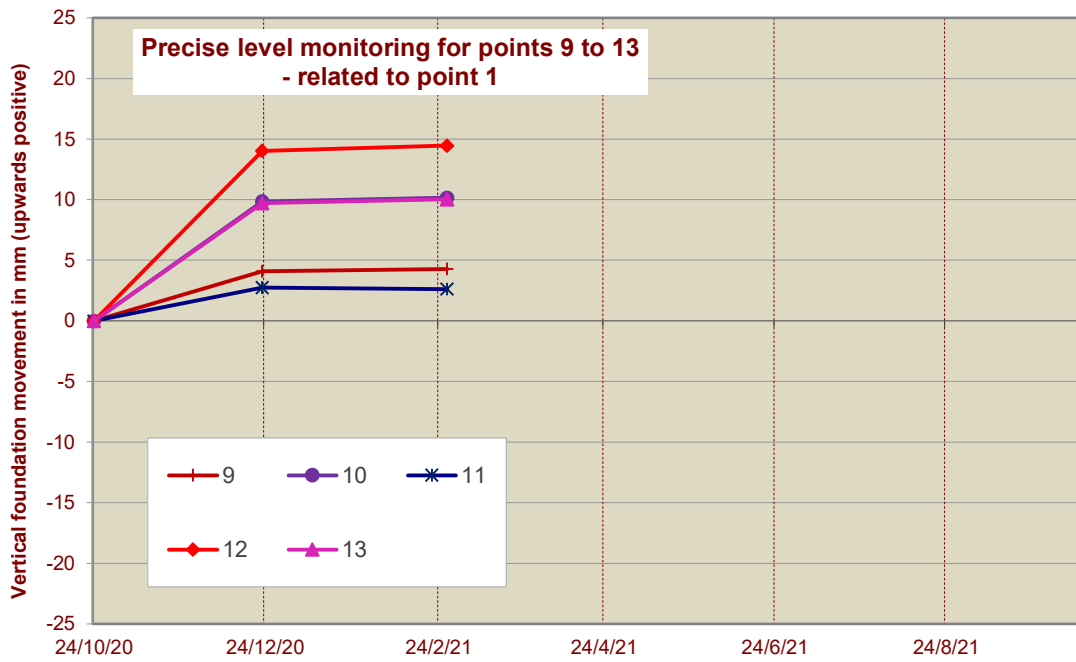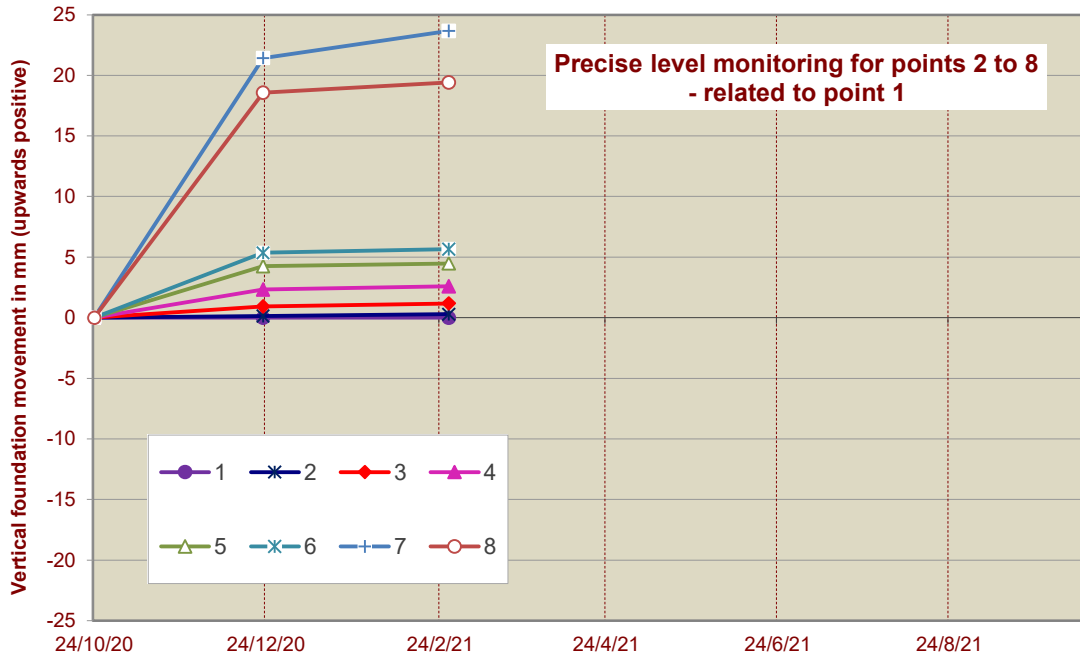

Crack monitoring results

Survey: By: Date:		1 CV 24/10/2020		2 CV 23/12/2020		3 CV 27/02/2021		4	5
Point ID	Initial widths mm		<i>chngs mm</i>		<i>chngs mm</i>		<i>chngs mm</i>	<i>chngs mm</i>	<i>chngs mm</i>
A (horiz)	4.5	100.91	0.0	99.15	-1.8		#N/A		
A (diag)		129.80	0.0	128.42	-1.4		#N/A		
A (chck)		77.13	0.0	77.10	0.0		#N/A		
B (horiz)	2.8	78.66	0.0	77.80	-0.9		#N/A		
B (vert)		73.68	0.0	73.66	0.0		#N/A		
B (chck)		108.29	0.0	108.29	0.0		#N/A		

A (horiz)	Demec triplet, internal, crack below landing window
B (horiz)	Demec triplet, internal, crack above landing window

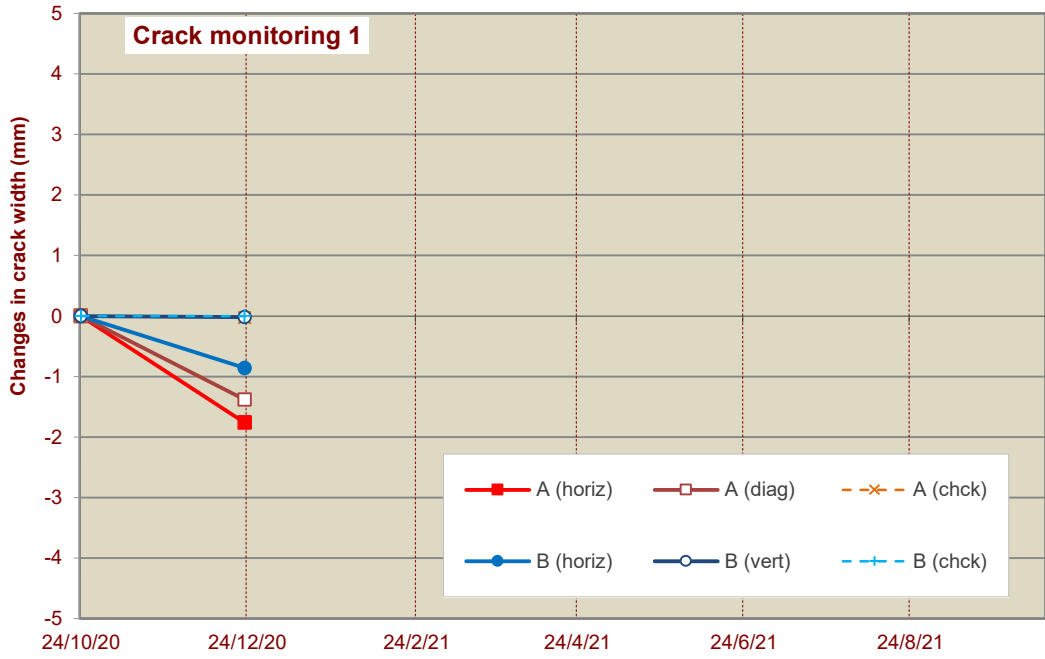

Date

27/02/2021

Comment



Crack A



Crack B

