

Your ref DLG-SN-20-002038


Our ref ZBM07026GLOB

Geo-Serv Limited  
17 Hoveden Road  
London NW2 3XE

tel: 020 8208 0343

email: mon@geo-serv.com

Subsidence  
Monitoring  
Services

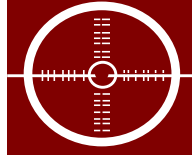

GEO-SERV

360Globalnet Ltd  
Regus House, Herald Way,  
Pegasus Business Park,  
Castle Donnington,  
Leicestershire  
DE74 2TZ

Issue date: 24/10/2020

Monitoring Visit: 1 of 4

### Monitoring Plus Report

Owners name	Mrs. Julia Oakley	Suspected cause	To be advised	Monitoring type	Levels & Cracks
Address	9 Rudlands Ipswich Suffolk  IP8 3RQ	Principal area of damage	To be advised	Installed	24/10/2020
Home phone		Damage category	To be advised	No of visits / weeks	4 @ 8.7
Work phone		Surface geology	To be advised	Completion date	
Correspondence address		Feedback from last visit		Status	new
Comment	Max movement 0.0 Focal area	Sketch showing location of monitoring points			
		<p style="text-align: center;">Front Elevation</p>			

Level monitoring results

Survey: By: Date:	1 CV 24/10/2020		2		3		4		5	
Point ID	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
1	1000.00	<b>0.0</b>	1000.00	<b>0.0</b>	1000.00	<b>0.0</b>	1000.00	<b>0.0</b>	1000.00	<b>0.0</b>
2	1007.17	<b>0.0</b>								
3	1004.08	<b>0.0</b>								
4	996.67	<b>0.0</b>								
5	990.52	<b>0.0</b>								
6	993.63	<b>0.0</b>								
7	963.16	<b>0.0</b>								
8	806.36	<b>0.0</b>								
9	738.12	<b>0.0</b>								
10	1093.81	<b>0.0</b>								
11	1119.77	<b>0.0</b>								
12	1085.02	<b>0.0</b>								
13	1180.03	<b>0.0</b>								

closing error (mm)

0.30

0.00

0.00

0.00

0.00

### Crack monitoring results

Survey: By: Date:		1 CV 24/10/2020		2	3	4	5
Point ID	Initial widths mm		<i>chngs mm</i>	<i>chngs mm</i>	<i>chngs mm</i>	<i>chngs mm</i>	<i>chngs mm</i>
<b>A (horiz)</b>	4.5	100.91	<b>0.0</b>				
<b>A (diag)</b>		129.80	<b>0.0</b>				
<b>A (chck)</b>		77.13	<b>0.0</b>				
<b>B (horiz)</b>	2.8	78.66	<b>0.0</b>				
<b>B (vert)</b>		73.68	<b>0.0</b>				
<b>B (chck)</b>		108.29	<b>0.0</b>				

A (horiz)	Demec triplet, internal, crack below landing window
B (horiz)	Demec triplet, internal, crack above landing window

Date

24/10/2020

Comment



Crack A



Crack B

