

Monitoring Details

Provider Name:	My Home Needs Ltd	Monitoring Interval:	6 Weekly
Instruction Date:	19/05/2021	Number of Visits:	10
Reading Date:	01/03/2022	Visits Completed:	7
Date of Issue:	02/03/2022	Visits Outstanding:	3


Client Details

Client:	Sedgwick
Job Reference:	9255790

Monitored Address

Occupier:	Mr & Mrs Banthorpe
Address:	21 Freeman Avenue, Ipswich, IP6 0RZ
Telephone:	07837 435836

Site Plan

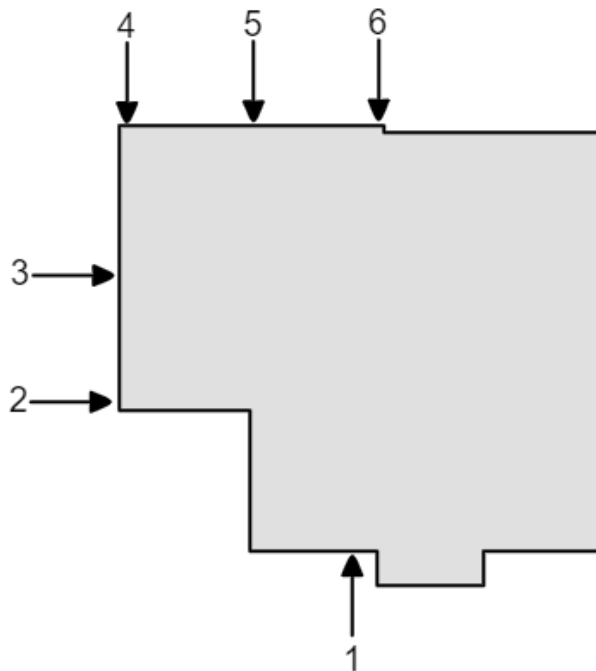

Level Readings (Displayed in metres)



Visits	1	2	3	4	5	6
02/06/2021	10.0000	9.9844	9.9828	9.9628	9.9782	9.9883
22/07/2021	10.0000	9.9840	9.9822	9.9620	9.9775	9.9884
03/09/2021	10.0000	9.9838	9.9796	9.9551	9.9756	9.9881
22/10/2021	10.0000	9.9829	9.9793	9.9533	9.9750	9.9873
30/11/2021	10.0000	9.9843	9.9804	9.9575	9.9759	9.9881
12/01/2022	10.0000	9.9839	9.9809	9.9603	9.9769	9.9880
01/03/2022	10.0000	9.9842	9.9814	9.9617	9.9778	9.9882

1: Datum is level station 1, it has an assumed value of 10,0000m. Secondary datum is a gully to the front of property. If this is not suitable please advise if a deep datum is required.


Level Readings Difference (Displayed in millimetres)

Visits	1	2	3	4	5	6
02/06/2021	N/A	N/A	N/A	N/A	N/A	N/A
22/07/2021	0.00 =	-0.40 ↓	-0.60 ↓	-0.80 ↓	-0.70 ↓	0.10 ↑
03/09/2021	0.00 =	-0.20 ↓	-2.60 ↓	-6.90 ↓	-1.90 ↓	-0.30 ↓
22/10/2021	0.00 =	-0.90 ↓	-0.30 ↓	-1.80 ↓	-0.60 ↓	-0.80 ↓
30/11/2021	0.00 =	1.40 ↑	1.10 ↑	4.20 ↑	0.90 ↑	0.80 ↑
12/01/2022	0.00 =	-0.40 ↓	0.50 ↑	2.80 ↑	1.00 ↑	-0.10 ↓
01/03/2022	0.00 =	0.30 ↑	0.50 ↑	1.40 ↑	0.90 ↑	0.20 ↑

Relative Movement (Relative Survey, for illustration purposes only)

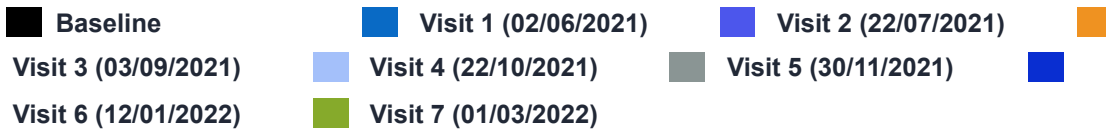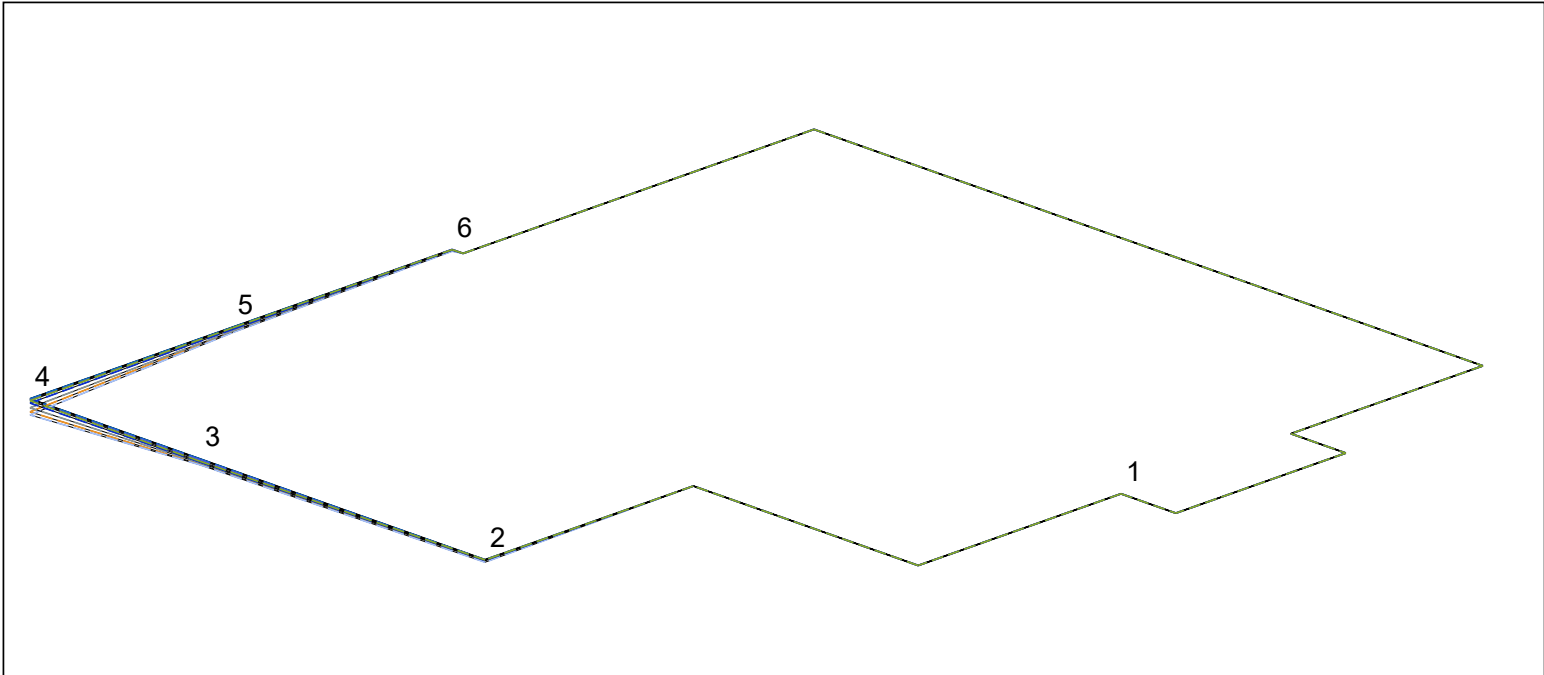

Level Readings Chart

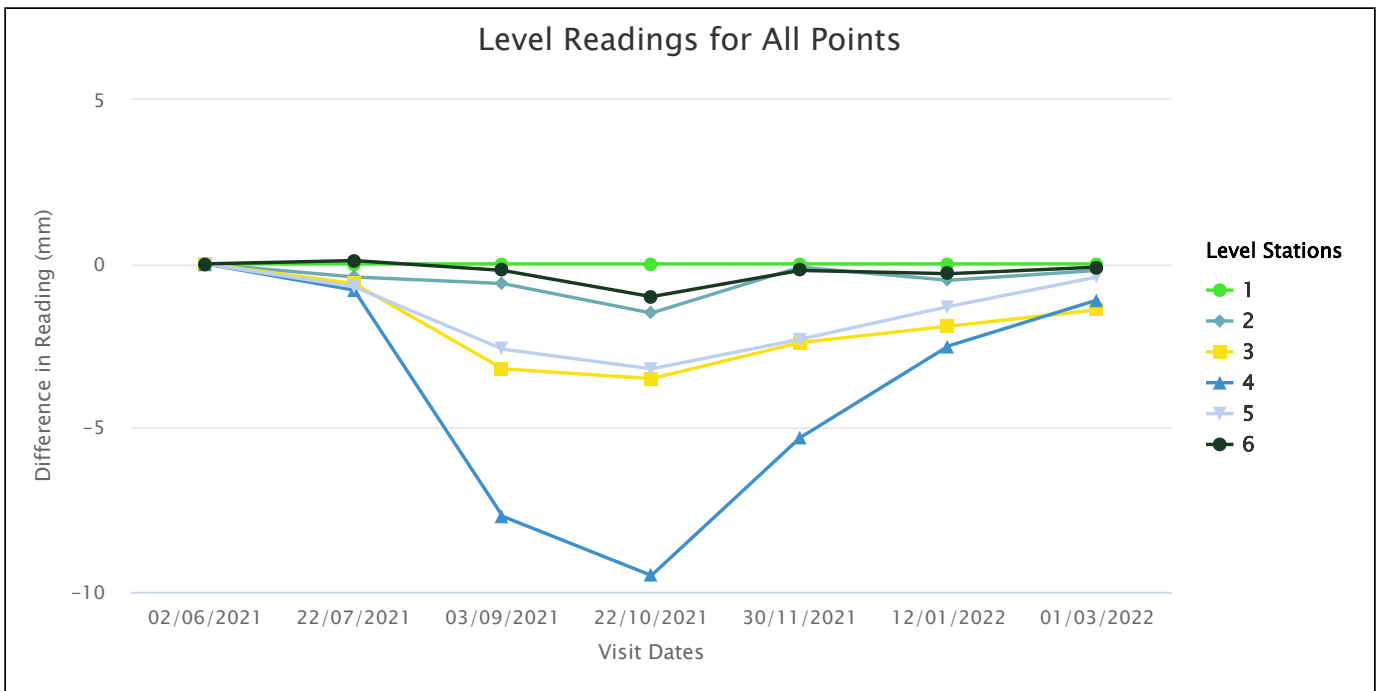

Homeowner Notes

Visit	Homeowner Notes
22/07/2021	No concerns raised.
03/09/2021	No concerns raised.
22/10/2021	No concerns raised.
30/11/2021	No concerns raised.
12/01/2022	No concerns raised.
01/03/2022	No concerns raised.