

**Monitoring Details**

<b>Provider Name:</b>	My Home Needs Ltd	<b>Monitoring Interval:</b>	2 Monthly
<b>Instruction Date:</b>	16/01/2023	<b>Number of Visits:</b>	4
<b>Reading Date:</b>	10/08/2023	<b>Visits Completed:</b>	4
<b>Date of Issue:</b>	16/08/2023	<b>Visits Outstanding:</b>	0


**Client Details**

<b>Client:</b>	Crawfords	<b>Engineer / Handler:</b>	French M
<b>Job Reference:</b>	SU2205985		

**Monitored Address**


<b>Occupier:</b>	
<b>Address:</b>	The Elms, Badwell Road, Walsham-le-Willows , Bury St Edmunds, IP31 3BT

**Site Plan**

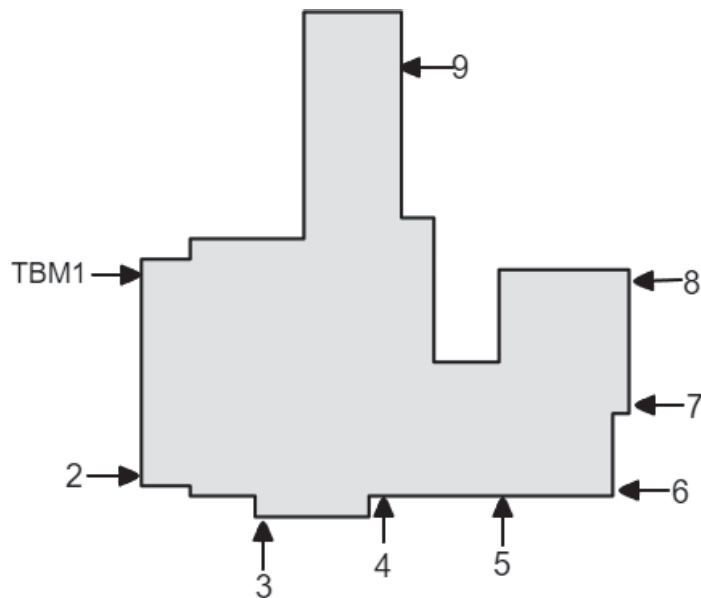

**Level Readings (Displayed in metres)**


Visits	2	3	4	5	6	7	8	9
08/02/2023	9.9192	9.8735	9.7930	9.7060	10.3420	9.7785	9.8270	9.8535
14/04/2023	9.9191	9.8736	9.7932	9.7073	10.3455	9.7820	9.8266	9.8533
15/06/2023	9.9194	9.8742	9.7935	9.7084	10.3480	9.7837	9.8265	9.8534
10/08/2023	9.9191	9.8749	9.7931	9.7074	10.3443	9.7828	9.8274	9.8546

Visits	 DATUM 1
08/02/2023	10.0000
14/04/2023	10.0000
15/06/2023	10.0000
10/08/2023	10.0000



**DATUM 1:** TBM as station 1. TBM 2 manhole in road

**Level Readings Difference (Displayed in millimetres)**


Visits	2	3	4	5	6	7	8	9
08/02/2023	N/A	N/A	N/A	N/A	N/A	N/A	N/A	N/A
14/04/2023	-0.10 ↓	0.10 ↑	0.20 ↑	1.30 ↑	3.50 ↑	3.50 ↑	-0.40 ↓	-0.20 ↓
15/06/2023	0.30 ↑	0.60 ↑	0.30 ↑	1.10 ↑	2.50 ↑	1.70 ↑	-0.10 ↓	0.10 ↑
10/08/2023	-0.30 ↓	0.70 ↑	-0.40 ↓	-1.00 ↓	-3.70 ↓	-0.90 ↓	0.90 ↑	1.20 ↑

Visits	 DATUM 1
08/02/2023	N/A
14/04/2023	0.00 =
15/06/2023	0.00 =
10/08/2023	0.00 =

**Relative Movement (Relative Survey, for illustration purposes only)**

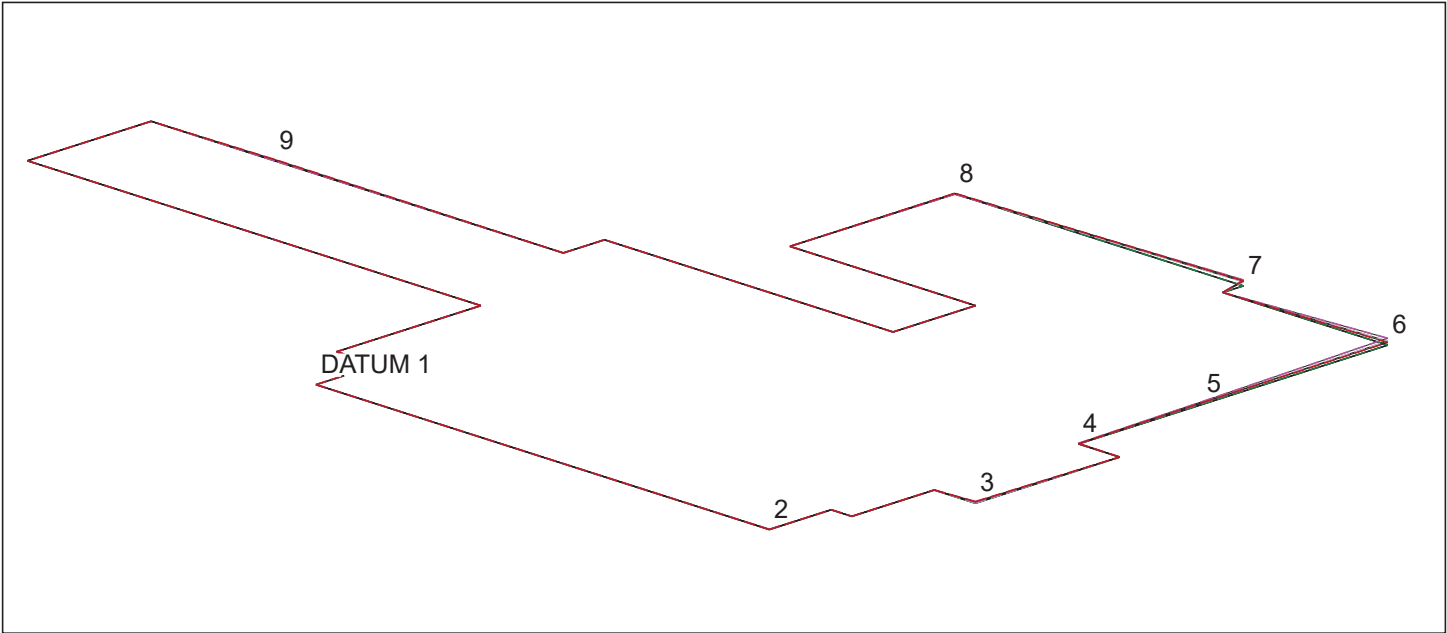

**Level Readings Chart**

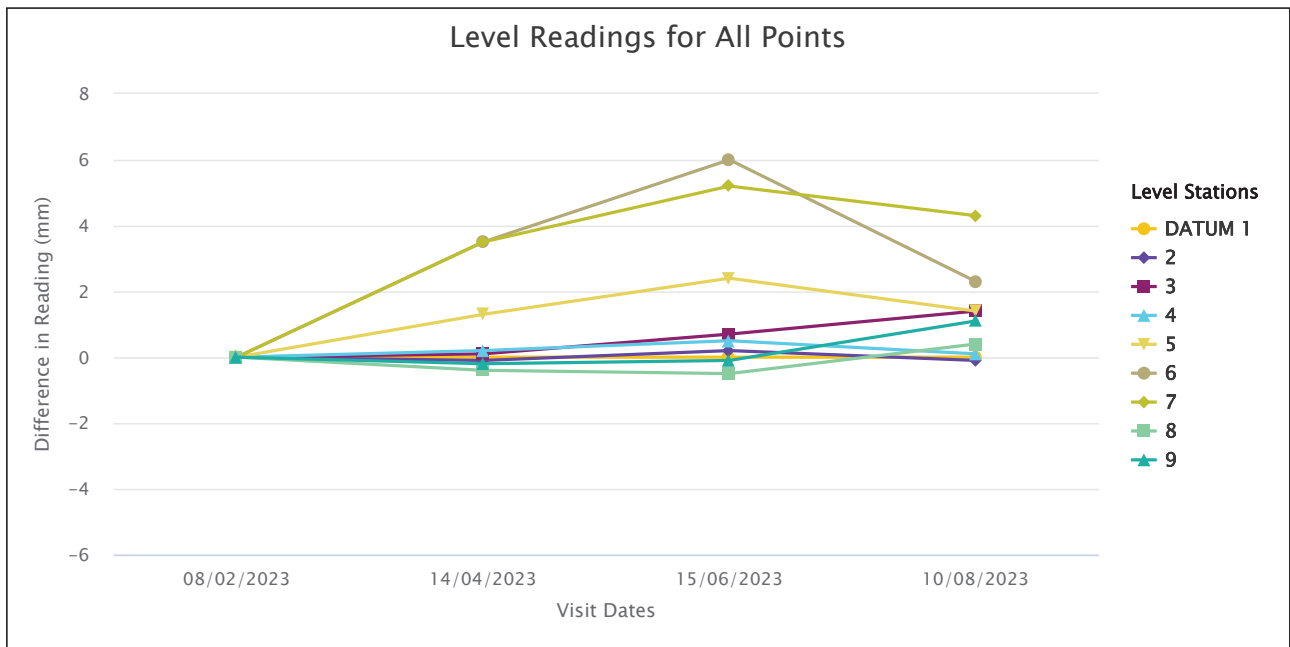

**Homeowner Notes**

<b>Visit</b>	<b>Homeowner Notes</b>
08/02/2023	No concerns raised.
14/04/2023	No concerns raised.
15/06/2023	No concerns raised.
10/08/2023	No concerns raised.