



1 Existing South and West Elevations
A10.1 1:50 @ A1

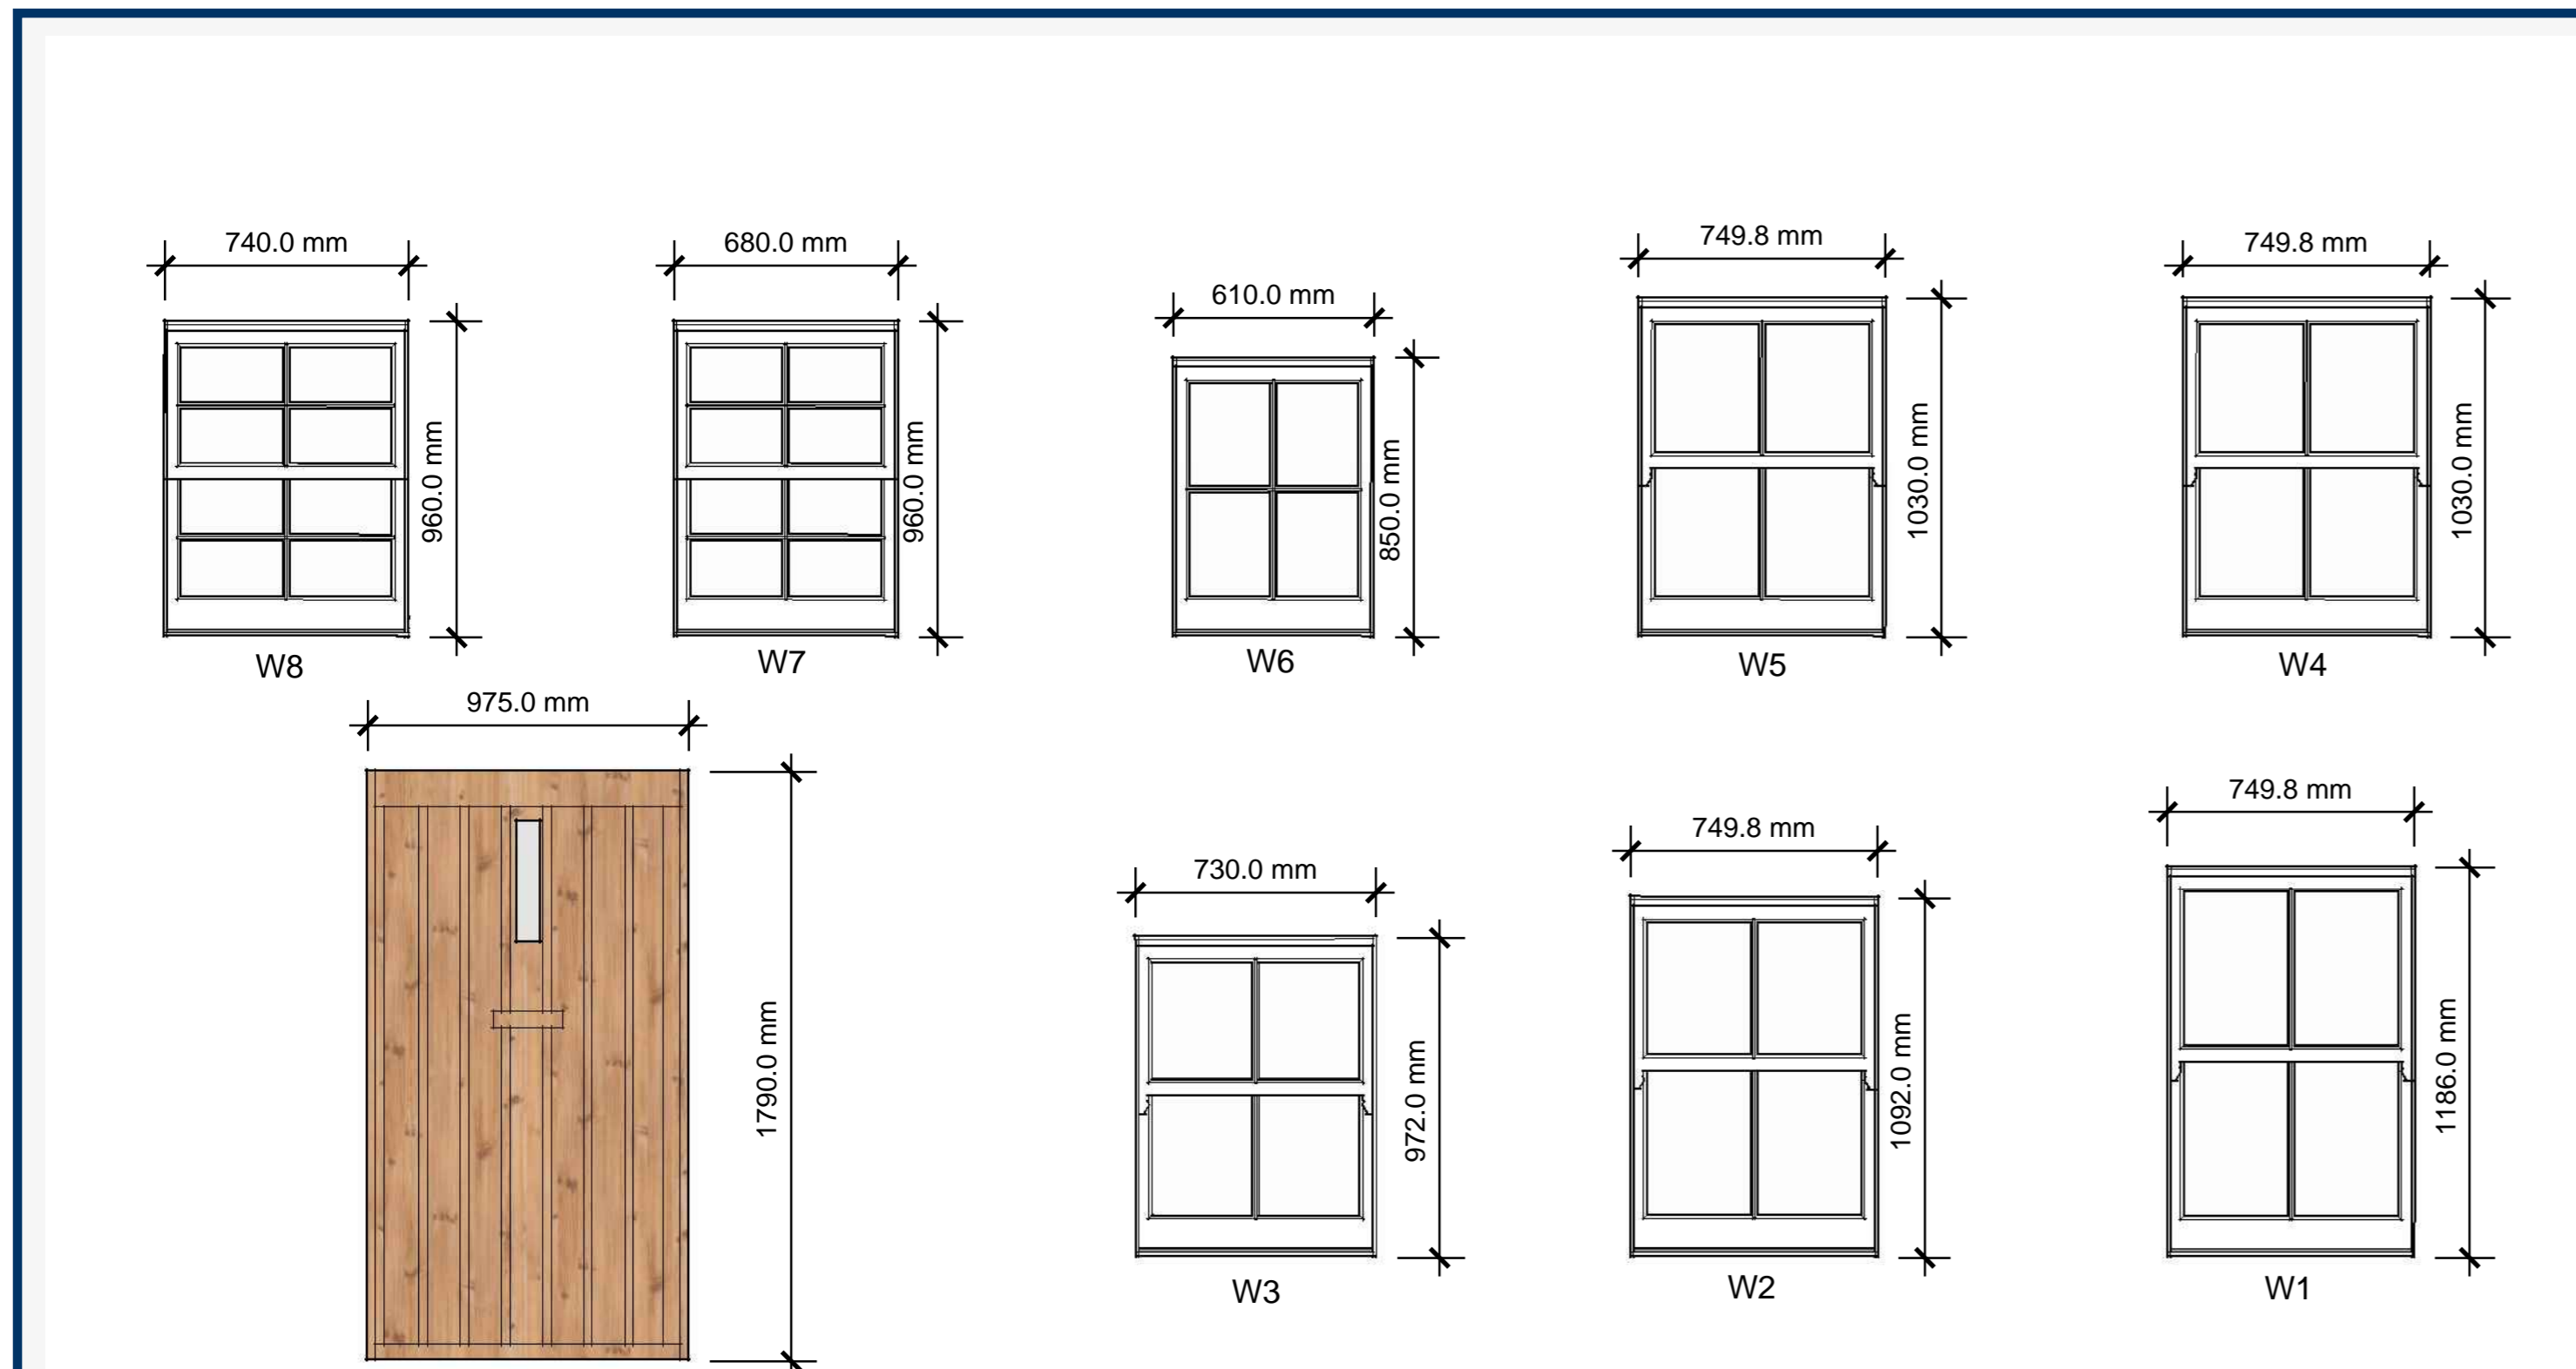

The existing Westend Cottage windows are indicative only. This is due to the condition that they were in once the exterior render was removed. When the cottage was renovated in the 1980's the windows were replaced with static sash windows. All sash boxes were removed as were the weights and pulleys. The windows were painted shut and the frames were ripped down to fit the rough opening of the stone wall. This meant that once the exterior harling was applied this was what held the windows in place. The glass is modern with and no plate glass survived. The windows can not be refurbished in their current state as there is little left that can be used to bring these specific windows back to a working model. The astragals are also of no value as they have no relationship with the original context of the window and have been modified when the new glass was installed. Please see photos.

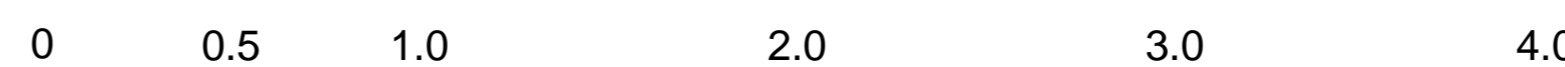

2 Existing Windows
A10.1 1:20 @ A1

FEATHERSTONE PROJECT
WESTEND COTTAGE

Document Date:
August 14, 2023

Document Phase:
Planning Permission

rev.	date	remark

WINDOWS
AND DOORS
Scale @ A1

A10.1