



Your ref **DLG-SN-22-004171**

Our ref **08343GLOB**

360Globalnet Ltd
Regus House, Herald Way,
Pegasus Business Park,
Castle Donnington, Leicestershire,
DE74 2TZ



Issue date: **29/09/2023**

Monitoring visit **5** of **7**

Monitoring Plus Report

| | | | | | |
|--------------|---|--|---|-------------------|------------|
| Owners name | Mrs Alison Sinclair | Suspected cause | to be advised | Monitoring type | levels |
| Address | 41 Knox Green Binfield Bracknell Berkshire RG42 4NZ | Principal area of damage | to be advised | Installed | 03/10/2022 |
| | | Damage category | to be advised | Frequency (weeks) | 8.7 |
| | | Surface geology | to be advised | Completion date | tbc |
| | | | | Status | completed |
| Comment | | Feedback from last visit | no feedback for this visit | | |
| Max movement | 2.8 mm | | | | |
| Focal area | Pts 5, 6, 7, 8, | | | | |
| | no comment for this visit | | | | |
| | | Sketch showing location of monitoring points | <p style="text-align: center;">FRONT ELEVATION</p> | | |

Level Monitoring Results

| Survey: | 1 | | 2 | | 3 | | 4 | | 5 | |
|----------|----------------|---------------------------|----------------|---------------------------|----------------|---------------------------|----------------|---------------------------|----------------|---------------------------|
| By: | RC | | Vanya | | PB | | PB | | PB | |
| Date: | 03/10/2022 | | 04/01/2023 | | 29/03/2023 | | 21/06/2023 | | 29/09/2023 | |
| Point ID | levels mm | <i>chngs</i> <i>mm</i> | levels mm | <i>chngs</i> <i>mm</i> | levels mm | <i>chngs</i> <i>mm</i> | levels mm | <i>chngs</i> <i>mm</i> | levels mm | <i>chngs</i> <i>mm</i> |
| 1 | 1000.00 | 0.0 | 1000.00 | 0.0 | 1000.00 | 0.0 | 1000.00 | 0.0 | 1000.00 | 0.0 |
| 2 | 848.27 | 0.0 | 848.56 | 0.3 | 848.88 | 0.6 | 848.71 | 0.4 | 848.85 | 0.6 |
| 3 | 859.59 | 0.0 | 859.52 | -0.1 | 860.32 | 0.7 | 860.67 | 1.1 | 860.82 | 1.2 |
| 4 | 857.07 | 0.0 | 857.92 | 0.8 | 858.59 | 1.5 | 858.21 | 1.1 | 858.28 | 1.2 |
| 5 | 854.18 | 0.0 | 854.18 | 0.0 | 856.45 | 2.3 | 855.73 | 1.6 | 855.51 | 1.3 |
| 6 | 921.55 | 0.0 | 922.00 | 0.5 | 924.39 | 2.8 | 923.88 | 2.3 | 923.66 | 2.1 |
| 7 | 920.26 | 0.0 | 921.38 | 1.1 | 923.09 | 2.8 | 922.57 | 2.3 | 923.11 | 2.8 |
| 8 | 842.01 | 0.0 | 842.56 | 0.6 | 844.33 | 2.3 | 843.63 | 1.6 | 843.61 | 1.6 |
| 9 | 833.27 | 0.0 | 833.23 | 0.0 | 834.87 | 1.6 | 833.83 | 0.6 | 834.17 | 0.9 |

closing error (mm)

-0.21


0.35

0.35

0.00

-0.10

Precise level monitoring related to Point 1

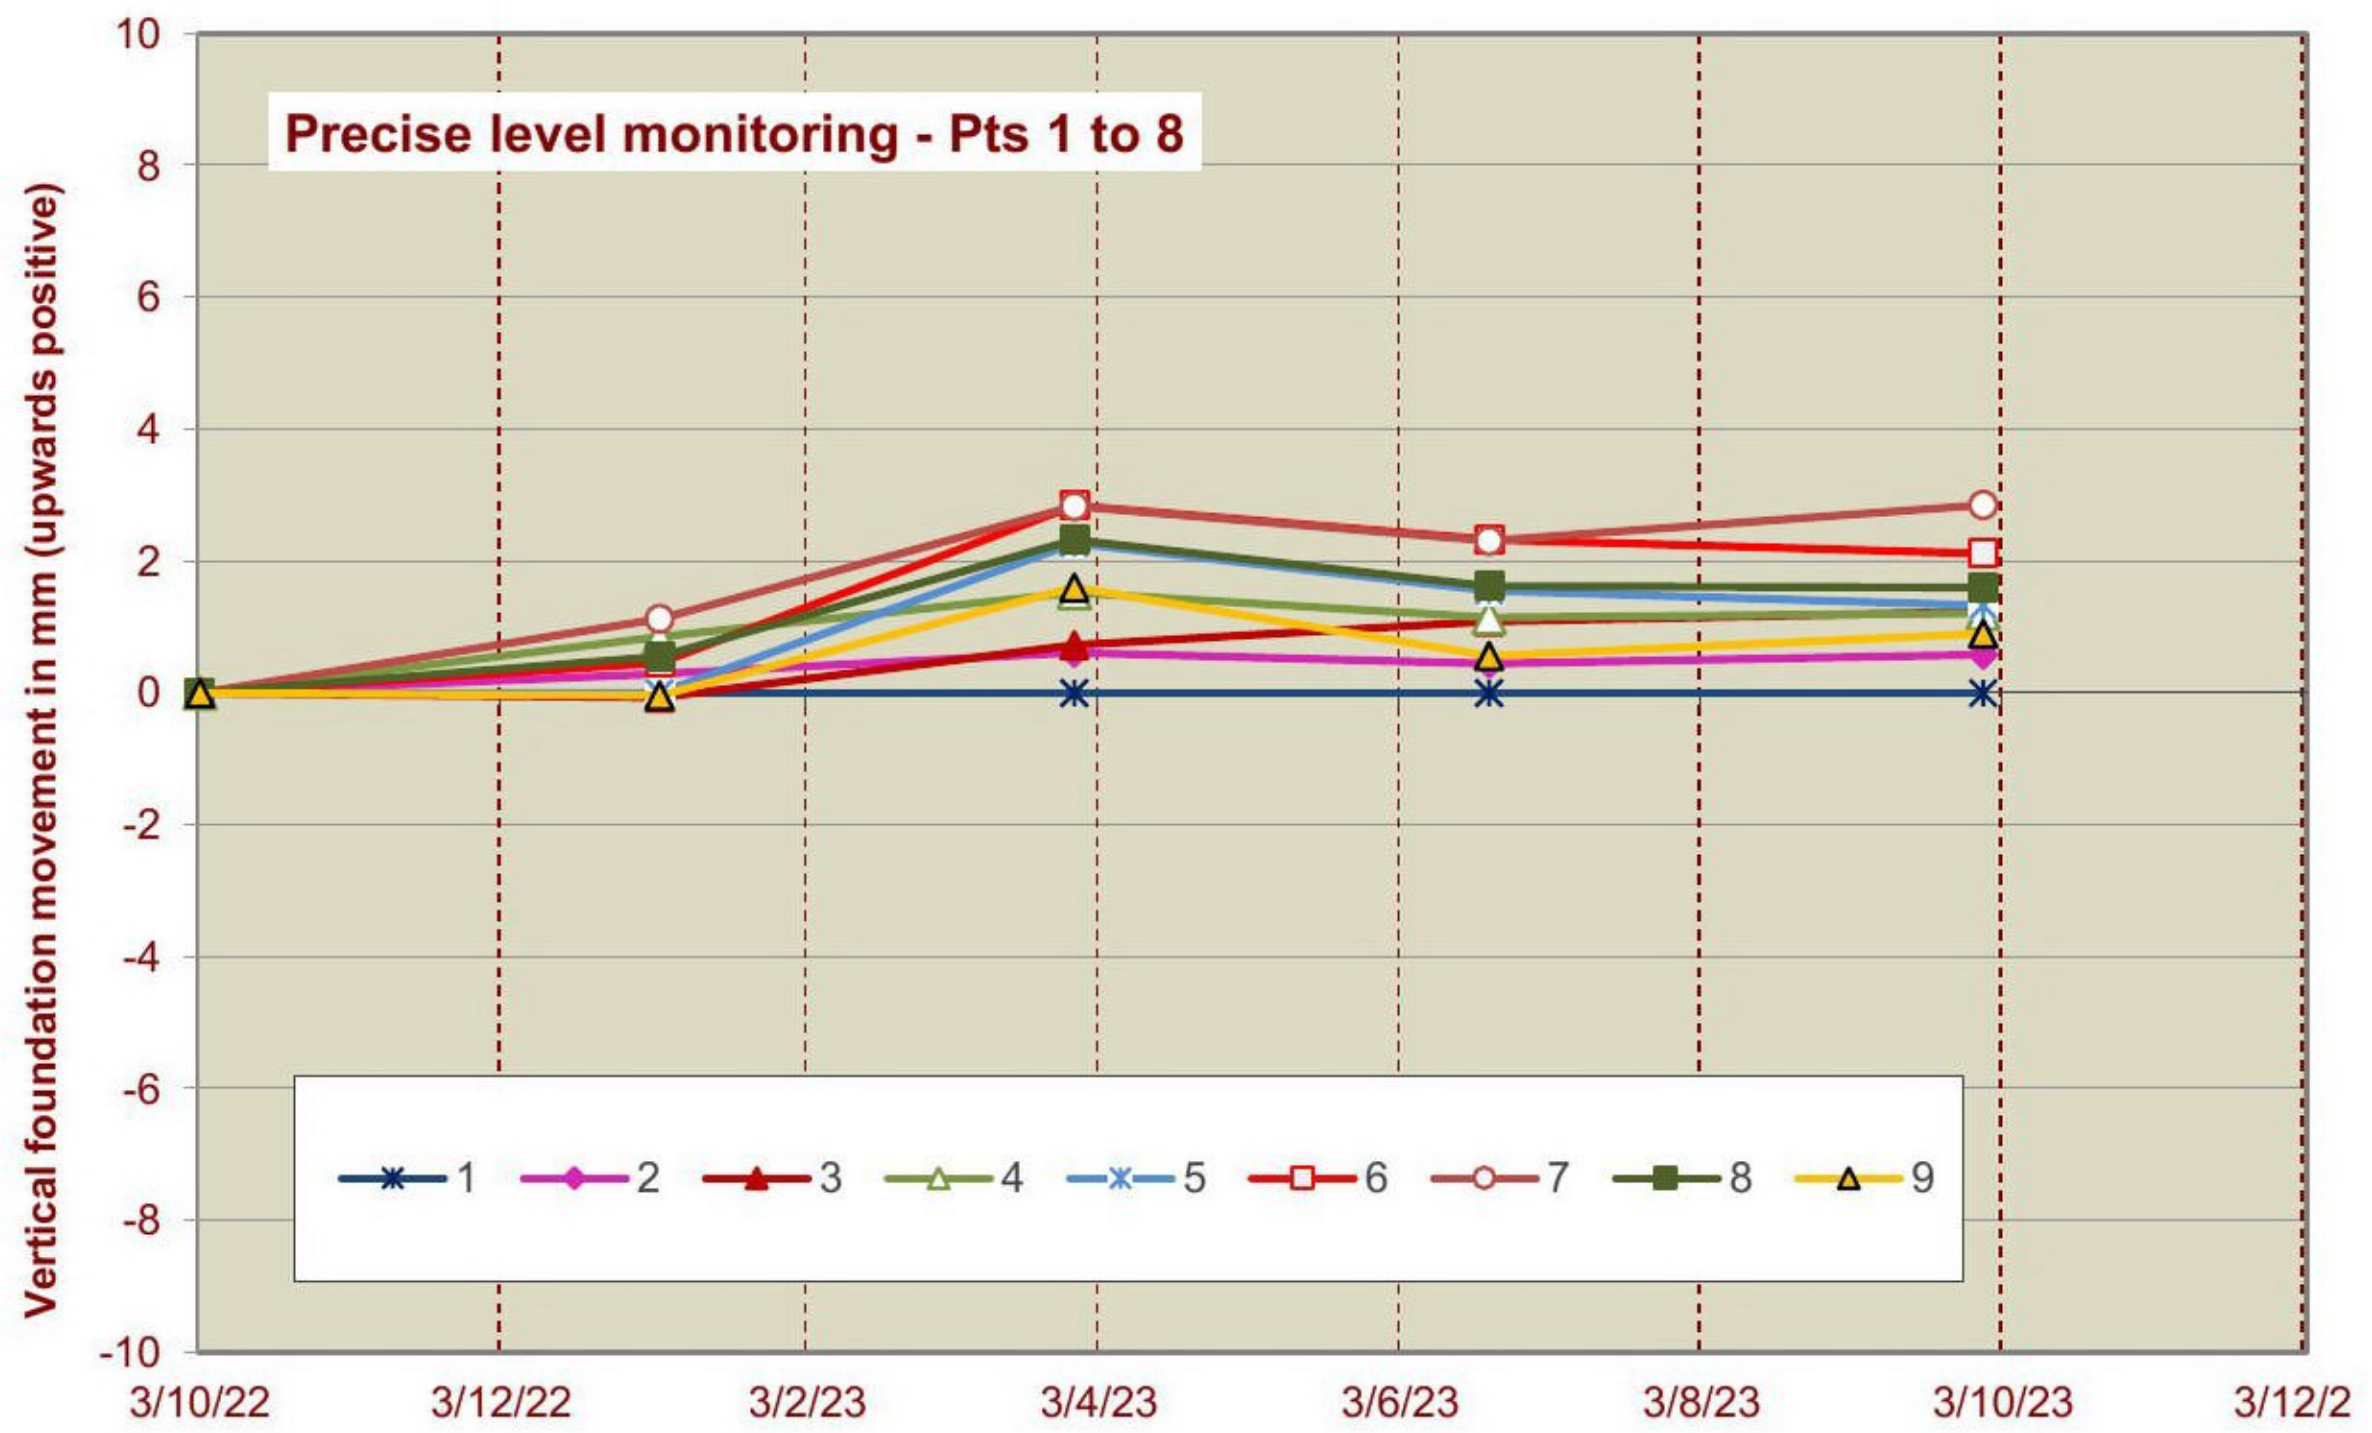

Photos from visit on 29/09/2023

