


Yes
YOUR ENVIRONMENTAL
SOLUTIONS

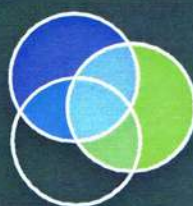

DISCUSS - INVESTIGATE - DELIVER


CLIENT: THE RAINBOW GROUP

PROJECT: LAUREN HOUSE, CAMBORNE, CORNWALL

REPORT TITLE: PHASE 1 DESK STUDY

REPORT REF: YES 2123a

REPORT DATE: 11th OCTOBER 2023

WRITTEN BY: 
ANDREA WOODCOCK HND BSc ACSM AIEMA

This report has been prepared by Your Environmental Solutions with all reasonable skill, care and diligence, within the terms of the Contract with the Client. The report is confidential to the Client and Your Environmental Solutions accept no responsibility of whatever nature to third parties to whom this report may be made known.

No part of this document may be reproduced without the prior written approval of YES -Your Environmental Solutions.

YES

Your Environmental Solutions

Woodcocks Roost

Fore Street, Barrigger

Camborne, Cornwall, TR14 0QR

M. 07766 850 351

E. info@urenvironmentalsolutions.com

W. www.urenvironmentalsolutions.com

TABLE OF CONTENTS

SUMMARY	3
1.0 INTRODUCTION	5
1.1 Background.....	5
1.2 Objectives	5
1.3 Sources of Information	5
1.4 Site Details and Development Proposals	6
2.0 SITE WALKOVER SURVEY	7
3.0 ENVIRONMENTAL SETTING.....	9
3.1 Recorded Geology.....	9
3.1.1 Superficial Geology	9
3.1.2 Solid Geology	9
3.1.3 Mineralisation.....	9
3.1.4 Radon	9
3.1.5 Hydrogeological and Hydrological Setting.....	10
3.2 Environmental Report Findings	11
3.3 Historical Land Use	12
3.4 Mining Report	13
4.0 PRELIMINARY CONTAMINATION RISK ASSESSMENT	14
4.1 Introduction	14
4.2 Preliminary Contamination Risk Assessment In Line with the Conceptual Site Model.....	15
5.0 CONCLUSIONS AND RECOMMENDATIONS	18
6.0 LIMITATIONS.....	19
7.0 BIBLIOGRAPHY	20

FIGURES

Figure 1:	Site Location Plan
Figure 2:	Site Boundary Plan
Figure 3:	Proposed Development Layout Plan
Figure 4:	Conceptual Site Model

APPENDICES

Appendix A:	Site Walkover Survey Photographs
Appendix B:	Environmental Report and Historical Mapping
Appendix C:	Mining Report
Appendix D:	Tables 6.3 – 6.6 ‘Contaminated Land Risk Assessment, A Guide to Good Practice’. CIRIA Report C552. Published 2001

SUMMARY

Your Environmental Solutions (YES) has been commissioned by The Rainbow Group to undertake a Phase 1 Desk Study at a site known as Lauren House, Camborne in Cornwall. This report has been commissioned to fulfil contamination planning requirements for the proposed development.

The site comprises a residential dwelling with front driveway and rear garden area. It is proposed to demolish an existing outbuilding in the rear garden area and to construct a single new residential dwelling with soft, private garden areas.

Prior to the site's current development, it was part of a larger field. The surrounding area of the site has seen use as farmland, for metalliferous mining activity and development for residential purposes.

The site and immediate surrounding area are not recorded to be overlain by superficial deposits. The site is recorded to be underlain by the Mylor Slate Formation - Metabasaltic-rock. These were originally igneous rocks that were later altered by low-grade metamorphism as a result of heat.

The site is situated within a mineralised area. The closest recorded mineralised structure (lode) contains copper, tin and arsenic and is approximately 100m to the southwest of the site. Topsoil arsenic concentrations in the area of the site are recorded to range between 146mg/kg and 448mg/kg.

The site is recorded to be underlain by a secondary aquifer (A). A Spring is located at 60m distance from the site. There are no other surface water features in the surrounding 250m. The site is not recorded to be within a water source protection zone.

Due to the local mineralogy, a potential for heavy metals to be present within the site's soils has been identified. The preliminary contamination risk assessment concluded a moderate risk to human health and building materials in line with its proposed use for a residential development with soft garden areas. A Phase 2 Site Investigation with soil sampling and chemical analyses should be carried out to quantify the risks.

The risk to flora, fauna and ecosystems is considered to be low with no further action required.

The risk to controlled waters is considered to be low with no further action required.

Standard plastic pipework should be suitable for the proposed water supply at the site.

The site is in a radon affected area. As such radon protection measures should be installed in all buildings in line with building regulations.

In accordance with the mining report, the presence of shallow old mine workings directly within the site has not been identified. However given the proximity of the site to known mining features, it is recommended that if any new foundation trenches are excavated, these should be inspected by a suitably qualified and experienced professional, prior to being infilled with concrete, to check for any evidence of unrecorded or otherwise unknown mining activity.

1.0 INTRODUCTION

1.1 Background

Your Environmental Solutions (YES) has been commissioned by The Rainbow Group to undertake a Phase 1 Desk Study at a site known as Lauren House, Camborne in Cornwall. This report has been commissioned to fulfil the contamination planning requirements for the proposed residential development.

1.2 Objectives

The objectives of this report were as follows:

- Summarise the site setting.
- Carry out a walkover survey of the site.
- Review of historical mapping for the site area.
- Review of geological and soil mapping of the site area.
- Review of a mining report for the site area.
- Produce a conceptual model of sources, pathways and receptors of contamination.
- Undertake a preliminary contamination risk assessment.
- Provide recommendations for phase 2 intrusive works, if any.

1.3 Sources of Information

The following sources of information have been used:

- Walkover and Photographic Survey of the Site (Appendix A).
- British Geological Survey Online 3D Map of Britain.
- DEFRA Online Magic Maps.
- UK Soil Observatory Online Mapping.
- British Geological Survey 1:50,000 Solid and Drift Geological Mapsheet 352 'Falmouth'
- UK Health Security Agency Online UKradon mapping.
- Environmental Report & Historical Mapping (Appendix B).
- Mining Report (Appendix C).

1.4 Site Details and Development Proposals

The site location, site boundary and proposed development layout are shown on Figures 1, 2 and 3, respectively.

The site is located at coordinates: 165020 39090, postcode: TR14 7RX.

The site comprises a residential dwelling with front driveway and rear garden area.

It is proposed to demolish an existing outbuilding in the rear garden area and to construct a single new residential dwelling with soft, private garden areas.

2.0 SITE WALKOVER SURVEY

An Environmental Scientist from YES undertook the site walkover survey on the 10th October 2023 to assess the site for visual evidence of contamination.

Photographs taken during the walkover survey can be found within Appendix A.

The site is accessed from an alley which connects it to Cadogan Road to the northeast.

The site is surrounded by mostly residential development and farmland.

The site comprises a residential dwelling and front driveway, with a garden area that contains a number of outbuildings.

The dwelling is of concrete block construction with a slate roof.

The front driveway is surfaced in well maintained concrete and is in use for vehicle parking and domestic waste storage.

The rear garden is mostly surfaced in lawn and contains garden furniture and concrete pathways.

In the south-western garden area, an outbuilding is located over the proposed development location. The outbuilding is of stone, concrete and brick construction with a pitched slate, flat felt and corrugated plastic roof. The interior floor surface of the building is surfaced in concrete. The building is in use for the storage of bikes and miscellaneous non-contaminative household items.

A second outbuilding, comprising a wooden garden shed, is located on the northeastern boundary of the site. This was found to be empty.

A third outbuilding is located in the central-eastern area of the site and comprises a former coal store. The building is of concrete block and brick construction with a felt roof and

concrete floor. The building was empty at the time of the walkover.

It was noted that the exterior of the coal store is also surfaced in concrete.

The fourth outbuilding is located in the north-western corner of the site and is constructed of concrete block with a corrugated metal roof. The interior of the outbuilding could not be accessed during the survey visit.

The topography of the site and surrounding area is generally sloping down gradient from the northeast towards the southwest.

There were no visual signs of any contamination noted during the walkover survey.

3.0 ENVIRONMENTAL SETTING

3.1 Recorded Geology

Reference has been made to the British Geological Survey 1:50,000 Solid and Drift Geological Mapsheet 352 'Falmouth' and mapping from the UK Soil Observatory.

3.1.1 Superficial Geology

The site and immediate surrounding area are not recorded to be overlain by superficial deposits.

3.1.2 Solid Geology

The site is recorded to be underlain by the Mylor Slate Formation - Metabasaltic-rock formed approximately 359 to 383 million years ago in the Devonian Period. These were originally igneous rocks formed by eruptions of silica-poor magma, later altered by low-grade metamorphism.

3.1.3 Mineralisation

The site is situated within a mineralised area. The closest recorded mineralised structure (lode) contains copper, tin and arsenic and is approximately 100m to the southwest of the site.

Topsoil arsenic concentrations in the area of the site are recorded to range between 146mg/kg and 448mg/kg.

3.1.4 Radon

In line with the UK Health Security Agency online UKradon mapping, the site is located in an area where greater than 30% of homes have elevated (>200 Bq per m³) radon concentrations within indoor air.

3.1.5 Hydrogeological and Hydrological Setting

The site is recorded to be underlain by a secondary aquifer (A). These aquifers are formed of moderately permeable layers capable of supporting water supplies at a local scale, and in some cases forming an important source of base flow to rivers.

The only surface water feature within 250m of the site is a spring at 60m distance to the southwest.

The site is not recorded to be within a water source protection zone.

3.2 Environmental Report Findings

The environmental report for the site is presented in Appendix B. Using the report, the following data has been investigated for the site:

- Contaminated Land Register Entries and Notices.
- BGS, Registered, Local Authority, Historical Landfill and Other Waste Sites.
- Local Authority Pollution Prevention and Control Permits.
- Registered Radioactive, Explosive and Hazardous Substances Sites.
- Environmental Enforcement, Prohibition Notices and Prosecutions.
- Discharge Consents to Controlled Waters.
- Environmental Pollution Incidents.
- Contemporary Trade Directory and Fuel Station Entries.
- Potentially Contaminative Historical Land Uses and Features.
- Environmentally Sensitive Sites.

The following potentially contaminative features and/or land uses are recorded within 250m of the site:

- Sewage Discharge Consent: 237m, 238m.
- Contemporary Trade Directory Entries:
 - Engineer – general: 88m.
 - Perfume suppliers: 219m.
 - Commercial cleaning services: 223m.
 - Automation systems and equipment: 225m.
- Potentially Infilled Land (pit, quarry etc): 243m.
- Potentially Contaminative Historical Land Uses and Features:
 - Mining and quarrying: 69m, 243m.
 - Tanks: 262m, 263m.

There are no environmentally sensitive sites recorded within 250m of the site.

The pertinent contamination risks from the environmental report are discussed in Chapter 4.

3.3 Historical Land Use

The historical maps for the site and surrounding area are presented in Appendix B. The findings from a review of the maps are outlined below.

1889: The site is shown to be part of a larger field. A mine shaft within an area of disturbed ground is shown to be present immediately adjacent to the site's southern boundary. At distance to the northwest of the site is a tin and copper mine. The remainder of the surrounding area of the site is farmland and woodland, within which are patches of mining land and sporadic residential development.

1908: The site has remained unchanged from the last mapping period. Immediately to the north and west of the site some small scale residential development has taken place. Other small scale developments have also occurred at distance in the surrounding area of the site. The mine at distance to the northwest is now shown to be disused.

1938: The site and the surrounding area appear mostly unchanged from the last mapping period with no new potentially contaminative features identified.

1966 – 1967: The site is shown to contain a main building and a number of smaller ancillary structures. In the surrounding area, further residential development and the construction of a reservoir has taken place.

1980 – 1987: The site and the surrounding area appear mostly unchanged from the last mapping period with no new potentially contaminative features identified.

1994: The site and the surrounding area appear mostly unchanged from the last mapping period with other than some further small scale residential development.

2000: The site has remained unchanged from the last mapping period. In the surrounding area, further residential development has taken place.

2023: The site and the surrounding area appear mostly unchanged from the last mapping period with no new potentially contaminative features identified.

3.4 Mining Report

The mining report for the site is presented in Appendix C. The findings of the mining report are detailed as follows.

The site is situated in an area which has witnessed extensive mining over several centuries.

A number of old mine dumps are recorded to lie approximately 15m to the southwest of the site and a mine shaft is recorded to lie within these.

A lode (mineralised structure) at surface outcrop is indicated to lie to the southwest of the site. The lode is shown to strike in a north-easterly direction and is thought to extend further than plotted, passing a short distance to the south-eastern side of the site.

Evidence of clay workings or other mineral workings in the immediate vicinity of the site has not been identified.

Evidence of water supply wells (which can pose a subsidence risk) has not been identified within the boundaries of the site.

Based on the information reviewed, documentary evidence to indicate the presence of shallow old mine workings directly within the site has not been identified. However given the proximity of the site to known mining features, it is recommended that if any new foundation trenches are excavated, these should be inspected by a suitably qualified and experienced professional, prior to being infilled with concrete, to check for any evidence of unrecorded or otherwise unknown mining activity.

4.0 PRELIMINARY CONTAMINATION RISK ASSESSMENT

4.1 Introduction

The contaminated land risk assessment has been undertaken in line with the conceptual site model (Figure 4) and the information collected from the desk study and site walkover survey.

Risk assessment is the process of collating known information on a hazard or set of hazards in order to estimate actual or potential risks to receptors. The guiding principle behind this approach is to establish connecting links between a hazardous source, via an exposure pathway to a potential receptor, referred to as a 'pollutant linkage'.

The conceptual model is a representation of the potential relationships between contaminant sources, pathways and receptors developed on the basis of hazard identification.

The objective of a preliminary contamination risk assessment is to identify the nature and magnitude of the potential risks through the consideration of likelihood (probability) and severity (consequence) of the hazard(s) to the receptor(s). The risk assessment has been carried out using the risk tables within Contaminated Land Risk Assessment. A guide to good practice (C552) (CIRIA, 2001), enclosed within Appendix D.

4.2 Preliminary Contamination Risk Assessment In Line with the Conceptual Site Model

The following table contains the sources, pathways and receptors, as identified in the conceptual model (Figure 4) and supporting table, compared to an appropriate level of risk.

Table 4.1: Preliminary Contamination Risk Assessment				
Sources	Receptors and Pathways	Categorisation of Risk		
		Probability	Consequence	Risk
Radon: Natural Mineralogy	Human Health: Inhalation of gas	Likely	Medium	Moderate
Heavy Metals: Natural Mineralogy	Human Health: Direct soil and dust ingestion Consumption of vegetation Dermal contact with soils Inhalation of dust	Likely	Medium	Moderate
	Controlled Waters: Migration into groundwater Migration through soil Surface water runoff Deposition onto surface water	Unlikely	Medium	Low
	Flora/Fauna and Ecosystems: Plant uptake and accumulation	Likely	Mild	Low
	Building Materials: Direct contact with soils	Likely	Medium	Moderate
Hydrocarbons & Volatile Organic Compounds: Vehicle Parking Coal Store	Human Health: Direct soil and dust ingestion Consumption of vegetation Dermal contact with soils Inhalation of dust & vapours	Unlikely	Medium	Low
	Controlled Waters: Migration into groundwater Migration through soil Surface water runoff Deposition onto surface water	Unlikely	Medium	Low
	Flora/Fauna and Ecosystems:	Unlikely	Mild	Low

Table 4.1: Preliminary Contamination Risk Assessment

Sources	Receptors and Pathways	Categorisation of Risk		
		Probability	Consequence	Risk
	Plant uptake and accumulation			
	Building Materials: Direct contact with soils	Unlikely	Medium	Low

Due to the local mineralogy and mining, a potential for heavy metals to be present within the site's soils has been identified. The preliminary contamination risk assessment concluded a moderate risk to human health in line with its proposed use for a residential development with soft garden areas. A Phase 2 Site Investigation with soil sampling and chemical analyses should be carried out to quantify the true risks.

It is considered that although vehicle parking and a coal store are located on site, as these features are and will have taken place over well maintained concrete, the risks to all receptors from hydrocarbon contamination is low.

The risk to controlled waters is considered to be low. The site is underlain by a minor aquifer and it is considered unlikely that the proposed development will encounter or penetrate the underlying groundwater body. The site is not within a water source protection zone and the nearest surface water feature is at 60m distance. With natural heavy metals identified as the only potential source of contamination, no further action is considered necessary.

The risks to building materials are considered to be moderate. Due to the local mineralogy there may be aggressive ground conditions with the potential to impact on any new concrete foundations. Soil sampling and chemical analyses should be undertaken for water soluble sulphate to determine the appropriate grade of concrete to be used.

The risk to water supply pipework is considered to be low. There are no identified sources of contamination on site with the potential to impact on water supply pipework. It is therefore considered that a standard plastic material would be suitable for any new potable water supplies at the site.

The risk to flora, fauna and ecosystems is considered to be low. The site is not within an environmentally designated area and contamination with the potential to impact on local species or habitats has not been identified at the site.

The risk from the inhalation of radon is considered to be moderate; however, full radon protection measures should be installed within all buildings, which would mitigate this risk.

The risks to construction workers have not been included in this risk assessment. The risks to construction workers should be assessed independently in line with current health and safety legislation and regulations.

5.0 CONCLUSIONS AND RECOMMENDATIONS

Due to the local mineralogy, a potential for heavy metals to be present within the site's soils has been identified. The preliminary contamination risk assessment concluded a moderate risk to human health and building materials in line with its proposed use for a residential development with soft garden areas. A Phase 2 Site Investigation with soil sampling and chemical analyses should be carried out to quantify the true risks.

The risk to flora, fauna and ecosystems is considered to be low with no further action required.

The risk to controlled waters is considered to be low with no further action required.

Standard plastic pipework will be suitable for the proposed water supply at the site.

The site is in a radon affected area. As such radon protection measures should be installed in all buildings in line with building regulations.

In accordance with the mining report, the presence of shallow old mine workings directly within the site has not been identified. However given the proximity of the site to known mining features, it is recommended that if any new foundation trenches are excavated, these should be inspected by a suitably qualified and experienced professional, prior to being infilled with concrete, to check for any evidence of unrecorded or otherwise unknown mining activity.

6.0 LIMITATIONS

The work undertaken to provide the basis of this report includes a study of the readily available documented information from a variety of sources. The information reviewed should not be considered exhaustive and has been accepted in good faith by YES, as providing a true indication of the site conditions. However, no liability can be accepted for the detailed accuracy or otherwise of any of the reports or documents prepared by others for the Client or for third parties, or for any associated errors or omissions.

It should be noted that the environment and contaminated land guidance and legislation are constantly under review, with authoritative guidance documents subject to change. The conclusions presented herein are based on guidance and legislation available at the time of issuing this report, and no liability can be accepted for the retrospective effects of any changes or amendments to such guidance and/or legislation.

YES has produced this report solely for the use of the Client and his agent. The report should not be relied upon in any way by any third party.

The copyright in this document (including electronic versions) shall remain vested in YES - Your Environmental Solutions ("YES") but the Client shall have a licence to copy and use the document for the purpose for which it was provided. YES shall not be liable for the use by any person of the document for any purpose other than that for which the same were provided by YES. This document shall not be reproduced in whole or in part or relied upon by third parties for any use whatsoever without the express written authority of YES .

7.0 BIBLIOGRAPHY

Applied Environmental Research (1994). Contaminated Land Research Report (CLR) 2: Guidance on Preliminary Site Inspection of Contaminated Land (Volumes 1 & 2). London, Department of the Environment

Aspinwall and Company (1994). Contaminated Land Research Report (CLR) 1: A Framework For Assessing The Impact Of Contaminated Land On Groundwater And Surface Water (Volumes 1 & 2). London, Department of the Environment

Building Research Establishment (BRE), Environment Agency (1991). Protective Measures for Housing on Gas Contaminated Land (BR414). London, BRE Publications

Building Research Establishment (BRE) (1991). Soakaway Design (Digest 365). London, BRE Publications

Building Research Establishment (BRE) (2004). Report 465: Cover Systems For Land Regeneration: Thickness of Cover Systems for Contaminated Land, London, BRE Publications

Building Research Establishment (BRE) (2005). Concrete in aggressive ground (Special Digest 1) – Part C: Assessment of the Chemical Aggressiveness of the Ground. London, BRE Publications

Building Research Establishment (BRE) (2007). Report 211: Radon: Guidance for protective measures for new buildings (including supplementary advice for extensions, conversions and refurbishment). London, BRE Publications

Card G, Haines S Wilson S (2004). Gas Protection – a Common Sense Approach. Contaminated Land – Achievements and Aspirations. London, Epp Publications Ltd

Card G, Wilson S (1999). Reliability and Risk in Gas Protection Design: Ground Engineering. London, EMAP

Chartered Institute of Environmental Health (CIEH) (2008). The Local Authority Guide to Ground Gas. London, CIEH

Construction Industry Research and Information Association (CIRIA) (2001). Remedial Processes for contaminated land: Principles and Practices (C549). London, CIRIA

Construction Industry Research and Information Association (CIRIA) (2004). Selection of Remedial treatments for contaminated land: a guide to good practice (C622). London, CIRIA

Construction Industry Research and Information Association (CIRIA) (2007). Assessing Risks Posed by Hazardous Ground Gases to Buildings (C665). London, CIRIA

Contaminated Land: Applications in Real Environments (CL:AIRE) et al (2008). Guidance on Comparing Soil Contamination Data with a Critical Concentration. London, Chartered Institute of Environmental Health (CIEH)

Contaminated Land: Applications In Real Environments (CL:AIRE) (2008). The Definition of Waste: Development Industry Code of Practice. London, CL:AIRE

Contaminated Land: Applications In Real Environments (CL:AIRE) (2012). A Pragmatic Approach to Ground Gas Risk Assessment. Online. CL:AIRE

Contaminated Land: Applications In Real Environments (CL:AIRE) (2020). Professional Guidance: Comparing Soil Contamination Data with a Critical Concentration. Haddenham, CL:AIRE

Public Health England (2017). Contaminated land information sheet: risk assessment approaches for polycyclic aromatic hydrocarbons (PAHs)*. London, PHE publications

CIEH (Chartered Institute of Environmental Health), Environment Agency, NHBC (National House-Building Council) (2008). Guidance for the Safe Development of Housing on Land Affected by Contamination: R&D Publication 66: 2008 (Volume 1) Bristol, Environment Agency, NHBC

Department of the Environment (DoE) (1995). Industry Profile: Airports. London, DoE

England & Wales. Department of the Environment (DoE) (1995). Industry Profile: Animal & Animal Product Processing Works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Asbestos Manufacturing Works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: coatings (paints and printing inks manufacturing works). London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: cosmetics and toiletries manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: disinfectants manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: explosives, propellants and pyrotechnics manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: organic chemicals manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: pesticides manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: pharmaceuticals manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: rubber processing works (including works manufacturing tyres or other rubber products). London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Chemical Works: soap and detergent manufacturing works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Dockyards and Dockland. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Gas works, coke works and other coal carbonisation plants. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Oil Refineries and Bulk Storage of Crude Oil and Petroleum Products. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Power stations (excluding nuclear power stations). London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Railway Land. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Sewage works and sewage farms. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Timber products manufacturing works. London, DoE

England & Wales. Department of the Environment (DoE) (1995). Industry Profile: Timber treatment works. London, DoE

Department of the Environment (DoE) (1995). Industry Profile: Waste Recycling, Treatment and Disposal Sites: metal recycling sites. London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Chemical Works: fertilisers manufacturing works. London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Chemical Works: inorganic chemicals manufacturing works. London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Pulp and Paper Manufacturing Works. London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Road Vehicle Fuelling, service and repair (garages and filling stations). London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Road Vehicle Fuelling, service and repair (transport and haulage centres). London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Textile Works and Dye Works. London, DoE

Department of the Environment (DoE) (1996). Industry Profile: Waste recycling and disposal sites (hazardous waste treatment plants). London, DoE

Department of the Environment (DoE) (1996). Profile of Miscellaneous industries, incorporating: charcoal works, dry-cleaners, fibreglass resins manufacturing works, glass manufacturing works, photographic processing industry, printing and bookbinding works. London, DoE

Department of the Environment (DoE) & Welsh Office (WO) (1990). Planning Policy Guidance (PPG) 14: Development on Unstable Land. London DoE/WO

Environment Agency (1999). Methodology for the Derivation of Remedial Targets for Soil and Groundwater to Protect Water Resources (R&D Publication 20). Bristol, Environment Agency

Environment Agency (2000). Assessing the Wider Environmental Value of Remediating Land Contamination: A Review - R&D Technical Report P238. Bristol, Environment Agency

Environment Agency (2000). Guidance on the Assessment and Monitoring of Natural Attenuation of Contaminants in Groundwater (R&D Publication 95). Bristol, Environment Agency

Environment Agency (2000). Secondary Model Procedure for the Development of Appropriate Soil Sampling Strategies for Land Contamination (R&D Technical Report P5-066/TR). Bristol, Environment Agency

Environment Agency (2000). Technical Aspects of Site Investigation (Volume I of II) (Technical Report P5-065/TR). Bristol, Environment Agency

Environment Agency (2000). Technical Aspects of Site Investigation (Volume II of II) (Technical Report P5-065/TR). Bristol, Environment Agency

Environment Agency (2001). Assessment and Management of Risks to Buildings, Building Materials and Services from Land Contamination – R&D Technical Report P5-035/TR/01. Bristol, Environment Agency

Environment Agency (2001). Piling and Penetrative Ground Improvement Methods on Land Affected by Contamination: Guidance on Pollution Prevention. Bristol, Environment Agency

Environment Agency (2002). Information on Land Quality in England: Sources of Information (including background contaminants) - R&D Technical Report P291. Bristol, Environment Agency

Environment Agency (2002). Landfill Directive: Regulatory Guidance Note 2 (Version 4.0): Interim Waste Acceptance Criteria and Procedures. Bristol, Environment Agency

Environment Agency (2003). Review of the Fate and Transport of Selected Contaminants in the Soil Environment - P5-079/TR1. Bristol, Environment Agency

Environment Agency (2004). Integrated Pollution Prevention and Control (IPPC). Guidance on the Protection of Land Under the PPC Regime: Application Site Report and Site Protection and Monitoring Programme (Technical Guidance Note IPPC H7). Bristol, Environment Agency

Environment Agency (2004). Mobilising nature's armoury: Monitored Natural Attenuation – dealing with pollution using natural processes. Bristol, Environment Agency

Environment Agency (2004). 10-Annex G Environmental Quality Standards (EQS) List Bristol, Environment Agency

Environment Agency (2005). Environment Agency Guidance on Requirements for Land Contamination Reports. Bristol, Environment Agency

Environment Agency (2005). Principles for Evaluating the Human Health Risks from Petroleum Hydrocarbons in Soils: (A Consultation Paper R&D Technical Report P5-080/TR1). Bristol, Environment Agency

Environment Agency (2005). Review and Summary of Existing Environment Agency Guidance on the Regulation of the Remediation of Contaminated Soils. Shrewsbury, Entec UK Limited

Environment Agency (2005). The UK Approach for Evaluating Human Health Risks from Petroleum Hydrocarbons in Soils (Science Report P5-080/TR3). Bristol, Environment Agency

Environment Agency (2006). Guidance for waste destined for disposal in landfills (Version 2): Interpretation of the Waste Acceptance Requirements of the Landfill (England and Wales) Regulations 2002 (as amended). Bristol, Environment Agency

Environment Agency (2006). RCLEA: Using RCLEA - The Radioactivity Contaminated Land Exposure Assessment Methodology (CLR 13). Bristol, Environment Agency

Environment Agency (2006). Remedial Targets Methodology: Hydrological Risk Assessment for Land Contamination. Bristol, Environment Agency

Environment Agency (2006). Remedial Targets Worksheet v3.1: Users Manual. Bristol, Environment Agency

Environment Agency (2007). Inter-laboratory comparison of in vitro bioaccessibility measurements for arsenic, lead and nickel in soil - SC040060/SR2. Bristol, Environment Agency

Environment Agency (2008). An Ecological Risk Assessment Framework for Contaminants in Soil: Science Report - SC070009/SR1. Bristol, Environment Agency

Environment Agency (2008). Human health toxicological assessment of contaminants in soil: science report – SC050021/SR2. Bristol, Environment Agency

Environment Agency (2008). Updated technical background to the CLEA model: science report – SC050021/SR3. Bristol, Environment Agency

Environment Agency (2008). Compilation of data for priority organic pollutants for derivation of Soil Guideline Values - SC050021/SR7. Bristol, Environment Agency.

Environment Agency (2020). Land contamination risk management (LCRM). Bristol, Environment Agency.

Health Protection Agency, British Geological Society (2007). HPA-RPD-033 - Indicative Atlas of Radon in England and Wales. Didcot, Health Protection Agency

Parliament (2004). Planning Policy Statement 23: Planning and Pollution Control. London, Stationary Office

Parliament (2005). The Landfill (England and Wales) (Amendment) Regulations. London, Queen's Printer of Acts of Parliament

Planning Policy Statement 10: Planning for Sustainable Waste Management. London, The Stationary Office

Parliament (2007). The Water Supply (Water Quality) Regulations 2000 (Amendment) Regulations 2007. London, Queen's Printer of Acts of Parliament

England. Parliament (2006). The Contaminated Land (England) Regulations. London, Queen's Printer of Acts of Parliament

Environmental Industries Commission (1997). Contaminated Land Research Report (CLR) 12: A Quality Approach For Contaminated Land Consultancy. London, Department of the Environment

Great Britain & European Union. Parliament (2002). Geotechnical investigation and testing. Identification and classification of soil. Identification and description (BS EN ISO 14688-1:2002). London, BSI

Great Britain & European Union. Parliament (2004). Geotechnical investigation and testing. Identification and classification of rock. Identification and description (BS EN ISO 14689-1:2003). London, BSI

Great Britain & European Union. Parliament (2006). Geotechnical investigation and testing. Field testing. Dynamic probing (BS EN ISO 22476-2:2005). London, BSI

Great Britain & European Union. Parliament (2006). Geotechnical investigation and testing. Identification and classification of soil. Principles for a classification (BS EN ISO 14688-2:2004). London, BSI

Great Britain & European Union. Parliament (2006). Geotechnical investigation and testing. Sampling methods and groundwater measurements. Technical principles for execution (BS EN ISO 22475-1:2006). London, BSI

Great Britain & European Union. Parliament (2006). Geotechnical investigation and testing. Field testing. Standard penetration test (BS EN ISO 22476-3:2005). London, BSI

Great Britain & European Union. Parliament (2007). Eurocode 7. Geotechnical design. Ground investigation and testing (BS EN 1997-2:2007). London, BSI

Great Britain. Parliament (1986). British Standard Code of Practice for Foundations (BS 8004:1986). London, BSI

Great Britain. Parliament (1999). Code of practice for site investigations (BS 5930:1999). London, BSI

Great Britain. Parliament (2001) Investigation of potentially contaminated sites. Code of practice (BS 10175:2001). London, BSI

Great Britain. Parliament (2006). Code of practice for the characterization and remediation from ground gas in affected developments (BS 8485:2007). London, BSI

Great Britain. Parliament (2006). The Building Regulations (2000) Site Preparation and Resistance to Contaminants and Moisture (C1/C2). London, The Stationary Office

Haines S, Wilson S (2005). Land Contamination and Reclamation: Site Investigation and Monitoring for Ground Gas Assessment – Back to Basics (Volume 13, No. 3). London, Epp Publications Ltd

LQM/CIEH (2015). The LQM/CIEH S4ULs for Human Health Risk Assessment. 2nd Edition. Nottingham, Land Quality Press

Meta_Generics Ltd (1994). Contaminated Land Research Report (CLR) 5: Information Systems For Land Contamination. London, Department of the Environment

M J Carter Associates (1995). Contaminated Land Research Report (CLR) 6: Prioritisation And Categorisation Procedure For Sites Which May Be Contaminated. London, Department of the Environment

RPS Consultants Ltd (1994). Contaminated Land Research Report (CLR) 3: Documentary Research on Industrial Sites. London, Department of the Environment

The Centre for Research into the Built Environment (1994). Contaminated Land Research Report (CLR) 4: Sampling Strategies for Contaminated Land. London, Department of the Environment

Total Petroleum Working Group (TPWG) (1997). Volume 3: Selection of Representative TPH Fractions Based on Fate and Transport Considerations. Massachusetts, USA, Amherst Scientific Publishers

Total Petroleum Working Group (TPWG) (1997). Volume 4: Development of Fraction Specific Reference Doses (RfDs) and Reference Concentration (RfCs) for Total Petroleum Hydrocarbons (TPH). Massachusetts, USA, Amherst Scientific Publishers

Total Petroleum Working Group (TPWG) (1998). Volume 1: Analysis of Petroleum Hydrocarbons in Environmental Media. Massachusetts, USA, Amherst Scientific Publishers

Total Petroleum Working Group (TPWG) (1998). Volume 2: Composition of Petroleum Mixtures. Massachusetts, USA, Amherst Scientific Publishers

United Kingdom. Department of Environment/Department of Transport (1989). Waste Management Paper No. 27: Landfill Gas. London, Department of Environment


United Kingdom. Environment Agency (2005). The UK Approach for Evaluating Human Health Risks from Petroleum Hydrocarbons in Soils (Science Report P5-080/TR3). Bristol, Environment Agency

United Kingdom. Ministry of Agriculture Fisheries and Food (MAFF) (1998). Code of Good Agricultural Practice for the Protection of Soil. London, Department for Environment Food and Agriculture (DEFRA)

United Kingdom. UK Water Industry Research (UK WIR) (2010). Guidance for the selection of Water Supply Pipes to be used in Brownfield Sites (10/WM/03/21). London, UK WIR

Wilson S (2008). Modular Approach to analysing vapour migration into buildings in the UK. London, EPP Publications Ltd

FIGURES

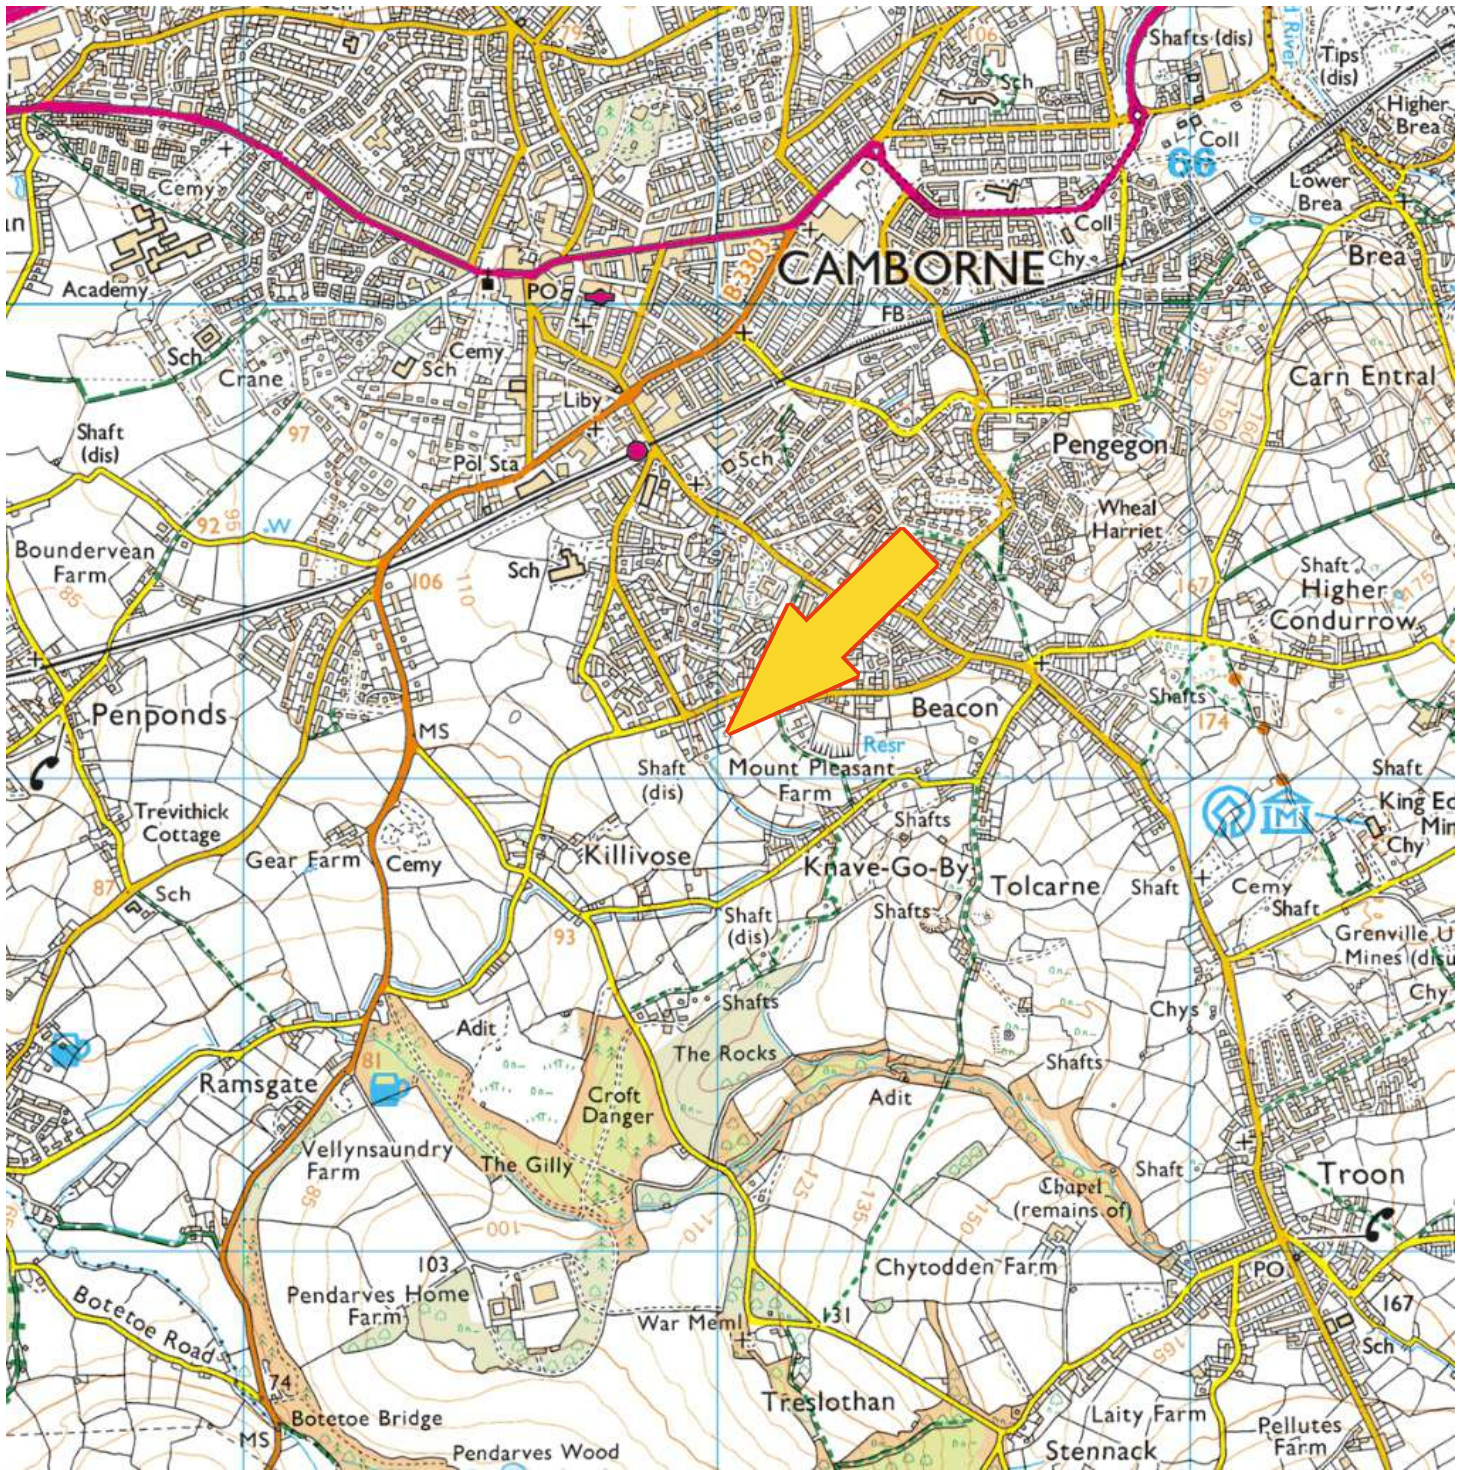

Drawing Notes:

Legend:

Client:

The Rainbow Group

Figure 1:

Site Location Plan
 Lauren House, Camborne, Cornwall

Project Ref: YES 2123a	Drawing Ref: YES 2123a
Drawn By: AM	Date: 05/10/23
Checked By: AW	Date: 05/10/23
Grid Ref: 165020, 39090	Not To Scale



Woodcocks Roost,
 Fore Street, Barripper,
 Camborne, Cornwall TR14 0QR
 M. 07766 850351
 E. info@urenvironmentalsolutions.com
 W. www.urenvironmentalsolutions.com



Drawing Notes:

Legend:

— Site Boundary

Client:

The Rainbow Group

Figure 2:

Site Boundary Plan
Lauren House, Camborne, Cornwall

Project Ref: YES 2123a	Drawing Ref: YES 2123a
Drawn By: AM	Date: 05/10/23
Checked By: AW	Date: 05/10/23
Grid Ref: 165020, 39090	Not To Scale

yes
YOUR ENVIRONMENTAL
SOLUTIONS LTD

Woodcocks Roost,
Fore Street, Barrripper,
Camborne, Cornwall TR14 0QR
M. 07766 850351
E. info@urenvironmentalsolutions.com
W. www.urenvironmentalsolutions.com



Drawing Notes:

Legend:

 Site Boundary

Client:

The Rainbow Group

Figure 3:

Proposed Development Layout Plan
Lauren House, Camborne, Cornwall

Project Ref: YES 2123a | Drawing Ref: YES 2123a

Drawn By: AM | Date: 05/10/23


Checked By: AW | Date: 05/10/23

Grid Ref: 165020, 39090 | Not To Scale

yes
YOUR ENVIRONMENTAL
SOLUTIONS LTD



Woodcocks Roost,
Fore Street, Barrigger,
Camborne, Cornwall TR14 0QR
M. 07766 850351
E. info@urenvironmentalsolutions.com
W. www.urenvironmentalsolutions.com

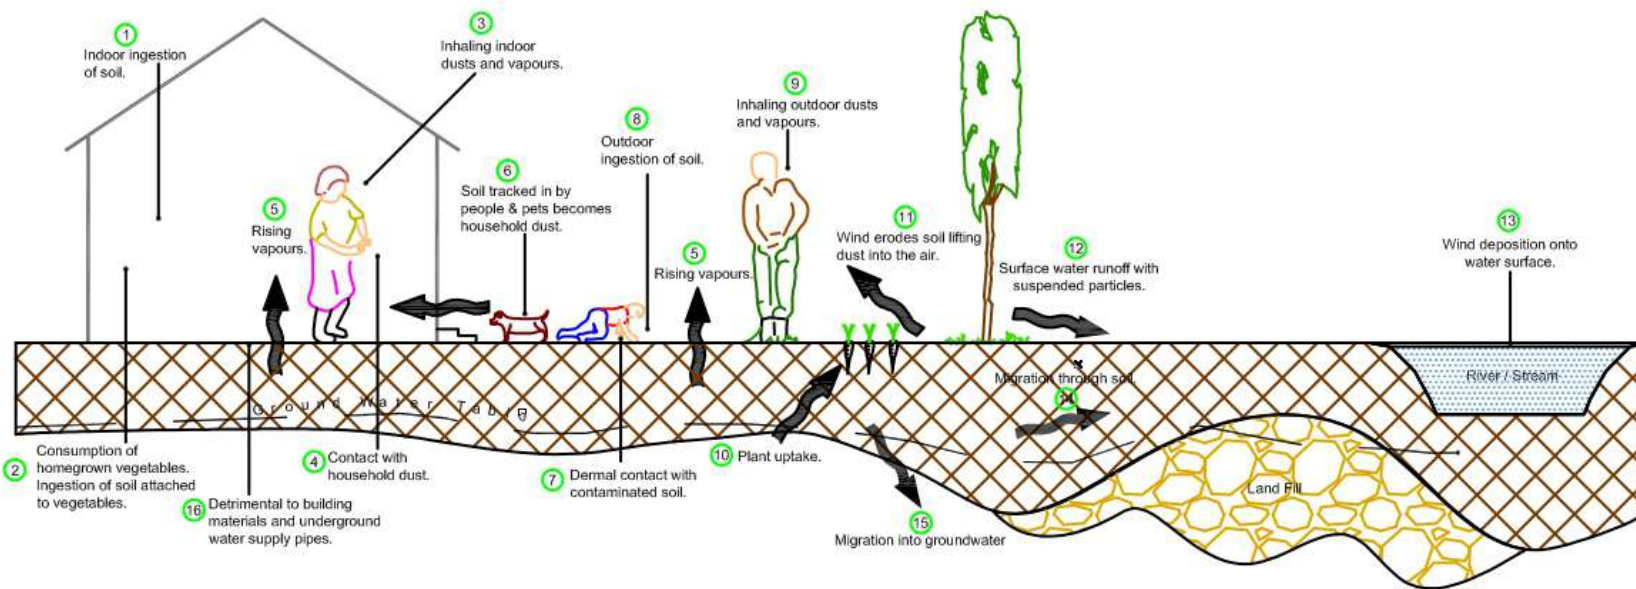

Drawing Notes:

Legend:

Client:

The Rainbow Group

Figure 4:

Conceptual Site Model

Lauren House, Camborne, Cornwall

Project Ref: YES 2123a Drawing Ref: YES 2123a

Drawn By: AM Date: 05/10/23

Checked By: AW Date: 05/10/23

Grid Ref: 165020, 39090 Not To Scale

yes
YOUR ENVIRONMENTAL
SOLUTIONS LTD



Woodcocks Roost,
Fore Street, Barrigger,
Camborne, Cornwall TR14 0QR
M. 07766 850351
E. info@urenvironmentalsolutions.com
W. www.urenvironmentalsolutions.com

FIGURE 4

CONCEPTUAL SITE MODEL – SITE SPECIFIC PLAUSIBLE POLLUTANT LINKAGES

Contaminant	Hazards	Pathways
Arsenic & Other Heavy Metals	Toxic by ingestion, skin contact and inhalation. Water pollutant. May reduce plant growth.	1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15 & 16
Radon	Toxic at elevated levels by inhalation.	5
Polyaromatic Hydrocarbons & Total Petroleum Hydrocarbons	Toxic by ingestion, skin contact and inhalation. Water pollutant. May reduce plant growth. Detrimental to buildings and water supply pipes.	1, 2, 3, 4, 5, 6, 7, 8, 9, 10, 11, 12, 13, 14, 15 & 16

APPENDIX A

SITE WALKOVER PHOTOGRAPHS

SITE WALKOVER PHOTOGRAPHS



PHOTOGRAPH 1: View of the site's access along the back alley towards Cadogan Road



PHOTOGRAPH 2: View of the site's entrance into its northern boundary



PHOTOGRAPH 3: View along the western boundary of the site



PHOTOGRAPH 4: View of the western lawned area of the site



PHOTOGRAPH 5: View of the western lawn garden area towards the south



PHOTOGRAPH 6: View of a concrete block with corrugated metal roof outbuilding located in the north-western corner of the site



PHOTOGRAPH 7: View along the western boundary of the site towards the north



PHOTOGRAPH 8: View along the western area of the site towards the north



PHOTOGRAPH 9: View of an existing outbuilding (over the footprint of the proposed dwelling)
located in south-western area of the site



PHOTOGRAPH 10: View of the access to the outbuilding



PHOTOGRAPH 11: View of the interior of the outbuilding



PHOTOGRAPH 12: View of the interior of the outbuilding



PHOTOGRAPH 13: View of the interior of the outbuilding



PHOTOGRAPH 14: View of the soft garden area located to the immediate south of the dwelling



PHOTOGRAPH 15: View of a shed located on the south-eastern boundary of the site



PHOTOGRAPH 16: View of a former coal store located in the central-northern area of the site



PHOTOGRAPH 17: View of the interior of the coal store

APPENDIX B

ENVIRONMENTAL REPORT

Homecheck Environmental



Contamination Risk PASSED

Professional Opinion

Argyll Environmental Consultants have passed this report in accordance with the definition of contaminated land within Part 2A of the Environmental Protection Act 1990. Please refer to the Professional Opinion page and Section 1 for further information.



Flood Risk: None Identified

Refer to Section 2 for further information

Conveyancer Guidance

While this report may have identified areas at risk of flooding within 250m of the search centre, we consider there to be no significant risk of flooding to the property. Please refer to Section 2 for further information.



Radon: IDENTIFIED

Refer to Section 3 for further information



Ground Stability: None Identified

Refer to Section 4 for further information



Other Influential Factors:

Refer to Section 5 for further information

Environmental Constraints: None Identified

See Section 5a

Report issued for the property at

**Lauren House
CAMBORNE
TR14 7RX**

Report Reference
319399409_1_1

National Grid Reference
165020 39090

Customer Reference
2123_HCP

Report Date
5 October 2023

Contact Details

If you require assistance please contact your Search Provider or phone Customer Services on 0844 844 9966 or email helpdesk@homecheck.co.uk

Landmark Contribution

By purchasing this report, the recipient may be eligible for Remediation Contribution of up to £100,000 if served with a Remediation Notice by the Local Authority. Such a notice may require the homeowner to pay for all, or contribute to, the remediation of the property. For more information see Landmark's Terms and Conditions.



Professional Opinion

Contamination Risk

PASSED

In the professional opinion of Argyll Environmental Consultants, the level of contamination risk associated with the information disclosed in the Homecheck Professional report dated 5th October 2023 and reference 319399409_1_1, 2123_HCP for

Lauren House

CAMBORNE

TR14 7RX

1) is unlikely that the property would be designated "contaminated land" within the meaning of Part 2A of the Environmental Protection Act 1990.

2) is unlikely to have an adverse effect on the security of the property for normal lending purposes.

The professional opinion refers to Section 1 of this report and should always be read in conjunction with the full text of that report. No physical site inspection or survey has been carried out or is proposed.

Approved by

Argyll Environmental Ltd



Contents and Summary of Findings



Site Location



Section 1: Contamination Risk Findings

Contamination Risk	0-25m	25-250m	250-500m	See Section
Designated Contaminated Land	No	No	No	1a
Landfill and Waste	No	No	No	1b
Potentially Contaminative Activities	No	Yes	Yes	1c
Known Pollution Incidents	No	No	No	1d
Other Potential Contaminative Land Uses	No	Yes	n/a	1e



Section 2: Flood Findings

Flood	0-25m	25-250m	See Section
River Flooding	No	No	2a
Coastal Flooding	No	No	2b
Surface Water Flooding	No	No	2c



Section 3: Radon Findings

Radon	Result	See Section
Radon Affected Property	Yes	3



Section 4: Ground Stability Findings

Ground Stability	Result	See Section
Man-Made Factors	No	4a
Natural Factors	No	4b



Section 5: Other Influential Factors

Other Influential Factors	Result	See Section
Environmental Constraints	No	5a



Site Location



Aerial Photograph

The photograph below shows the location of the site to which this report relates.



Homecheck® Report


Lauren House
CAMBORNE
TR14 7RX

Report Reference 319399409_1_1

©Copyright 2023, Landmark Information Group Ltd
All rights reserved
Date 5 October 2023
Page 2 of 24

Location Map

The map below shows the location of the site to which this report relates.

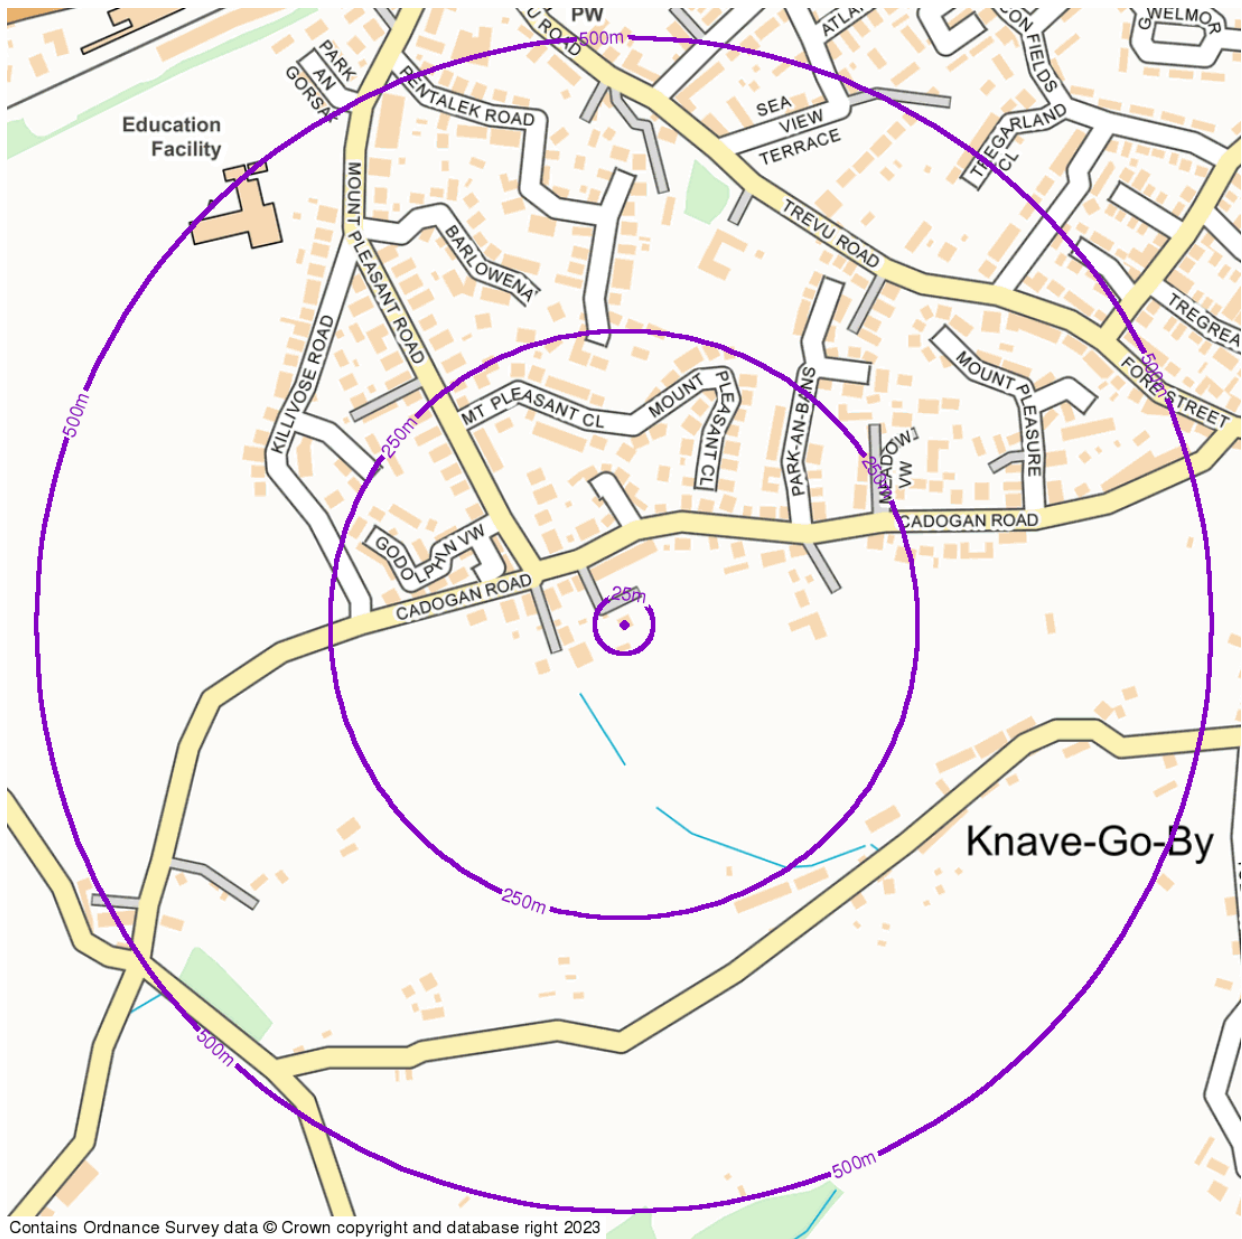

Homecheck® Report

Lauren House
CAMBORNE
TR14 7RX

Report Reference 319399409_1_1

©Copyright 2023, Landmark Information Group Ltd
All rights reserved
Date 5 October 2023
Page 3 of 24




Section 1: Contamination Risk Findings

The whole of section 1 deals with potential sources of contamination and provides the information by which this report has either been passed or referred for assessment.




Section 1a and 1b: Information Map

The map detailed below shows the location of the Designated Contaminated Land and Landfill and Waste features highlighted within sections 1a and 1b of this report.










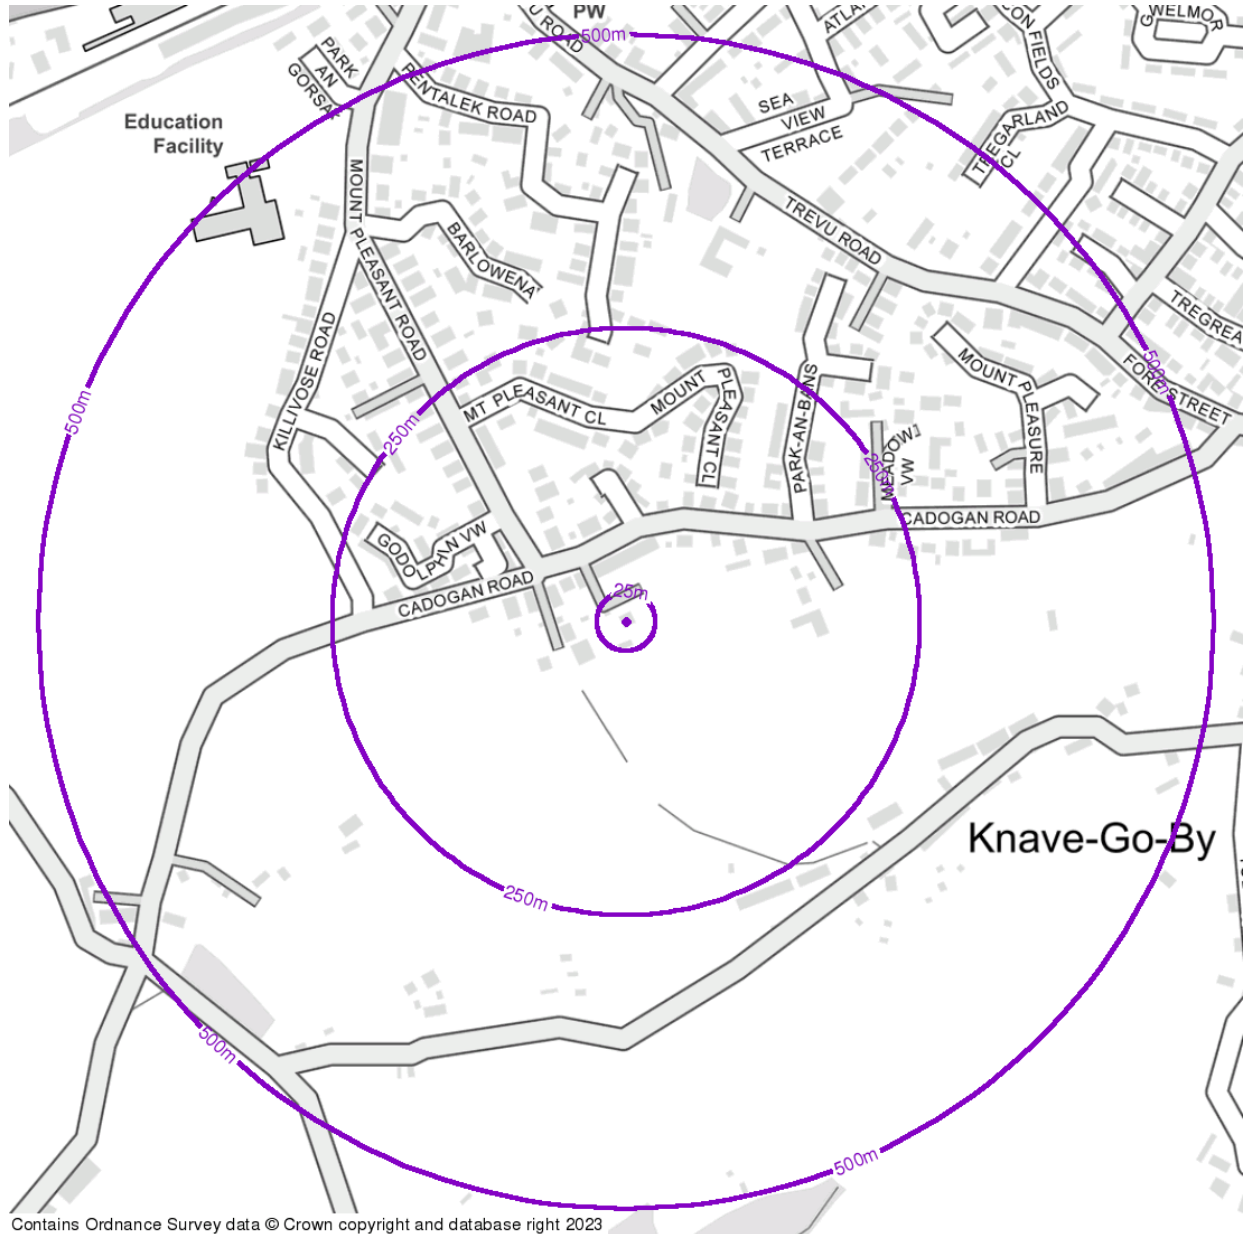


Contains Ordnance Survey data © Crown copyright and database right 2023

Section 1a

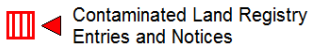

Section 1b

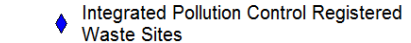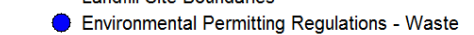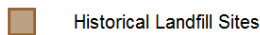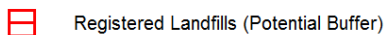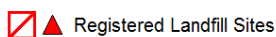

Section 1a: Designated Contaminated Land

The data within this section tells you whether your property or surrounding area has been identified by the Local Authority as "Contaminated Land" under the Environmental Protection Act 1990. Should there be an indication of contamination, it is not necessarily a cause for concern. Your report will be assessed by our professional environmental consultants who will advise you what, if any, considerations need to be made should you proceed with the property purchase.

Enquiry	Result
Has any contaminated land been identified within 500m of the property?	No

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Contaminated Land Register Entries and Notices

No factors identified for this property

Section 1b: Landfill and Waste

The information in this section is telling you about active and historic landfill and waste sites within 500 metres of the property. Having a landfill or waste site near your property does not necessarily mean that you or the property will be affected. However, it is something you need to be aware of, because landfill and waste can have a detrimental effect on the surrounding environment, house value and health. A closed landfill/waste site should be given equal consideration to an active site, because of landfill by-products. For instance, landfill with lots of organic material can continue to produce odours and gas for many years.

Enquiry	Result
Have any landfill and waste sites been identified within 500m of the property?	No

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Registered Landfill Sites

No factors identified for this property

BGS Recorded Landfill Sites

No factors identified for this property

Local Authority Recorded Landfill Sites

No factors identified for this property

Local Authority Recorded Landfill Coverage

The following list details the Local Authorities that cover the search area who have made landfill data available:

Kerrier District Council	- Has no landfill data to supply	3
Cornwall County Council	- Had landfill data but passed it to the relevant environment agency	4

For further information regarding the availability of Local Authority Recorded Landfill data you may wish to forward enquiries to one or more of the contacts indicated above.

Historical Landfill Sites

No factors identified for this property

Permitted Waste Sites - Authorised Landfill Site Boundaries

No factors identified for this property

Environmental Permitting Regulations - Waste

No factors identified for this property

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Integrated Pollution Control Registered Waste Sites

No factors identified for this property

Registered Waste Treatment or Disposal Sites

No factors identified for this property


Registered Waste Transfer Sites

No factors identified for this property



Section 1c and 1d: Information Map

The map detailed below shows the location of the Potentially Contaminative Activities and Known Pollution Incidents features highlighted within sections 1c and 1d of this report.

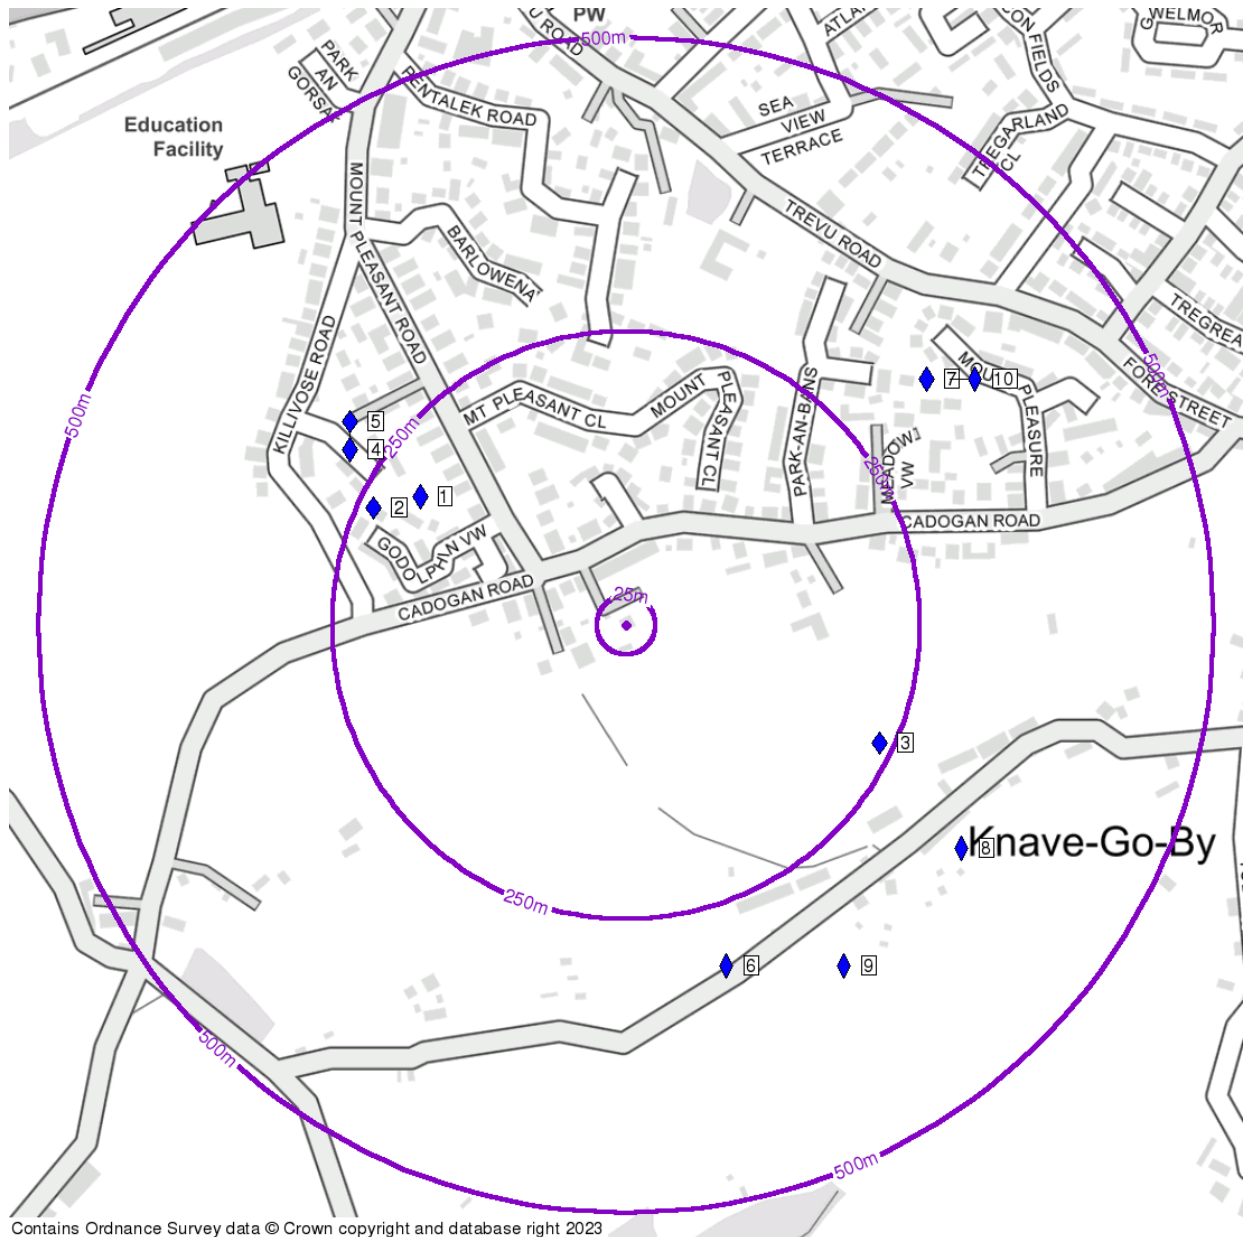

Contains Ordnance Survey data © Crown copyright and database right 2023

Section 1c

- ▲ Local Authority Pollution Prevention and Controls
- ▼ Local Authority Integrated Pollution Prevention and Control
- ▲ Integrated Pollution Controls
- ▶ Environmental Permitting Regulations - Industry
- ◆ Consent to Discharge to Controlled Waters

- ✕ Radioactive Substances Register
- ✕ Planning Hazardous Substance Consents
- ✕ Control of Major Accident Hazards Sites (COMAH)
- ✕ Notification of Installations Handling Hazardous Substances (NIHHS)
- ★ Explosive Sites

Section 1d

- + Local Authority Pollution Prevention and Control Enforcements
- + Enforcement and Prohibition Notices
- + Planning Hazardous Substance Enforcements
- Prosecutions Relating to Authorised Processes
- Environmental Pollution Incidents
- Prosecutions Relating to Controlled Waters

Section 1c: Potentially Contaminative Activities

This section describes current and historic licensed activities within 500 metres of the property, which have the potential to cause contamination or have an impact on the environment. The licensed activities could range from pollution to air, land or water; storage or disposal of radioactive substances; or storage of hazardous or explosive materials. Licences may no longer be active, but the nature of the past activity means it could still have an impact.

Enquiry	Result
Have any potentially contaminative activities been identified within 500m of the property?	Yes

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Local Authority Pollution Prevention and Controls

No factors identified for this property

Local Authority Integrated Pollution Prevention And Control

No factors identified for this property

Integrated Pollution Controls

No factors identified for this property

Environmental Permitting Regulations - Industry

No factors identified for this property

Consent to Discharge to Controlled Waters

1	<p>Name: Mr C R & Mrs G A Stevens</p> <p>Reference: 300216/Sa/01</p>	<p>Plot 2 Killivose Gardens Killivose Road Camborne Cornwall Tr14 7rn</p>	<p>Type: Sewage Discharge</p> <p>Discharge Type: Sewage Discharges - Final/Treated Effluent - Not Water Company</p> <p>Property Type: DOMESTIC PROPERTY (SINGLE) (INCL FARM HOUSE)</p> <p>Discharge Environment Type: Land/Soakaway</p> <p>Receiving Water: Soakaway</p> <p>Status: Varied by Application - (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995)</p> <p>Date of Issue: 15th January 1997</p> <p>Positional Accuracy: Located by supplier to within 100m</p>	207m	1
2	<p>Name: Robert Thornley & Jill Weeks</p> <p>Reference: 300218/Sa/01</p>	<p>Plot 4 Killivose Gardens Killivose Road Camborne Cornwall Tr14 7rn</p>	<p>Type: Sewage Discharge</p> <p>Discharge Type: Sewage Discharges - Final/Treated Effluent - Not Water Company</p> <p>Property Type: DOMESTIC PROPERTY (SINGLE) (INCL FARM HOUSE)</p> <p>Discharge Environment Type: Land/Soakaway</p> <p>Receiving Water: Soakaway</p> <p>Status: Varied by Application - (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995)</p> <p>Date of Issue: 15th January 1997</p> <p>Positional Accuracy: Located by supplier to within 100m</p>	238m	1

Map ID	Reference	Location	Details	Distance	Contact
3	Name: South West Water Reference: 300701	Knave-Go-Bye Combined Sewer Overflo Knave-Go-Bye Beacon Camborne Cornwall Tr14 9ae	Type: Sewerage Discharge Discharge Type: Public Sewage: Storm Sewage Overflow Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Discharge Environment Type: Freshwater Stream/River Receiving Water: Trib Of The Reen Stream(S) Status: New Consent (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995) Date of Issue: 20th January 2000 Positional Accuracy: Located by supplier to within 10m	238m	1
4	Name: Mr C R & Mrs G A Stevens Reference: 300217/Sa/01	Plot 3 Killivose Gardens Killivose Road Camborne Cornwall Tr14 7rn	Type: Sewage Discharge Discharge Type: Sewage Discharges - Final/ Treated Effluent - Not Water Company Property Type: DOMESTIC PROPERTY (SINGLE) (INCL FARM HOUSE) Discharge Environment Type: Land/Soakaway Receiving Water: Soakaway Status: Varied by Application - (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995) Date of Issue: 15th January 1997 Positional Accuracy: Located by supplier to within 100m	279m	1
5	Name: Ms J M L Thompson Reference: 300215/Sa/01	Plot 1 Killivose Gardens Killivose Road Camborne Cornwall Tr14 7rn	Type: Sewage Discharge Discharge Type: Sewage Discharges - Final/ Treated Effluent - Not Water Company Property Type: DOMESTIC PROPERTY (SINGLE) (INCL FARM HOUSE) Discharge Environment Type: Land/Soakaway Receiving Water: Soakaway Status: Varied by Application - (Water Resources Act 1991, Schedule 10 as amended by Environment Act 1995) Date of Issue: 15th January 1997 Positional Accuracy: Located by supplier to within 100m	285m	1
6	Name: South West Water Reference: 300701	Knave-Go-Bye Combined Sewer Overflo Knave-Go-Bye Beacon Camborne Cornwall Tr14 9ae	Type: Sewerage Discharge Discharge Type: Public Sewage: Storm Sewage Overflow Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Discharge Environment Type: Freshwater Stream/River Receiving Water: Trib Of Roseworthy Stream Status: Varied under EPR 2010 Date of Issue: 11th June 2020 Positional Accuracy: Located by supplier to within 100m	303m	1

Map ID	Reference	Location	Details	Distance	Contact
7	Name: B Bolitho Reference: NRA-SW-2350/1	Plot 1 Meadowview Cadogan Road CAMBORNE Cornwall	Type: Sewerage Discharge Discharge Type: Sewage Effluent Discharge-Treated Effluent Property Type: Wooden Containers Discharge Environment Type: Land/Soakaway Receiving Water: Licence Status: Lapsed, Revoked Or Cancelled Status: Not Supplied Date of Issue: 13th November 1990 Positional Accuracy: Located by supplier to within 100m	331m	1
8	Name: South West Water Reference: Nra-Sw-1278	Helston (Knave Go By) Sso Helston Cornwall	Type: Sewage Discharge Discharge Type: Sewage Discharges - Stw Storm Overflow/Storm Tank - Water Company Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Discharge Environment Type: Freshwater Stream/River Receiving Water: Renns Stream Red River Status: New Consent (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995) Date of Issue: 30th October 1989 Positional Accuracy: Located by supplier to within 100m	343m	1
9	Name: South West Water Reference: 15/49/26/P/47	Troon Storm Sewage Overflow No1 Camborne Cornwall	Type: Sewage Discharge Discharge Type: Sewage Discharges - Stw Storm Overflow/Storm Tank - Water Company Property Type: STORM TANK/CSO ON SEWERAGE NETWORK (WATER COMPANY) Discharge Environment Type: Freshwater Stream/River Receiving Water: Reens Stream Status: Authorisation revoked Date of Issue: 27th January 1971 Positional Accuracy: Located by supplier to within 100m	344m	1
10	Name: B Bolitho Reference: Nra-Sw-2351	Plot 2 Meadowview Cadogan Road Camborne Cornwall	Type: Sewage Discharge Discharge Type: Sewage Discharges - Final/Treated Effluent - Not Water Company Property Type: DOMESTIC PROPERTY (SINGLE) (INCL FARM HOUSE) Discharge Environment Type: Land/Soakaway Receiving Water: Soakaway Status: New Consent (Water Resources Act 1991, Section 88 & Schedule 10 as amended by Environment Act 1995) Date of Issue: 13th November 1990 Positional Accuracy: Located by supplier to within 100m	347m	1

Radioactive Substances Register

No factors identified for this property

Planning Hazardous Substance Consents

No factors identified for this property

Homecheck® Report

Lauren House
CAMBORNE
TR14 7RX

Report Reference 319399409_1_1

©Copyright 2023, Landmark Information Group Ltd
All rights reserved
Date 5 October 2023
Page 10 of 24

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Control of Major Accident Hazards Sites (COMAH)

No factors identified for this property

Notification of Installations Handling Hazardous Substances (NIHHS)

No factors identified for this property

Explosive Sites

No factors identified for this property

Next Steps

If you would like any further information in respect of the above findings we recommend that you contact the relevant Local Authority or the Environment Agency/Natural Resources Wales, their contact details can be found in the 'Useful Contacts' section of this report. Further Information is also available in the 'Useful Information' section.

Section 1d: Known Pollution Incidents

The data within this section describes unpermitted activity in your area (e.g. polluting incidents, or exceedance of permitted allowance) where the activity led to a prosecution or enforcement of regulations. Whilst all of these records are historic, the nature of the incident may have long term effects.

Enquiry	Result
Have any known pollution incidents been identified within 500m of the property?	No

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Local Authority Pollution Prevention and Control Enforcements

No factors identified for this property

Enforcement and Prohibition Notices

No factors identified for this property

Planning Hazardous Substance Enforcements

No factors identified for this property

Prosecutions Relating to Authorised Processes

No factors identified for this property

Environmental Pollution Incidents

No factors identified for this property

Prosecutions Relating to Controlled Waters

No factors identified for this property



Section 1e: Information Map

The map detailed below shows the location of the Other Potential Contaminative Land Uses features highlighted within section 1e of this report.



Contains Ordnance Survey data © Crown copyright and database right 2023

- | | |
|--|---|
| ✘ Fuel Station Entries | ☒ Potentially Infilled Land (Non-Water) |
| ★ Contemporary Trade Directories | ☒ Potentially Infilled Land (Water) |
| ⊕ Former Marshes | ■ Potentially Contaminative Industrial Uses (Past Land Use) |
| ▼ Historical Tanks and Energy Facilities | |

Section 1e: Other Potential Contaminative Land Uses

This section describes either current or historic activity, which could be considered to be contaminative. This section makes no statement about whether the activity requires a licence; however our environmental experts deem that the activities described in this section could lead to potential contamination. The information is taken from a variety of sources including trade directories, Landmark's extensive historical map collection and analysis of historic activity. Records are highlighted due to the potential for contamination to exist.

Enquiry	Result
Have any other potential sources of contamination been identified within 250m of the property?	Yes

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Fuel Station Entries

No factors identified for this property

Contemporary Trade Directory Entries

11	Name: P R Consultants	95 Mount Pleasant Road Camborne Cornwall TR14 7RJ	Classification: Engineers - General Status: Inactive Positional Accuracy: Automatically positioned to the address	88m	-
12	Name: Pique Perfumes	41 Mount Pleasant Close Camborne Cornwall TR14 7RZ	Classification: Perfume Suppliers Status: Inactive Positional Accuracy: Automatically positioned to the address	219m	-
13	Name: Abbey Cleaning Uk	9 Parc-an-Bans Camborne TR14 7RW	Classification: Commercial Cleaning Services Status: Active Positional Accuracy: Automatically positioned to the address	223m	-
14	Name: Jenstar Integration Ltd	31 Mount Pleasant Close Camborne Cornwall TR14 7RZ	Classification: Automation Systems & Equipment Status: Inactive Positional Accuracy: Automatically positioned to the address	225m	-

Former Marshes

No factors identified for this property

Potentially Infilled Land (Non-Water)

15	Not Supplied	Not Supplied	Unknown Filled Ground (Pit, quarry etc) Map Published Date: 1980	243m	-
----	--------------	--------------	--	------	---

Potentially Infilled Land (Water)

No factors identified for this property

Potentially Contaminative Industrial Uses (Past Land Use)

16	Not Supplied	Not Supplied	Class: Mining & quarrying general Map Published Date: 1888	69m	-
17	Not Supplied	Not Supplied	Class: Mining & quarrying general Map Published Date: 1888	243m	-

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Historical Tanks And Energy Facilities

18	Not Supplied	Not Supplied	Type: Tanks Positional Accuracy: Positioned to location of cartographic text Date of Mapping: 1967	162m	-
18	Not Supplied	Not Supplied	Type: Tanks Positional Accuracy: Positioned to location of cartographic text Date of Mapping: 1967	163m	-

Next Steps

If you would like any further information in respect of the above findings we recommend that you contact our Customer Services Team, whose details can be found in the 'Useful Contacts' section of this report. Further Information is also available in the 'Useful Information' section.




Section 2: Flood Findings

The whole of this section deals with potential sources of flooding that may impact the property.




Section 2a and 2b: River and Coastal Flood Map

The map detailed below shows the location of potential river and coastal flood risk. The potential risk has been modelled on the basis of an event occurring on average every 75, 200 or 1000 years.

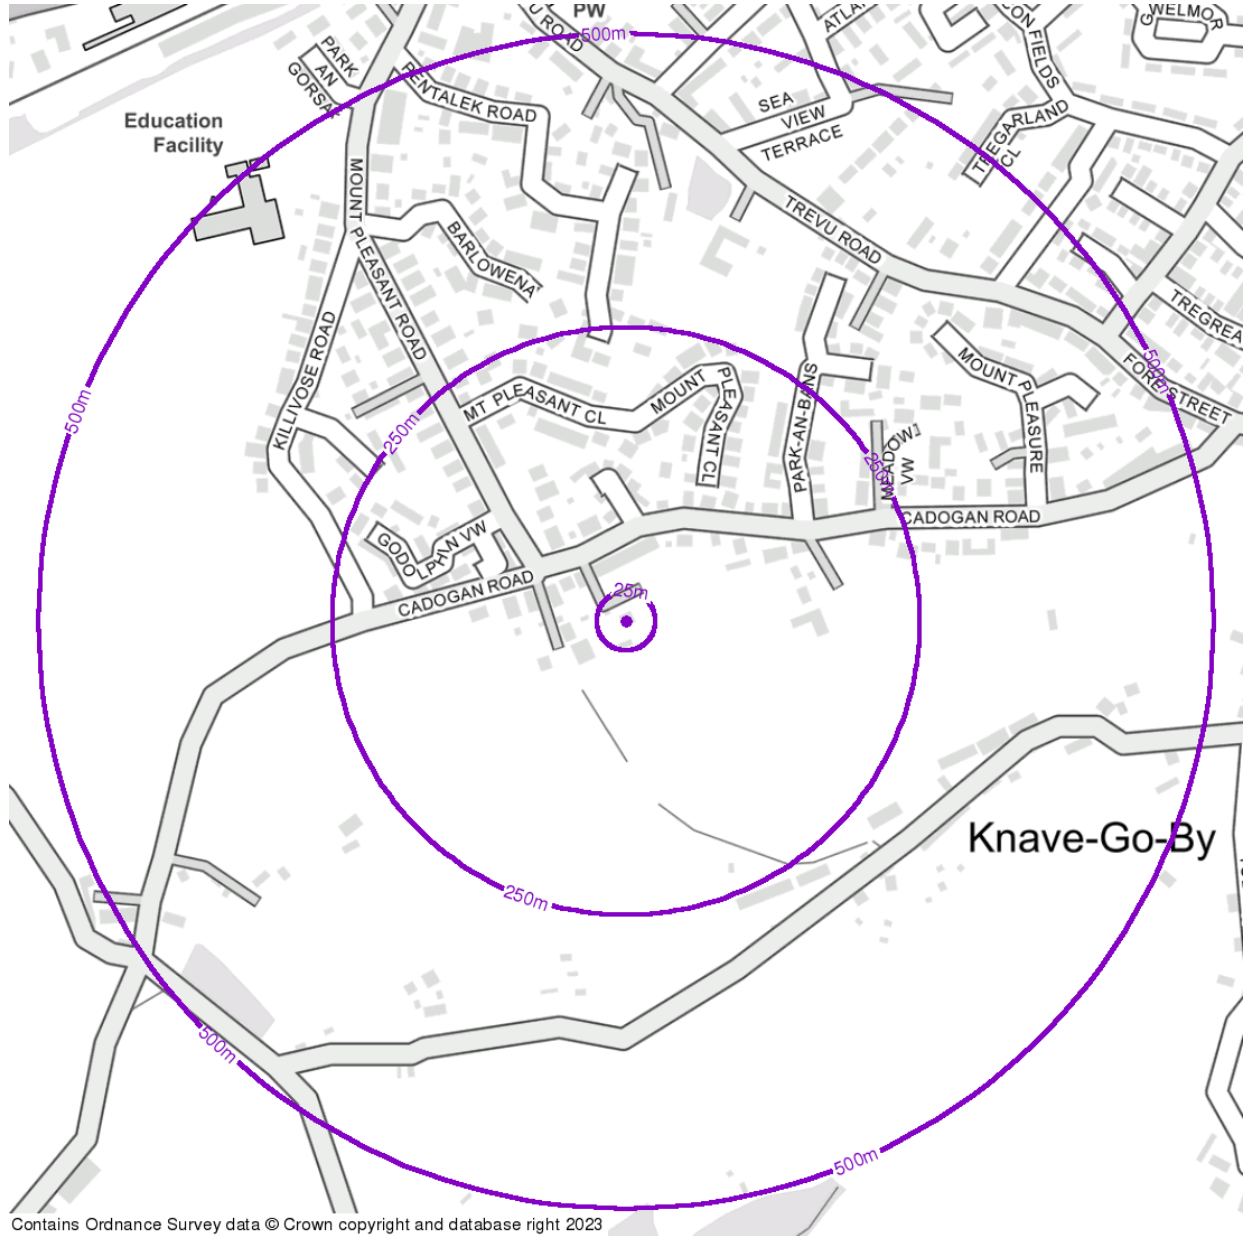


Contains Ordnance Survey data © Crown copyright and database right 2023

River Flooding

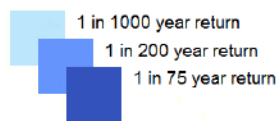


Coastal Flooding

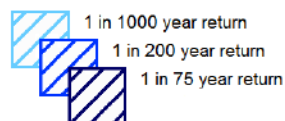




Section 2c: Surface Water Flood Map

The map detailed below shows the location of potential surface water flood risk. The potential risk has been modelled on the basis of an event occurring on average every 75, 200 or 1000 years.

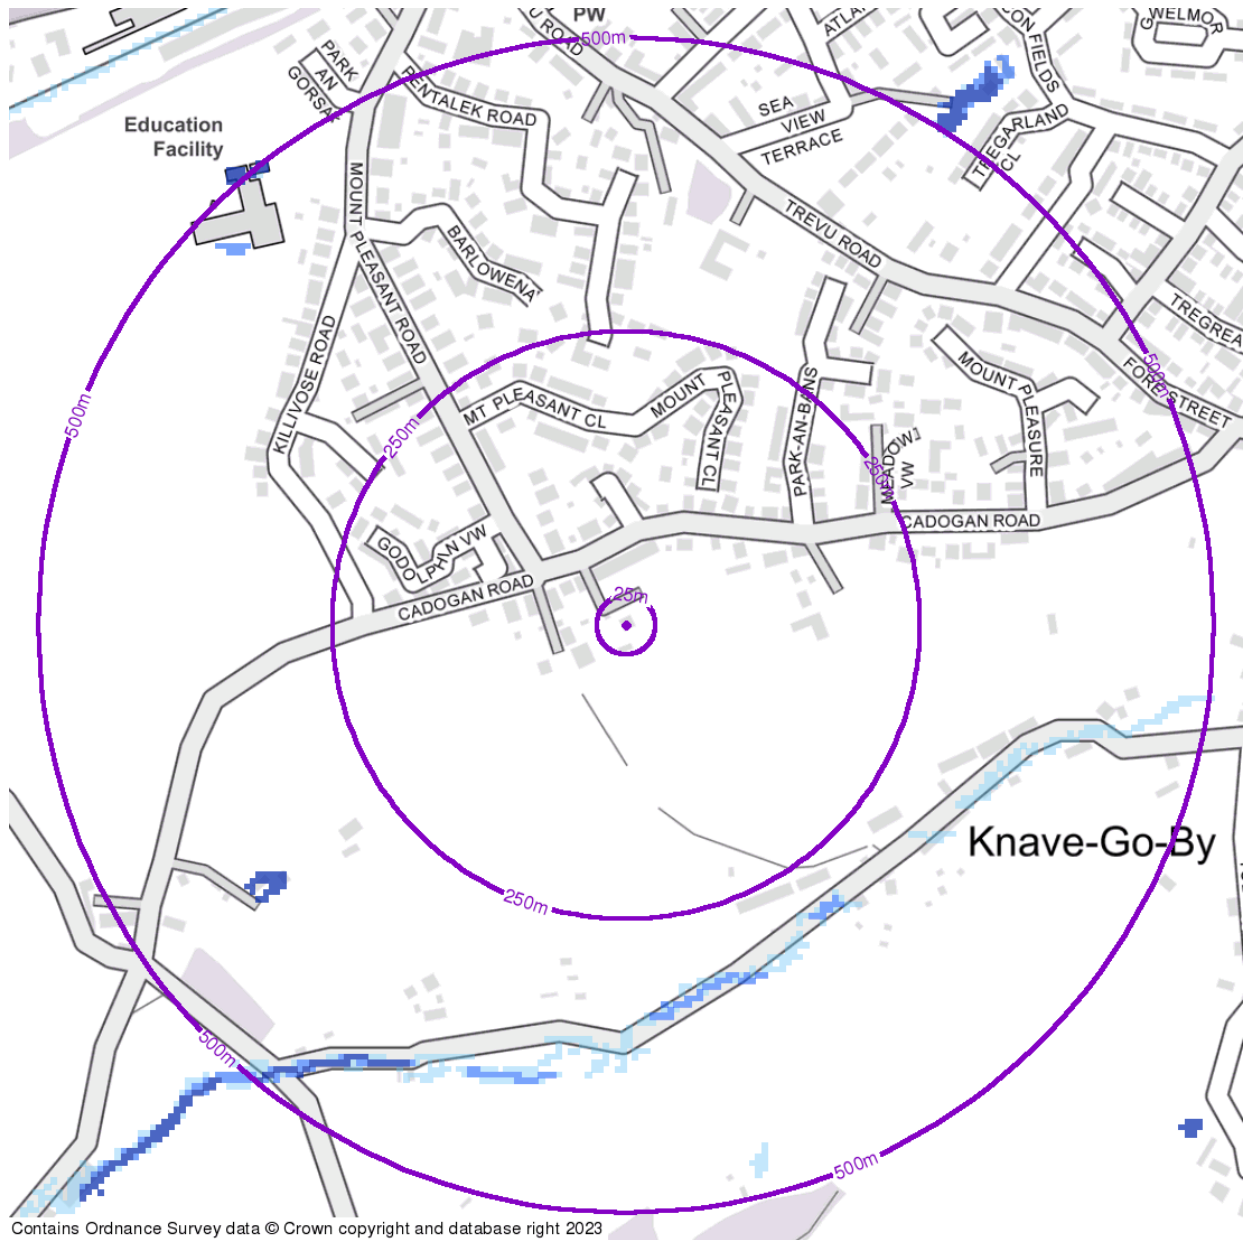

Contains Ordnance Survey data © Crown copyright and database right 2023

Surface Water Flooding



Section 2a: River Flooding

River flooding mainly happens when the river catchment (that is the area of land that feeds water into the river and the streams that flow into the main river) receives greater than usual amounts of water (for example through rainfall or melting of snow). The amount of runoff depends on the soil type, catchment steepness, drainage characteristics, agriculture and urbanisation as well as the saturation of the catchment. The extra water causes the level of the water in the river to rise above its banks or retaining structures.

Enquiry	Result	Contact
Is there a potential risk of river flooding within 250m of the property?	No	-

Section 2b: Coastal Flooding

Coastal flooding is the inundation of land areas along the coast caused by sea water rising above normal tidal conditions. Coastal flooding can arise from a combination of high tides, wind induced tidal surge, storm surge created by low pressure and wave action.

Enquiry	Result	Contact
Is there a potential risk of coastal flooding within 250m of the property?	No	-

Section 2c: Surface Water Flooding

Surface water flooding results from rainfall running over ground before entering a watercourse or sewer. It is usually associated with high intensity rainfall events (typically greater than 30mm per hour) but can also occur with lower intensity rainfall or melting snow where the ground is already saturated, frozen, developed (for example in an urban setting) or otherwise has low permeability.

Enquiry	Result	Contact
Is there a potential risk of surface water flooding within 250m of the property?	No	-

Next Steps

In order to gain more detailed information on the type and likelihood of your property being impacted by a flood event, and the potential impact on insurance, we recommend that you purchase our Landmark Flood Report.

If you would like more information please contact your Search Provider or our Customer Services Team on **0844 844 9966** or email helpdesk@homecheck.co.uk.

Flood data provided by JBA Risk Management Limited. © Copyright JBA Risk Management Limited 2008-2023



Section 3: Radon Findings

The information within this section tells you whether the property is located in a radon affected area. Radon is a radioactive gas which occurs naturally in rocks and soils. You cannot see, hear, feel or taste it. Exposure to particularly high levels of radon may increase the risk of developing lung cancer, and is therefore something you need to be aware of or should consider.

Enquiry	Result	Contact
Is the property in a radon affected area?	The property is in a radon affected area, as over 30% of homes are above the action level	2
What level of radon protection measures for new dwellings or extensions to existing ones is required for the property?	Full radon protective measures are necessary in the construction of new dwellings or extensions	2

Next Steps

The level of radon concentration can only be established by having the building tested. Action should be taken if the indoor radon level is measured and found to be above 200 becquerel's per cubic meter. If you would like any further information we recommend you contact Public Health England whose details can be found in the 'Useful Contacts' section of this report.

Further Action

Airtech Environmental Systems can advise on radon testing kits, which cost £39.36 including VAT and can run from 7 days to 3 months. They also have a team of surveyors on hand to provide recommendations and advice for any properties above the target level of 100 becquerel's per cubic meter or action level of 200 becquerel's per cubic meter. Airtech Environmental Systems can provide a report, recommendations and a quotation for any recommended works. For more detailed information please call their free-phone number 0800 378017.



Section 4: Ground Stability Findings

This section provides summary information on factors that could affect the ground stability of the property. It considers both man-made factors (e.g. mining activity) and natural hazards (e.g. geological stability).

Section 4a: Man-Made Factors

Enquiry	Result	Contact
Is the property within 25m of a Coal Mining Affected Area?	No	-

Section 4b: Natural Factors

Enquiry	Result	Contact
What is the potential for natural ground instability in the area within 50m of the property?	Very Low	-
<p>Comment: The British Geological Survey has assessed the area of search as having very low potential for natural ground instability. This does not necessarily mean there is cause for concern in terms of the property's stability. Active subsidence will be dependent on local conditions, such as the proximity of trees or areas where trees have been removed, which require an inspection of the site to identify the nature of the ground on which the property is built. A house buyers survey is advised to look for signs of property damage that may indicate poor natural ground conditions.</p>		



Section 5: Other Influential Factors

The following section provides information on a variety of factors which may have an influence on the property or surrounding area.



Section 5a: Environmental Constraints

Enquiry	Result
Is the property within 250m of an area likely to be impacted by Environmental Constraints?	No

Map ID	Reference	Location	Details	Distance	Contact
--------	-----------	----------	---------	----------	---------

Areas of Outstanding Natural Beauty

No factors identified for this property

Local Nature Reserves

No factors identified for this property

National Nature Reserves

No factors identified for this property

National Parks

No factors identified for this property

Ramsar Sites

No factors identified for this property

Sites of Special Scientific Interest

No factors identified for this property

Special Areas of Conservation

No factors identified for this property

Special Protection Areas

No factors identified for this property

Useful Contacts

Contact 1 - Environment Agency - National Customer Contact Centre (NCCC)

PO Box 544 Templeborough Rotherham S60 1BY	Tel: 03708 506 506	enquiries@environment-agency.gov.uk
---	--------------------	--

Contact 2 - Public Health England - Radon Survey, Centre for Radiation, Chemical and Environmental Hazards

Chilton Didcot Oxfordshire OX11 0RQ	Tel: 01235 822622 Fax: 01235 833891	radon@phe.gov.uk www.ukradon.org
--	--	--

Contact 3 - Kerrier District Council (now part of Cornwall Council) - Environmental Health Department

County Hall Treyew Road Truro Cornwall TR1 3AY	Tel: 0300 1234 100	enquiries@cornwall.gov.uk www.cornwall.gov.uk
--	--------------------	--

Contact 4 - Cornwall County Council (now part of Cornwall Council)

County Hall Treyew Road Truro Cornwall TR1 3AY	Tel: 0300 1234 100	enquiries@cornwall.gov.uk www.cornwall.gov.uk
--	--------------------	--

Landmark Information Group Limited

Legal and Financial Imperium Reading Berkshire RG2 0TD	Tel: 0844 844 9966 Fax: 0844 844 9980	helpdesk@homecheck.co.uk www.landmarkinfo.co.uk
--	--	--

The Landmark website contains links to many of our data suppliers which may prove useful.

Please note that the Environment Agency/Natural Resources Wales/SEPA have a charging policy in place for enquiries.

Landmark works in association with:



Report Version: HCP v1.0.4.5

Useful Information

The following explanatory notes may be of assistance to users of the Homecheck Professional report. Practitioners are reminded that full guidance notes are contained in the Practitioners Guide.

Professional Opinion

A Professional Opinion in relation to Part 2A of the Environmental Protection Act 1990 is provided by Argyll Environmental Consultants. In many cases the report will be PASSED without referral. However, in some cases, entries that may be of concern are revealed by the search, in which case the report is REFERRED free of charge for more detailed consideration, although this will not include a physical site inspection. After such referral the report may be PASSED or suggestions made of some FURTHER ACTION that could be taken, in the form of questions to ask of the appropriate authorities. When responses to these questions are received it is the responsibility of the client and their professional advisors to decide if they are happy to proceed.

Flood Risk

A limited flood risk screening exercise is included in this report designed to satisfy basic flood risk screening due diligence including consideration of river, coastal and surface water flooding. Where a potential flood risk is "Identified" you may wish to consider commissioning a more detailed flood risk screening report. When there is "None Identified" this does not indicate that there is not risk of flooding at the property, but that the risk of flooding from the sources screened (river, coastal and surface water) within the vicinity of the property is such that the risk may not be considered significant.

Location Map

The Ordnance Survey location map may show features which are not necessarily otherwise included in this report. You are advised to supplement the information contained in the report with the descriptive text shown on the map.

Positional Accuracy

We locate data in a variety of ways according to information provided to us and subsequent in-house research. If data is provided as a point on the ground, we provide a "positional accuracy" which tells you how confident we are of the actual location.

Section 1b: Landfill and Waste

At present no complete national data set exists for landfill site boundaries, therefore, a point grid reference, provided by the data supplier, is used for some landfill sites. In certain cases the point grid references supplied provide only an approximate position, and can vary from the site entrance to the centre of the site. Where the exact position of the site is unclear for Registered Landfill data, Landmark construct either a 100 metre or 250 metre "buffer" around the point to warn of the possible presence of landfill. The size of this "buffer" relates to the positional accuracy that can be attributed to the site. The "buffer" is shown on the map as a red hatched area. For further information regarding landfill sites identified in the report, please contact the relevant environment agency or authority referenced in the Useful Contacts section.

The BGS holds records of over 3,000 landfill sites that accepted waste prior to the Control of Pollution Act (COPA) 1974. These were not subject to any strict regulation or monitoring.

Permitted Waste Sites and Environmental Permitting Regulations - Waste cover current or recently current consents issued for landfill sites, waste transfer, treatment or disposal sites by the Environment Agency/Natural Resources Wales, under Section 64 of the Environmental Protection Act 1990 (Part 2) and prescribed by regulation 10 of SI No. 1056 of the Waste Management Licensing Regulations 1994.

Section 1c: Potentially Contaminative Activities

Identified discharge consents could be for storm water discharges, soakaways or septic tanks.

If a radioactive substance licence has been identified the consent band will be given under enquiries and replies. Consents fall into one of four bands: Band 1 and 2 Nuclear licensed sites authorised by the Nuclear Installations Inspectorate e.g. nuclear power stations Band 3 Site registered/authorised to accumulate and dispose of radioactive materials, only non-nuclear operations are carried out on site e.g. hospitals Band 4 Sites registered to keep and use radioactive material e.g. laboratories, universities, commercial premises using appliances such as monitoring equipment, alarm systems, tritium lighting etc.

Data supplied for Explosive Sites, Control of Major Accident Hazards Sites (COMAH) and Notification of Installations Handling Hazardous Substances (NIHHS) contains public sector information published by the Health and Safety Executive and licensed under the Open Government Licence.

Section 1e: Other Potential Contaminative Land Uses

This section relates to categories of potentially contaminative land uses that have been identified by the analysis of selected Ordnance Survey historical mapping. The published date (range of dates) of the map (s) and the distance from the centre of search to the nearest point of the feature is given. Further details of the extent of the site or its activities are not available. Should you wish to examine the Ordnance Survey maps these are normally available for public inspection at the local archive or local major library. Alternatively, extracts of editions of Ordnance Survey maps are available on www.old-maps.co.uk

Potentially infilled land has been identified when a 'cavity' (a hole made by an extractive industry or natural occurrence e.g. pond) was indicated on a historic map but there was no evidence of its existence in the last available map for the area. No details of what may have been used to fill the cavity or exactly when or if it was filled are available from the mapping.

The point locations of historical tanks and energy facilities are identified from the text on Ordnance Survey 1:1250 and 1:2500 scale mapping published between 1943 and 1996, based upon a predetermined list of abbreviations, e.g. El Sub (Electricity Sub-station) and F Stn (Filling Station). The position of the point has been located at the centre of the identified text so that it would be within approximately 30 meters of the feature it was describing. The features themselves are related to energy and petroleum storage and cover the following: tanks, petrol storage, potential tanks (at depots etc.), electricity sub stations and related features, gas and gas monitoring related features, oil related features and miscellaneous power features. NB: It should be noted that the Ordnance Survey abbreviation for tank (tk) is the same as that for tracks. Therefore some of the captured text may relate to tracks and not tanks when the exact nature of the feature is not clear from the mapping.

Section 2: Flood Findings

Sections 2a, b and c of the report provide data on modelled extents of river, coastal and surface water flooding generated by JBA Risk Management, a market leader in flood risk assessment commonly engaged by insurers to assess flood risk. The data has been modelled for several perils or return periods: 1 in 75, 1 in 200 or 1 in 1000 which relate to areas with a 1.3%, 0.5% and 0.1% annual probability of flooding in any one year respectively. Properties at risk of flooding during a 1 in 75 year event are typically considered to be at a high risk of flooding. The data has been generated to provide a UK wide screening tool and as a result may have inherent limitations. In addition, there may be areas of the country which are modelled to varying degrees of accuracy based on currently available topographical information.

Section 3: Radon Findings

Due to the nature of way the information is gathered, your property/site may have more than one probability of radon attributed to it. We report the worst case scenario on the property/site you have provided. This information is an estimate of the probability that a property /site in Great Britain is at or above the "Action Level" for radon (the level at which Public Health England recommends that radon levels should be reduced, those with an average of 200 Bq m⁻³ or more). This information satisfies CON29 Standard Enquiry of Local Authority; 3.13 Radon Gas: Location of the Property in a Radon Affected Area. Where the property/site is a new build, this information provides information on the level of protection required for new buildings under BR211 (Scivyer, 2007) Radon: Guidance on protective measures for new buildings.

Disclaimer: "Some of the responses contained in this section are based on data and information provided by the Natural Environment Research Council (NERC) or its component bodies the British Geological Survey (BGS). Your use of any information contained in this report which is derived from or based upon such data and information is at your own risk. Neither NERC, BGS nor Public Health England where applicable, gives any warranty, condition or representation as to the quality, accuracy or completeness of such information and all liability (including liability for negligence) arising from its use is excluded to the fullest extent permitted by law."

Section 5a: Environmental Constraints

The Local Nature Reserves national dataset is "indicative" not "definitive". Definitive information can only be provided by individual local authorities and you should refer directly to their information for all purposes that require the most up to date and complete dataset.

General

If after reading the details in this report regarding the sites identified, you still require further information, please contact the relevant environment agency or authority indicated in the Useful Contacts section quoting the corresponding reference given in the text of the report.

The contacts in the Useful Contacts section may be able to provide further information relating to items identified in the report, however they are not in a position to advise how these might affect the value of a property. The findings of the report should be discussed with your professional advisor.

The Purpose and Scope of the Report

The report is designed to satisfy the concerns raised by the Law Society warning card and has been prepared to assist conveyancing professionals who may be advising clients when they sell or buy a property, obtain a mortgage, seek further mortgage advice, or commence any building works. It is designed to bring information to their attention and help them decide whether they need to seek any further specialist advice. As the report is so detailed, this information can cause concern, but professional advisors will see that further action is suggested on all issues that have been identified.

Limitations

This report has been published by Landmark Information Group Limited ("Landmark") and is supplied subject to our Terms and Conditions of Business, which can be found at <http://www.landmarkinfo.co.uk/Terms/Show/534>. It has been prepared on the understanding that it is to be used for an individual residential property transaction and should not be used or relied upon in a commercial property transaction. This report is neither a guarantee of the physical condition of the subject property nor a substitute for any physical investigation or inspection. The information in Homecheck Professional is derived from a number of statutory and non-statutory sources (see The Practitioner Guide for details). Whilst every effort is made to ensure the details in the report are correct, Landmark cannot guarantee the accuracy or completeness of such information or data, nor identify all the factors that may be relevant. If you are a private individual using this report Landmark recommends that you discuss its contents in full with your professional advisor. The methodology for risk assessment and the conclusions drawn therefrom are the responsibility of Argyll Environmental Consultants.

Insurance

Houses registered between 1st April 1999 and 31st December 2002 and covered by the NHBC Buildmark scheme probably have insurance against certain costs if contamination occurs within ten years of their construction. From 1st January 2003, NHBC will only provide this cover if building control has been carried out by NHBC Building Control Services Limited.

Landmark Standard Terms and Conditions

Full Terms and Conditions can be found on the following link: <http://www.landmarkinfo.co.uk/Terms/Show/534>

If you experience difficulties accessing our Terms and Conditions, please copy and paste the link directly into your browser, you will then be able to access our Terms and Conditions from there. Should you still experience difficulties, please telephone our Customer Service Team on 0844 844 9966.

Copyright Statement

The data supplied for this Homecheck Professional report falls under the following copyrights: © Landmark Information Group and/or its Data Suppliers 2023; © Environment Agency and database right 2023; © Environment Agency & United Kingdom Research and Innovation 2023; ©Experian Ltd 2023; Produced in whole or in part under licence from, and based in whole or in part from copyright material of © Thomson Directories Limited; © The Coal Authority owns the copyright to this data and the coal mining information used to produce it; © Peter Brett Associates LLP 2023; © Ofcom copyright 2023; © Natural England copyright. Contains Ordnance Survey data © Crown copyright and database right 2023; Ordnance Survey © Crown copyright and/or Database Right. All rights reserved. Licence 100022432; © HS2 Ltd and licensed under the Open Government Licence; © Natural Resources Wales & United Kingdom Research and Innovation 2023; Contains Natural Resources Wales information © Natural Resources Wales and Database Right. All rights Reserved. Contains Ordnance Survey Data. Ordnance Survey Licence number 100019741. Crown Copyright and Database Right.

Important Consumer Protection Information

This search has been produced by Landmark Information Group Ltd, Imperium, Imperial Way, Reading, Berkshire, RG2 0TD

Tel: 0844 844 9966

Fax: 0844 844 9980

Email: helpdesk@landmark.co.uk

Landmark adheres to the Conveyancing Information Executive (CIE) standards.

The Standards:

- Conveyancing Information Executive Members shall act in a professional and honest manner at all times in line with the Conveyancing Information Executive Standards and carry out the delivery of the Search with integrity and due care and skill.
- Compliance with the Conveyancing Information Executive Standards will be a condition within the Conveyancing Information Executive Member's Terms and Conditions.
- Conveyancing Information Executive Members will promote the benefits of and deliver the Search to the agreed standards and in the best interests of the customer and associated parties.
- The standards can be seen here: <http://www.conveyinfoexec.com>

Complaints

If you have a query or complaint about your search, you should raise it directly with the search firm, and if appropriate ask for any complaint to be considered under their formal internal complaints procedure. If you remain dissatisfied with the firm's final response, after your complaint has been formally considered, or if the firm has exceeded the response timescales, you may refer your complaint for consideration under The Property Ombudsman scheme (TPOs). The Ombudsman can award up to £5,000 to you if the Ombudsman finds that you have suffered actual financial loss and/or aggravation, distress or inconvenience as a result of your search provider failing to keep to the Standards.

Please note that all queries or complaints regarding your search should be directed to your search provider in the first instance, not to TPO.

TPOs Contact Details:

The Property Ombudsman scheme
Milford House
43-55 Milford Street
Salisbury
Wiltshire SP1 2BP

Tel: 01722 333306

Fax: 01722 332296

Website: www.tpos.co.uk

Email: admin@tpos.co.uk

Landmark Complaints Procedure

If you want to make a complaint to Landmark, we will:

- Acknowledge it within 5 working days of receipt
- Normally deal with it fully and provide a final response, in writing, within 20 working days of receipt
- Keep you informed by letter, telephone or e-mail, as you prefer, if we need more time
- Provide a final response, in writing, at the latest within 40 working days of receipt
- Liaise, at your request, with anyone acting formally on your behalf

Complaints should be sent to:

Customer Relationships Manager
Landmark Information
Imperium
Imperial Way
Reading
RG2 0TD

Tel: 0844 844 9966

Email: helpdesk@landmark.co.uk

Fax: 0844 844 9980

If you are not satisfied with our final response, or if we exceed the response timescales, you may refer the complaint to The Property Ombudsman scheme (TPOs):

Tel: 01722 333306

Email: admin@tpos.co.uk

We will co-operate fully with the Ombudsman during an investigation and comply with his final decision.

Historical Mapping Legends

Ordnance Survey County Series and Ordnance Survey Plan 1:2,500

Quarry **Gravel Pit** **Sand Pit**
Clay Pit **Shingle** **Refuse Heap**
Sloping Masonry **Flat Rock**
Marsh **Reeds** **Osiers**
Rough Pasture **Furze** **Wood**
Mixed Wood **Brushwood** **Orchard**
Fir **Ford** **Stepping Stones**
Ferry **Waterfall** **Lock**
Trig. Station **Altitude at Trig. Station**
B.M. 325.9 **Bench Mark** **Surface Level**
Arrow denotes flow of water **Antiquities (site of)**
Cutting **Embankment**
Railway crossing Road **Level Crossing** **Road crossing Railway**
Railway crossing River or Canal **Road over single stream** **Road over River or Canal**
County Boundary (Geographical)
County & Civil Parish Boundary
Administrative County & Civil Parish Boundary
County Borough Boundary (England)
County Burgh Boundary (Scotland)
Co. Boro. Bdy.
Co. Burgh Bdy.
BP BS Boundary Post or Stone **P.C.B** Police Call Box
B.R. Bridle Road **P** Pump
E.P Electricity Pylon **S.P** Signal Post
F.B. Foot Bridge **SL** Sluice
F.P. Foot Path **Sp.** Spring
G.P Guide Post or Board **T.C.B** Telephone Call Box
M.S Mile Stone **Tr.** Trough
M.P M.R Mooring Post or Ring **W** Well

Ordnance Survey Plan, Additional SIMs and Supply of Unpublished Survey Information 1:2,500 and 1:1,250

Inactive Quarry, Chalk Pit or Clay Pit **Active Quarry, Chalk Pit or Clay Pit**
Rock **Boulders**
Cliff **Slopes** **Top**
Roofed Building **Glazed Roof Building**
Sloping Masonry **Archway**
Non-Coniferous Tree (surveyed) **Coniferous Tree (surveyed)**
Non-Coniferous Trees (not surveyed) **Coniferous Trees (not surveyed)**
Orchard Tree **Scrub** **Bracken**
Coppice, Osier **Reeds** **Marsh, Saltings**
Rough Grassland **Heath** **Culvert**
Direction of water flow **Bench Mark** **Antiquity (site of)**
Cave Entrance **Triangulation Station** **Electricity Pylon**
Electricity Transmission Line
County Boundary (Geographical)
County & Civil Parish Boundary
Civil Parish Boundary
Admin. County or County Bor. Boundary
London Borough Boundary
Symbol marking point where boundary mereing changes
BH Beer House **P** Pillar, Pole or Post
BP, BS Boundary Post or Stone **PO** Post Office
Cn, C Capstan, Crane **PC** Public Convenience
Chy Chimney **PH** Public House
D Fn Drinking Fountain **Pp** Pump
EI P Electricity Pillar or Post **SB, S Br** Signal Box or Bridge
FAP Fire Alarm Pillar **SP, SL** Signal Post or Light
FB Foot Bridge **Spr** Spring
GP Guide Post **Tk** Tank or Track
H Hydrant or Hydraulic **TCB** Telephone Call Box
LC Level Crossing **TCP** Telephone Call Post
MH Manhole **Tr** Trough
MP Mile Post or Mooring Post **Wr Pt, Wr T** Water Point, Water Tap
MS Mile Stone **W** Well
NTL Normal Tidal Limit **Wd Pp** Wind Pump

Large-Scale National Grid Data 1:2,500 and 1:1,250

Cliff **Slopes** **Top**
Rock **Rock (scattered)**
Boulders **Boulders (scattered)**
Positioned Boulder **Scree**
Non-Coniferous Tree (surveyed) **Coniferous Tree (surveyed)**
Non-Coniferous Trees (not surveyed) **Coniferous Trees (not surveyed)**
Orchard Tree **Scrub** **Bracken**
Coppice, Osier **Reeds** **Marsh, Saltings**
Rough Grassland **Heath** **Culvert**
Direction of water flow **Triangulation Station** **Antiquity (site of)**
Electricity Transmission Line **Electricity Pylon**
B.M. 231.60m Bench Mark **Buildings with Building Seed**
Roofed Building **Glazed Roof Building**
Civil parish/community boundary
District boundary
County boundary
Boundary post/stone
Boundary mereing symbol (note: these always appear in opposed pairs or groups of three)
Bks Barracks **P** Pillar, Pole or Post
Bty Battery **PO** Post Office
Cemy Cemetery **PC** Public Convenience
Chy Chimney **Pp** Pump
Cis Cistern **Ppg Sta** Pumping Station
Dismtd Rly Dismantled Railway **PW** Place of Worship
EI Gen Sta Electricity Generating Station **Sewage Ppg Sta** Sewage Pumping Station
EI P Electricity Pole, Pillar **SB, S Br** Signal Box or Bridge
EI Sub Sta Electricity Sub Station **SP, SL** Signal Post or Light
FB Filter Bed **Spr** Spring
Fn / D Fn Fountain / Drinking Ftn. **Tk** Tank or Track
Gas Gov Gas Valve Compound **Tr** Trough
GVC Gas Governor **Wd Pp** Wind Pump
GP Guide Post **Wr Pt, Wr T** Water Point, Water Tap
MH Manhole **Wks** Works (building or area)
MP, MS Mile Post or Mile Stone **W** Well


Envirocheck®

LANDMARK INFORMATION GROUP®

Historical Mapping & Photography included:

Mapping Type	Scale	Date	Pg
Cornwall & Isles Of Scilly	1:2,500	1879	2
Cornwall & Isles Of Scilly	1:2,500	1908	3
Ordnance Survey Plan	1:1,250	1966 - 1967	4
Additional SIMs	1:1,250	1966 - 1967	5
Ordnance Survey Plan	1:2,500	1967 - 1975	6
Additional SIMs	1:1,250	1989	7
Large-Scale National Grid Data	1:1,250	1994	8
Large-Scale National Grid Data	1:2,500	1994	9
Large-Scale National Grid Data	1:1,250	1995	10

Historical Map - Segment A13

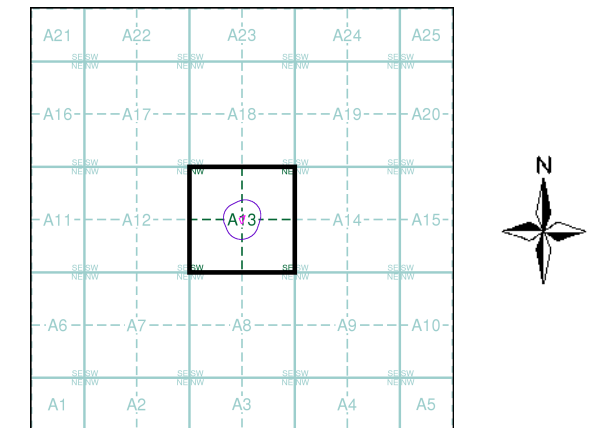

Order Details


Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk

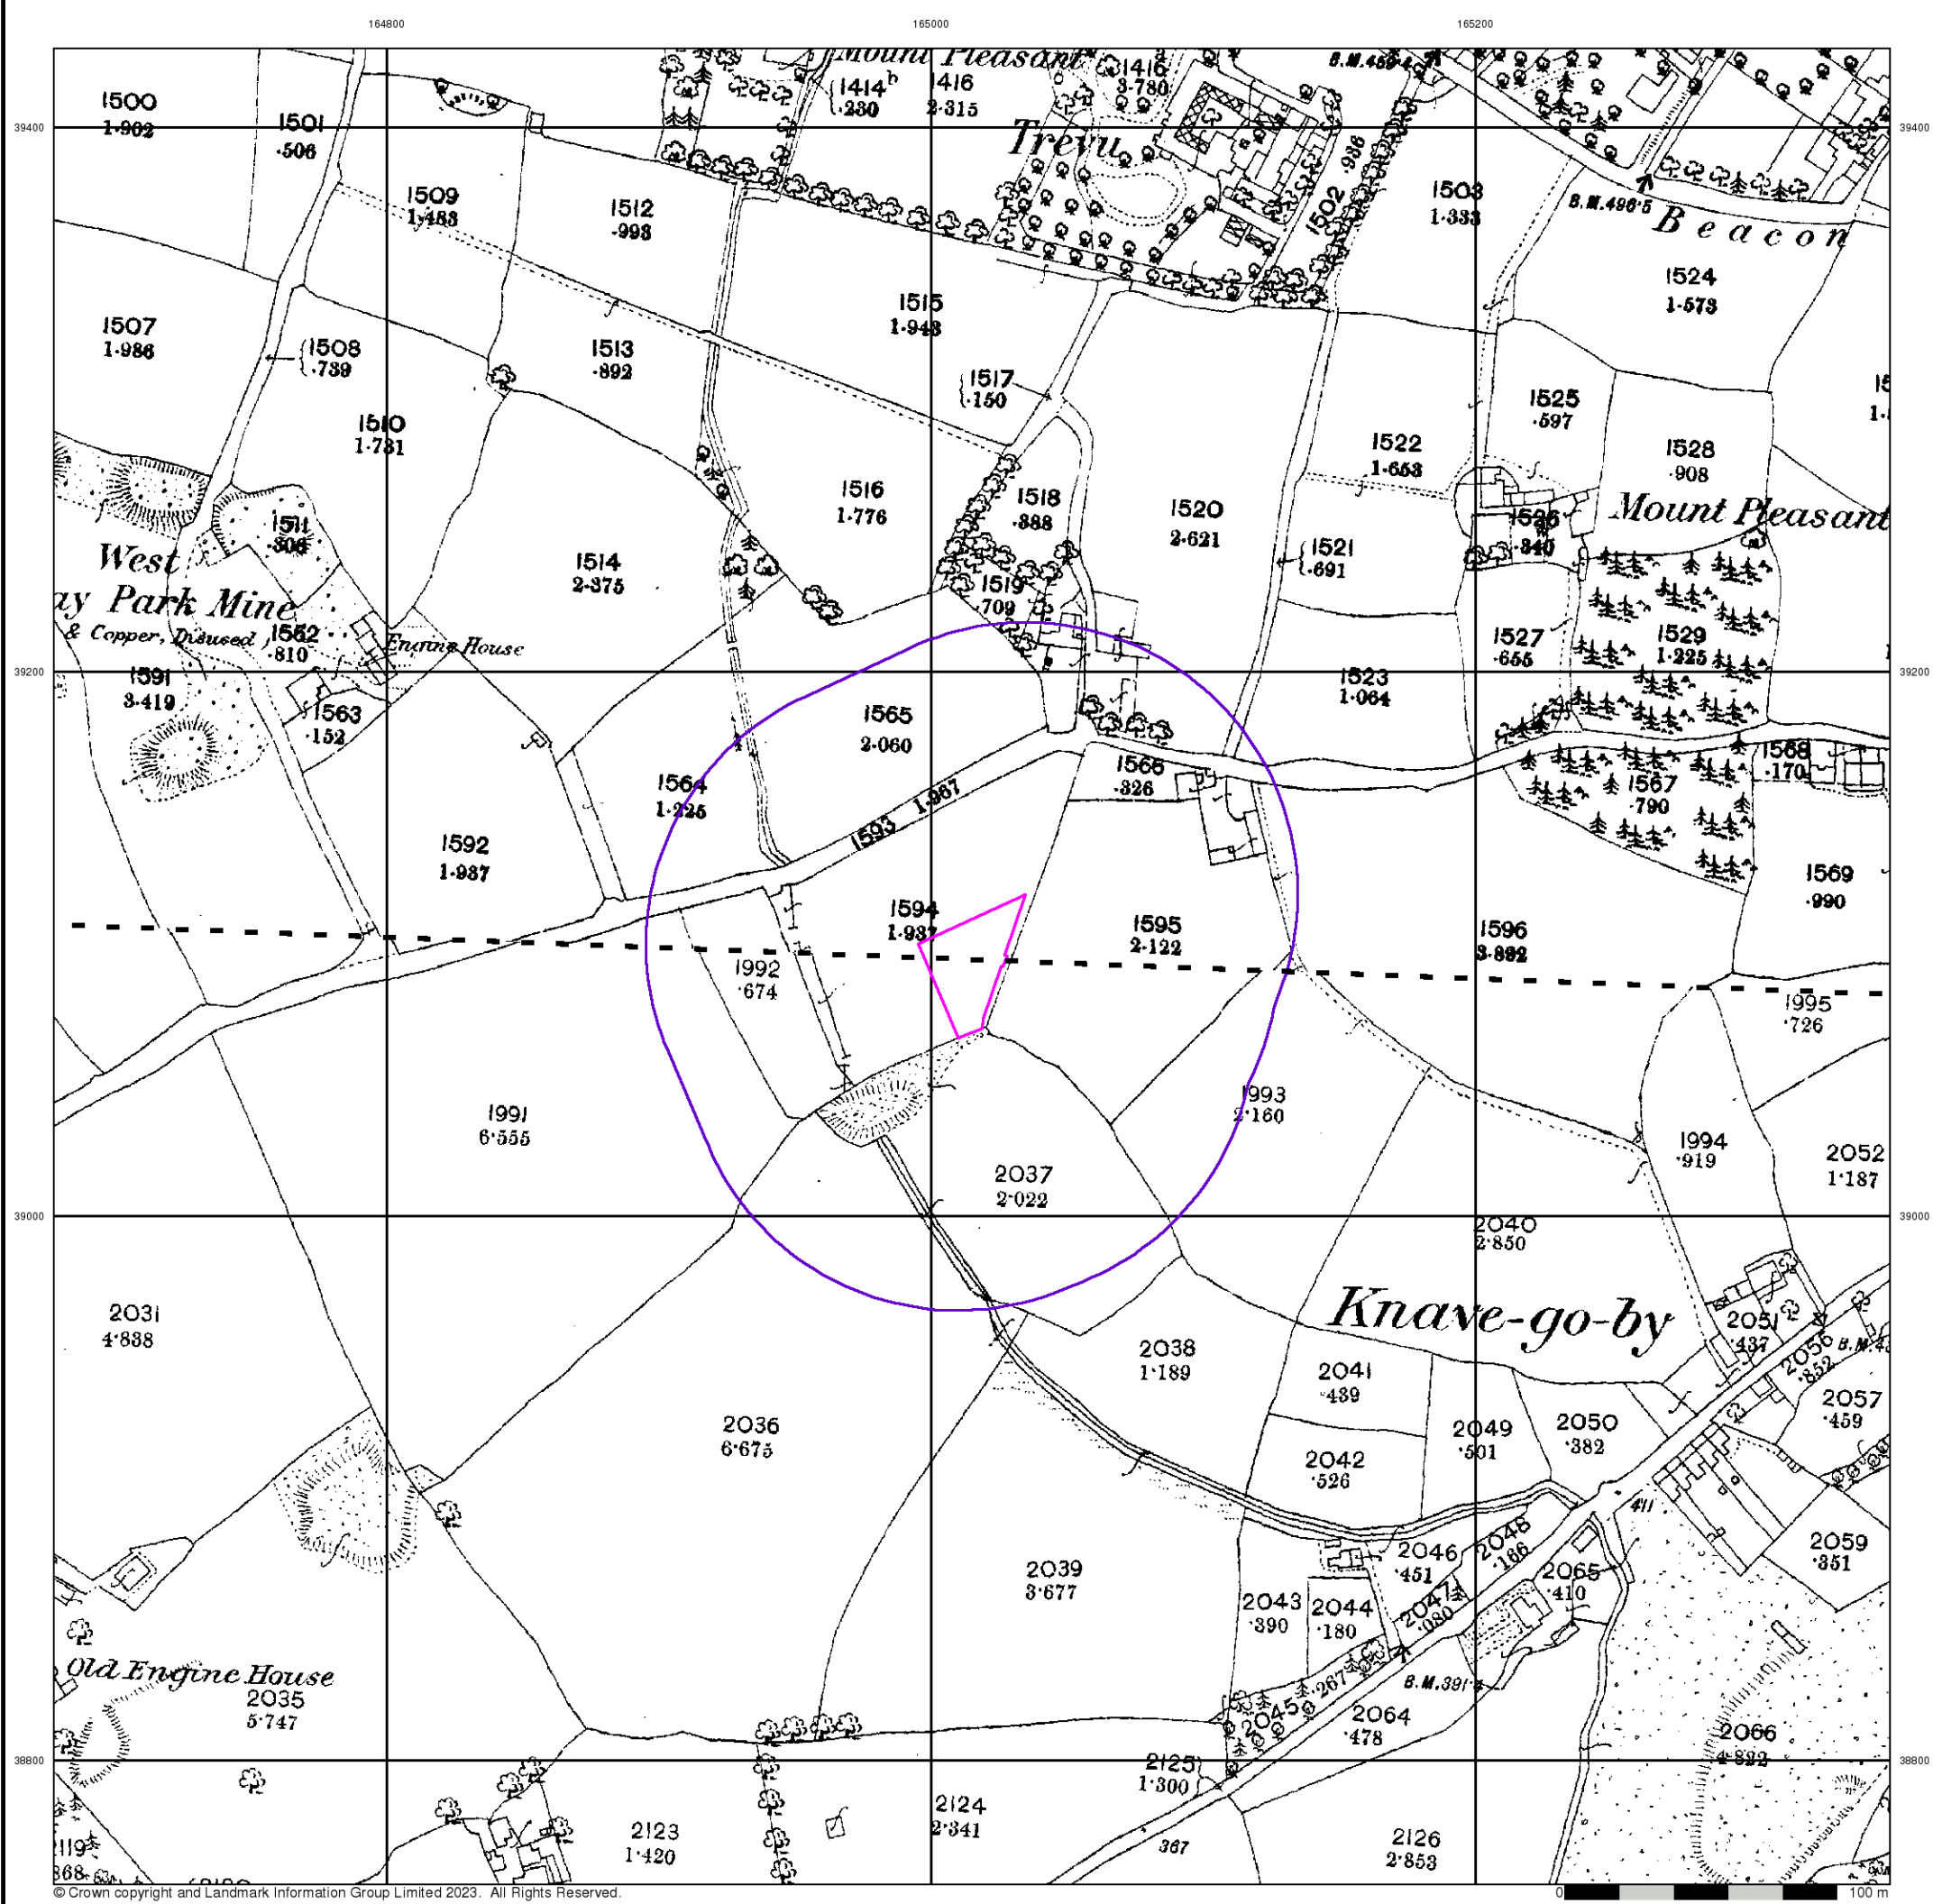

Envirocheck

LANDMARK INFORMATION GROUP


Cornwall & Isles Of Scilly

Published 1879


Source map scale - 1:2,500

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas and by 1896 it covered the whole of what were considered to be the cultivated parts of Great Britain. The published date given below is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas.

Map Name(s) and Date(s)

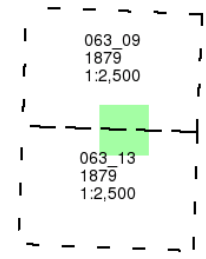

Historical Map - Segment A13

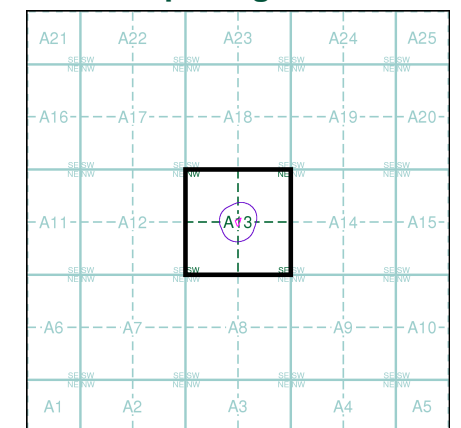

Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk


Cornwall & Isles Of Scilly

Published 1908


Source map scale - 1:2,500

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas and by 1896 it covered the whole of what were considered to be the cultivated parts of Great Britain. The published date given below is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas.

Map Name(s) and Date(s)

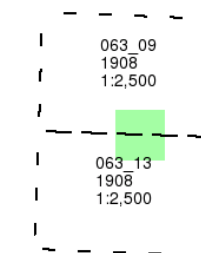

Historical Map - Segment A13

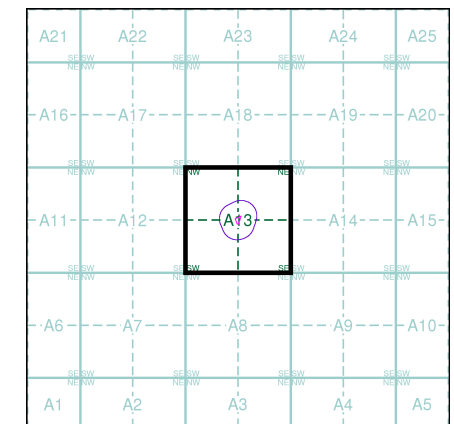


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

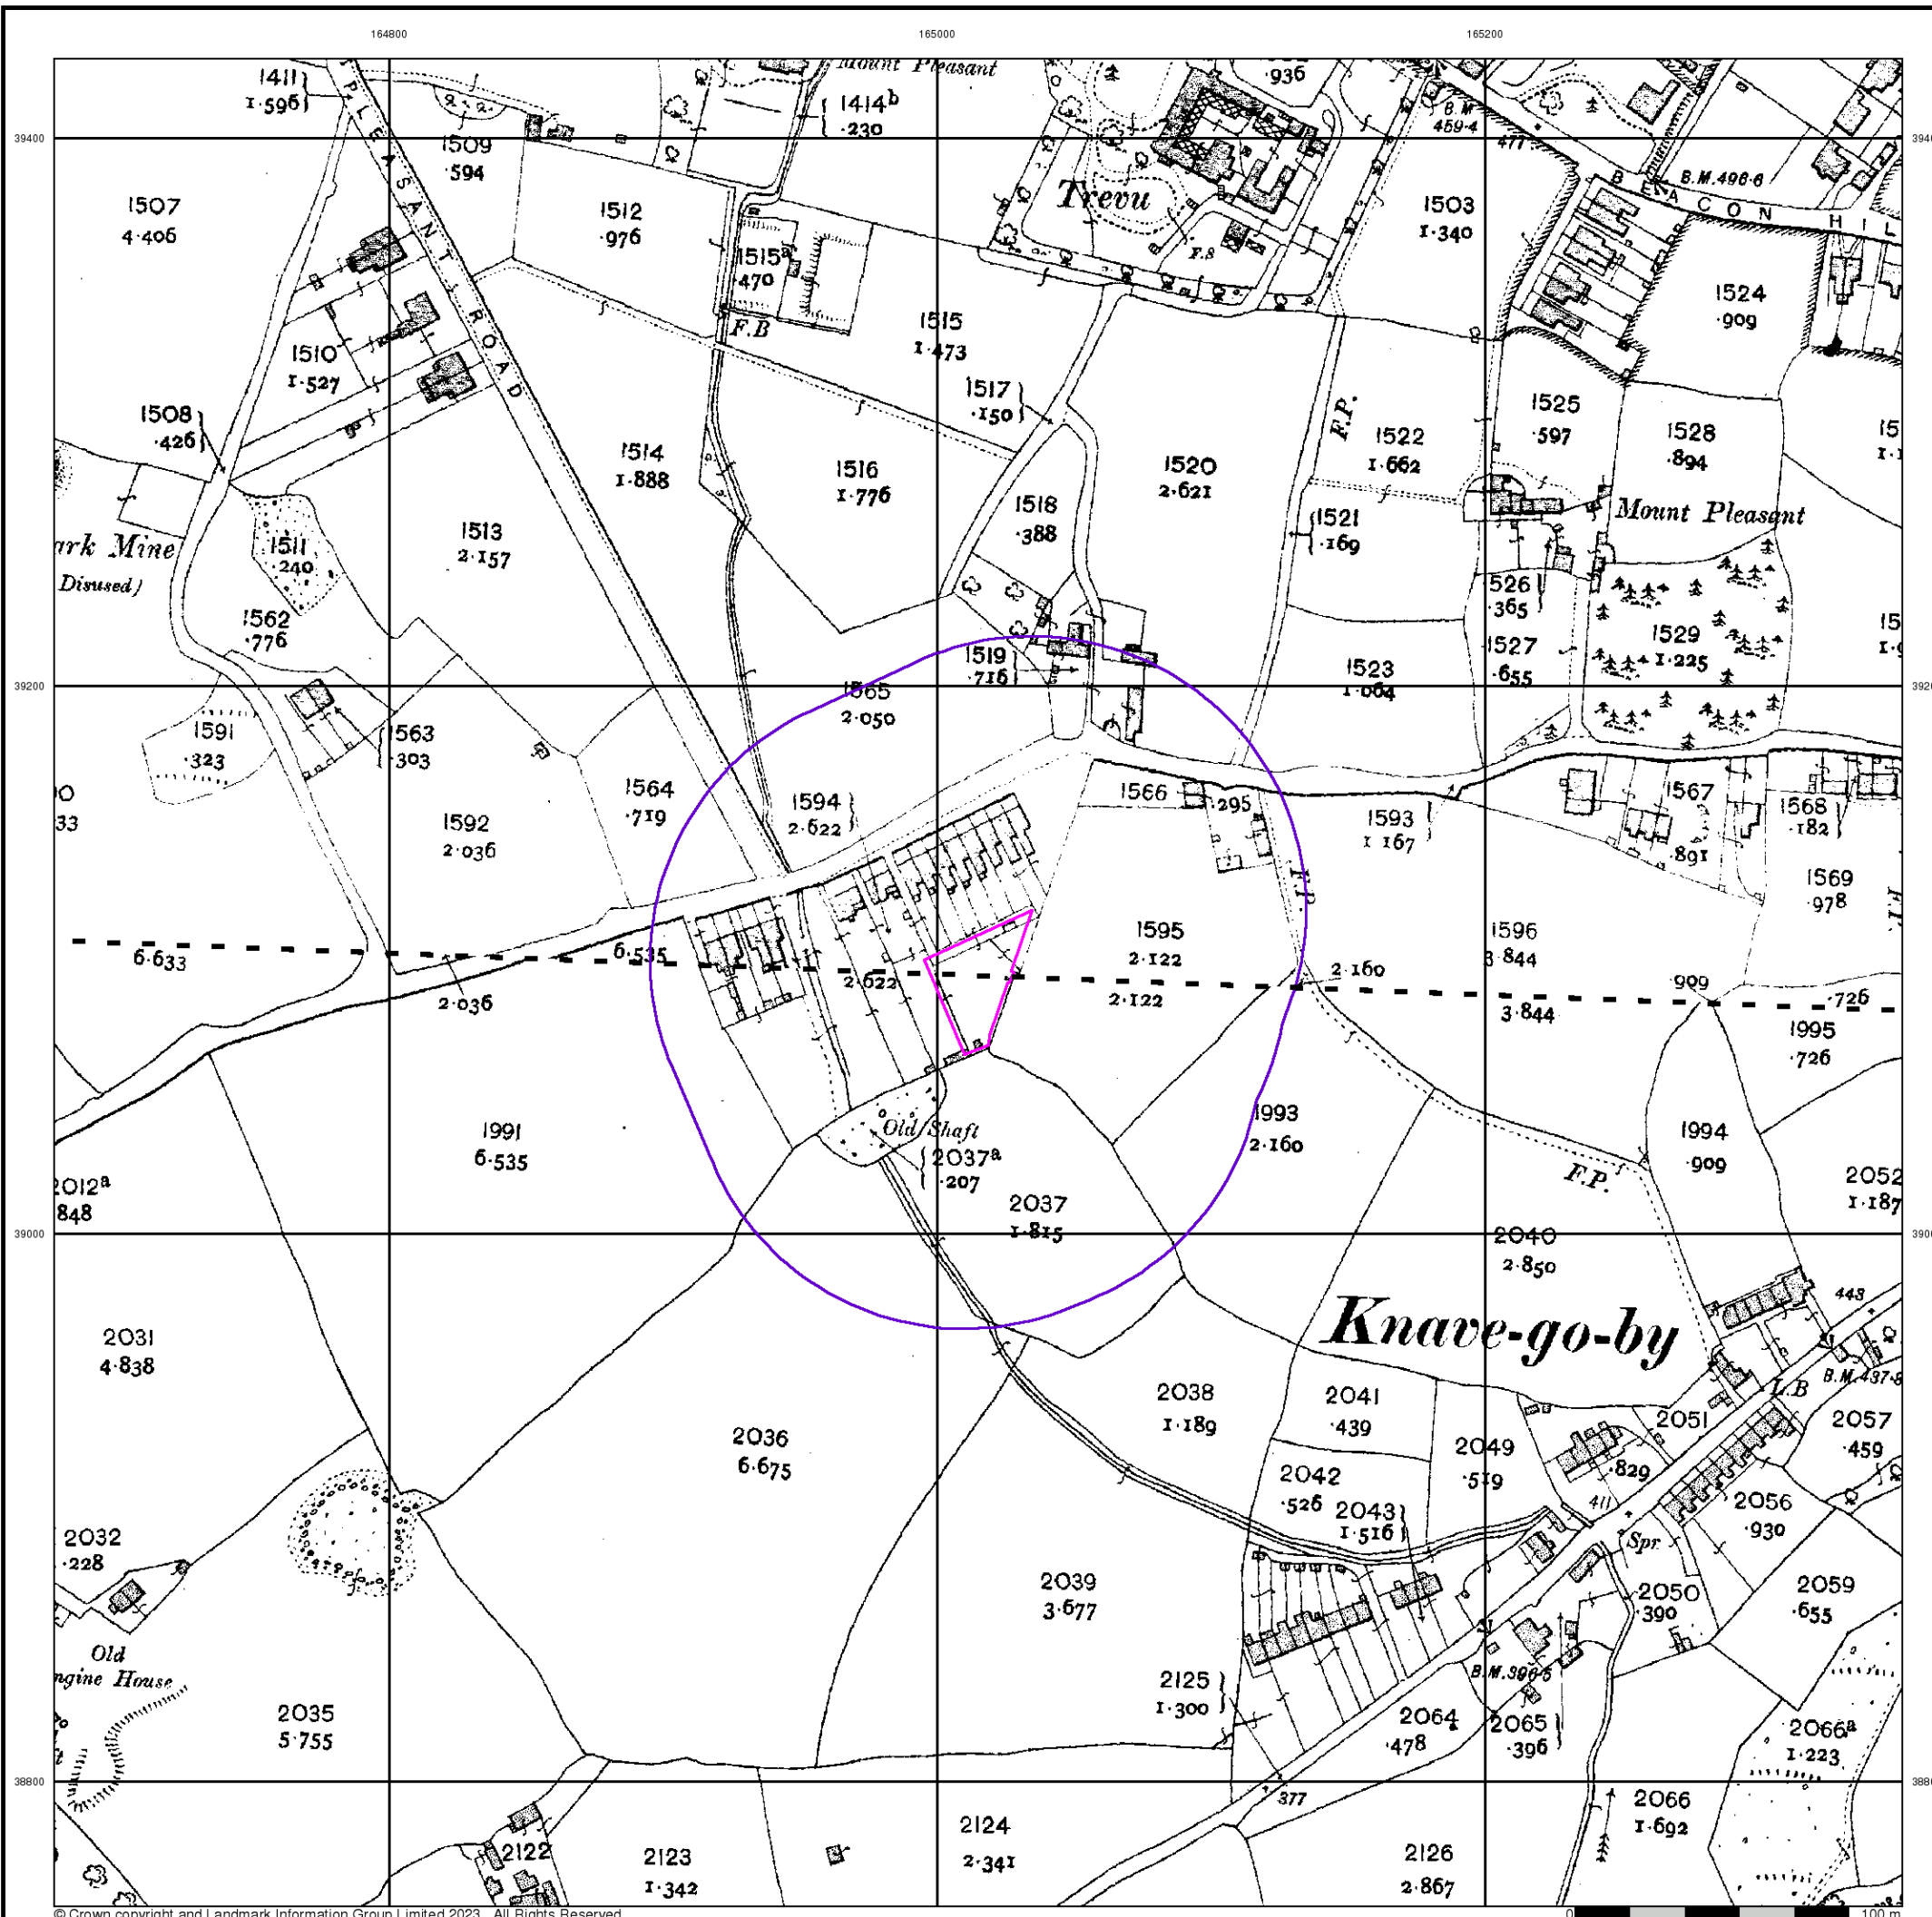

Additional SIMs

Published 1966 - 1967


Source map scale - 1:1,250

The SIM cards (Ordnance Survey's 'Survey of Information on Microfilm') are further, minor editions of mapping which were produced and published in between the main editions as an area was updated. They date from 1947 to 1994, and contain detailed information on buildings, roads and land-use. These maps were produced at both 1:2,500 and 1:1,250 scales.

Map Name(s) and Date(s)

SW6439SE	SW6539SW
1966	1967
1:1,250	1:1,250

Historical Map - Segment A13

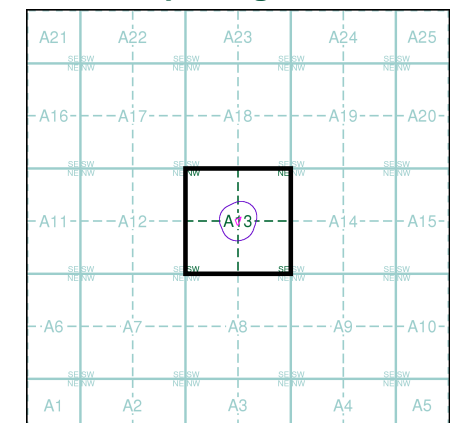


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

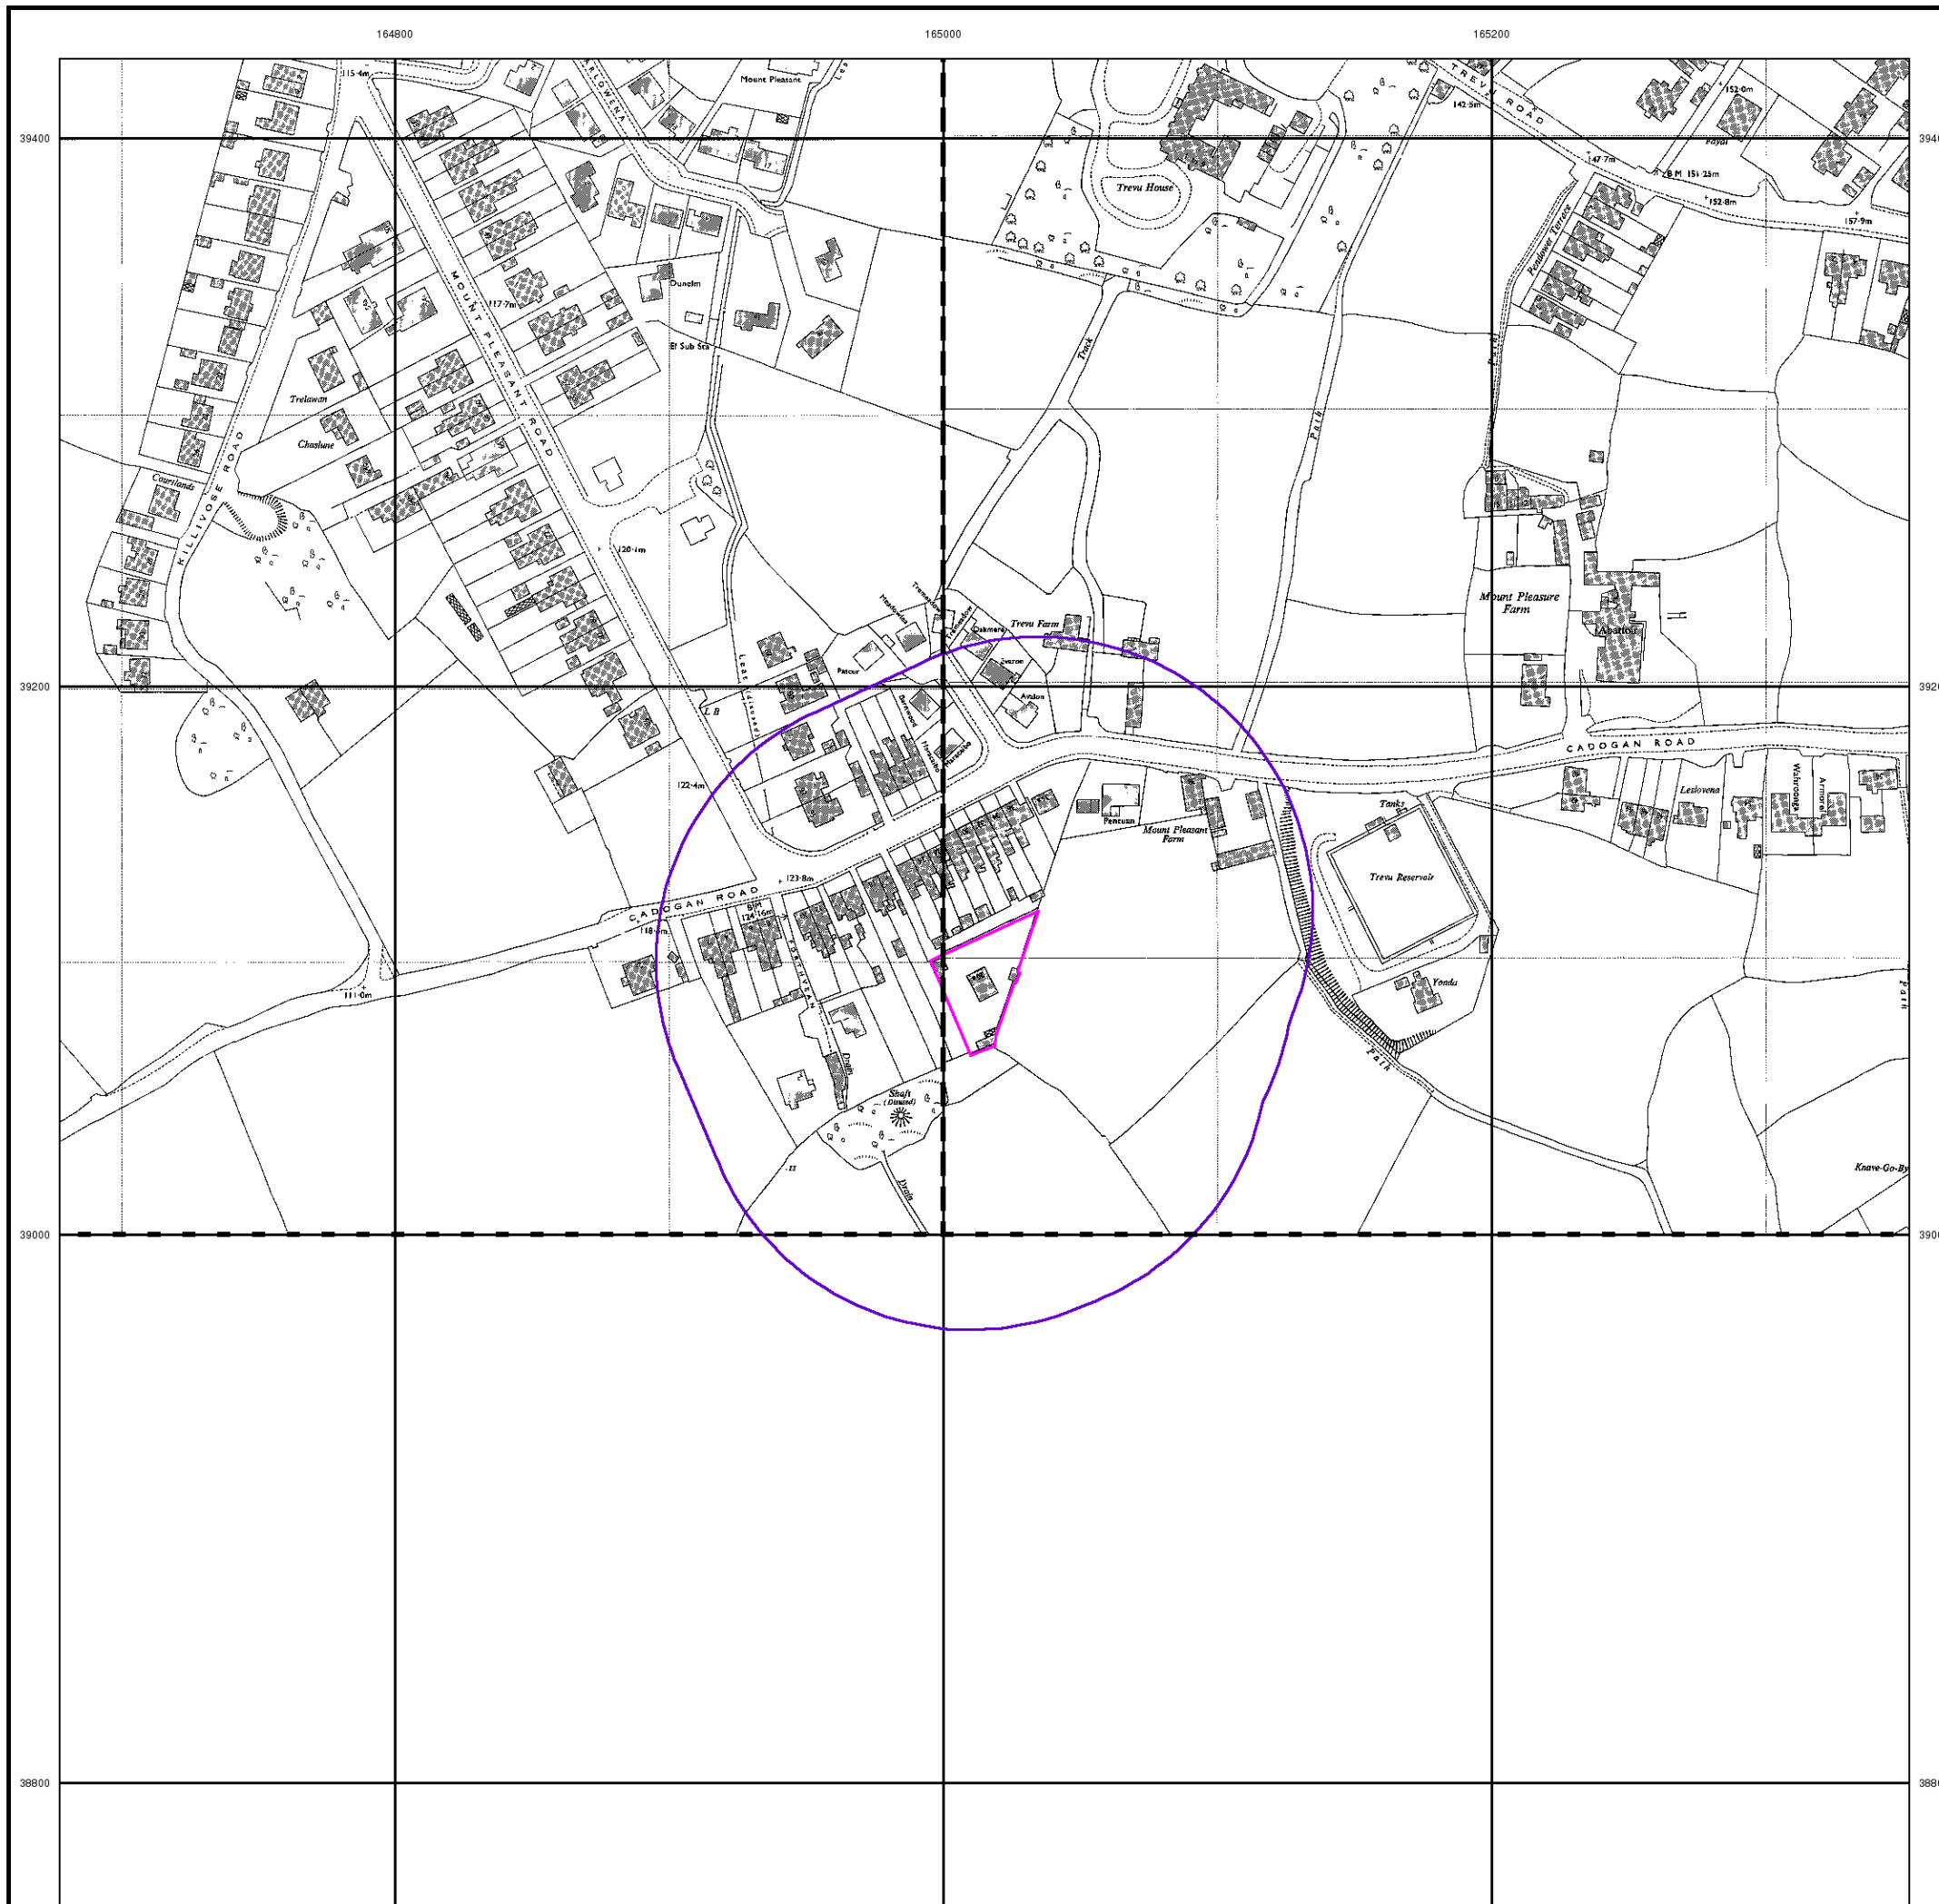

Ordnance Survey Plan

Published 1967 - 1975


Source map scale - 1:2,500

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas and by 1896 it covered the whole of what were considered to be the cultivated parts of Great Britain. The published date given below is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas.

Map Name(s) and Date(s)

SW6439 1967 12,500	SW6539 1967 12,500
SW6438 1975 12,500	SW6538 1975 12,500

Historical Map - Segment A13

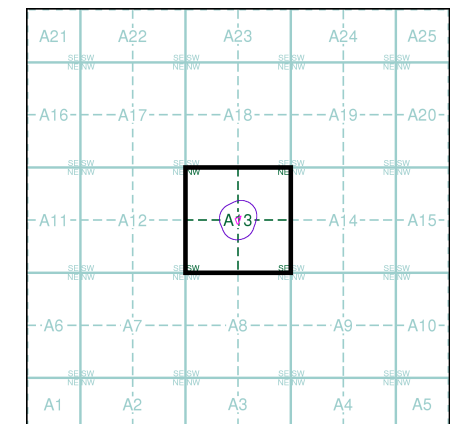


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

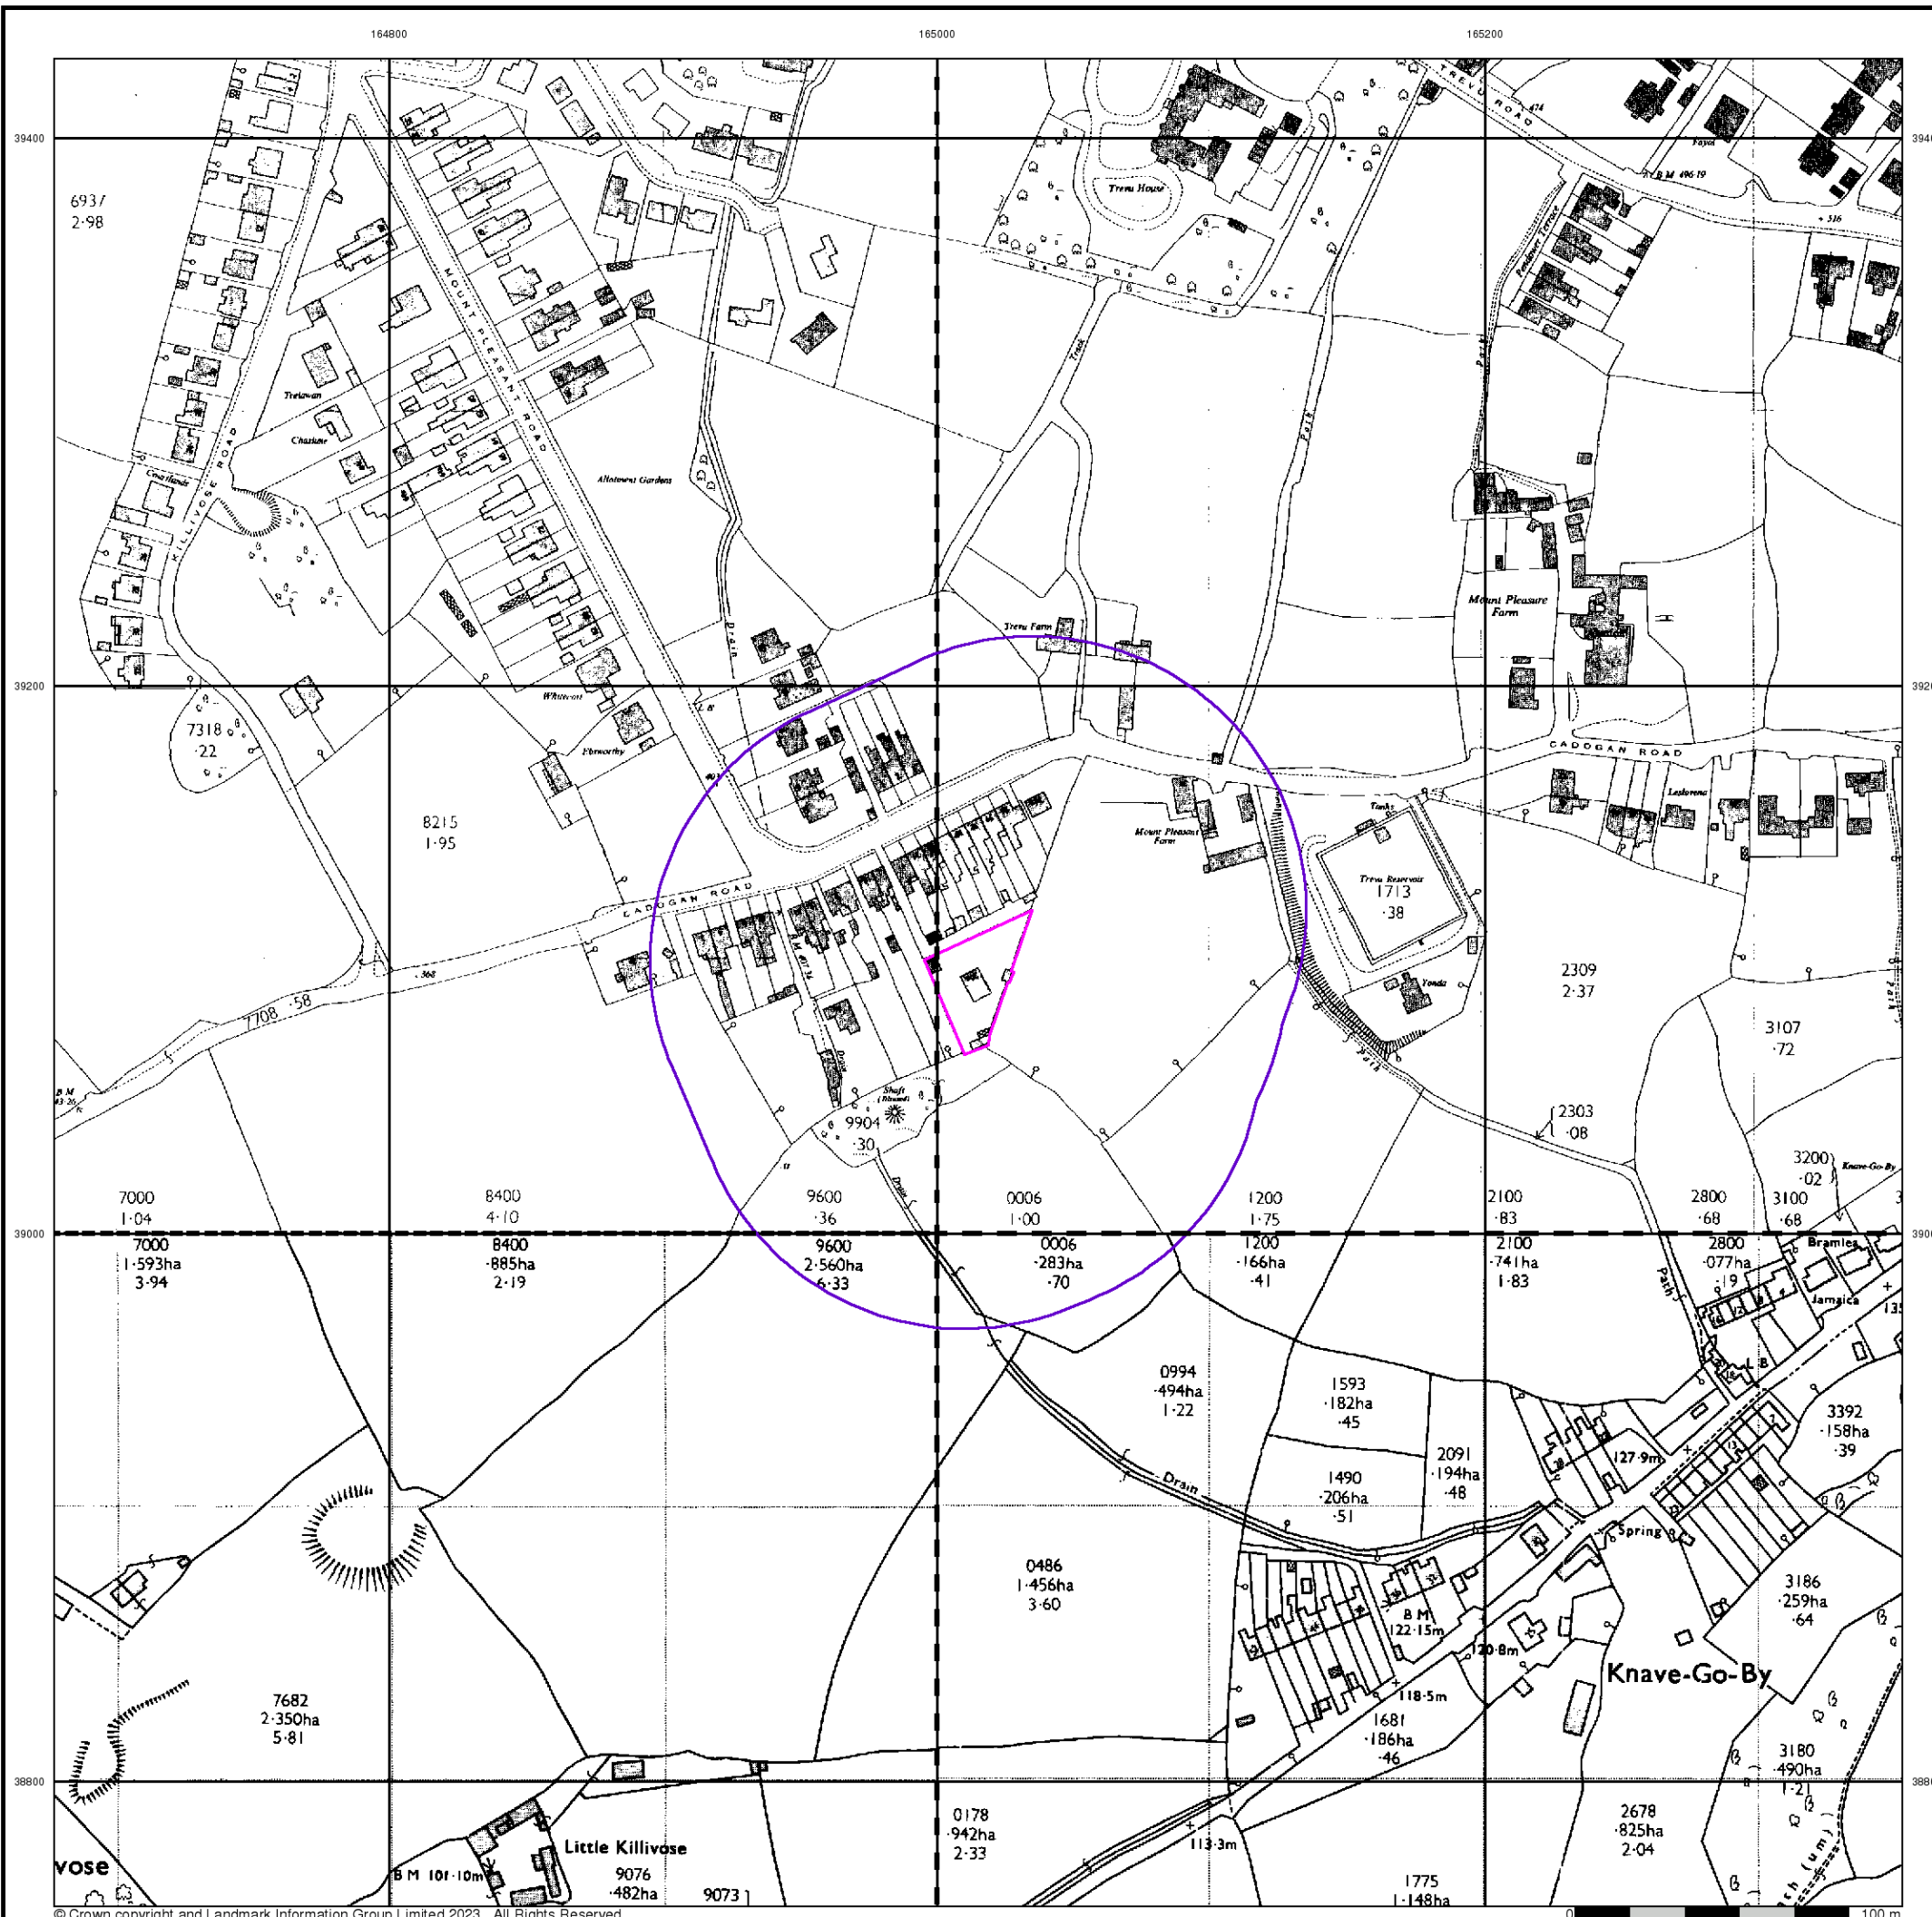


Additional SIMs

Published 1989


Source map scale - 1:1,250

The SIM cards (Ordnance Survey's 'Survey of Information on Microfilm') are further, minor editions of mapping which were produced and published in between the main editions as an area was updated. They date from 1947 to 1994, and contain detailed information on buildings, roads and land-use. These maps were produced at both 1:2,500 and 1:1,250 scales.

Map Name(s) and Date(s)

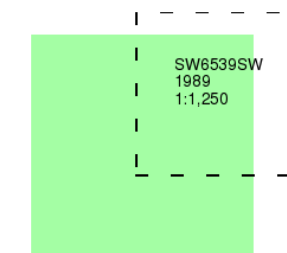

Historical Map - Segment A13

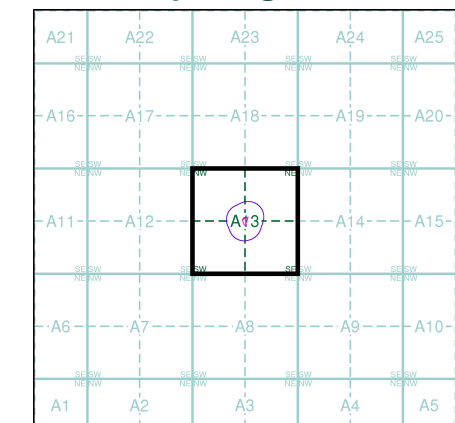


Order Details

Order Number: 319400084_1_1
Customer Ref: 2123
National Grid Reference: 165020, 39090
Slice: A
Site Area (Ha): 0.1
Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

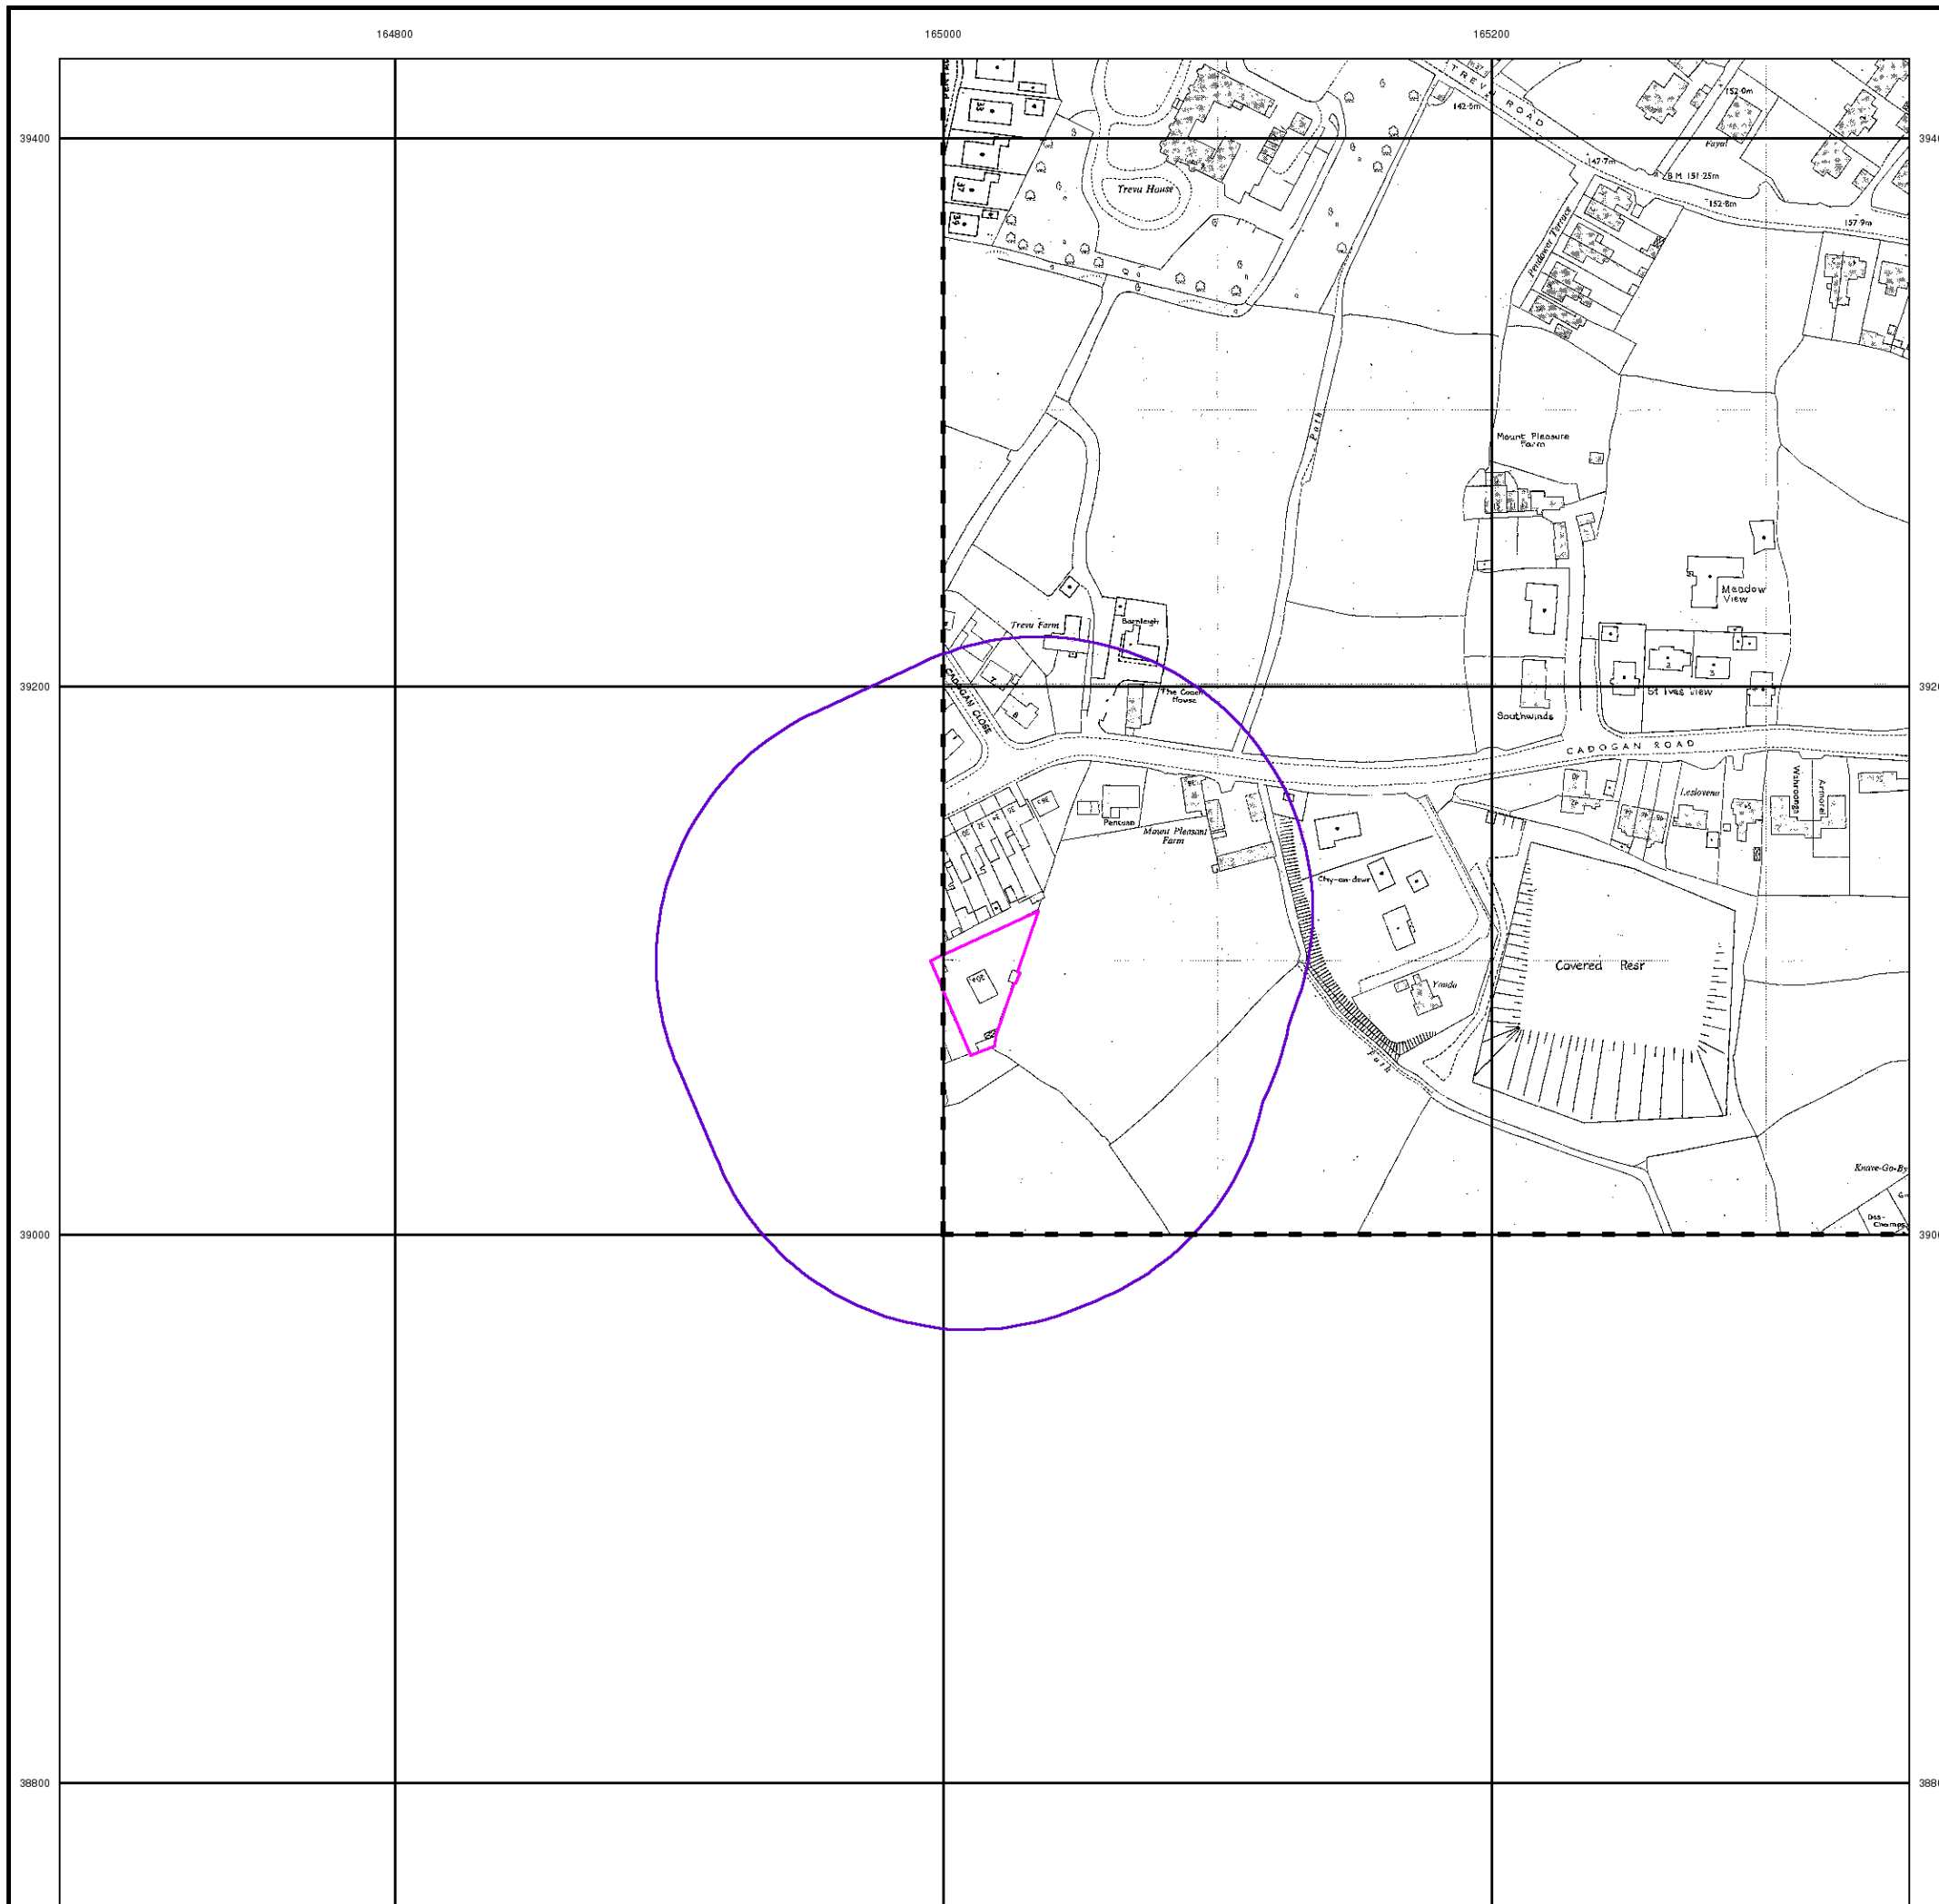

Large-Scale National Grid Data

Published 1994


Source map scale - 1:1,250

'Large Scale National Grid Data' superseded SIM cards (Ordnance Survey's 'Survey of Information on Microfilm') in 1992, and continued to be produced until 1999. These maps were the fore-runners of digital mapping and so provide detailed information on houses and roads, but tend to show less topographic features such as vegetation. These maps were produced at both 1:2,500 and 1:1,250 scales.

Map Name(s) and Date(s)

SW6439SE 1994 1:1,250	SW6539SW 1994 1:1,250
-----------------------------	-----------------------------

Historical Map - Segment A13

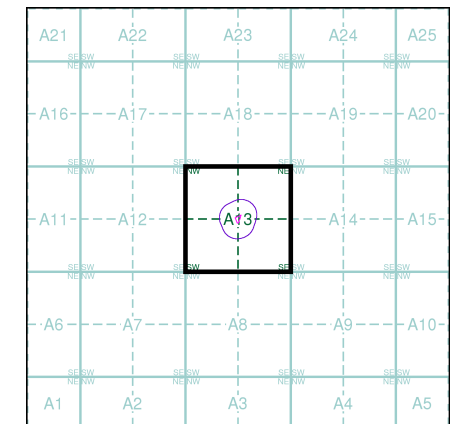


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

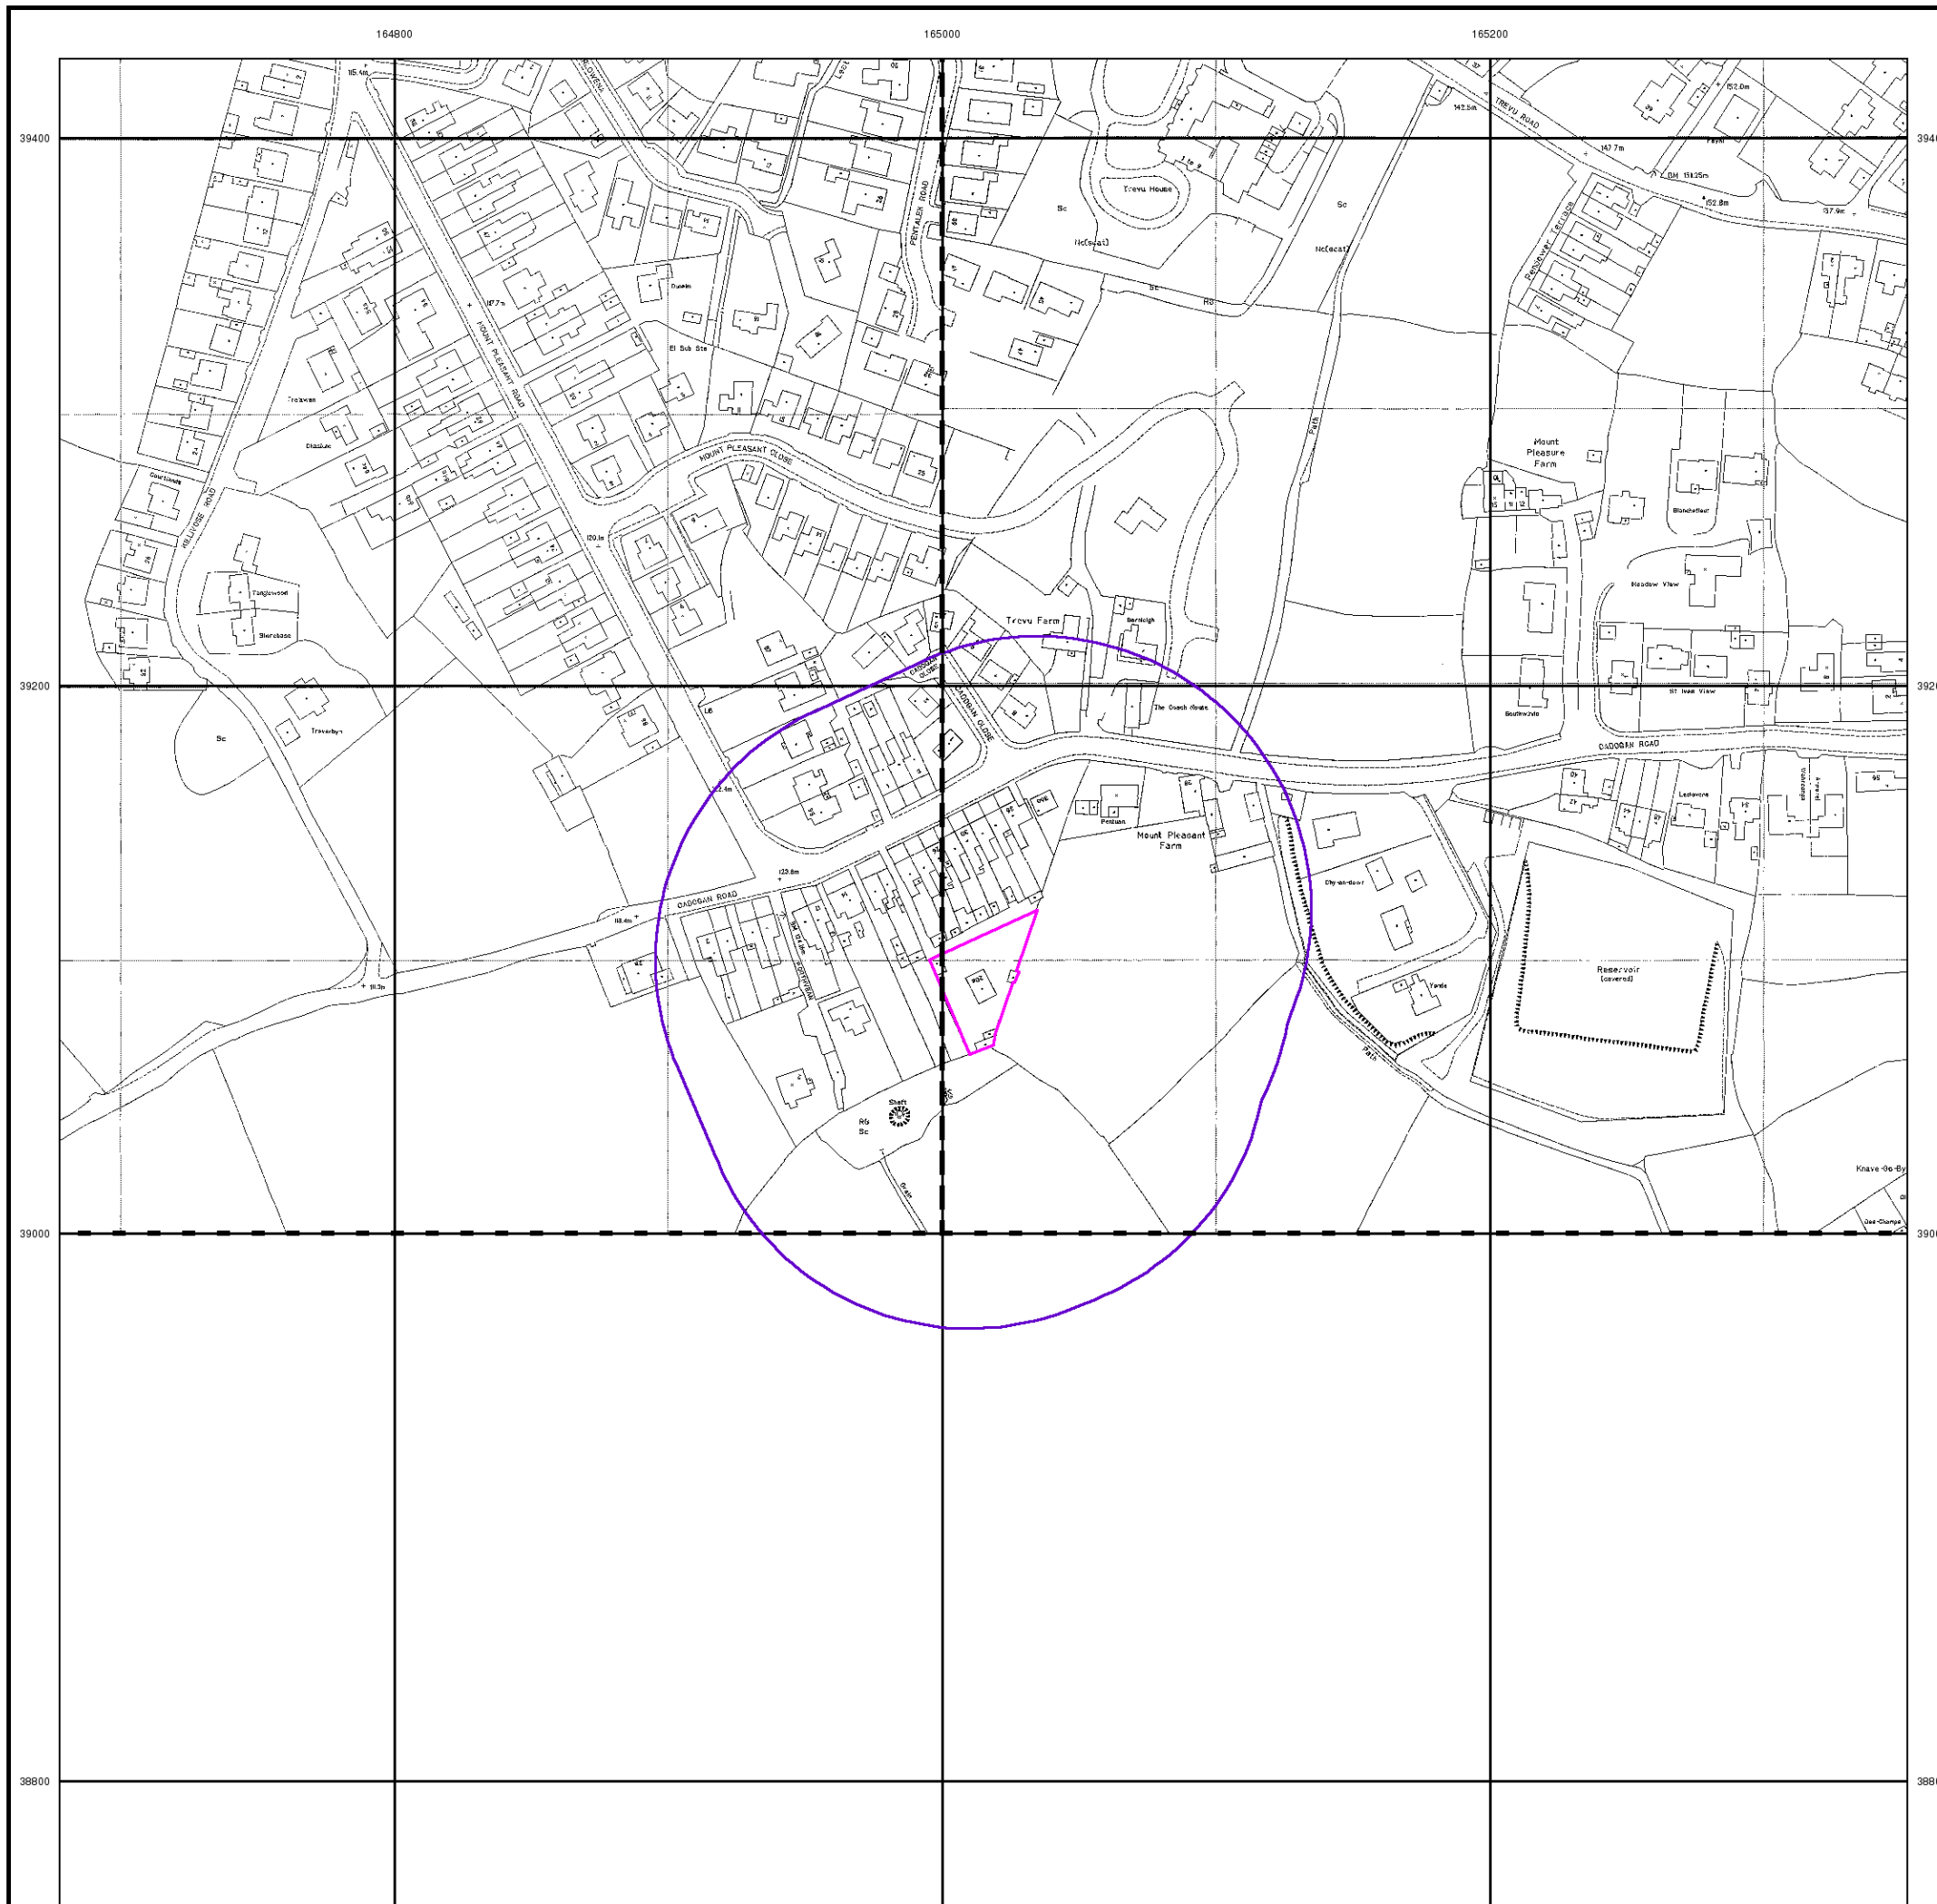


Large-Scale National Grid Data

Published 1994


Source map scale - 1:2,500

'Large Scale National Grid Data' superseded SIM cards (Ordnance Survey's 'Survey of Information on Microfilm') in 1992, and continued to be produced until 1999. These maps were the fore-runners of digital mapping and so provide detailed information on houses and roads, but tend to show less topographic features such as vegetation. These maps were produced at both 1:2,500 and 1:1,250 scales.

Map Name(s) and Date(s)

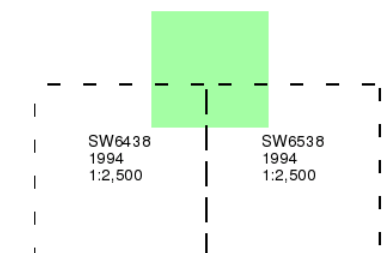

Historical Map - Segment A13

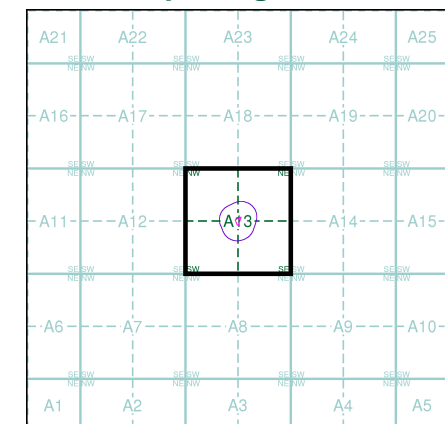


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

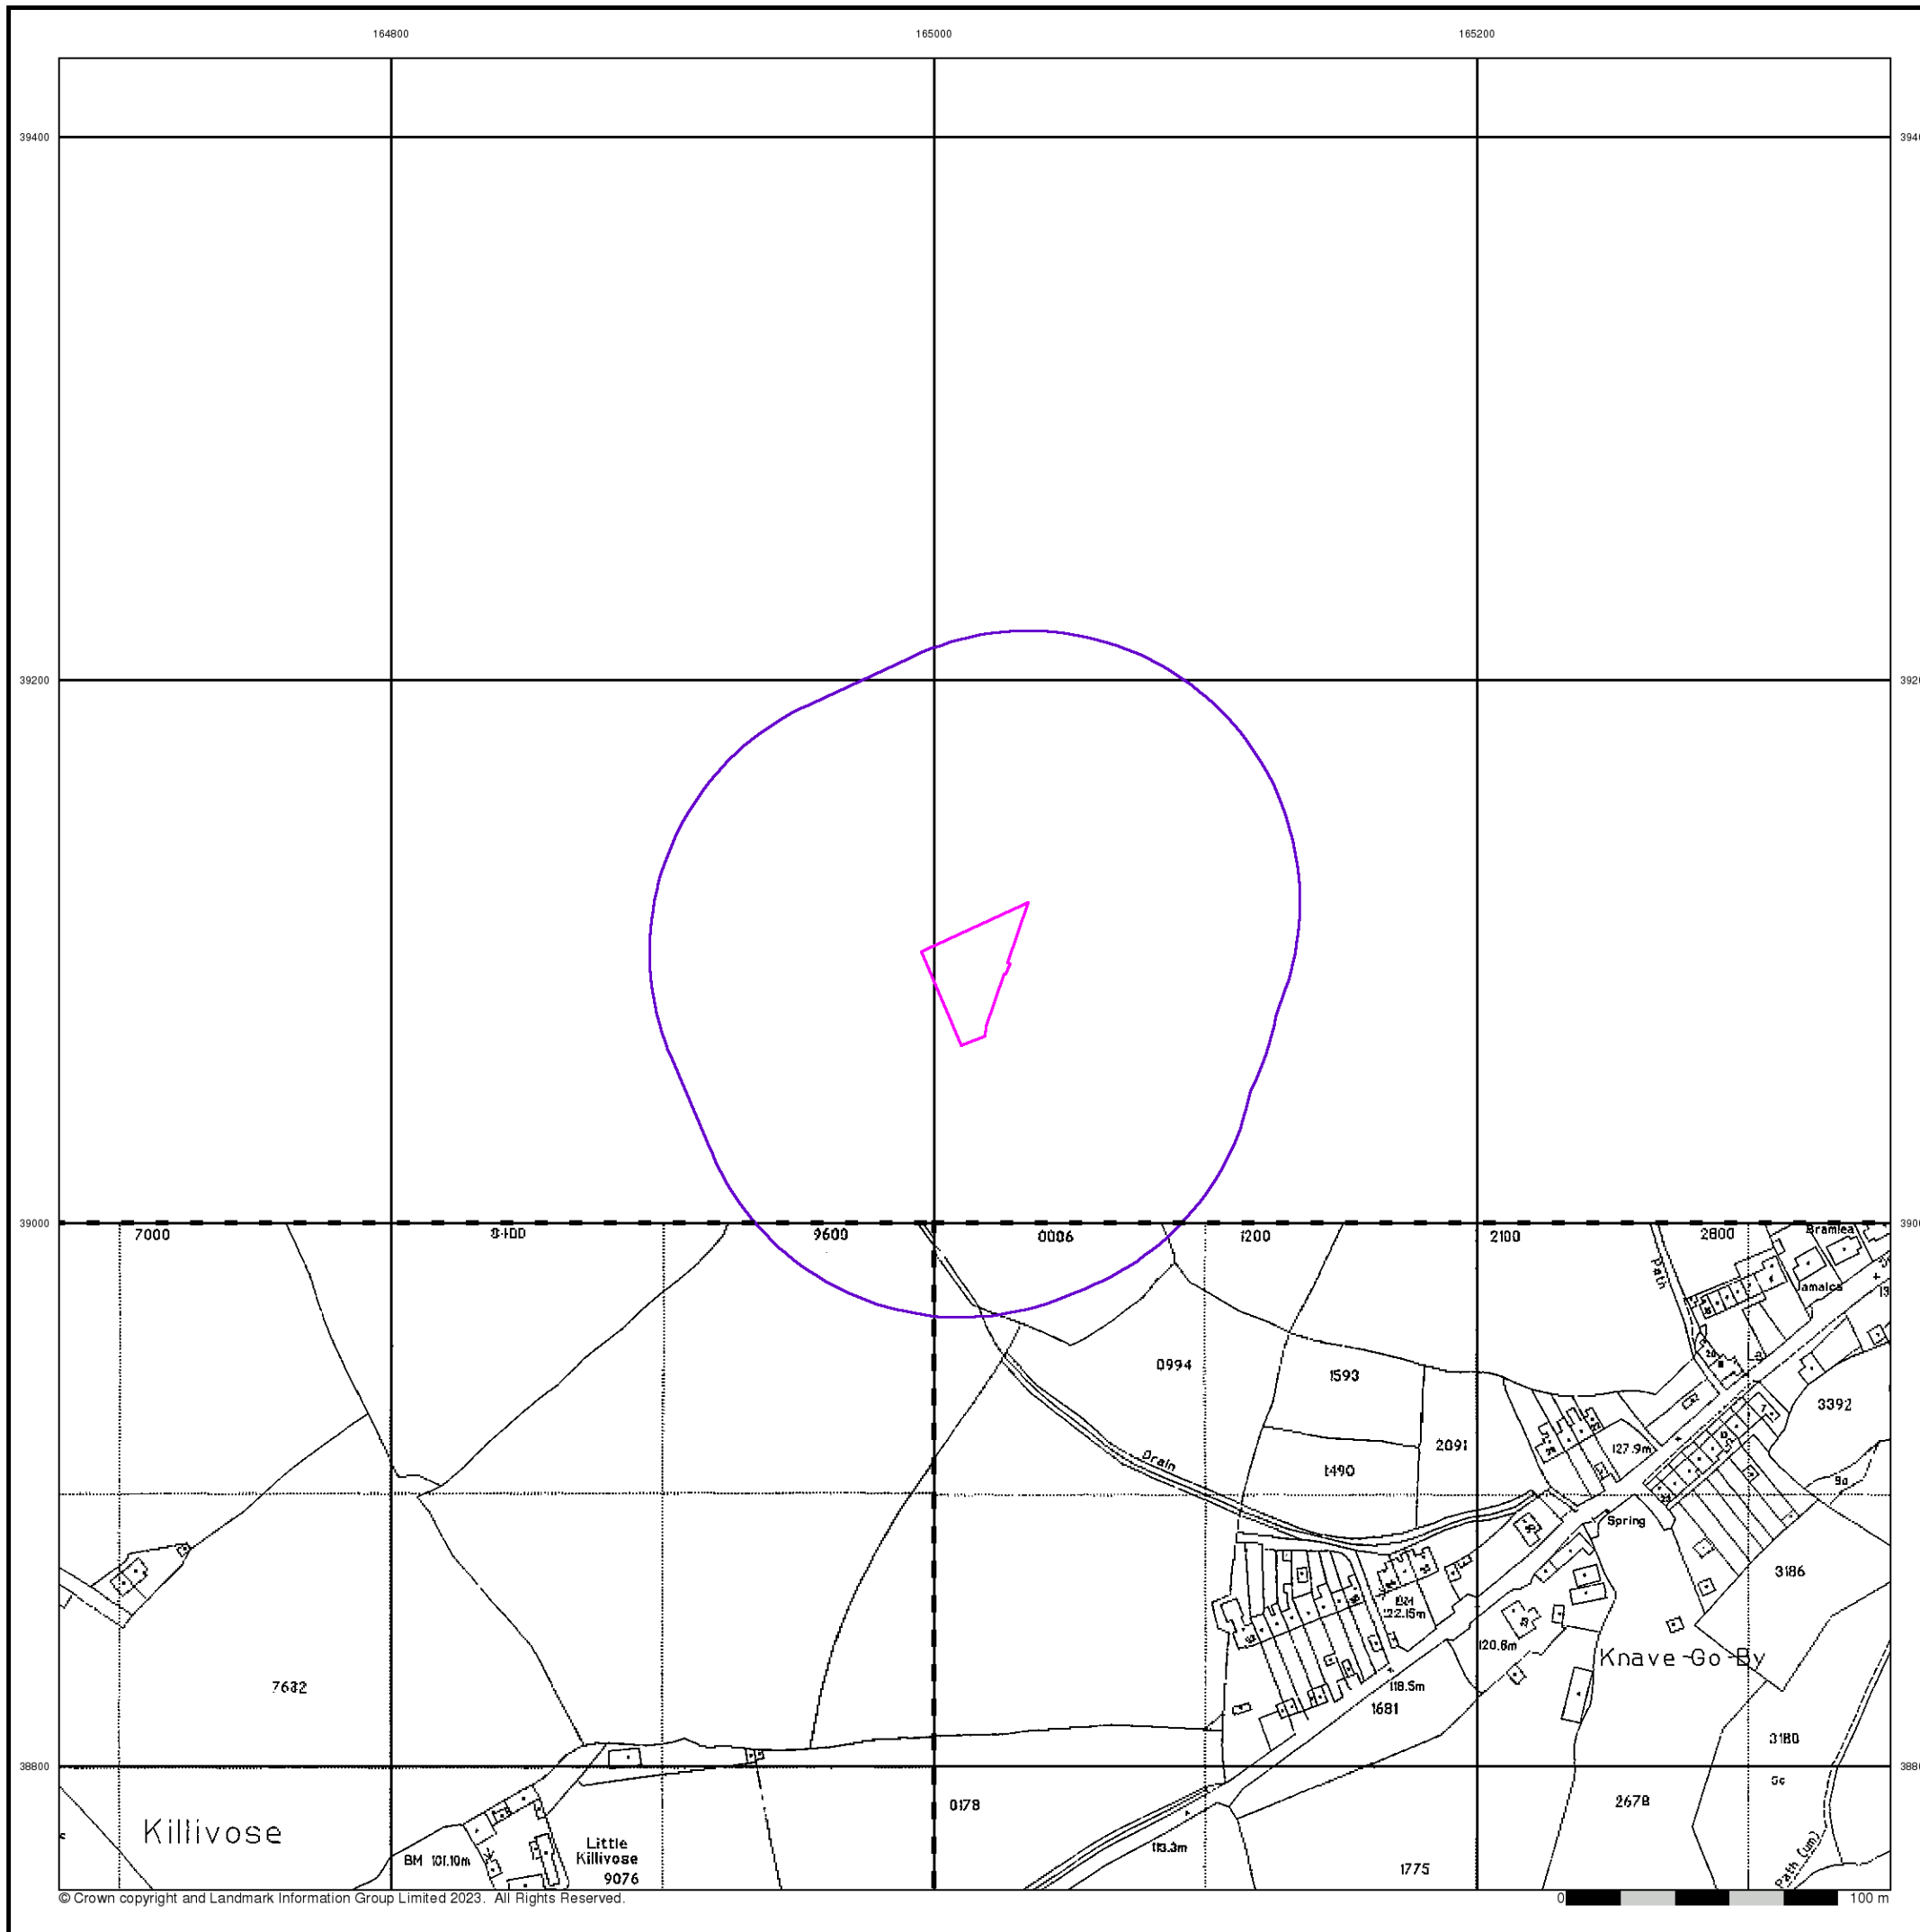


Large-Scale National Grid Data

Published 1995


Source map scale - 1:1,250

'Large Scale National Grid Data' superseded SIM cards (Ordnance Survey's 'Survey of Information on Microfilm') in 1992, and continued to be produced until 1999. These maps were the fore-runners of digital mapping and so provide detailed information on houses and roads, but tend to show less topographic features such as vegetation. These maps were produced at both 1:2,500 and 1:1,250 scales.

Map Name(s) and Date(s)

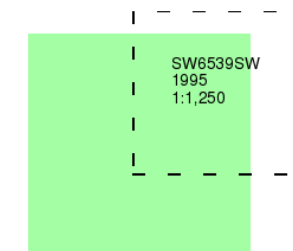

Historical Map - Segment A13

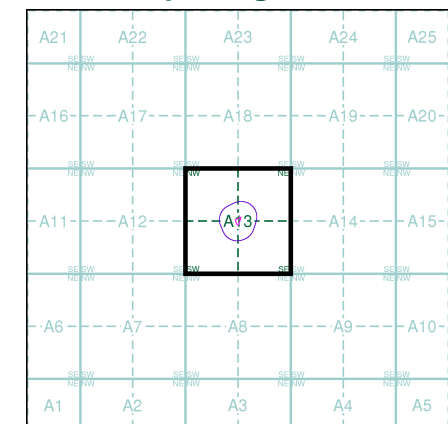


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 100

Site Details

Lauren House, CAMBORNE, TR14 7RX

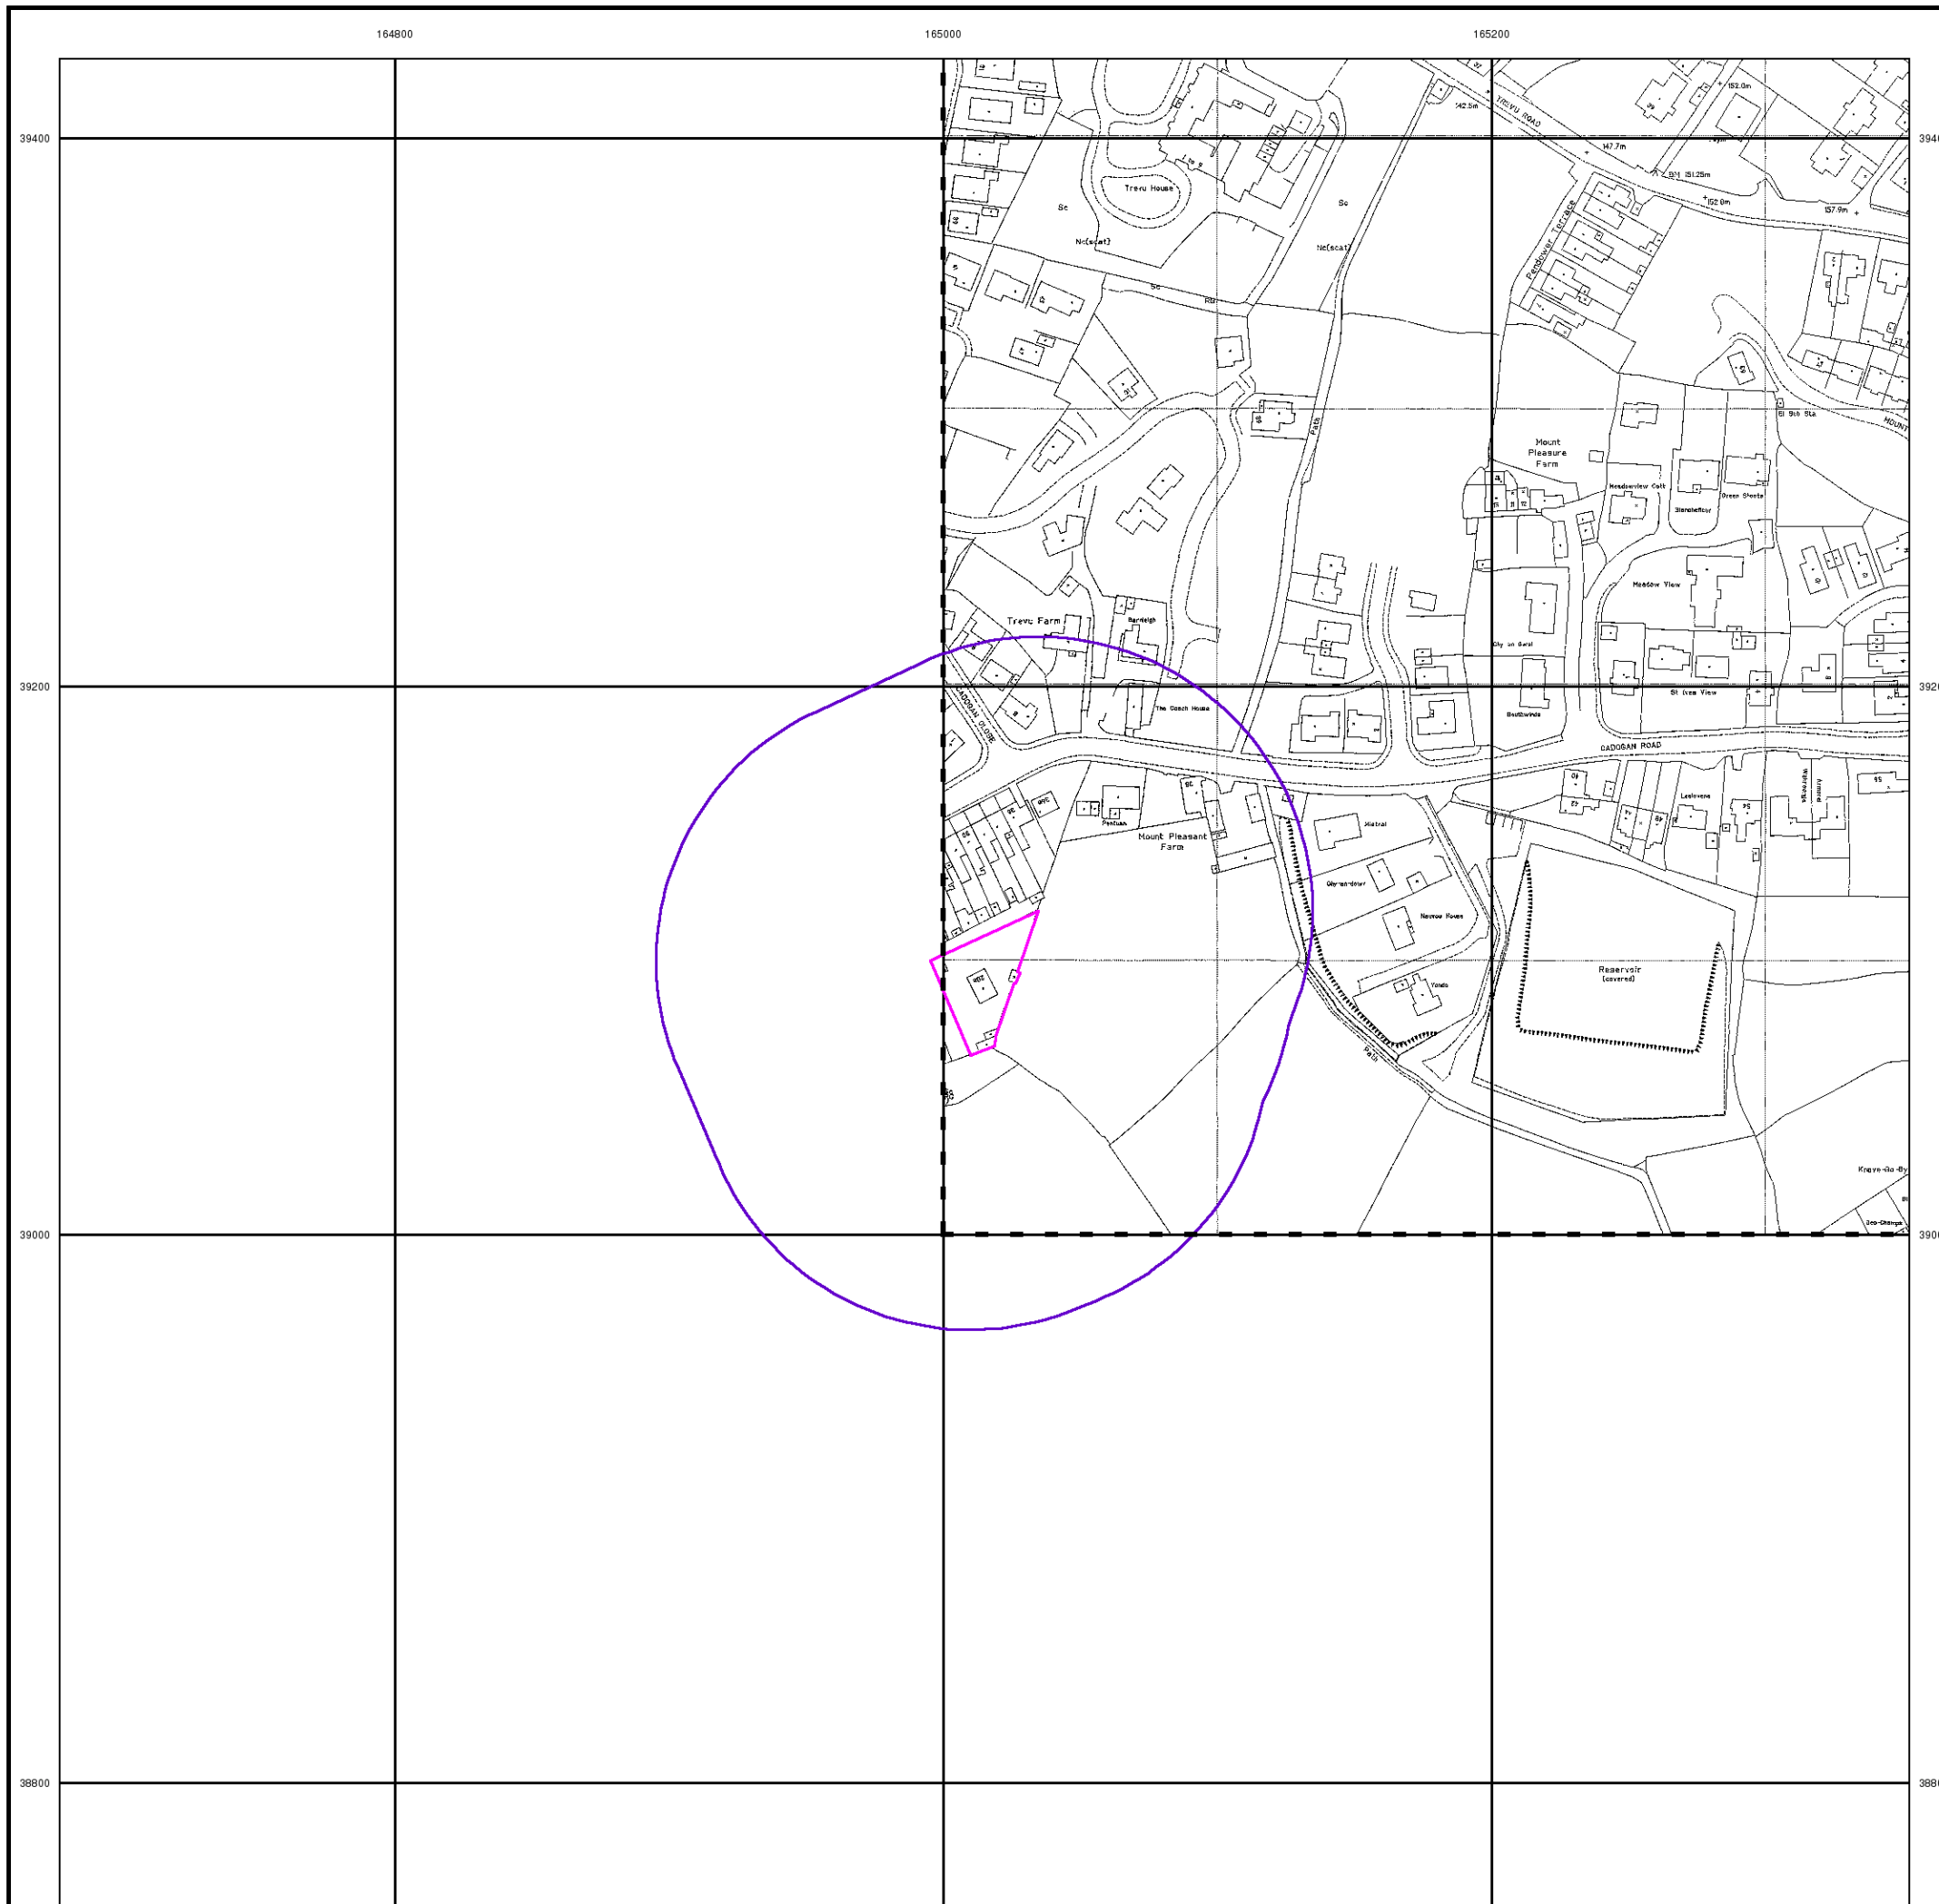

Historical Mapping Legends

Ordnance Survey County Series 1:10,560

	Gravel Pit		Sand Pit		Other Pits
	Quarry		Shingle		Orchard
	Osiers		Reeds		Marsh
	Mixed Wood		Deciduous		Brushwood
	Fir		Furze		Rough Pasture
	Arrow denotes flow of water		Trigonometrical Station		
	Site of Antiquities		Bench Mark		
	Pump, Guide Post, Signal Post		Well, Spring, Boundary Post		
	-285 Surface Level				
	Sketched Contour		Instrumental Contour		
	Main Roads		Minor Roads		
	Sunken Road		Raised Road		
	Road over Railway		Railway over River		
	Railway over Road		Level Crossing		
	Road over River or Canal		Road over Stream		
	Road over Stream				
	County Boundary (Geographical)				
	County & Civil Parish Boundary				
	Administrative County & Civil Parish Boundary				
	County Borough Boundary (England)				
	County Burgh Boundary (Scotland)				
	Rural District Boundary				
	Civil Parish Boundary				

Ordnance Survey Plan 1:10,000

	Chalk Pit, Clay Pit or Quarry		Gravel Pit
	Sand Pit		Disused Pit or Quarry
	Refuse or Slag Heap		Lake, Loch or Pond
	Dunes		Boulders
	Coniferous Trees		Non-Coniferous Trees
	Orchard		Scrub
	Coppice		Heath
	Rough Grassland		Marsh
	Reeds		Saltings
	Building		Glasshouse
	Sloping Masonry		Pylon
	Electricity Transmission Line		Pole
	Cutting		Embankment
	Standard Gauge Multiple Track		Standard Gauge Single Track
	Siding, Tramway or Mineral Line		Narrow Gauge
	Geographical County		
	Administrative County, County Borough or County of City		
	Municipal Borough, Urban or Rural District, Burgh or District Council		
	Borough, Burgh or County Constituency Shown only when not coincident with other boundaries		
	Civil Parish Shown alternately when coincidence of boundaries occurs		
	BP, BS Boundary Post or Stone		Pol Sta Police Station
	Ch Church		PO Post Office
	CH Club House		PC Public Convenience
	F E Sta Fire Engine Station		PH Public House
	FB Foot Bridge		SB Signal Box
	Fn Fountain		Spr Spring
	GP Guide Post		TCB Telephone Call Box
	MP Mile Post		TCP Telephone Call Post
	MS Mile Stone		W Well

1:10,000 Raster Mapping

	Gravel Pit		Refuse tip or slag heap
	Rock		Rock (scattered)
	Boulders		Boulders (scattered)
	Shingle		Mud
	Sand		Sand Pit
	Slopes		Top of cliff
	General detail		Underground detail
	Overhead detail		Narrow gauge railway
	Multi-track railway		Single track railway
	County boundary (England only)		Civil, parish or community boundary
	District, Unitary, Metropolitan, London Borough boundary		Constituency boundary
	Area of wooded vegetation		Non-coniferous trees
	Non-coniferous trees (scattered)		Coniferous trees
	Coniferous trees (scattered)		Positioned tree
	Orchard		Coppice or Osiers
	Rough Grassland		Heath
	Scrub		Marsh, Salt Marsh or Reeds
	Water feature		Flow arrows
	MHW(S) Mean high water (springs)		MLW(S) Mean low water (springs)
	Telephone line (where shown)		Electricity transmission line (with poles)
	Bench mark (where shown)		Triangulation station
	Point feature (e.g. Guide Post or Mile Stone)		Pylon, flare stack or lighting tower
	Site of (antiquity)		Glasshouse
	General Building		Important Building


Envirocheck®

LANDMARK INFORMATION GROUP®

Historical Mapping & Photography included:

Mapping Type	Scale	Date	Pg
Cornwall & Isles Of Scilly	1:10,560	1887 - 1888	2
Cornwall & Isles Of Scilly	1:10,560	1908	3
Cornwall & Isles Of Scilly	1:10,560	1938	4
Ordnance Survey Plan	1:10,000	1963	5
Ordnance Survey Plan	1:10,000	1979	6
Ordnance Survey Plan	1:10,000	1980 - 1987	7
Ordnance Survey Plan	1:10,000	1991	8
10K Raster Mapping	1:10,000	2000	9
Street View	Variable		10

Historical Map - Slice A

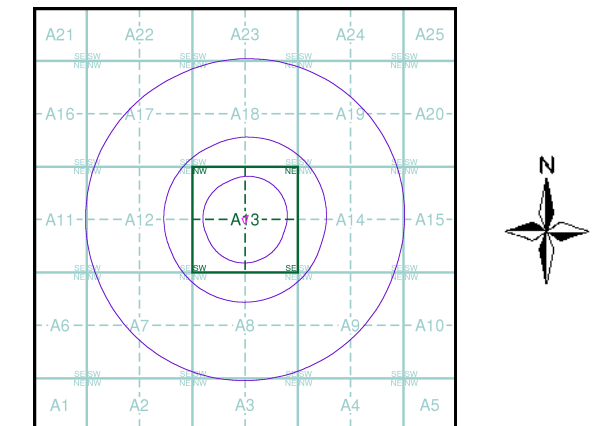

Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX

Landmark
 INFORMATION GROUP

Tel: 0844 844 9952
 Fax: 0844 844 9951
 Web: www.envirocheck.co.uk


Cornwall & Isles Of Scilly

Published 1887 - 1888


Source map scale - 1:10,560

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

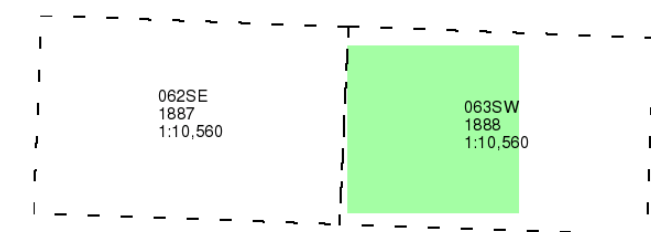

Historical Map - Slice A

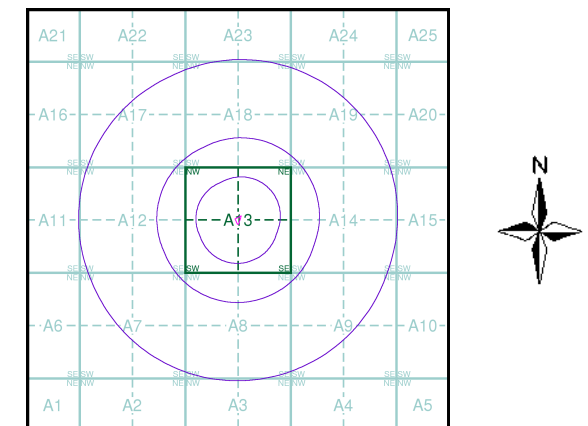


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 1000


Site Details

Lauren House, CAMBORNE, TR14 7RX

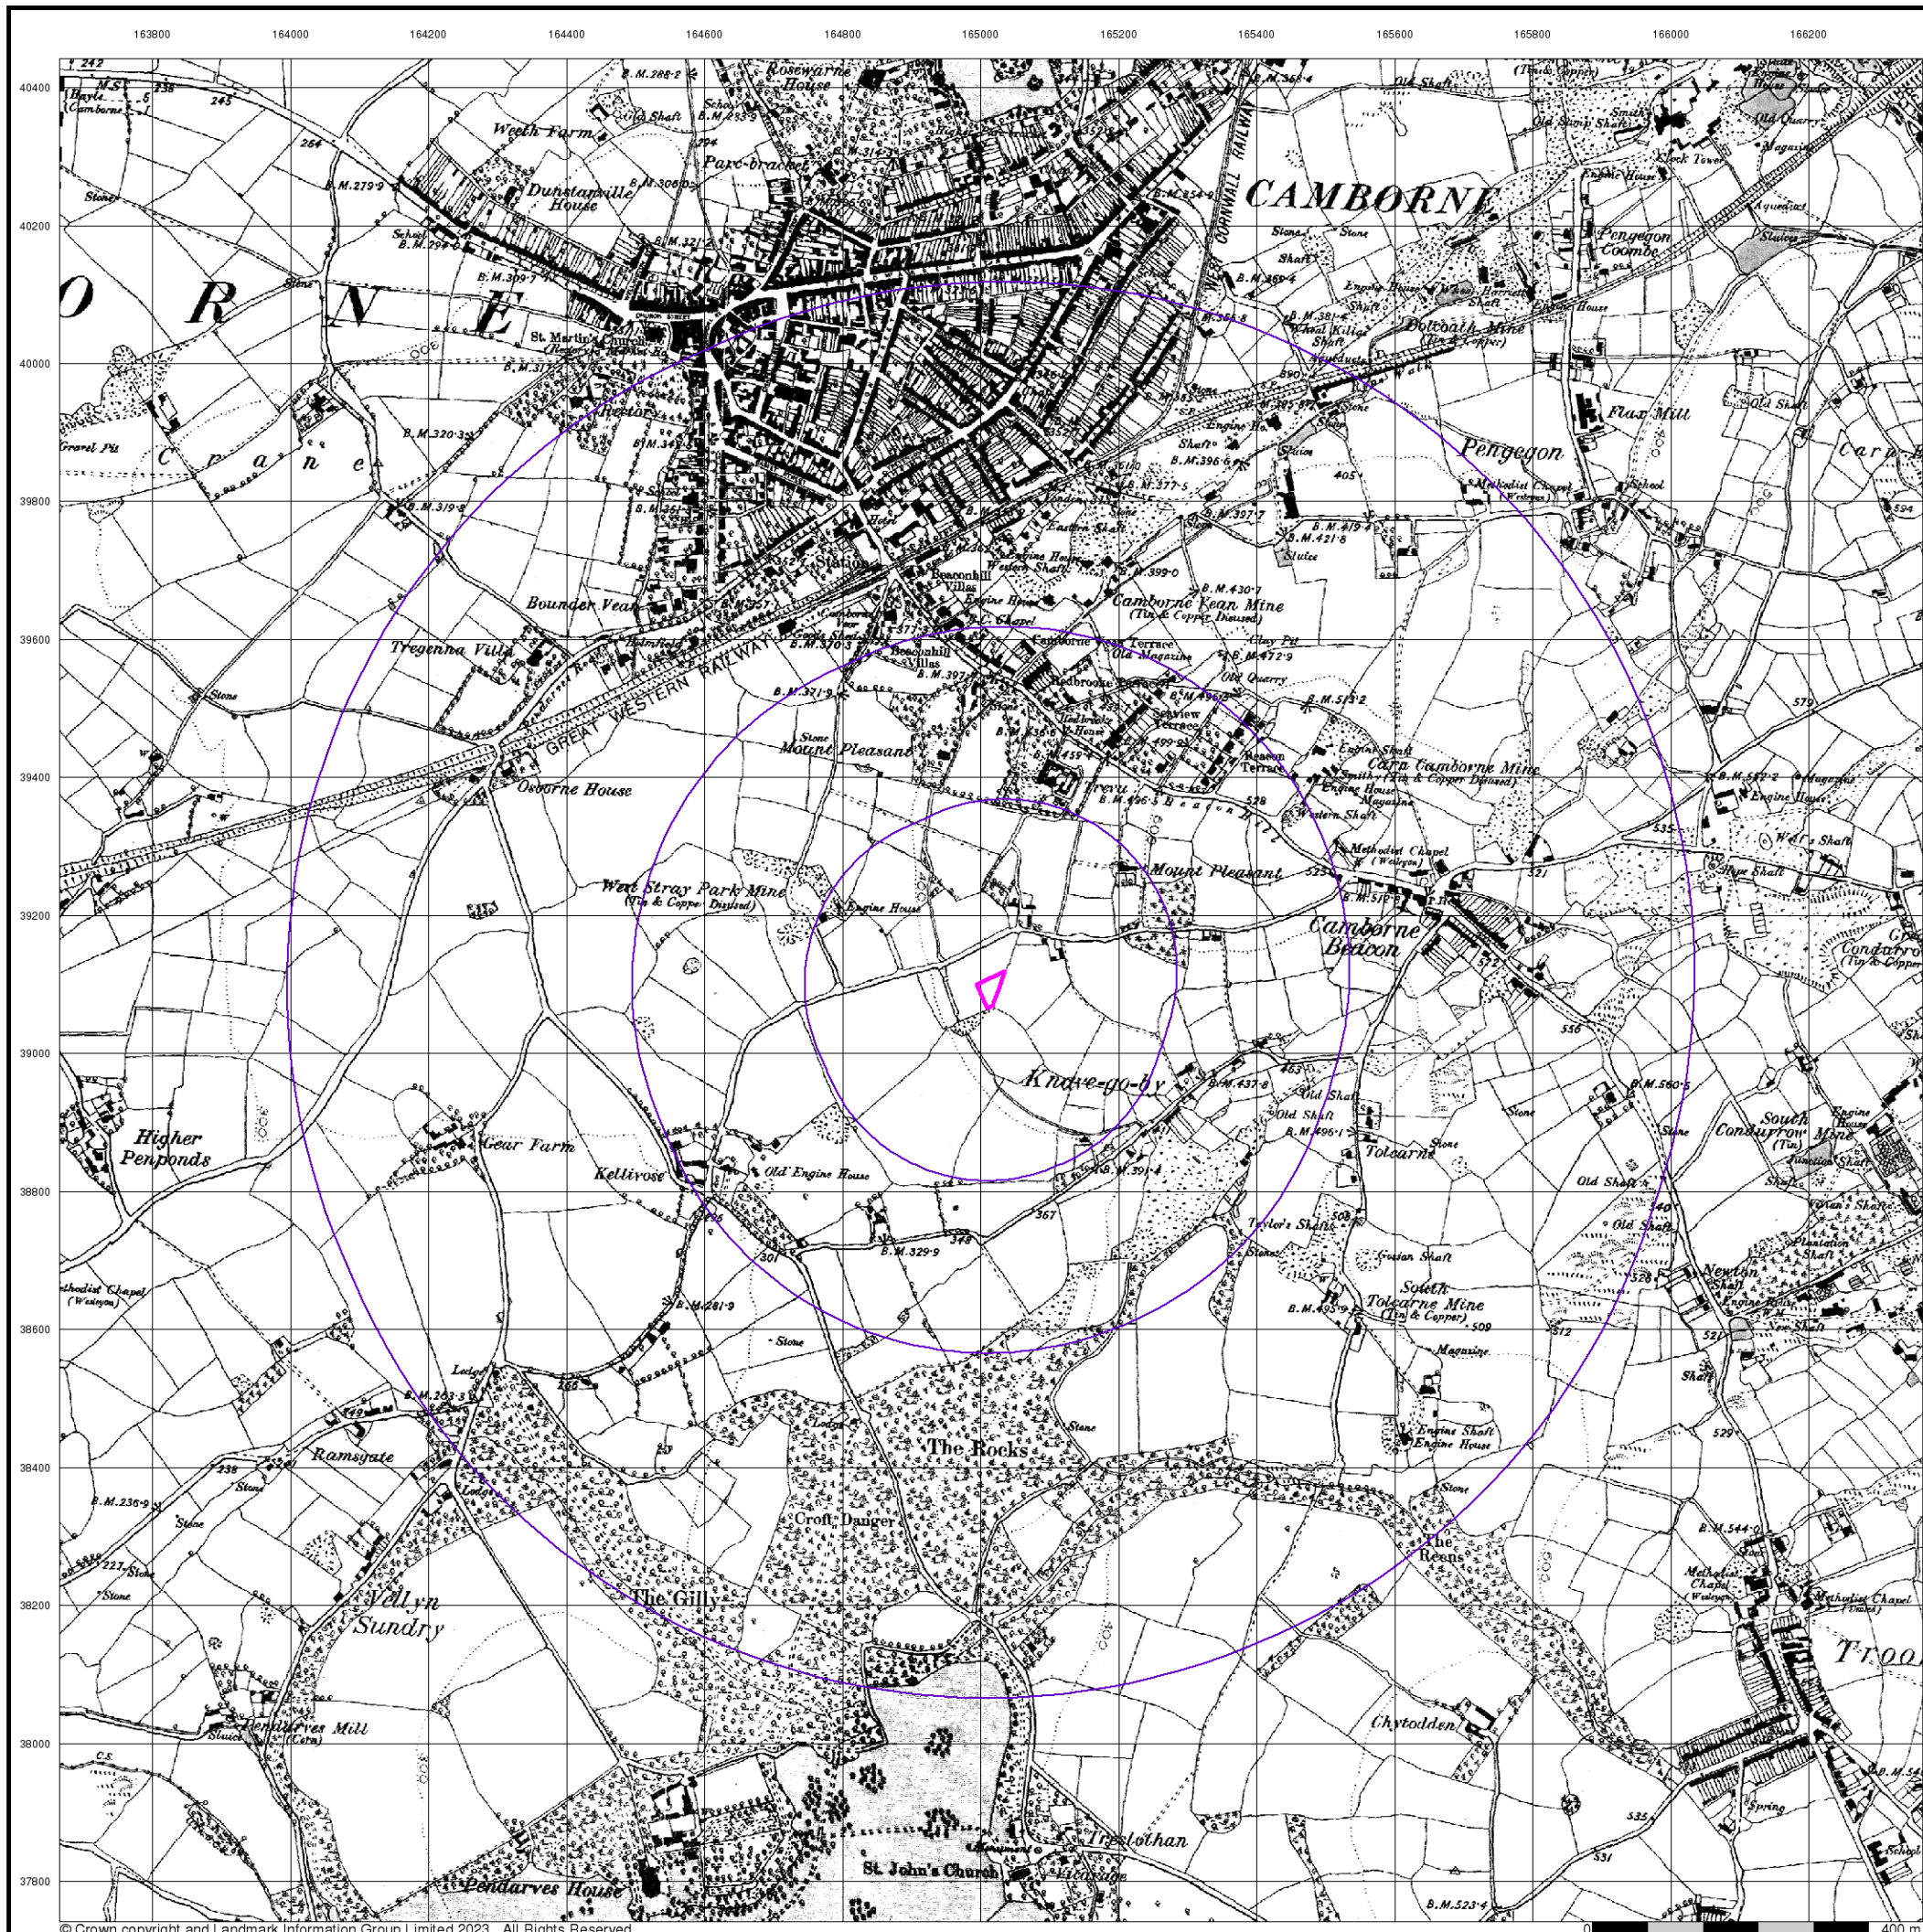


The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

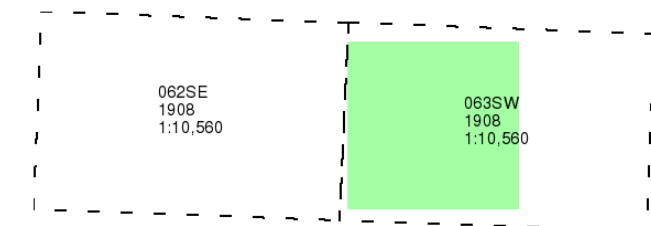

Historical Map - Slice A

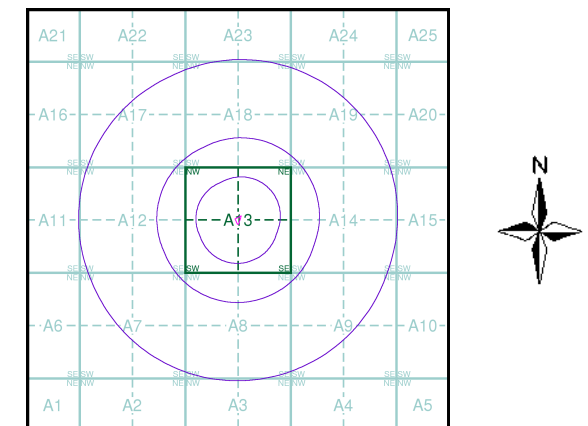


Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX

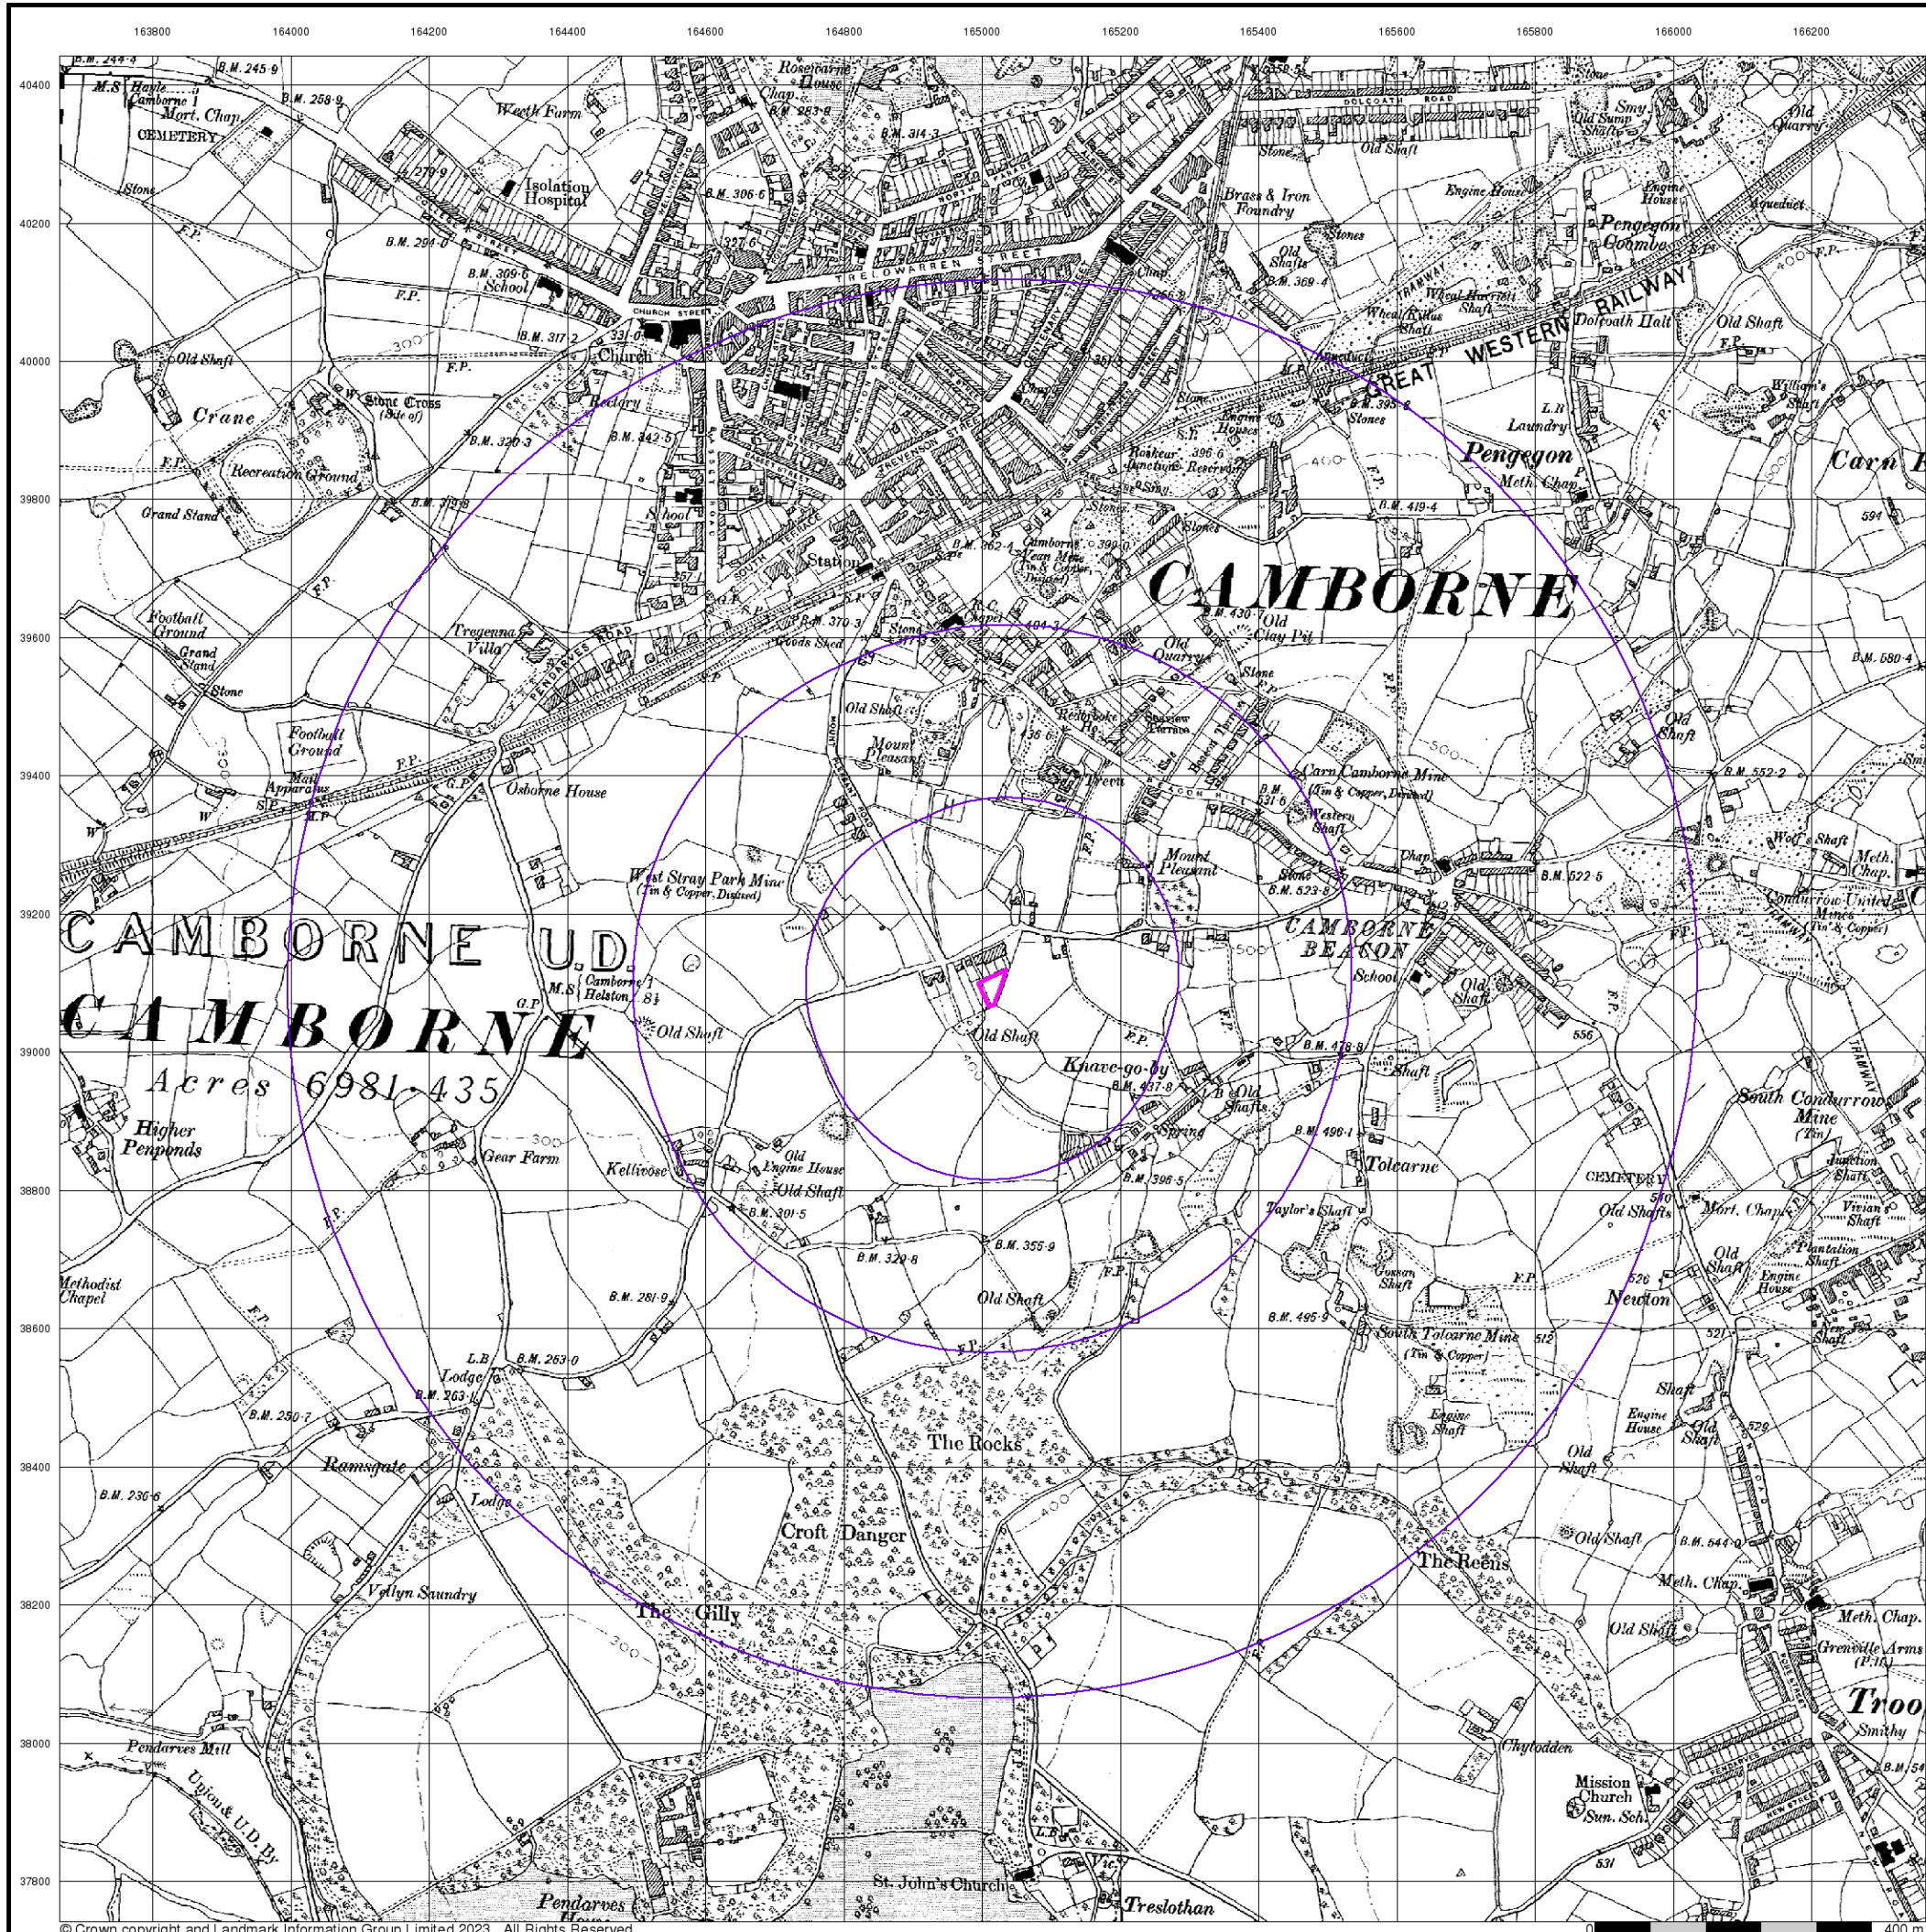


Cornwall & Isles Of Scilly

Published 1938


Source map scale - 1:10,560

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

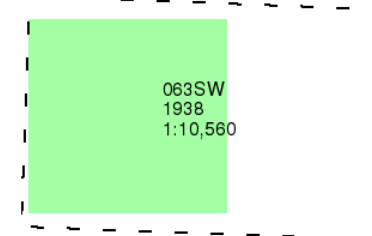

Historical Map - Slice A

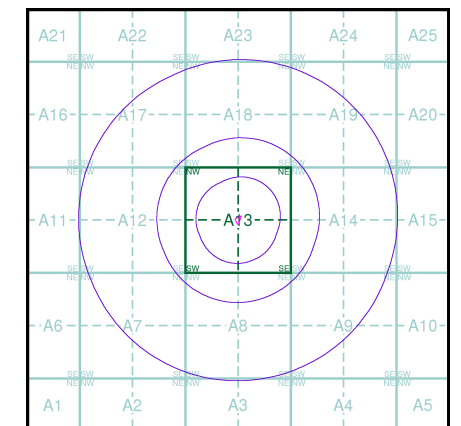

Order Details

Order Number: 319400084_1_1
Customer Ref: 2123
National Grid Reference: 165020, 39090
Slice: A
Site Area (Ha): 0.1
Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX



Ordnance Survey Plan

Published 1979


Source map scale - 1:10,000

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

SW64SW	SW64SE
1979	1979
1:10,000	1:10,000

Historical Map - Slice A

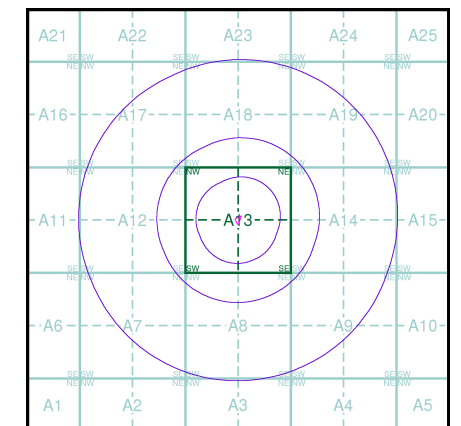


Order Details

Order Number: 319400084_1_1
Customer Ref: 2123
National Grid Reference: 165020, 39090
Slice: A
Site Area (Ha): 0.1
Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX

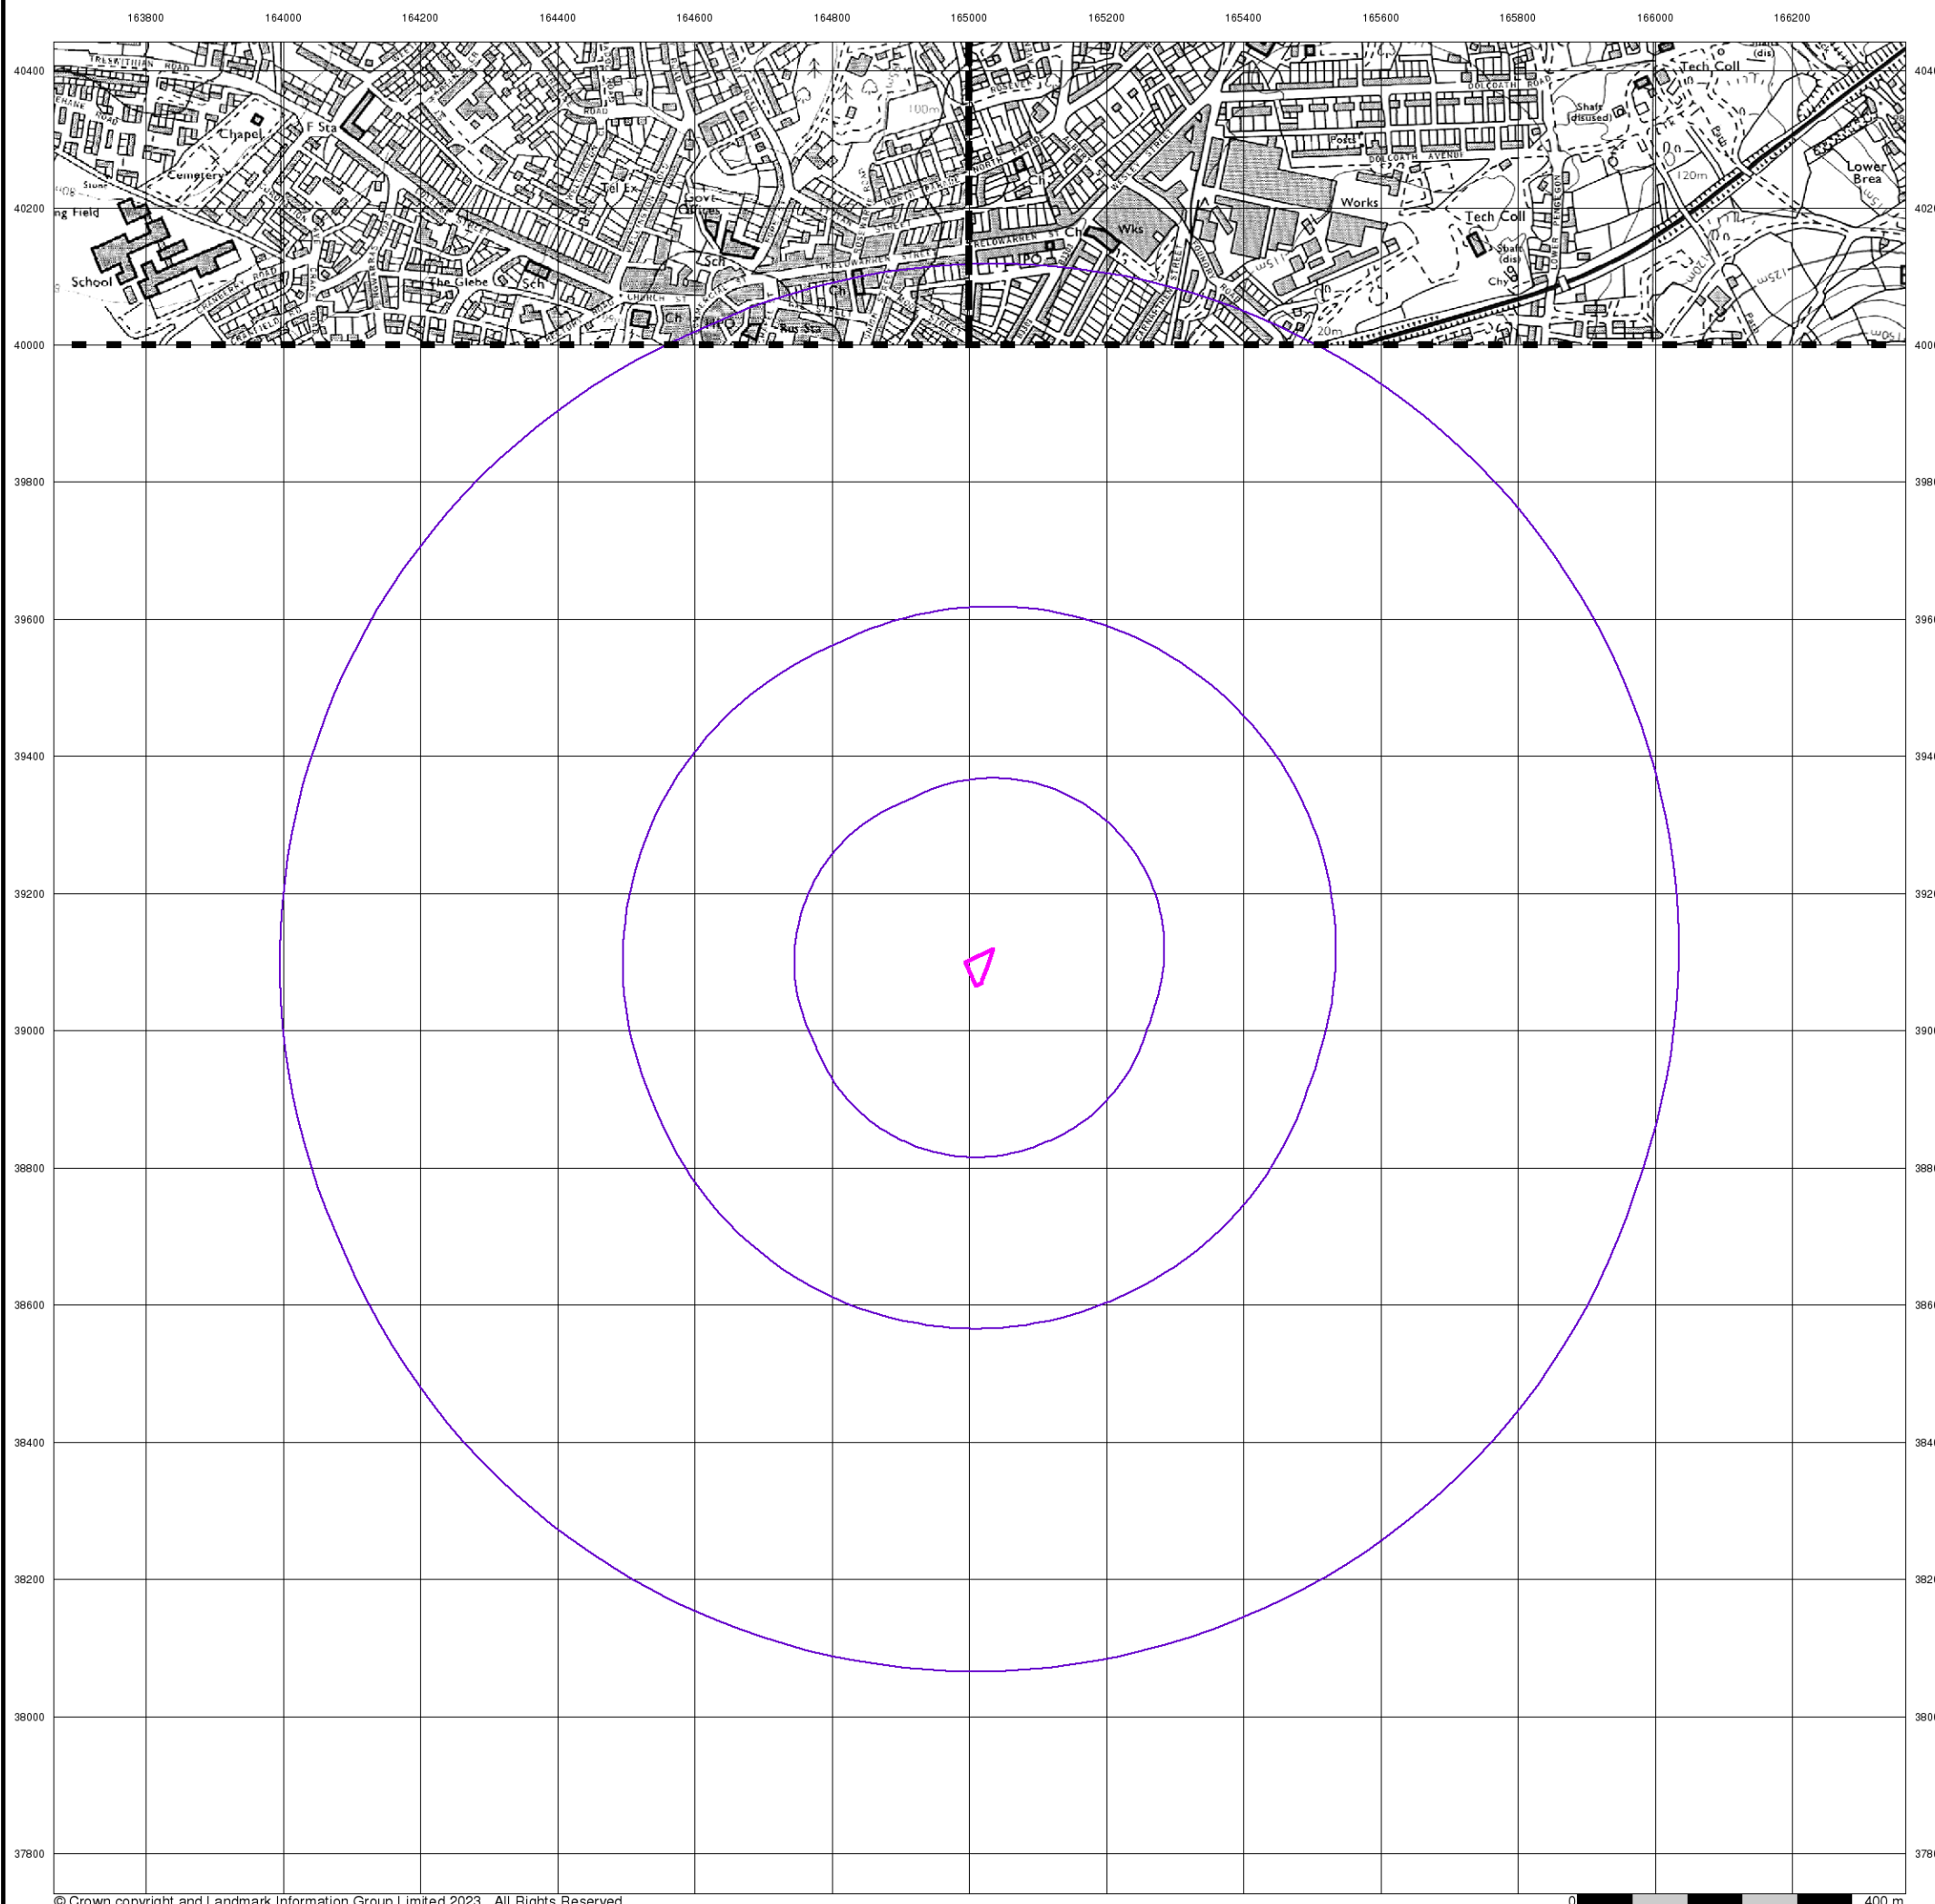

Ordnance Survey Plan

Published 1980 - 1987


Source map scale - 1:10,000

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

SW64SW	1987	1:10,000
SW63NW	1980	1:10,000
SW63NE	1981	1:10,000

Historical Map - Slice A

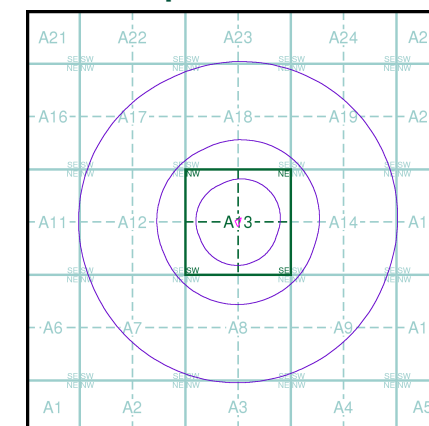

Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX




Ordnance Survey Plan

Published 1991


Source map scale - 1:10,000

The historical maps shown were reproduced from maps predominantly held at the scale adopted for England, Wales and Scotland in the 1840's. In 1854 the 1:2,500 scale was adopted for mapping urban areas; these maps were used to update the 1:10,560 maps. The published date given therefore is often some years later than the surveyed date. Before 1938, all OS maps were based on the Cassini Projection, with independent surveys of a single county or group of counties, giving rise to significant inaccuracies in outlying areas. In the late 1940's, a Provisional Edition was produced, which updated the 1:10,560 mapping from a number of sources. The maps appear unfinished - with all military camps and other strategic sites removed. These maps were initially overprinted with the National Grid. In 1970, the first 1:10,000 maps were produced using the Transverse Mercator Projection. The revision process continued until recently, with new editions appearing every 10 years or so for urban areas.

Map Name(s) and Date(s)

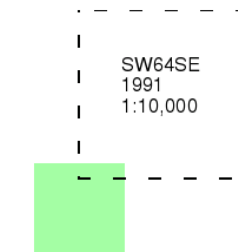

Historical Map - Slice A

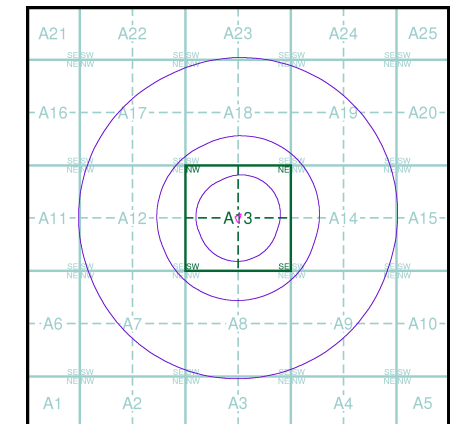


Order Details

Order Number: 319400084_1_1
Customer Ref: 2123
National Grid Reference: 165020, 39090
Slice: A
Site Area (Ha): 0.1
Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX

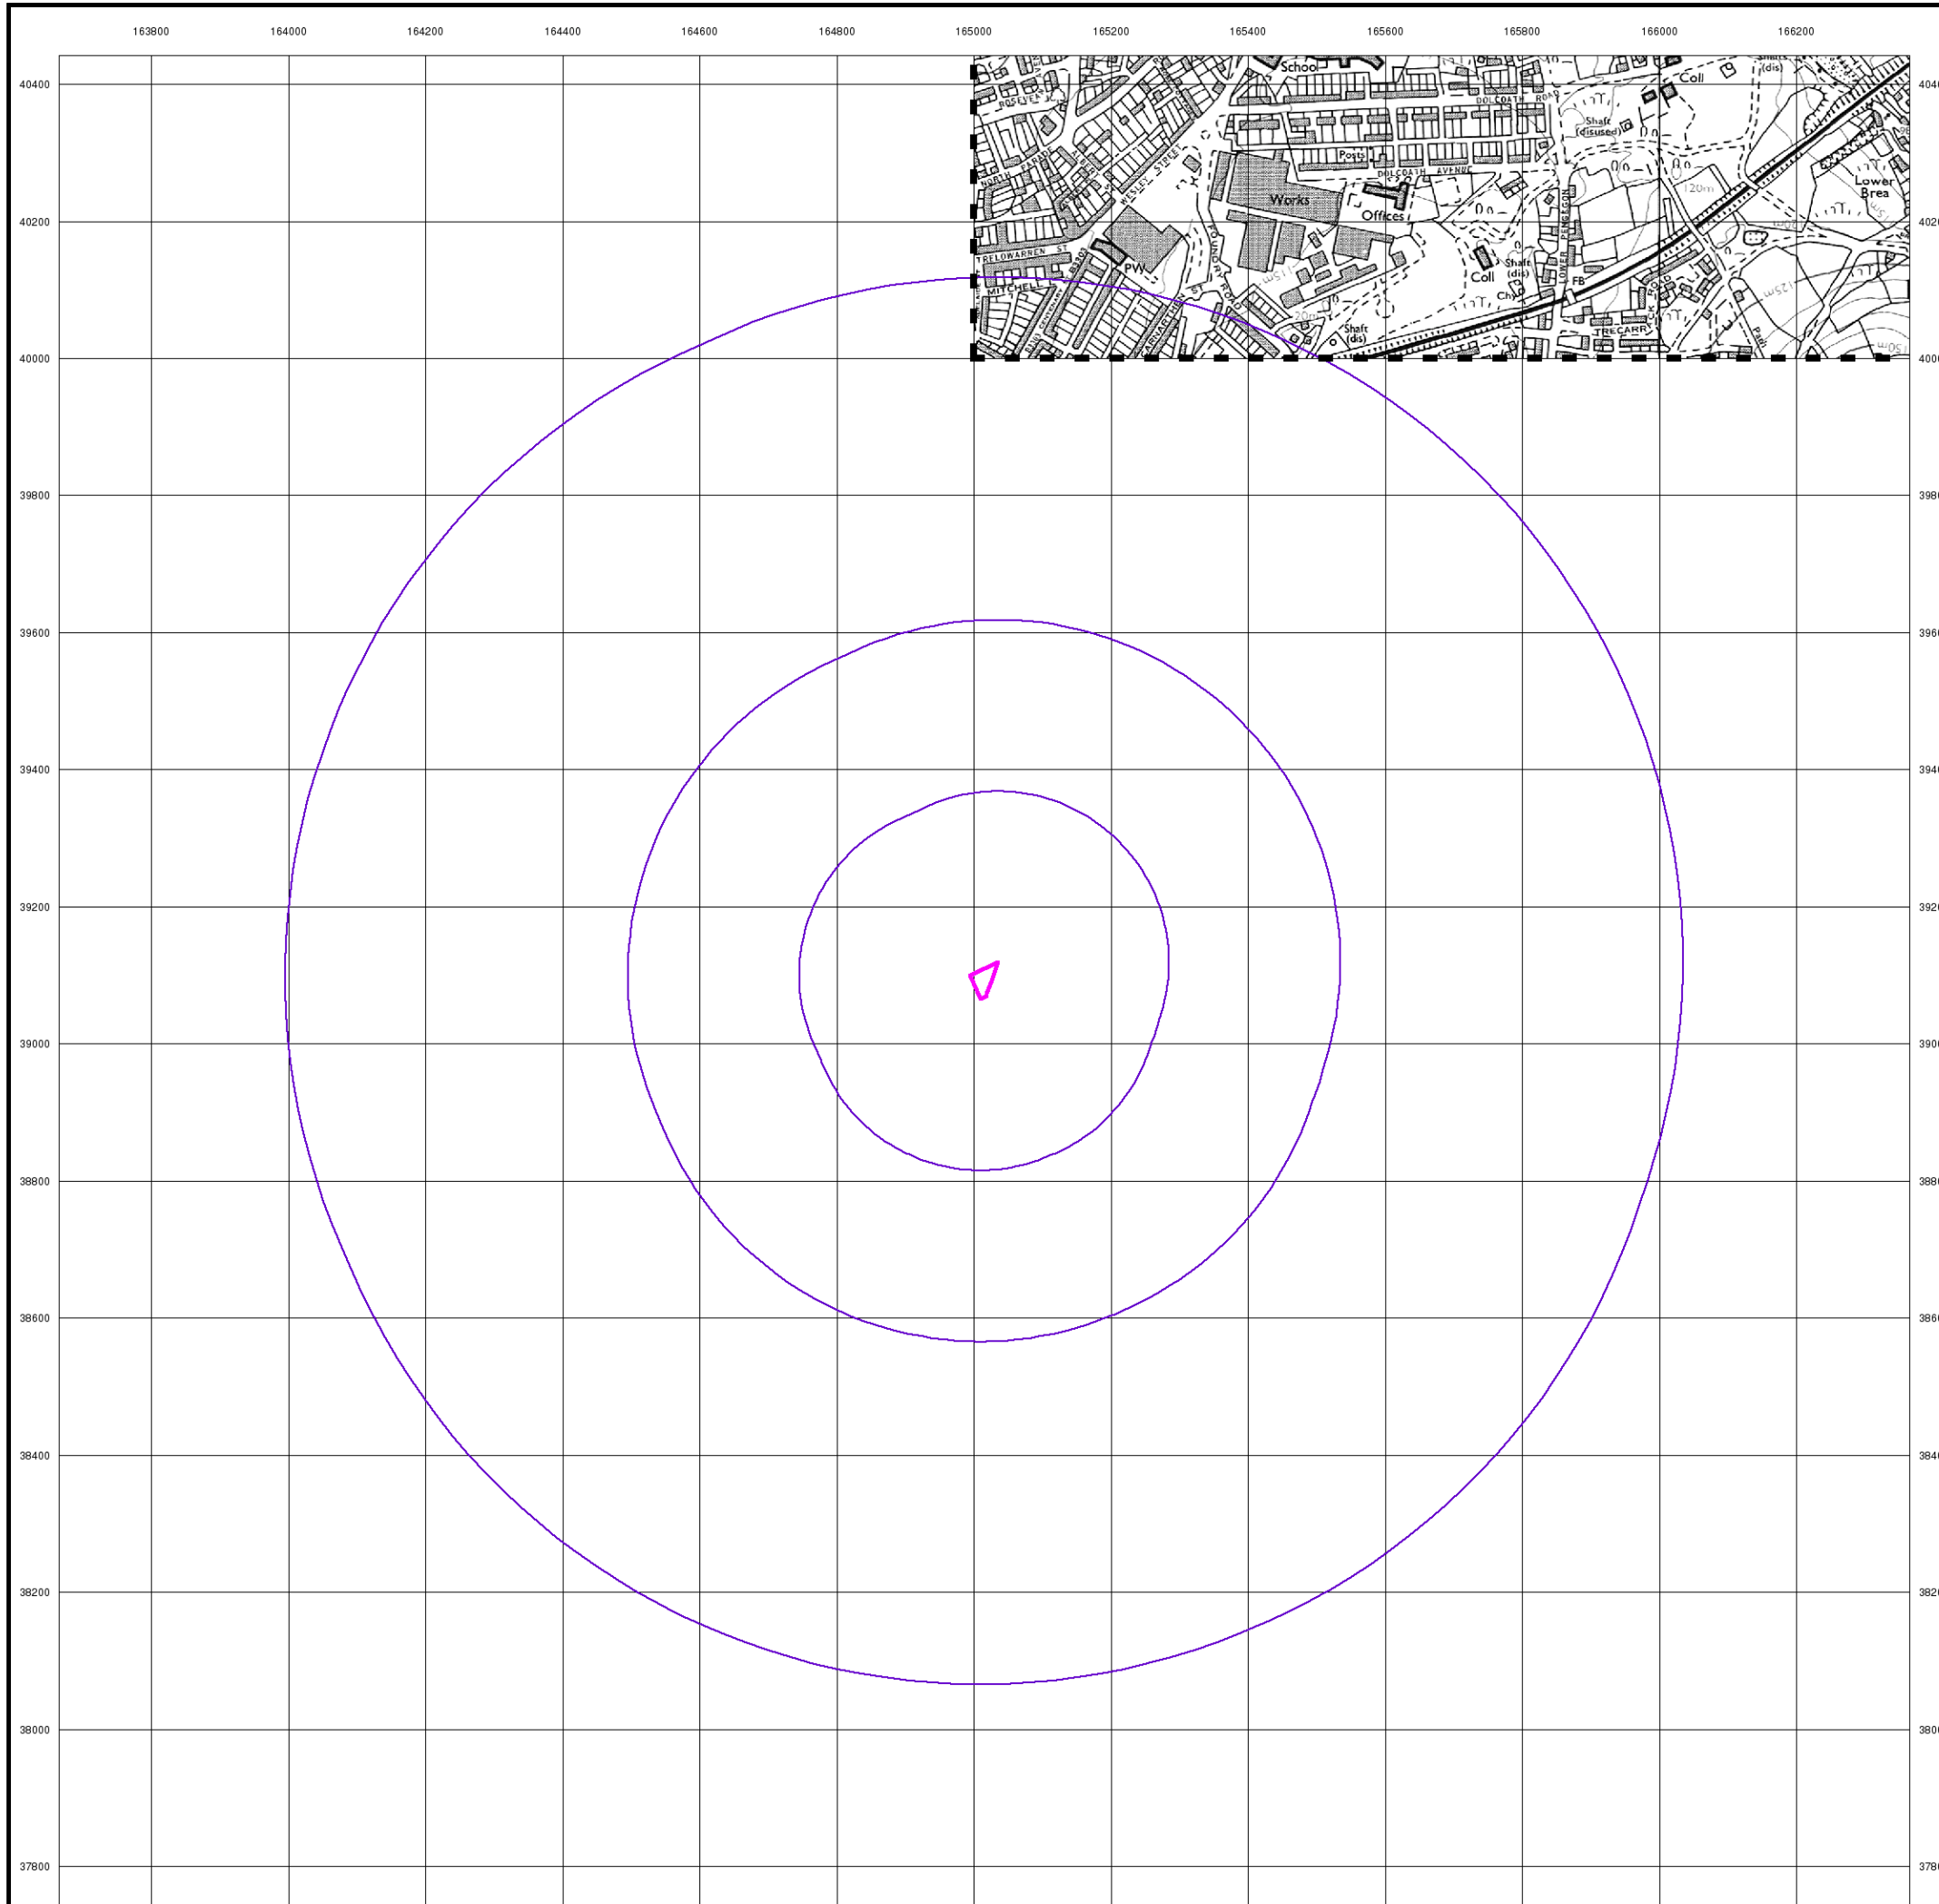

10k Raster Mapping

Published 2000


Source map scale - 1:10,000

The historical maps shown were produced from the Ordnance Survey's 1:10,000 colour raster mapping. These maps are derived from Landplan which replaced the old 1:10,000 maps originally published in 1970. The data is highly detailed showing buildings, fences and field boundaries as well as all roads, tracks and paths. Road names are also included together with the relevant road number and classification. Boundary information depiction includes county, unitary authority, district, civil parish and constituency.

Map Name(s) and Date(s)

SW64SW	SW64SE
2000	2000
1:10,000	1:10,000
SW63NW	SW63NE
2000	2000
1:10,000	1:10,000

Historical Map - Slice A

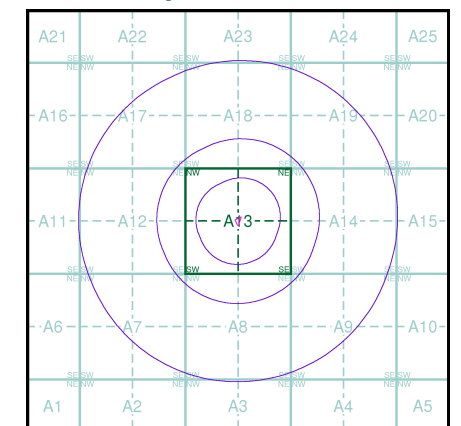

Order Details

Order Number: 319400084_1_1
 Customer Ref: 2123
 National Grid Reference: 165020, 39090
 Slice: A
 Site Area (Ha): 0.1
 Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX



Street View

Published 2023


Source map scale - 1:10,000

Street View is a street-level map for the whole of Great Britain produced by the Ordnance Survey. These maps are provided at a nominal scale of 1:10,000

Map Name(s) and Date(s)



Street View Map - Slice A

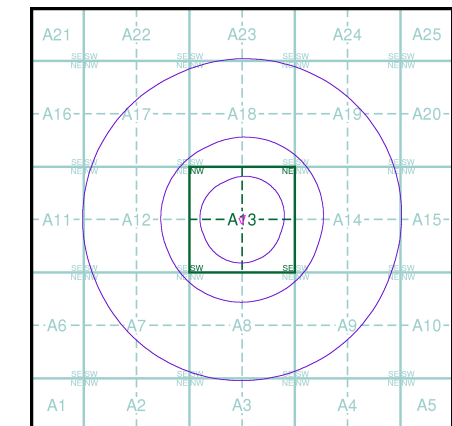


Order Details

Order Number: 319400084_1_1
Customer Ref: 2123
National Grid Reference: 165020, 39090
Slice: A
Site Area (Ha): 0.1
Search Buffer (m): 1000

Site Details

Lauren House, CAMBORNE, TR14 7RX

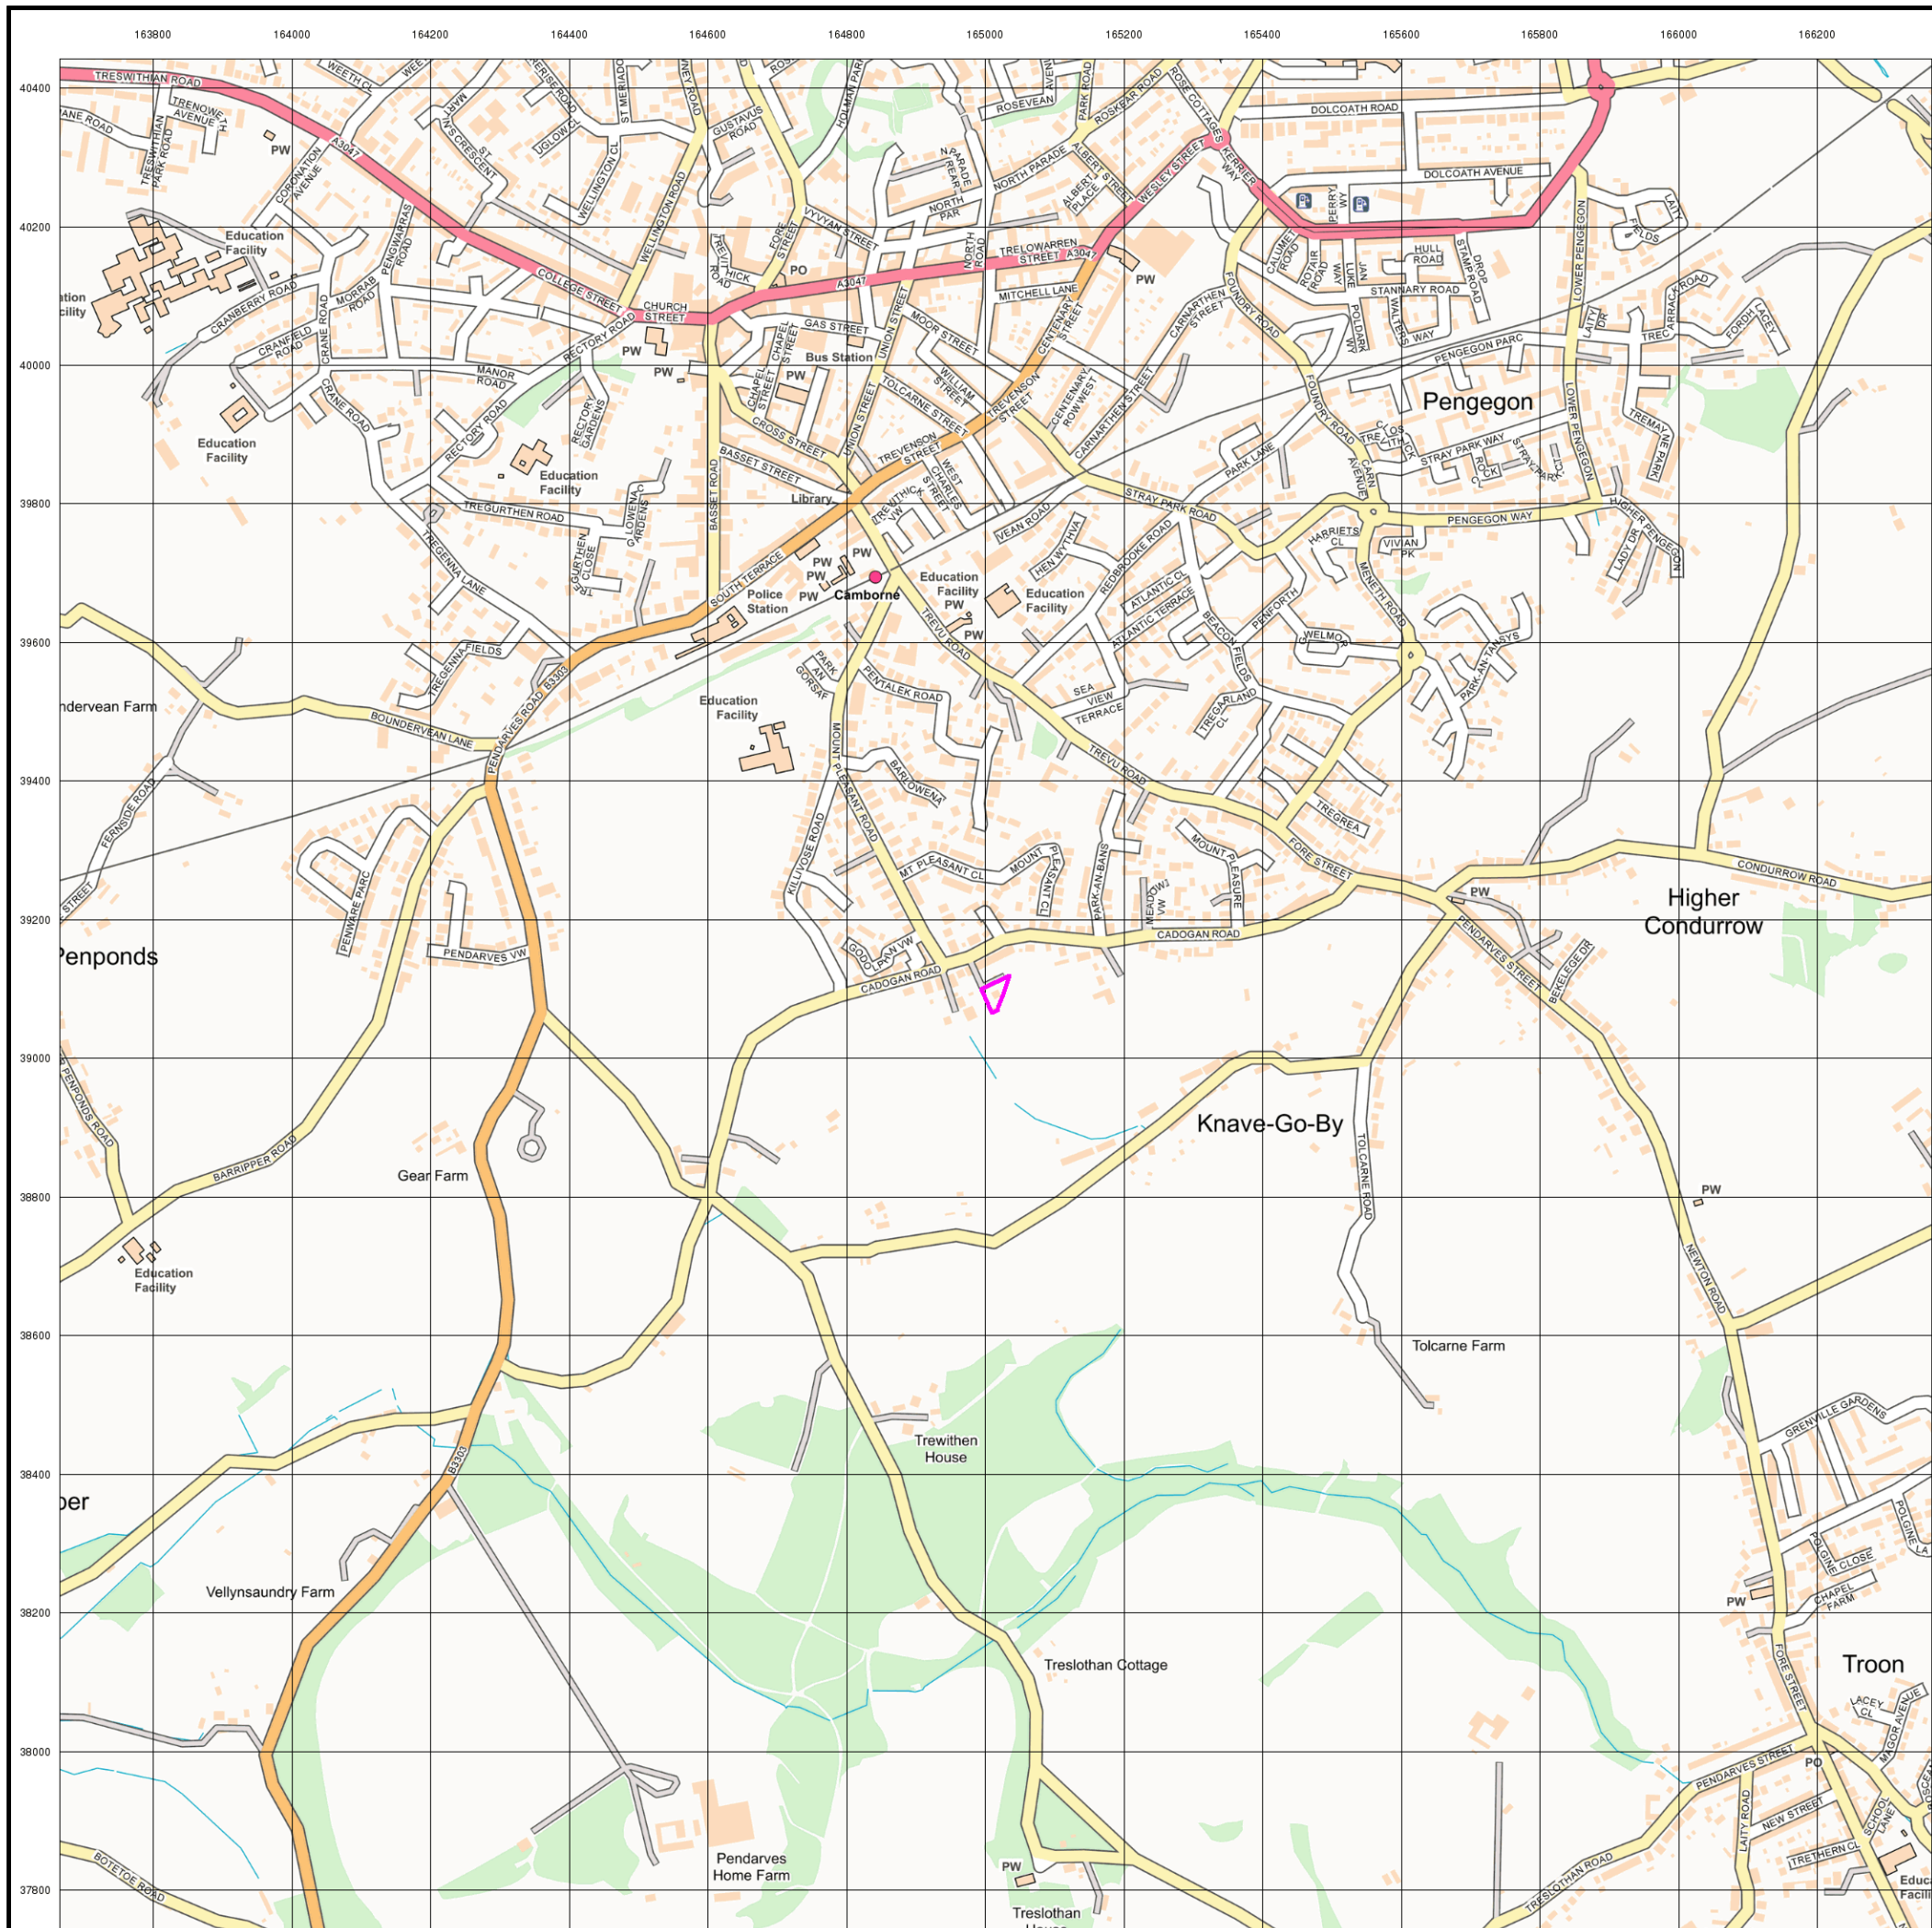

APPENDIX C

MINING REPORT



Wheal Jane Consultancy
Old Mine Offices
Wheal Jane
Baldhu, Truro
Cornwall, TR3 6EE

Wheal Jane
Consultancy



Geotechnical, environmental
& mining services

Archival Metalliferous Mining Search

Mining Risk: Moderate

Action: Footings Inspection

Address: Lauren House
Cadogan Road
Camborne
Cornwall
TR14 7RX

Client: Your Environmental Solutions Ltd
Woodcocks Roost
Fore Street
Barripper
Camborne
Cornwall
TR14 0QR

Your Ref.: 2123

Our Ref.: MS44442

Date: 11 October 2023

01872 560 200
consultancy@wheal-jane.co.uk



Action: Footings Inspection

Dear Sirs,

Re: Lauren House, Cadogan Road, Camborne, Cornwall, TR14 7RX

We thank you for your recent request.

As instructed, we have carried out a mining search in respect of the above property, as delineated on the plan supplied for the purpose of requesting this search (a copy of which is included with this report).

The purpose of this mine search is to examine and interpret the plans and records in our possession relating to metalliferous mining activity and based upon this information, give a professional opinion in respect of potential risk to the property from such historical mining activity and, if required, make recommendations as may be deemed appropriate.

Where other workings relating to clay, stone or other minerals are noted to be in close proximity to the property mention will be made of them.

This report is of a format suitable for conveyancing and other purposes in connection with the property.

Mining Activity

The property is situated in an area which has witnessed extensive mining over several centuries.

The plans and records that are currently held in our possession at the time of compiling this report, relating to this district, do not indicate the presence of any old shallow/surface mine workings or shafts within the boundaries of the property.

Old mine dumps are recorded to lie some 15 metres to the south-west of the property, a mine shaft is recorded to lie within this area of dumps.

A lode (mineralised structure) at surface outcrop indicated to lie to the south-west of the property.

This lode is shown to strike in a north-easterly direction and is thought to extend further than plotted, passing a short distance to the south-eastern side of the property.

We have found no evidence of clay workings or other mineral workings in the immediate vicinity of the property.

Based upon the historic mapping sources we have reviewed we have found no evidence of any water supply wells within the boundaries of the property.

Conclusions

The South Crofty Mine is being prepared for potential re-opening, any future workings would be undertaken subject to stringent conditions to ensure they would not affect the ground surface and would be unlikely to extend into the vicinity of the property.

Action: Footings Inspection

With the exception of ongoing work at South Crofty Mine for potential re-opening, we know of no other plans to exploit metallic minerals in the locality.

Based upon the information that is held in our possession, at the time of writing this report, we have found no documentary evidence to indicate the presence of shallow old mine workings directly underlying the property.

However, the property appears to be of relatively recent construction and construction is likely to have been preceded by some form site investigation as a routine precaution. If further building development is proposed, we would consider some ground inspection to be prudent.

Recommendations

We would recommend that, as a routine precaution, if any new foundation trenches are required to be excavated, these should be inspected prior to being infilled with concrete to check for any evidence of any unrecorded or otherwise unknown mining activity.

Action: Footings Inspection

Scope of Search & Limitations

This search has been carried out with reference to the extensive collection of plans, records and archives that are held in our possession at the time of writing this report and from this material we have endeavoured to give as accurate a report as possible in respect of the property as delineated in the initial request.

However, taking into account that such records may not be wholly complete or accurate, that records may exist of which we do not hold copies, or records exist that are held in private sources which are not available to us and that in Cornwall, Devon and Somerset many ancient shallow workings and shafts exist of which there are no records, we cannot accept liability for any inaccuracies there may be.

This report is concerned solely with the property searched and should not be used in connection with adjacent properties as only relevant mining features have been mentioned and any known features that would not have a direct influence upon the target property may have been omitted for clarity.

The report is based upon the property boundaries as shown on the supplied request plan.

We cannot accept liability for any inaccuracies if the property boundaries, as supplied to us by the client or the client's agent, are subsequently shown to be incorrect, incomplete or if no such request plan has been supplied when the search has been requested.

This report is confidential to the client, the client's legal advisor and/or mortgage lender or any other party involved in the conveyancing of the property and / or development of the dwelling or land contained within the boundaries defined on the request plan.

We have no liability toward any person or organisation not party to commissioning this report.

This report or any part of it, is not permitted to be reproduced, copied, altered or in any other way distributed by any other person or organisation.

Unless otherwise expressly stated, nothing in this report shall create or confer any rights or other benefits pursuant to the Contracts (Rights of Third Parties) Act 1999 in favour of any person or organisation other than the person/organisation commissioning this report.

This report is not a contaminated land, environmental, geotechnical or archaeological survey and should not be interpreted as such.

No site visit has been made.

We trust that this report is to your satisfaction and will be happy to answer any queries with respect to it.

Yours faithfully,



Wheal Jane Consultancy

dalef@wheal-jane.co.uk

01872 560200

Action: Footings Inspection

Mining Glossary

Adit	Horizontal mine drainage tunnel driven from low ground into mine workings. The adit tunnel is the shallowest level shown on mine plans and usually represents the earliest period of workings recorded. Adits have ventilation shafts at regular intervals, which are mostly unrecorded.
Alluvium	Clay, sand and debris deposited by a river. Often streambed for tin.
Burrow	A mine waste tip.
Caunter lode	A lode which runs in a different direction to the general trend of lodes in the district.
Coffin/Koffen	Trench-like openwork at surface.
Costean Pit	A small surface pit excavated to locate and/or sample a lode.
Crosscourse	Geological features which run at right-angles to the principal lodes of a district, and are vertical or sub-vertical faults. Mostly barren of payable minerals, but can carry values of iron ore, cobalt and other metallic minerals. Also known as 'guides' or 'trawns' in the St Just and St Ives mining districts respectively.
Crosscut	Tunnel driven underground, usually at right-angles to the lodes.
Dip of Lode	Angle of inclination of a lode from the horizontal.
Drive	Tunnel driven along the course of a lode.
Elvan	Igneous rock (quartz-porphry) occurring as a vein or dyke. Can be extremely hard. Exploited by quarrying.
Granite	Igneous rock. Crystalline mixture of quartz, feldspar and mica.
Greenstone	Igneous rock also called 'blue elvan'. Generally extremely hard.
Gunnis	Open stope at surface or underground.
Kaolinisation	Alterations or weathering of granite to clay and sand from solid rock.
Killas	Generic term given to sedimentary rock in Cornwall.
Leat	A man-made watercourse.
Level	Horizon underground where ore movement and communications are maintained. Levels consist of lode drives and crosscut tunnels: i.e. 12 fathom level; the system of tunnels driven at 12 fathoms below adit horizon.
Lode	A mineralised structure or vein. Most lodes run from surface vertically or sub-vertically, and can vary from a few inches to several metres in width.
Mundic	Iron pyrite, arsenic and sulphur - arsenopyrite.
Openwork	A surface working, which has usually left a pit or backfilled excavation.
Outcrop	The part of the lode which breaks surface. Worked-out voids and backfilled areas are outcrop features.
Rab	Weathered zone of mixed rock and soil (natural profile)
Sett	An area of land leased for mining.
Shaft	Holes in the ground, which can vary from 0.5m x 1m up to shafts 7m across. Engine shafts tends to be large (typically 3m x 2m) and adit shafts are smaller (typically 1.2m x 1.8m). Depths vary down to 700m.
Stockwork	Mass of narrow veins or lodes running parallel and sub-parallel.
Stope	Ground where lode has been removed leaving void. Sometimes open to surface.
Tailings	Residual sands and slimes from ore dressing. Usually heavily contaminated.

Action: Footings Inspection


Mining References (generic listing)

H G Dines - The Metalliferous Mining Region of South West England (2 Vols)
A K Hamilton Jenkin - Mines & Miners of Cornwall (16 Vols)
A K Hamilton Jenkin - Mines of Devon (2 Vols)
A K Hamilton Jenkin - Wendron
Thomas Spargo - Tin Mines of Cornwall (6 Vols)
J H Collins - Observations of West of England Mining Region
Sellwood, Durrance & Bristow - Geology of Cornwall
Durrance & Laming - Geology of Devon
Burt, Waite & Burnley - Cornish Mines
MRO Plans (CRO)
MRO Copies (SC Archive)
MRO Microfiche (SC)
South Crofty Archive
Tehidy Minerals Archive
JMS/JAB/JHB Archive
Wheal Jane Collection
Wheal Pendarves Collection
Geevor Collection
Thyssen Review & Plans
A K H Jenkin, Annotated 6" Plans
Geological 6" Plans
Richard Thomas Plans
Robert & Brenton Symons Plans
Nicholas Whitley Plans
K Bennet Annotated Plans
R Lyon Annotated Plans
Ordnance Survey 1880, 1906, etc Maps
H G Dines Composites

Action: Footings Inspection

Search Request Plan

Copy of the request plan(s) provided to Wheal Jane Consultancy to identify the property for search purposes:

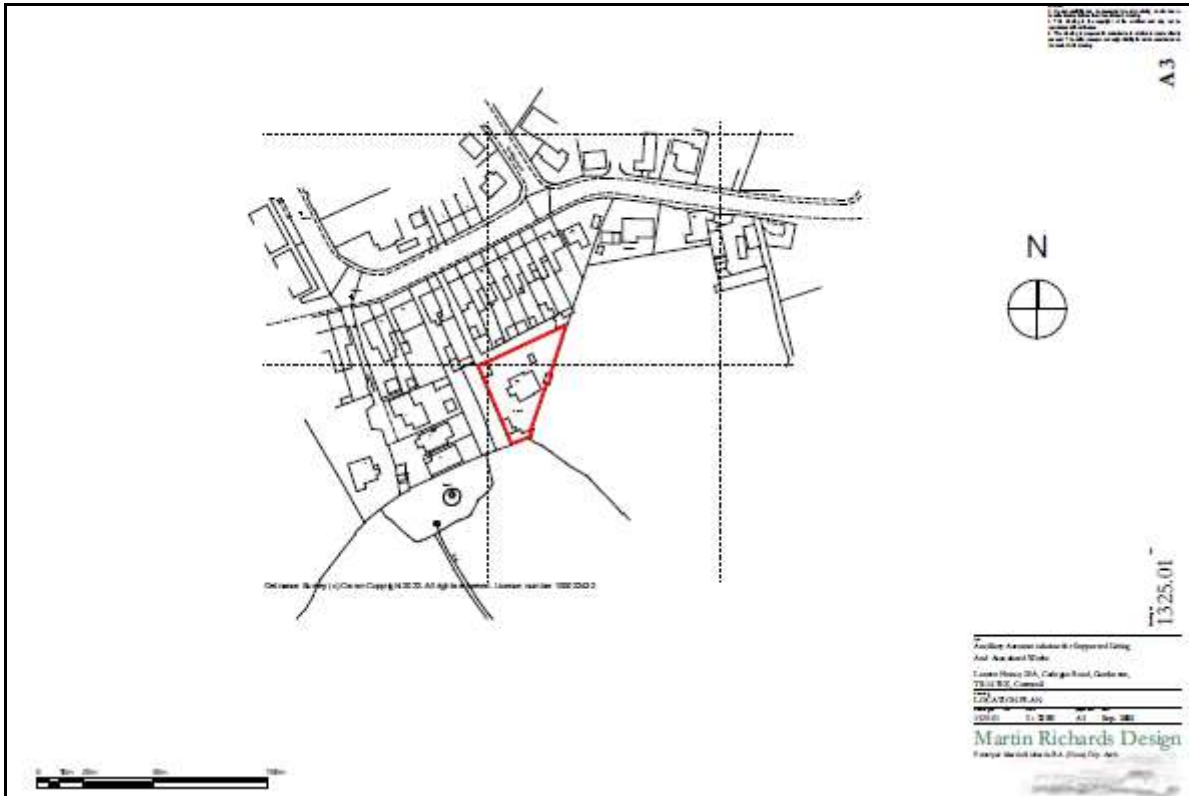

Please note that request plans do not automatically follow the convention for north to be oriented 'up' the page, however, all directional references made in this report are based upon correctly oriented mapping resources that are held by Wheal Jane Consultancy.

APPENDIX D

**TABLES 6.3 – 6.6 ‘CONTAMINATED LAND RISK
ASSESSMENT, A GUIDE TO GOOD PRACTICE’.
CIRIA REPORT C552. PUBLISHED 2001**

Table 6.3 *Classification of consequence*

Classification	Definition	Examples
Severe	Short-term (acute) risk to human health likely to result in “significant harm” as defined by the Environment Protection Act 1990, Part IIA. Short-term risk of pollution (note: Water Resources Act contains no scope for considering significance of pollution) of sensitive water resource. Catastrophic damage to buildings/property. A short-term risk to a particular ecosystem, or organism forming part of such ecosystem (note: the definitions of ecological systems within the Draft Circular on Contaminated Land, DETR, 2000).	High concentrations of cyanide on the surface of an informal recreation area. Major spillage of contaminants from site into controlled water. Explosion, causing building collapse (can also equate to a short-term human health risk if buildings are occupied).
Medium	Chronic damage to Human Health (“significant harm” as defined in DETR, 2000). Pollution of sensitive water resources (note: Water Resources Act contains no scope for considering significance of pollution). A significant change in a particular ecosystem, or organism forming part of such ecosystem. (note: the definitions of ecological systems within Draft Circular on Contaminated Land, DETR, 2000).	Concentrations of a contaminant from site exceed the generic, or site-specific assessment criteria. Leaching of contaminants from a site to a major or minor aquifer. Death of a species within a designated nature reserve.
Mild	Pollution of non-sensitive water resources. Significant damage to crops, buildings, structures and services (“significant harm” as defined in the <i>Draft Circular on Contaminated Land</i> , DETR, 2000). Damage to sensitive buildings/structures/services or the environment.	Pollution of non-classified groundwater. Damage to building rendering it unsafe to occupy (eg foundation damage resulting in instability).
Minor	Harm, although not necessarily significant harm, which may result in a financial loss, or expenditure to resolve. Non-permanent health effects to human health (easily prevented by means such as personal protective clothing etc). Easily repairable effects of damage to buildings, structures and services.	The presence of contaminants at such concentrations that protective equipment is required during site works. The loss of plants in a landscaping scheme. Discoloration of concrete.

Table 6.4 *Classification of probability*

Classification	Definition
High likelihood	There is a pollution linkage and an event that either appears very likely in the short term and almost inevitable over the long term, or there is evidence at the receptor of harm or pollution.
Likely	There is a pollution linkage and all the elements are present and in the right place, which means that it is probable that an event will occur. Circumstances are such that an event is not inevitable, but possible in the short term and likely over the long term.
Low likelihood	There is a pollution linkage and circumstances are possible under which an event could occur. However, it is by no means certain that even over a longer period such event would take place, and is less likely in the shorter term.
Unlikely	There is a pollution linkage but circumstances are such that it improbable that an event would occur even in the very long term.

Table 6.5 Comparison of consequence against probability

		Consequence			
		Severe	Medium	Mild	Minor
Probability	High likelihood	Very high risk	High risk	Moderate risk	Moderate/low risk
	Likely	High risk	Moderate risk	Moderate/low risk	Low risk
	Low likelihood	Moderate risk	Moderate/low risk	Low risk	Very low risk
	Unlikely	Moderate/low risk	Low risk	Very low risk	Very low risk

Table 6.6 Description of the classified risks and likely action required

Very high risk	<p>There is a high probability that severe harm could arise to a designated receptor from an identified hazard, OR, there is evidence that severe harm to a designated receptor is currently happening.</p> <p>This risk, if realised, is likely to result in a substantial liability.</p> <p>Urgent investigation (if not undertaken already) and remediation are likely to be required.</p>
High risk	<p>Harm is likely to arise to a designated receptor from an identified hazard.</p> <p>Realisation of the risk is likely to present a substantial liability.</p> <p>Urgent investigation (if not undertaken already) is required and remedial works may be necessary in the short term and are likely over the longer term.</p>
Moderate risk	<p>It is possible that harm could arise to a designated receptor from an identified hazard. However, it is either relatively unlikely that any such harm would be severe, or if any harm were to occur it is more likely that the harm would be relatively mild.</p> <p>Investigation (if not already undertaken) is normally required to clarify the risk and to determine the potential liability. Some remedial works may be required in the longer term.</p>
Low risk	<p>It is possible that harm could arise to a designated receptor from an identified hazard, but it is likely that this harm, if realised, would at worst normally be mild.</p>
Very low risk	<p>There is a low possibility that harm could arise to a receptor. In the event of such harm being realised it is not likely to be severe.</p>

YES

Your Environmental Solutions

Woodcocks Roost, Fore Street
Barripper, Camborne
Cornwall, TR14 0QR

T: 01209 715077 M: 07766 850 351

www.urenvironmentalsolutions.com
info@urenvironmentalsolutions.com

