

### Monitoring Details:

Provider Name: Moniteye

Monitoring Interval: Every 8 weeks

Instruction Date: 25/11/2022

Number of Visits: 5

Reading Date:

Visits Completed: 4

Date of Issue: 20/09/2023

Visits Outstanding: 1

### Client Details:

Client: Moniteye

Engineer / Handler: -

Job Reference:

### Monitored Address:

Occupier: Rebecka

Address: Ely St Mary's Junior School, High Barns, Ely, CB7 4RB


Telephone: -

Email: -

### Front Elevation



Site Plan

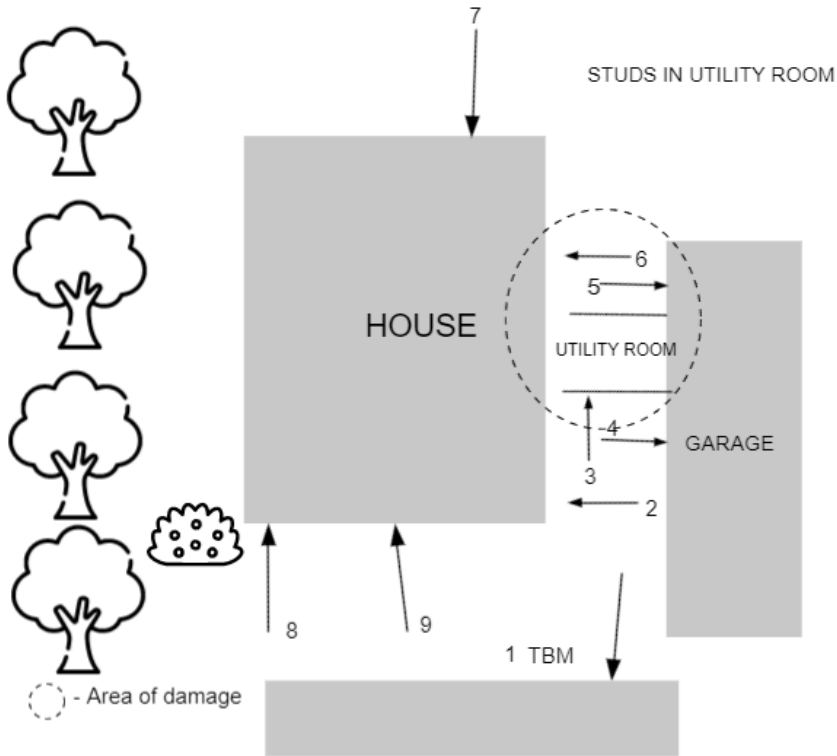

## Visit Notes

Visit	Surveyors Note
Visit 4	Ph reported concrete from roof coming away.


## Level Readings

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
TBM1	10.0000	10.0000	10.0000	10.0000	10.0000					
2	111330	111325	111340	111332	111320					
3	114436	114413	114431	114422	114416					
4	114371	114347	114362	114363	114359					
5	113007	112996	113003	113001	113001					
6	114395	114363	114382	114372	114379					
7	114366	114360	114371	114373	114362					
8			10.7939	10.7947	10.7755					
9			11.0495	11.0499	11.0426					


## Level Movement (Displayed in Millimeters)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
TBM1	0	0	0	0	0					
2	0	-0.5	+1	+0.2	-1					
3	0	-2.3	-0.5	-1.4	-2					
4	0	-2.4	-0.9	-0.8	-1.2					
5	0	-1.1	-0.4	-0.6	-0.6					
6	0	-3.2	-1.3	-2.3	-1.6					
7	0	-0.6	+0.5	+0.7	-0.4					
8			0	+0.8	-18.4					
9			0	+0.4	-6.9					

### Level Readings Chart (Points TBM 1 - 5)

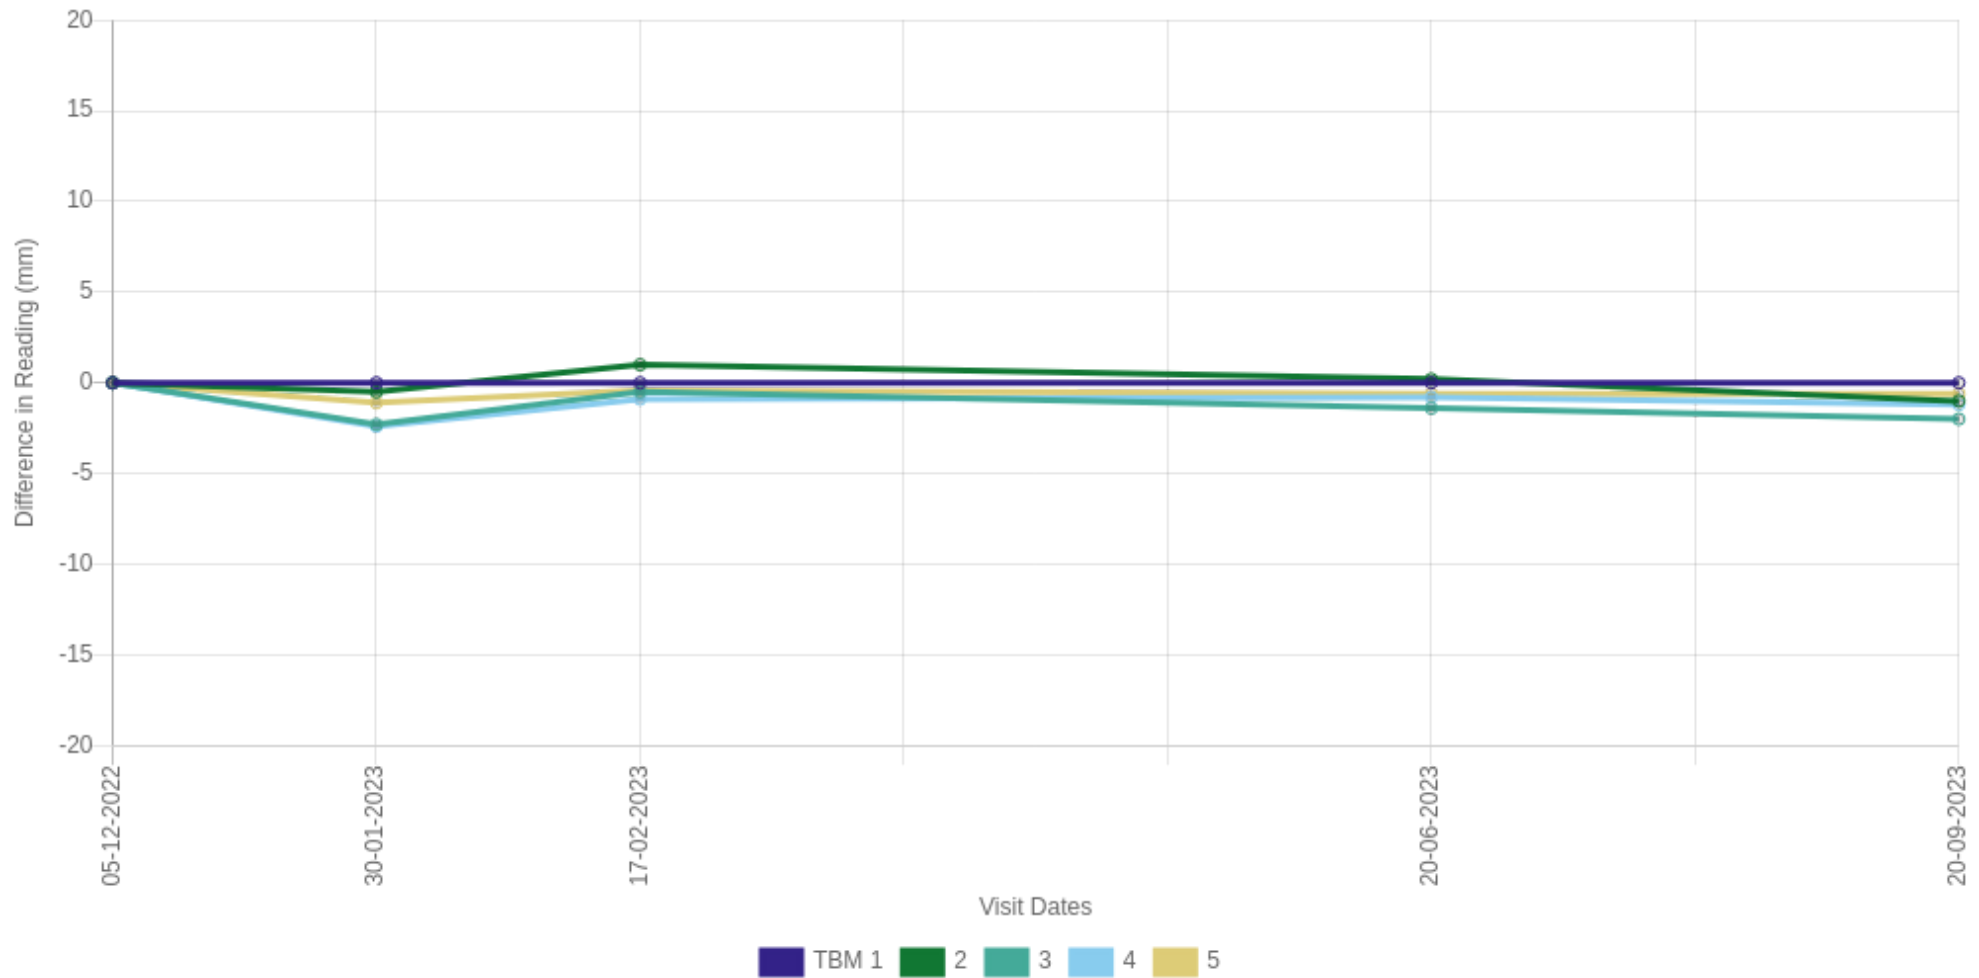

### Level Readings Chart (Points 6 - 9)

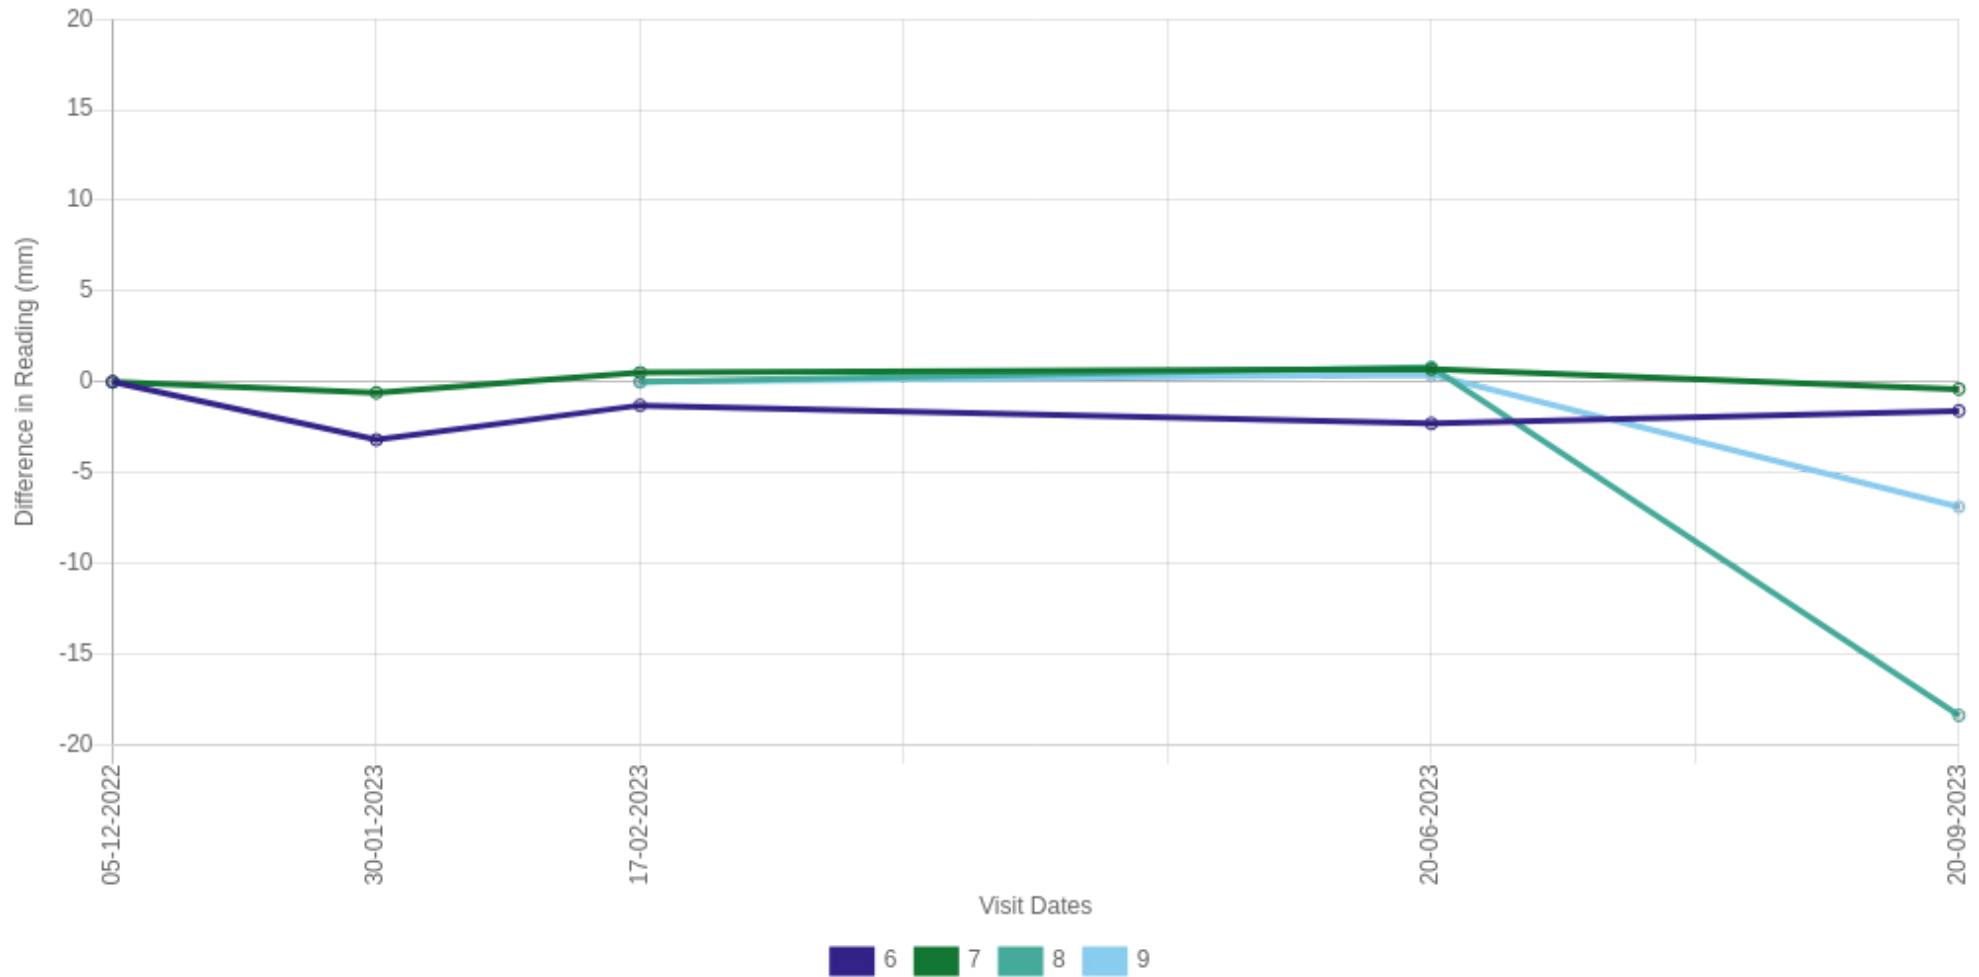


# Crack Monitoring

## EXT Conjunction of main house and utility

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	129.38	127.55	127.38	126.46	130.16					
Callipers	2016	148	850	0	0					
Taken by	O.B	A.B	N.M	B.B	B.B					

## EXT Conjunction of main house and utility - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	0	-1.83	-2	-2.92	0.78					

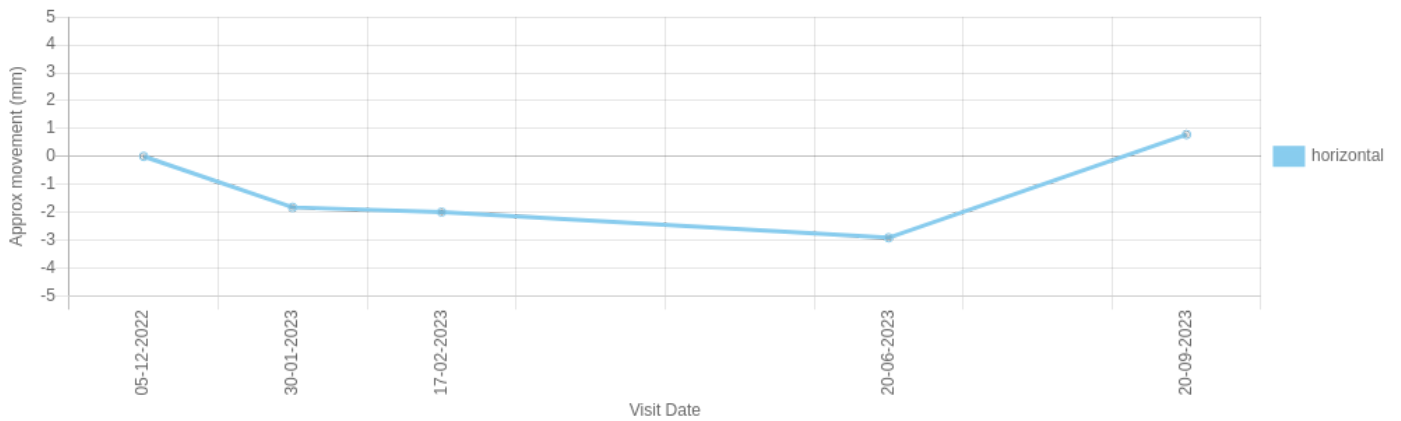


# Crack Monitoring

INT above rear utility door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	69.22	69.08	69.23	68.81	69.2					
Callipers	2016	148	850	0	0					
Taken by	O.B	A.B	N.M	B.B	B.B					

INT above rear utility door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	0	-0.14	0.01	-0.41	-0.02					

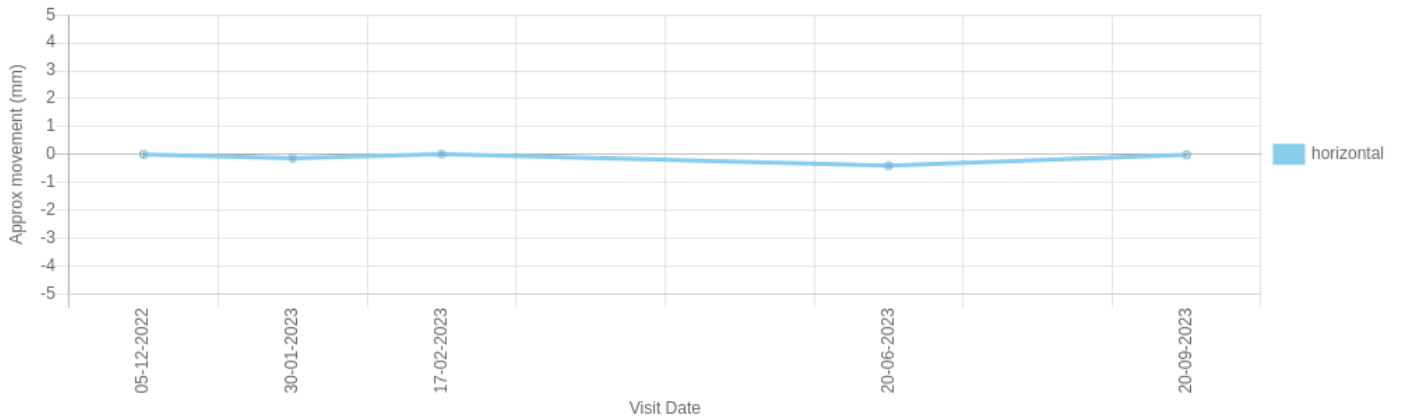




# Crack Monitoring

## INT Ceiling crack of door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
V	113.06	113	113.12	113.2	113.24					
Callipers	2016	148	850	0	0					
Taken by	O.B	A.B	N.M	B.B	B.B					

## INT Ceiling crack of door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
V	0	-0.06	0.06	0.14	0.18					

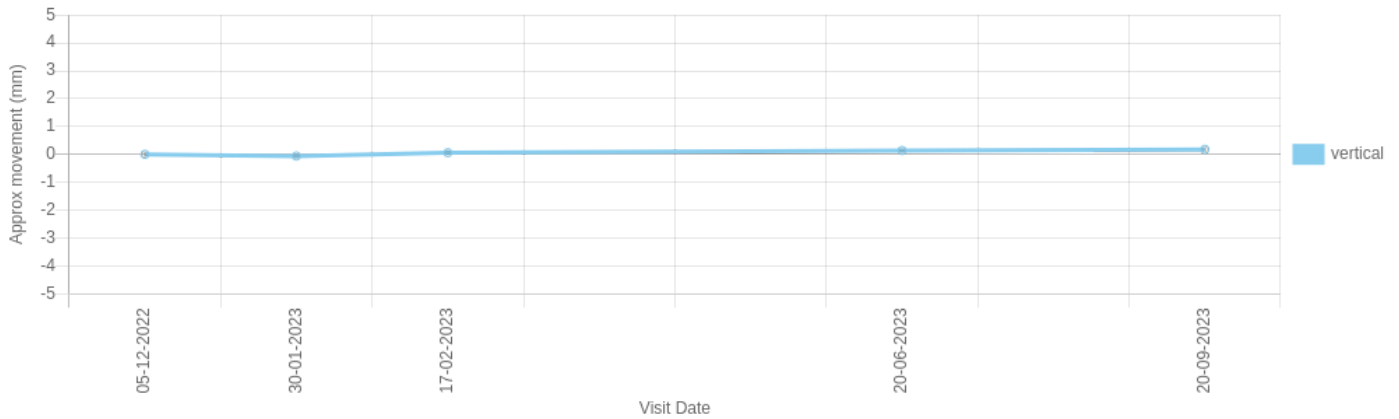


# Crack Monitoring

## INT crack above WC window

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	5788	5784	58	5788	5782					
D	76.51	76.4	76.6	76.49	76.36					
C	48.29	48.28	48.31	48.23	48.16					
Callipers	2016	148	850	0	0					
Taken by	O.B	A.B	N.M	B.B	B.B					

## INT crack above WC window - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	0	-0.04	0.12	0	-0.06					
D	0	-0.11	0.09	-0.02	-0.15					
C	0	-0.01	0.02	-0.06	-0.13					

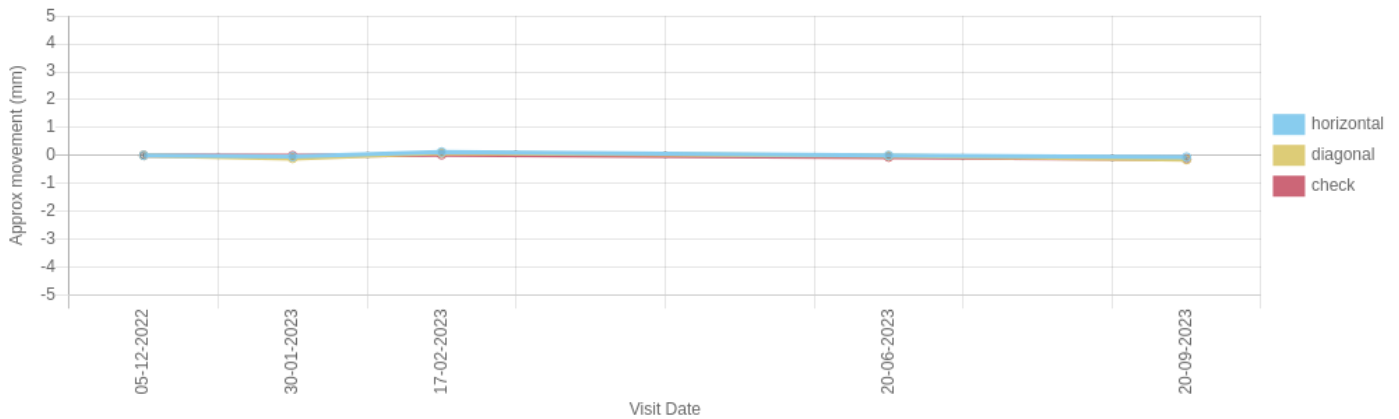

# Crack Monitoring

## INT crack above living room door

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	83.92	83.77	83.84	83.74	84.16					
Callipers	2016	148	850	0	0					
Taken by	O.B	A.B	N.M	B.B	B.B					

## INT crack above living room door - Crack Readings Differences (Displayed in Millimetres)

	Visit 1	Visit 2	Visit 3	Visit 4	Visit 5	Visit 6	Visit 7	Visit 8	Visit 9	Visit 10
	05/12/22	30/01/23	17/02/23	20/06/23	20/09/23					
H	0	-0.15	-0.08	-0.18	0.24					

