

Your ref [redacted]

Our ref 08919GLOB

Geo-Serv Limited
17 Hoveden Road
London NW2 3XE



GEO-SERV

tel: [redacted]
email: [redacted]

360Globalnet Ltd
Bramley House,
Bramley Road,
Long Eaton,
NG10 3SX

Issue date: 05/01/2024

Monitoring visit 4 of 7

Monitoring Plus Report

Owners name	Mrs. Ann Gaskin	Suspected cause	to be advised	Monitoring type	levels
Address	Helios House Clarkes Lane Barsham NR34 8HN	Principal area of damage	to be advised	Installed	22/04/2023
Comment		Damage category	to be advised	Frequency (weeks)	8.7
Max movement	7.1 mm	Surface geology	to be advised	Completion date	Apr 24
Focal area	Pts 10,	Feedback from last visit		Status	open
no comment for this visit		no feedback for this visit			
		Sketch showing location of monitoring points			
		<p>The diagram shows a front elevation of Helios House. It is a rectangular building with a smaller rectangular extension at the bottom center. Monitoring points are indicated by arrows: 1-5 are vertical arrows pointing up from the ground level; 6 is a horizontal arrow pointing left from the right side; 7-10 are vertical arrows pointing down from the roofline; 11 is a horizontal arrow pointing right from the left side. A 'Datum in Lawn' is marked with a downward arrow on the right side. The text 'Front Elevation' is written below the diagram.</p>			

Level Monitoring Results

Survey:	1		2		3		4		5	
By:	CV		CV		CV		CV		#N/A	
Date:	22/04/2023		25/07/2023		07/10/2023		05/01/2024		#N/A	
Point ID	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>	levels mm	<i>chngs</i> <i>mm</i>
Datum	1000.00	0.0	1000.00	0.0	1000.00	0.0	1000.00	0.0		#N/A
1	1067.64	0.0	1068.08	0.4	1067.00	-0.6	1067.50	-0.1		#N/A
2	1073.18	0.0	1073.70	0.5	1073.78	0.6	1072.73	-0.5		#N/A
3	1051.98	0.0	1052.55	0.6	1053.10	1.1	1051.33	-0.6		#N/A
4	1085.67	0.0	1086.20	0.5	1086.68	1.0	1084.93	-0.7		#N/A
5	1103.34	0.0	1103.92	0.6	1104.36	1.0	1102.93	-0.4		#N/A
6	1041.94	0.0	1041.88	-0.1	1041.44	-0.5	1041.23	-0.7		#N/A
7	1080.24	0.0	1079.76	-0.5	1078.04	-2.2	1079.43	-0.8		#N/A
8	1045.44	0.0	1045.56	0.1	1044.10	-1.3	1045.74	0.3		#N/A
9	1025.27	0.0	1025.90	0.6	1023.74	-1.5	1027.93	2.7		#N/A
10	1038.94	0.0	1039.60	0.7	1036.64	-2.3	1043.77	4.8		#N/A
11	1031.78	0.0	1032.22	0.4	1029.78	-2.0	1034.05	2.3		#N/A

closing error (mm)

0.00



0.00

0.00

0.00

#REF!

Precise level monitoring related to Datum

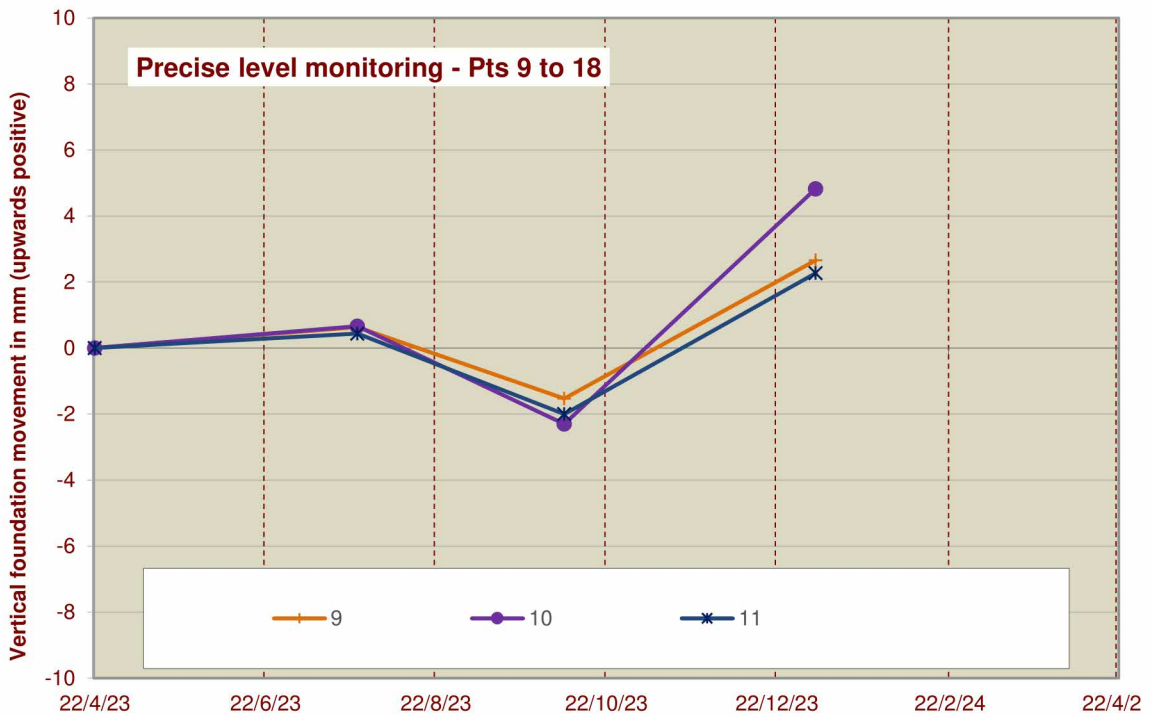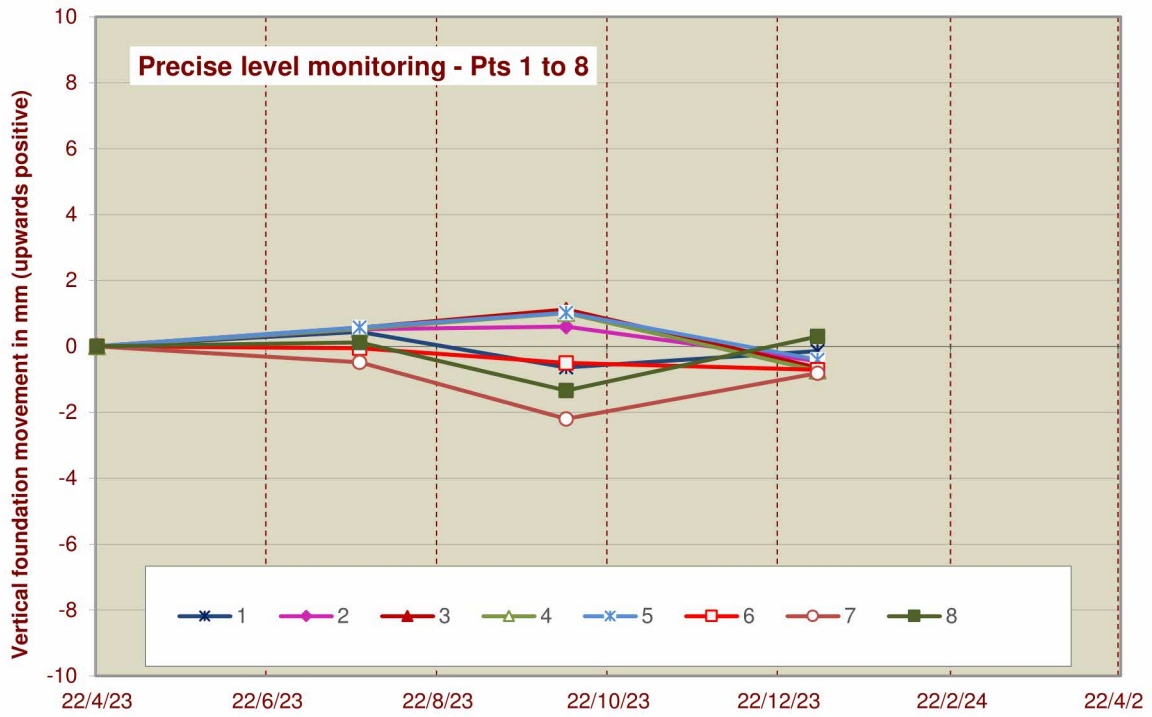

Photos from visit on 05/01/2024

